



Expertise

Protocol number: 46548697
Order No. / Reference: 26564894
Inspection date: 15 Jul 2026

Manufacturer: Ford	Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. ACTIVE
VIN: WF0PXXGCHPNA25867	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. ACTIVE	
Vehicle Identification number	WF0PXXGCHPNA25867
Mileage (Read)	151,516 km
First registration	22 Feb 2023
Number of holders	1
Power / Engine displacement	85 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Polar-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	41 %
Last service on / at	05/2026 at 150,939 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP499494
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BYE 00003		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,035 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94W	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	215/55 R17 94W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Goodyear	4mm / 4mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Airbag: Passenger airbag deactivation • Exterior mirrors painted in body color, electrically adjustable, heated and foldable • Tires: 7 J x 17 alloy wheels (4) with 215/55 R 17 tires • Hill start assist • Fabric headliner • Roof spoiler painted in car color • Tachometer • Electronic Safety and Stability Program (ESP) • Lane keeping assist including lane keeping assist • Chassis with increased ground clearance • Electric parking brake with auto-hold function • FordPass Connect including live traffic information • Luggage compartment lighting • Cruise control • Illuminated glove compartment • rear window wiper • Interior mirror, automatically dimming • Isofix bracket • Headrests: 2 front and 3 rear, height adjustable • LED headlights • Adjustable steering column • Center console "Premium" front • Navigation: Ford SYNC 4 including Ford navigation system with AppLink, 13.2" touchscreen and DAB/DAB+ • Upholstery: Cloth • Pre-Collision Assist • Tire Pressure Monitoring System (TPMS) • Headlight low beam • Selective driving mode switch (Active) • Seats: Passenger seat height-adjustable, manually • Seats: Rear seat backrest • Start-stop system • Carpet floor mats in the front • Lashing eyes in the luggage compartment • Electronic immobilizer • Central locking with remote control and remote luggage compartment release | <ul style="list-style-type: none"> • Anti-lock braking system (ABS) with electronic brake force distribution (EBD) • Attachment points behind the second row of seats for mounting the safety partition net • Crossover body kit • Roof rails, black • Diesel particulate filter (DPF) • Electronic Shifter • Driver information system with on-board computer, color (10.7 cm screen diagonal) • Electric windows front and rear • Ford Power Start function • Luggage compartment cover • Speed limiter • Transmission: 8-speed automatic transmission • Back window, heater • Interior lighting with LED technology • Intelligent security system • Air conditioning with automatic temperature control • LED taillights • Steering wheel: 3-spoke design • Make-up mirrors in driver and passenger sun visors • MyKey key system (individually programmable second key) • Emergency call assistant • Front and rear parking pilot system • Post-Collision Assist • Tire repair kit • Windscreen wipers with rain sensor (sensitivity adjustable) • Headlight assistant with day/night sensor • Electromechanical speed-dependent power steering • Seats: Driver's seat height adjustable • Seats: Front sports seats with enhanced lateral support • 12-volt power outlet in the luggage compartment • Variable radiator air intake • Warning system for unfastened seat belts for the 1st and 2nd rows of seats |
|--|--|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Swiveling towbar (incl. ESP trailer stabilization) • Package: Easy Parking (Active Parking Assist with parking and exiting function (in conjunction with 8-speed automatic transmission including semi-automated vehicle guidance) - Door edge protection - Rearview camera with "Split View" technology) | <ul style="list-style-type: none"> • Paint finish: Metallic • Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats) • Safety partition net for luggage compartment |
|--|--|



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim (gehört nicht zur Ausstattung) - Scratched - No deduction
2	Gearbox	Gearbox - Leaking - Perform diagnosis
3	Interior	Interior (Tier haare) - Soiled - Clean
4	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
5	Boot lid / rear door	Boot lid (Wandalismus) - Scratched - Smart repair
6	Roof	Roof (Wandalismus) - Scratch(es) - Smart repair
7	Interior	Interior - Odour - Ozone treatment
8	Engine	Engine cover - Damaged - Replace

Wear and tear

No.	Component group	Description
1	Trim / covers	Floor mats - Damaged - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 15 Dec 2025	5.044,51 €

Repainting

No.	Repainting
1	Mudguard - left side
2	Mudguard - right side



Paint coat thickness measurement

Roof	115 µm	Roof rail - left side	115 µm
Roof rail - right side	125 µm	Boot lid / rear door	135 µm
Mudguard - left side	161 µm	Mudguard - right side	177 µm
Bonnet	125 µm	Sill - left side	90 µm
Sill - right side	90 µm	Side panel - rear left side	120 µm
Side panel - rear right side	135 µm	Door - rear left side	125 µm
Door - rear right side	120 µm	Door - front left side	130 µm
Door - front right side	130 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

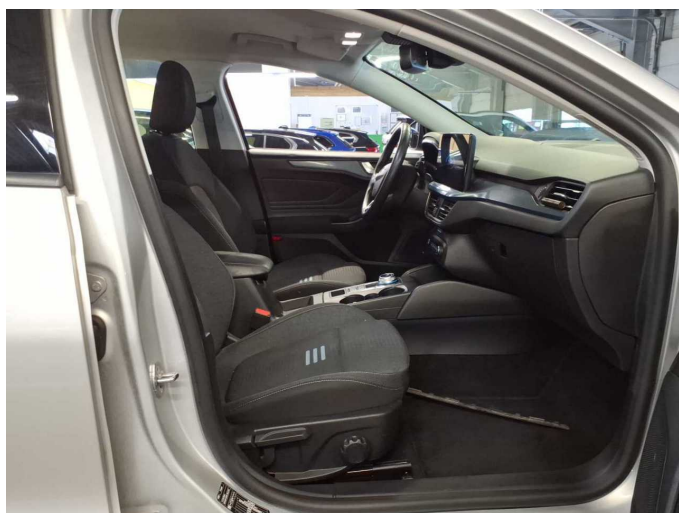


Figure 5: Interior - front

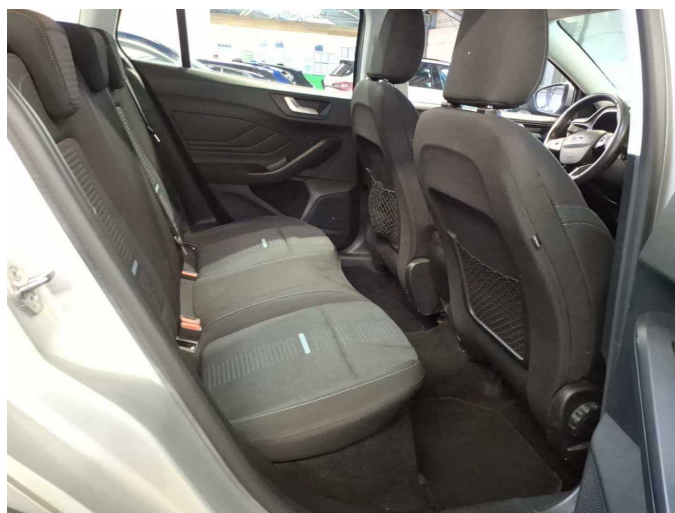


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

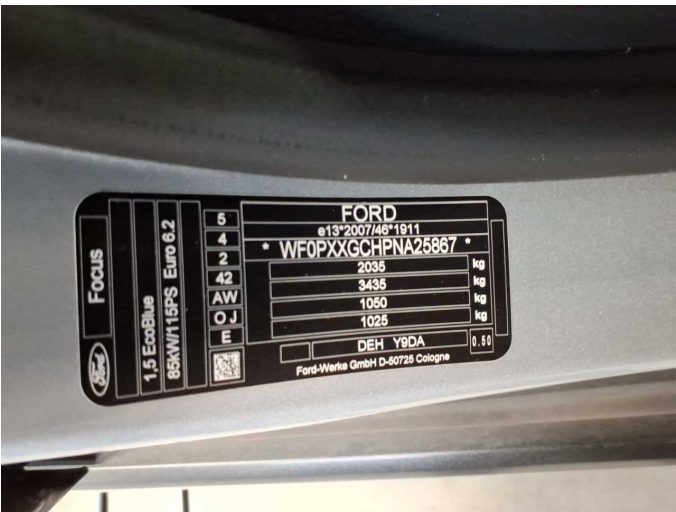


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 1: 2nd wheel set: 1 alloy rim (gehört nicht zur Ausstattung) - Scratched - No deduction



Damage 1: 2nd wheel set: 1 alloy rim (gehört nicht zur Ausstattung) - Scratched - No deduction



Damage 2: Gearbox: Gearbox - Leaking - Perform diagnosis



Damage 2: Gearbox: Gearbox - Leaking - Perform diagnosis




Damage 3: Interior: Interior (Tier haare) - Soiled - Clean




Damage 3: Interior: Interior (Tier haare) - Soiled - Clean



Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

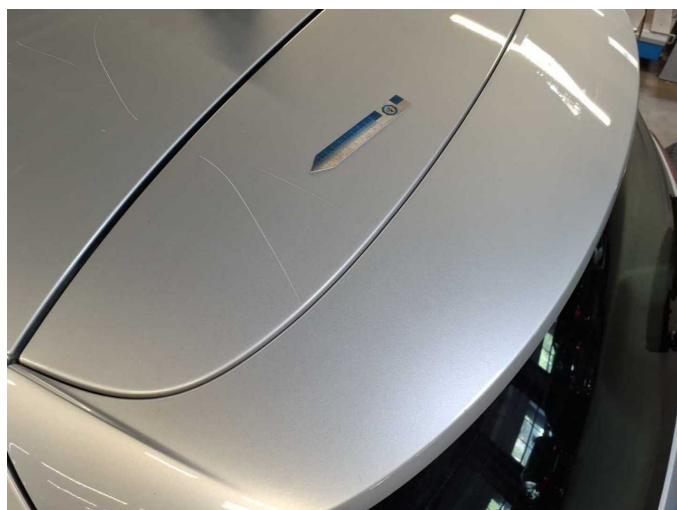

Damage 5: Boot lid / rear door: Boot lid (Wandalismus) - Scratched - Smart repair

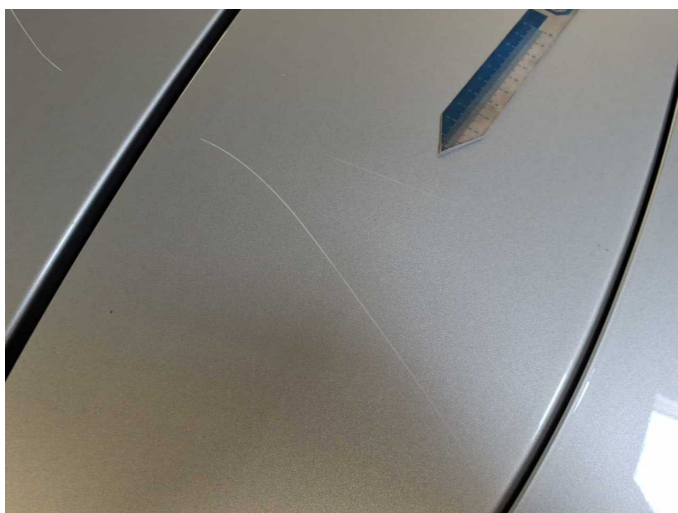

Damage 5: Boot lid / rear door: Boot lid (Wandalismus) - Scratched - Smart repair



Damage 6: Roof: Roof (Wandalismus) - Scratch(es) - Smart repair



Damage 6: Roof: Roof (Wandalismus) - Scratch(es) - Smart repair



Damage 8: Engine: Engine cover - Damaged - Replace




Damage 8: Engine: Engine cover - Damaged - Replace



Wear and tear 1: Trim / covers: Floor mats - Damaged - No deduction



Wear and tear 1: Trim / covers: Floor mats - Damaged - No deduction

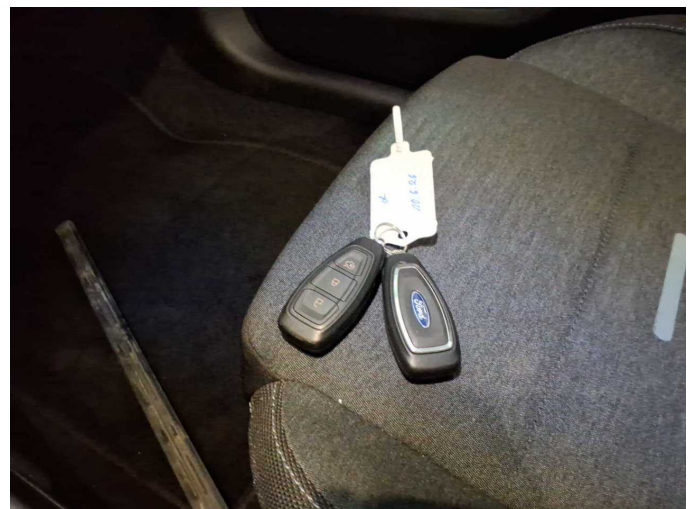

Missing part 1: Documents: Log book - Missing - Replace



Repainting 1: Mudguard - left side



Repainting 2: Mudguard - right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPNA25867

Hersteller / Modell: FORD FORD Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. ACTIVE

Datum	KM-Stand	Beschreibung
07.05.2026	150.939	Regelwartungsdienst
20.04.2026	32.305	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
05.02.2026	134.134	HU + AU; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.12.2025	126.033	Batterie ern; Reparatur Sonstiges; Spannrolle ern; Systemtest/ Eigendiagnose; Zahnriemen/Steuerkett ern
14.10.2025	122.088	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst
31.07.2025	112.128	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
31.03.2025	87.953	Reparatur Sonstiges; Systemtest/Eigendiagnose; Turbolader ern
25.03.2025	87.924	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.09.2024	67.962	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
14.08.2024	62.560	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges