



Expertise

Protocol number: 46576527
Order No. / Reference: 26751535
Inspection date: 15 Jul 2026

Manufacturer: Ford

Model: Transit Custom 320 L1H1 LKW VA Trend

VIN: WF0YXXTTGYMC77629



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Custom 320 L1H1 LKW VA Trend

Vehicle Identification number WF0YXXTTGYMC77629
Mileage (Read) 111,353 km
First registration 22 Nov 2021
Number of holders 1
Next periodical technical inspection 10/2027
(Report not on hand)

Power / Engine displacement 125 kw / 1,995 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Van

Colour / colour code Blue University
Doors / Seats 4 / 3
Upholstery type Cloth
Colour of upholstery Black-Grey

Re-import no
readiness to drive Not roadworthy /
moveable



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	20,000 km
Last service on / at	06/2026 at 111,080 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH377594
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BMV 06020		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Goodyear	1mm / 3mm
2)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 107T	All-season tyres on Steel	Goodyear	6 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- On-board computer (with consumption and mileage information (e.g. remaining range) and outside temperature display)
- Double-leaf rear door with 180° opening angle (without window)
- Electronic Stability Program (ESP) with Traction Control System (TCS) (Hill Start Assist - Crosswind Assist - Emergency Brake Assist - Rollover Protection)
- FordPass Connect (including live traffic information and Wi-Fi hotspot: Information about the current status or location of the vehicle, as well as control of selected vehicle functions via smartphone with the FordPass app. Real-time traffic information (in conjunction with audio systems 24 and 25). Wi-Fi hotspot (up to 4G/LTE, for up to 10 mobile devices). Further information about FordPass Connect can be found at <https://www.ford.de/fordpass-connect>.)
- Front air conditioning (including dust and pollen filter)
- Fuel tank 70 l
- Cargo area lighting with activatable switch-off delay (after 30 minutes)
- Emergency brake assist including emergency brake light
- Front and rear parking pilot system including fog lights
- Particulate filter: diesel particulate filter
- Wheel trims
- Wheels/Tires: Spare wheel, steel wheel
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 R tires (6.5 J x 16 with 215/65 R 16 R tires)
- Headlights: Halogen projector headlights (with LED daytime running lights and fog lights with static cornering lights)
- Mud flaps front and rear
- Half-height side wall cladding
- Seat belts (front seat belt tensioners and force limiters - warning system for unfastened driver's seat belt)
- Start-stop system
- Power outlet: 12-volt connection
- Front bumper in body color
- Lashing eyes 8
- Immobiliser
- Heat-insulating glazing, lightly tinted
- Central locking with remote control
- Auxiliary heater, electric
- Driver's side airbag
- Exterior mirrors, electrically adjustable and heated (with integrated turn signals)
- roof, flat
- Headliner in driver's cab (up to the partition wall to the cargo area)
- Tachometer
- Third brake light
- Front electric windows (with quickdown/up function for driver's side)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Generator, 240 A
- Cruise control including leather steering wheel (with adjustable speed limiter)
- Transmission: 6-speed transmission
- Lockable glove compartment with lid
- Interior lighting with delay function (with reading lights at the front)
- Paint finish: Solid color paint
- Cargo area floor: Vinyl floor covering, sealed, "Easy Clean"
- Steering column, adjustable in height and reach
- Package: Style color package (front and rear bumpers and exterior mirror caps painted in body color)
- Radio: Audio system 13 additionally with DAB/DAB+ (Radio (FM/AM) - Four speakers, antenna - Audio remote control on the steering wheel - Bluetooth, USB port and hands-free system - MyFord Dock - additionally with digital radio reception DAB/DAB+ (Digital Audio Broadcasting))
- Sliding door entry light automatically illuminates when the door is opened
- Sliding door: Sliding door, right
- Side protection strips
- Power steering
- Seats: Seat Package 13 - Partition (load-through flap), without window (Custom Truck Trend) (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Integrated tray in the double passenger seat (fold-out) - Interior armrest for driver - Manual lumbar support (driver's seat) - TREND seat cover: fabric - Partition (load-through flap), without window)
- Second key with remote control



Extra equipment

- Airbag (passenger side)
- Double locking mechanism for central locking
- LED lights in the cargo area
- Package: Visibility Package I (Trend) (Heated windshield - Windscreen washer fluid sensor)
- Package: Visibility Package II (Trend) (Heated windscreen - Electrically folding exterior mirrors - Adjustable instrument lighting - Windscreen wipers with rain sensor - Headlight assistant with day/night sensor)
- Radio: Audio System 24: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+, navigation system. (Radio (FM/AM) 8" touchscreen multifunction display (20.32 cm), 4 speakers, FordPass Connect Wi-Fi hotspot, integrated control panel and audio remote control on the steering wheel, Ford SYNC 3 with touchscreen (hands-free system with voice control, SMS readout/sending function, Bluetooth, Emergency Assistance...), AppLink (advanced voice control, privacy mode, Android Auto and Apple CarPlay support, capacitive touchscreen technology,...), dynamic navigation, lane guidance, road map for Western Europe)
- Programmable auxiliary heater (fuel-operated auxiliary heater including 2 batteries)
- Power outlet: 12-volt connection in the cargo area (D-pillar)
- Towing device (fixed, 13-pin socket - incl. trailer stability control (TSC))
- Package: Service Line (shelving systems (left and right) - vise - ventilation for transporting gas cylinders - HDF wall cladding - screen-printed wooden floor in the cargo area (the standard lashing eyes are omitted))
- Radio: Audio system 21: Ford audio system with 8" multifunction display plus DAB/DAB+ (Connected Radio - FordPass Connect Wi-Fi hotspot (up to 4G/LTE, for up to 10 mobile devices) - 8" touchscreen multifunction display (20.32 cm screen diagonal) - Four speakers, antenna - Integrated control panel and audio remote control on the steering wheel - Support for Android Auto and Apple CarPlay)
- Wheels: All-season tires (suitable for winter use)
- Seats: Seat Package 13 - Partition (load-through flap), with window (Custom Truck Trend) (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Integrated tray in the double passenger seat (fold-out) - Interior armrest for driver - Manual lumbar support (driver's seat) - TREND seat cover: fabric - Partition (load-through flap), with window)

Retrofitted equipment

- Sortimo shelving units

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Interior	Cargo space partition (Sortimo Regaleinbauten) - Differs from the original configuration - No deduction
2	Boot lid / rear door	Rear door - right side (Schwergängig) - Specify findings - Perform diagnosis
3	Boot lid / rear door	Rear door - left side (Schwergängig) - Specify findings - Perform diagnosis
4	Trim / covers	Door trim - front left side - Scratch(es) - Loss in value
5	Instrument panel	Indicator light (Abgassystem) - on - Perform diagnosis
6	Rear bumper	Rear bumper (Verschmutzt durch Metalabrieb) - Soiled - Clean
7	Sill - right side	Sill - Corrosion - Repair and paint
8	Sill - left side	Sill - Corrosion - Repair and paint
9	Interior	Cargo area floor - Scratch(es) - Loss in value
10	Body	Body - Glued / labelled - De-glue / neutralise
11	Trim / covers	Trim / covers (Heck tür links und rechts) - Broken / torn - Replace
12	Wheel / tyres	Tyre - front - Worn - Replace
13	Seat - front	Seat cover - left side - Broken / torn - Replace
14	Side panel - rear left side	Side panel - Scratch(es) - Paint
15	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - Repair and paint
16	Side panel - rear right side	Side panel (Spachtel eingefallen Einschlüsse) - Unprofessionally repaired - Repair and paint
17	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
18	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
19	Sliding door, right	Sliding door (Einschlüsse und unförmig) - Unprofessionally repaired - Repair and paint
20	Front bumper	Front bumper - Scratch(es) - Paint
21	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
22	Roof	Roof - Dent / paintcoat damage - Repair and paint
23	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Boot lid / rear door	Rear door - left side - Dent / paintcoat damage - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

1	Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	1,730 µm	Door - rear right side	189 µm
------------------------------	-------------	------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

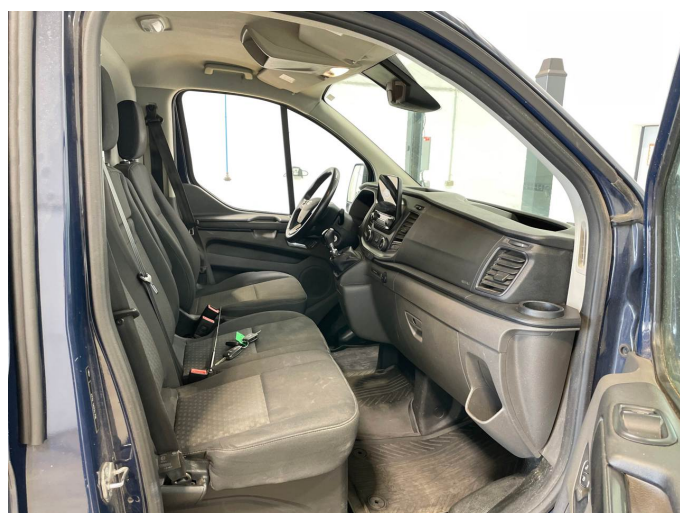


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

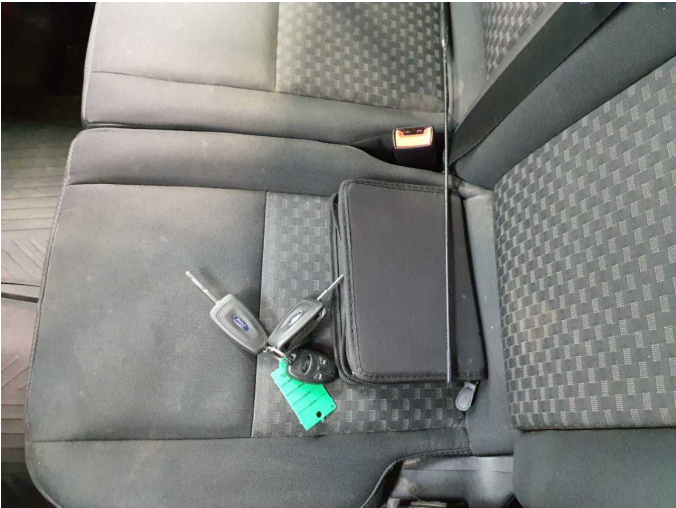


Figure 13: Documents

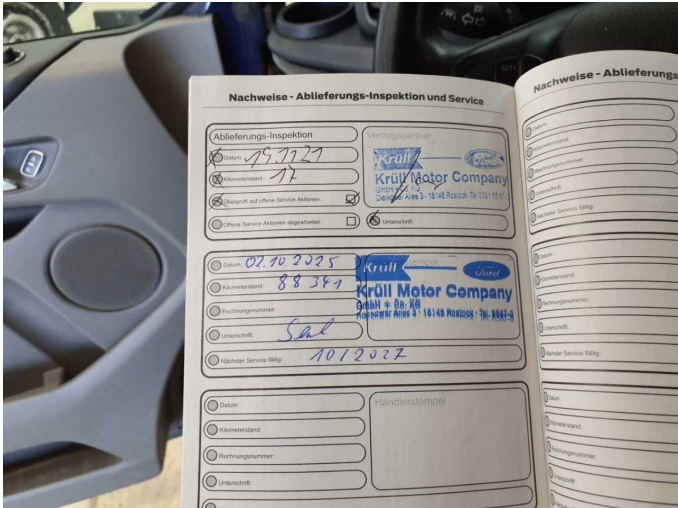


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.

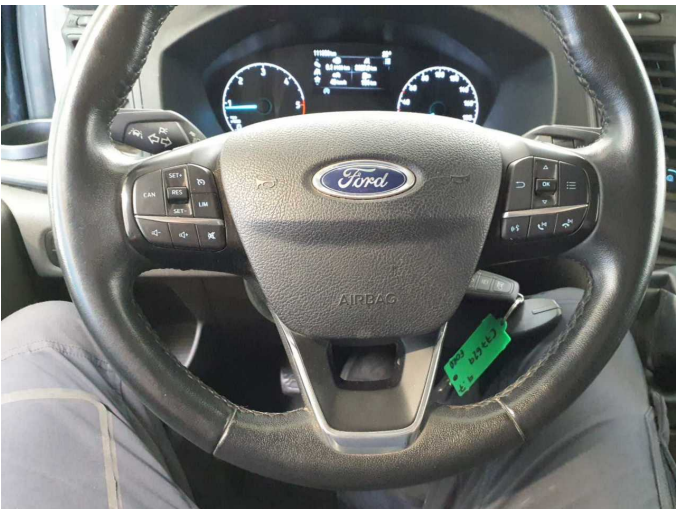


Figure 17: Misc.

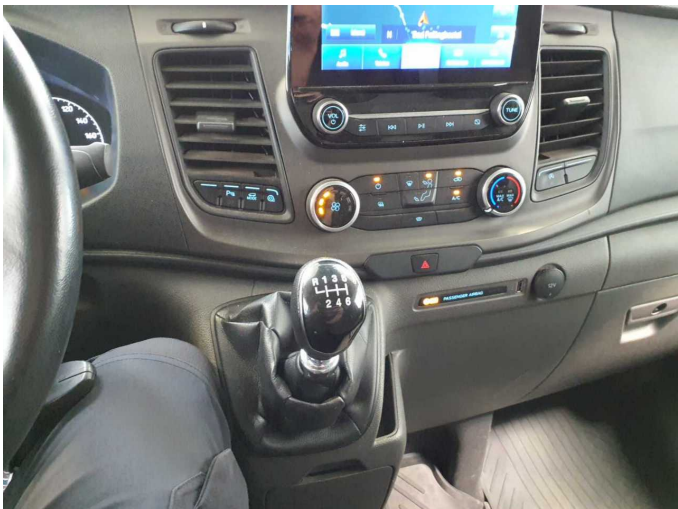


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

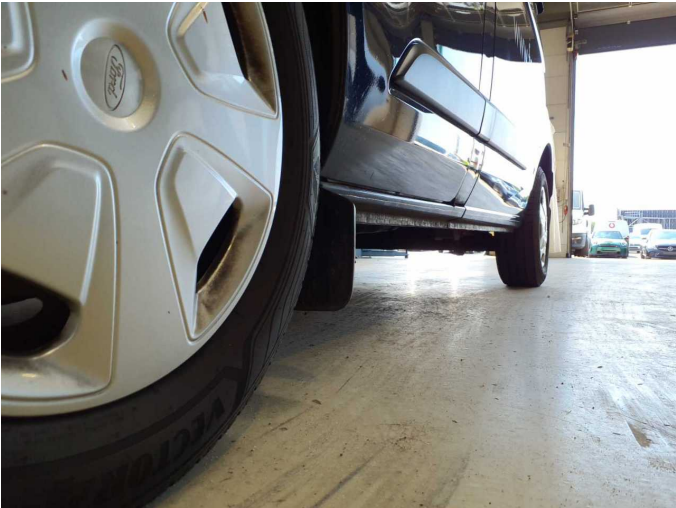


Figure 21: Misc.



Figure 22: Misc.

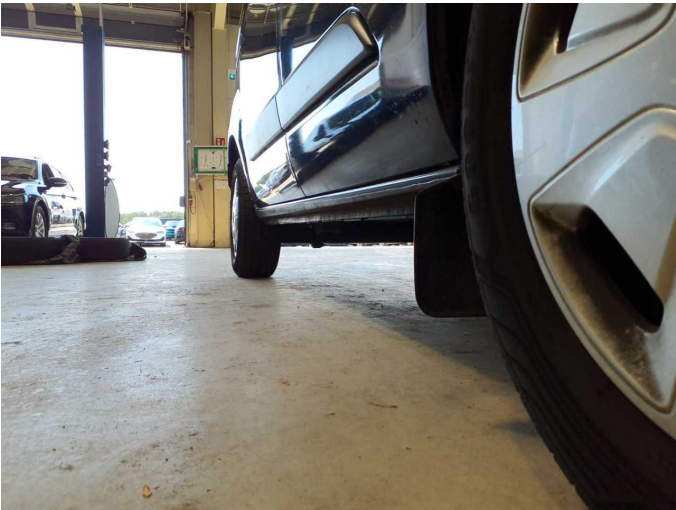


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

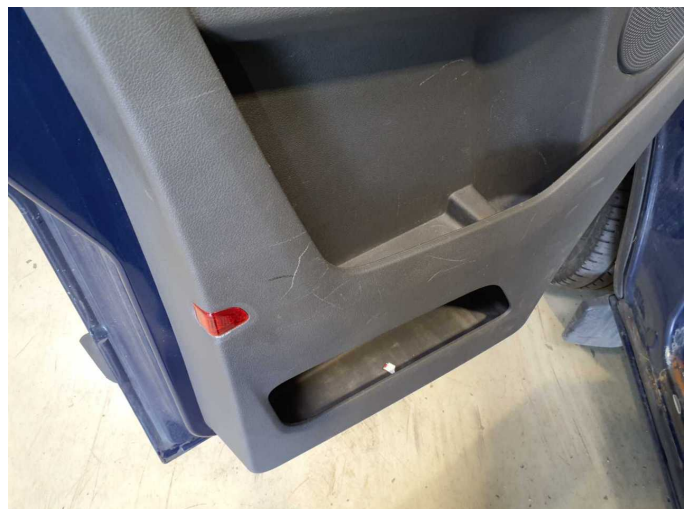

Damage 4: Trim / covers: Door trim - front left side - Scratch(es) - Loss in value




Damage 5: Instrument panel: Indicator light (Abgassystem) - on - Perform diagnosis



Damage 6: Rear bumper: Rear bumper (Verschmutz durch Metalabrieb) - Soiled - Clean




Damage 6: Rear bumper: Rear bumper (Verschmutz durch Metalabrieb) - Soiled - Clean

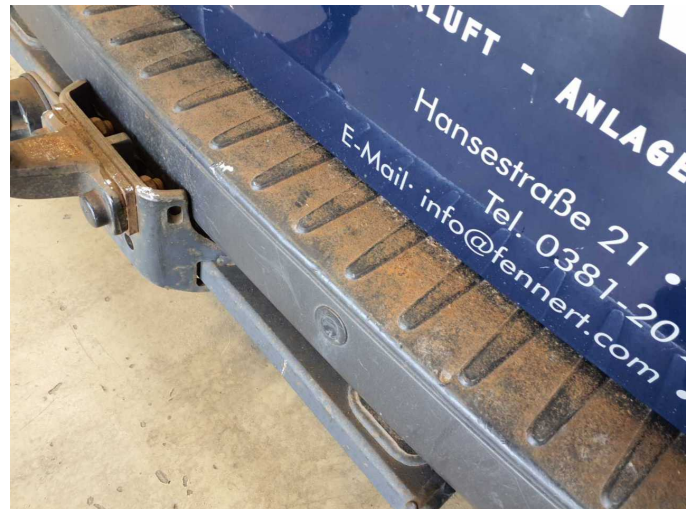

Damage 6: Rear bumper: Rear bumper (Verschmutz durch Metalabrieb) - Soiled - Clean



Damage 6: Rear bumper: Rear bumper (Verschmutz durch Metalabrieb) - Soiled - Clean

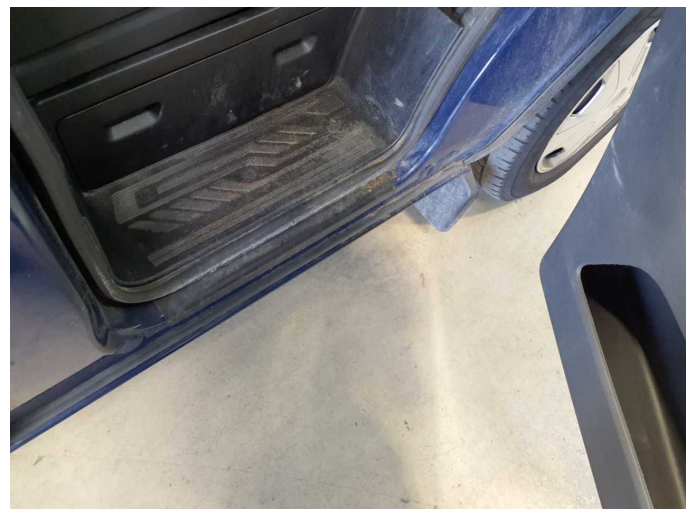

Damage 7: Sill - right side: Sill - Corrosion - Repair and paint



Damage 7: Sill - right side: Sill - Corrosion - Repair and paint



Damage 8: Sill - left side: Sill - Corrosion - Repair and paint



Damage 8: Sill - left side: Sill - Corrosion - Repair and paint



Damage 9: Interior: Cargo area floor - Scratch(es) - Loss in value



Damage 9: Interior: Cargo area floor - Scratch(es) - Loss in value



Damage 10: Body: Body - Glued / labelled - De-glue / neutralise



Damage 10: Body: Body - Glued / labelled - De-glue / neutralise




Damage 11: Trim / covers: Trim / covers (Heck tür links und rechts) - Broken / torn - Replace



Damage 11: Trim / covers: Trim / covers (Heck tür links und rechts) - Broken / torn - Replace



Damage 11: Trim / covers: Trim / covers (Heck tür links und rechts) - Broken / torn - Replace

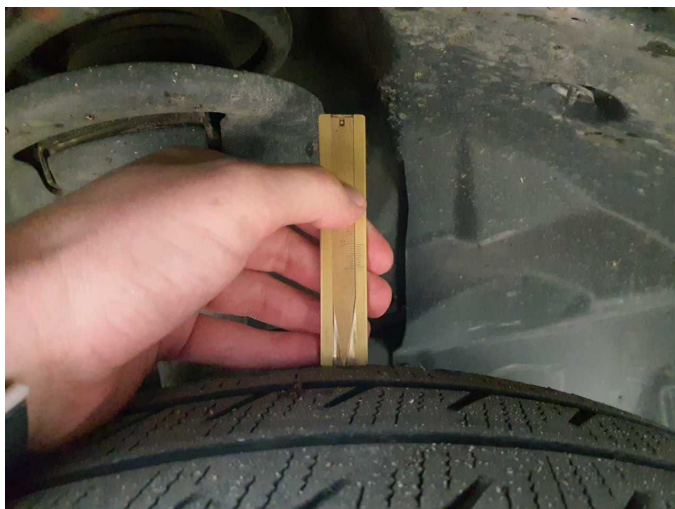

Damage 12: Wheel / tyres: Tyre - front - Worn - Replace



Damage 12: Wheel / tyres: Tyre - front - Worn - Replace




Damage 13: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 13: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 14: Side panel - rear left side: Side panel - Scratch(es) - Paint

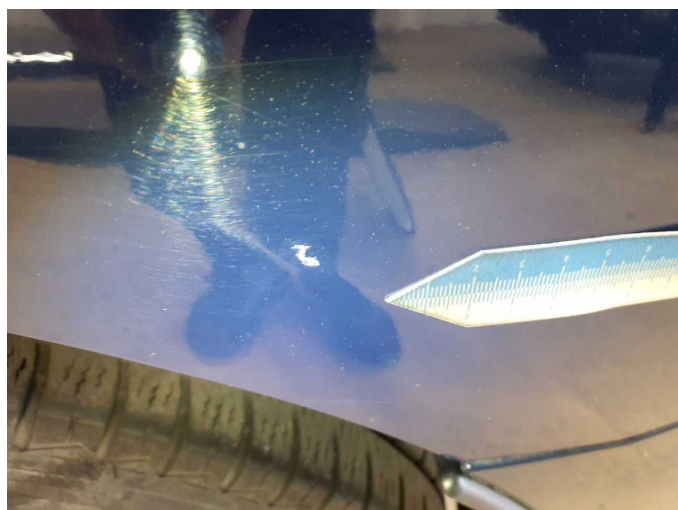


Damage 14: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 14: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 15: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint

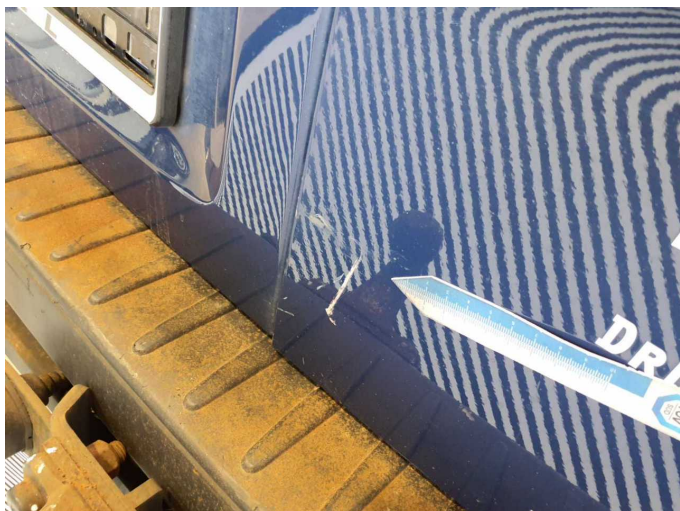


Damage 15: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint




Damage 15: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint




Damage 15: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint

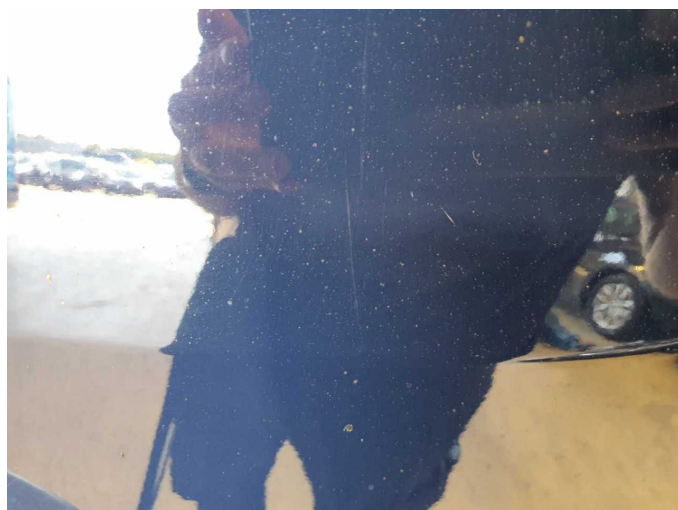


Damage 15: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint

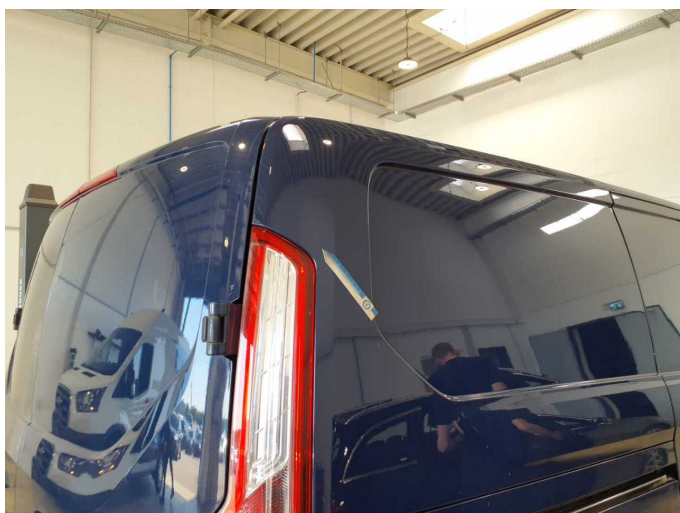


Damage 16: Side panel - rear right side: Side panel (Spachtel eingefallen Einschlüsse) - Unprofessionally repaired - Repair and paint

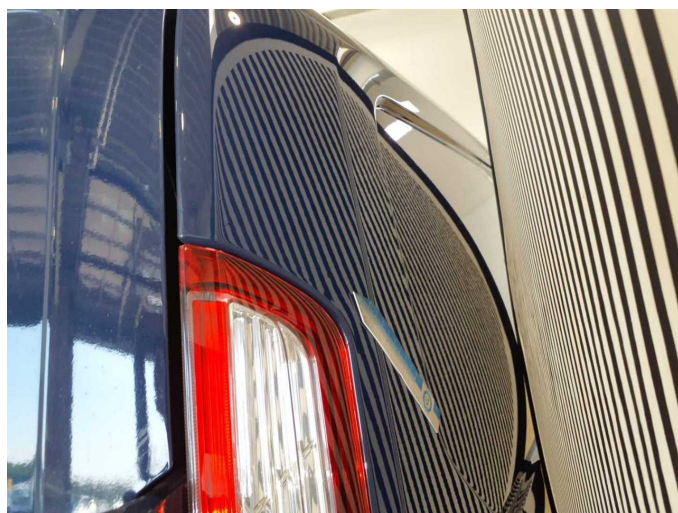


Damage 16: Side panel - rear right side: Side panel (Spachtel eingefallen Einschlüsse) - Unprofessionally repaired - Repair and paint

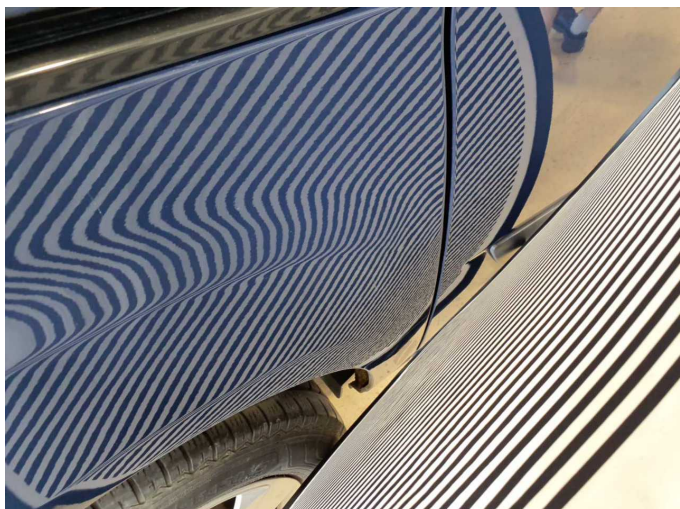


Damage 16: Side panel - rear right side: Side panel (Spachtel eingefallen Einschlüsse) - Unprofessionally repaired - Repair and paint

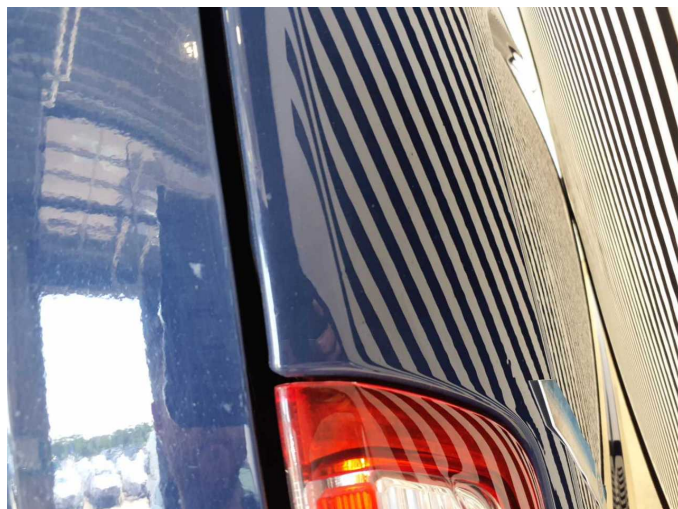

Damage 16: Side panel - rear right side: Side panel (Spachtel eingefallen Einschlüsse) - Unprofessionally repaired - Repair and paint

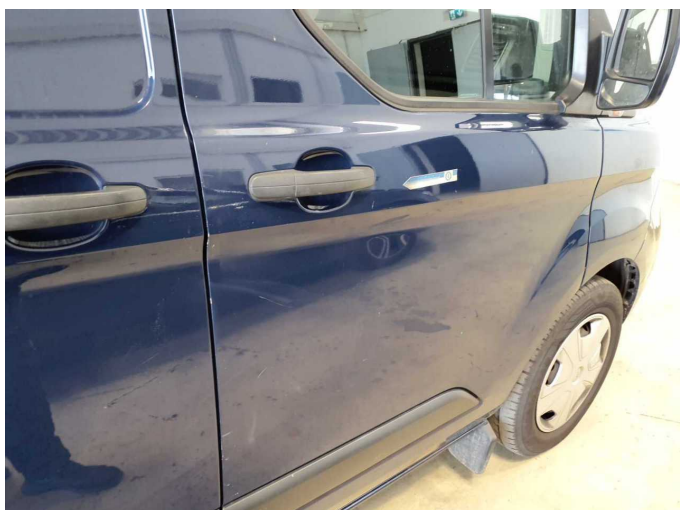

Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

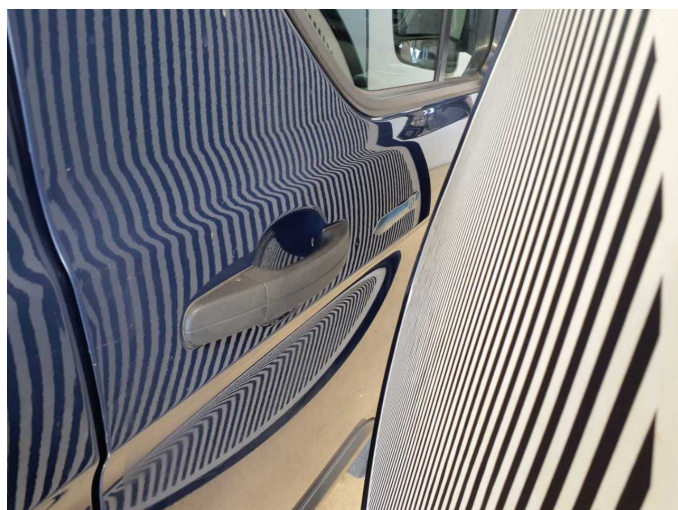

Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 18: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

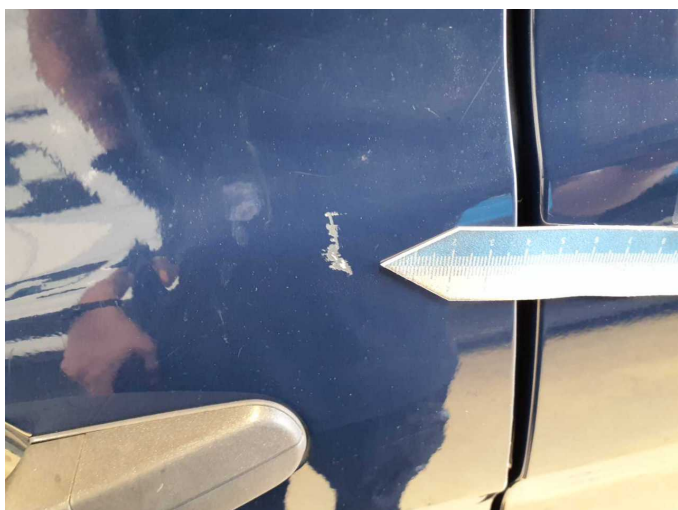


Damage 18: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 18: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

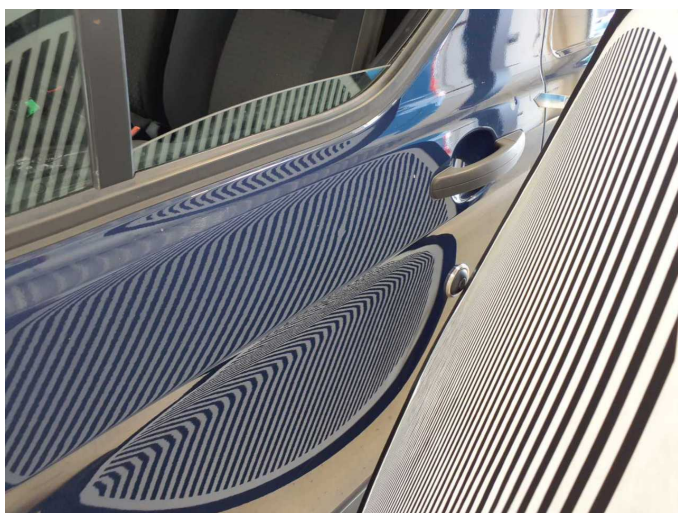


Damage 18: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

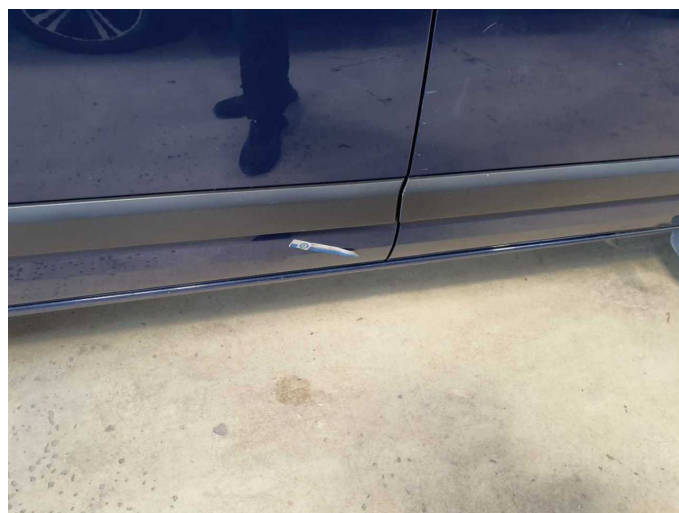


Damage 19: Sliding door, right: Sliding door (Einschlüsse und unförmig) - Unprofessionally repaired - Repair and paint




Damage 19: Sliding door, right: Sliding door (Einschlüsse und unförmig) - Unprofessionally repaired - Repair and paint

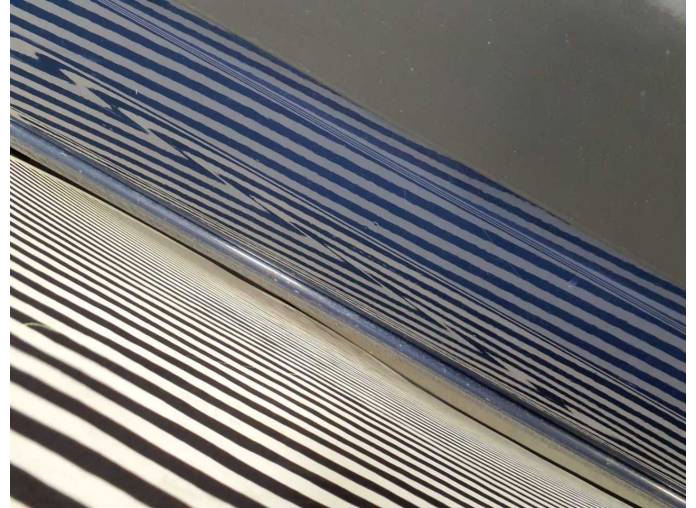


Damage 19: Sliding door, right: Sliding door (Einschlüsse und unförmig) - Unprofessionally repaired - Repair and paint

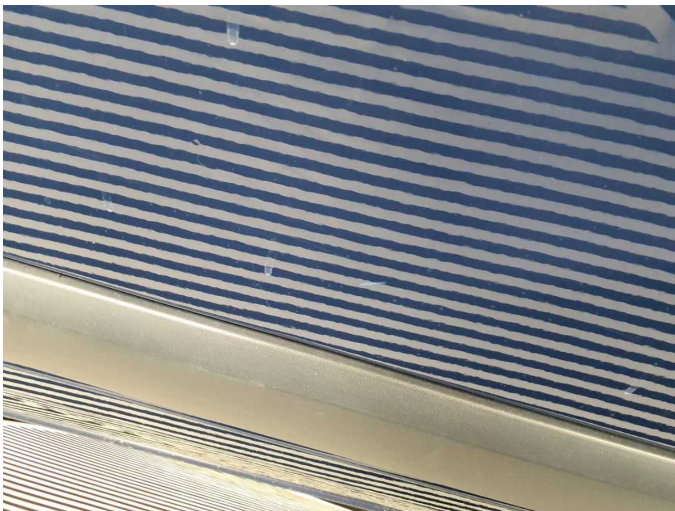

Damage 19: Sliding door, right: Sliding door (Einschlüsse und unförmig) - Unprofessionally repaired - Repair and paint

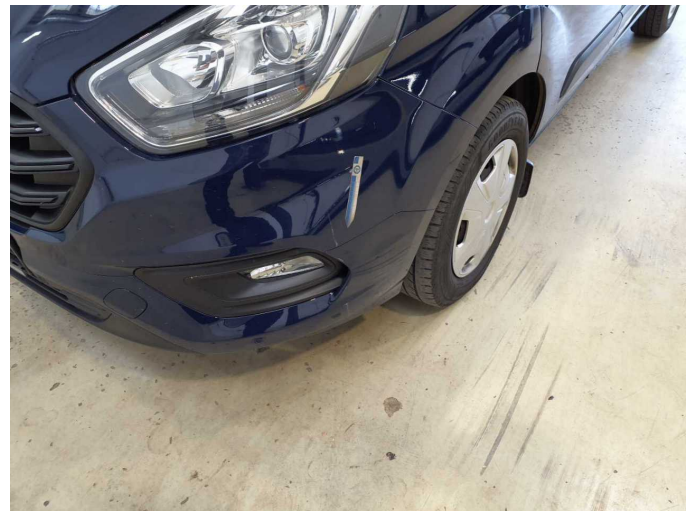

Damage 20: Front bumper: Front bumper - Scratch(es) - Paint

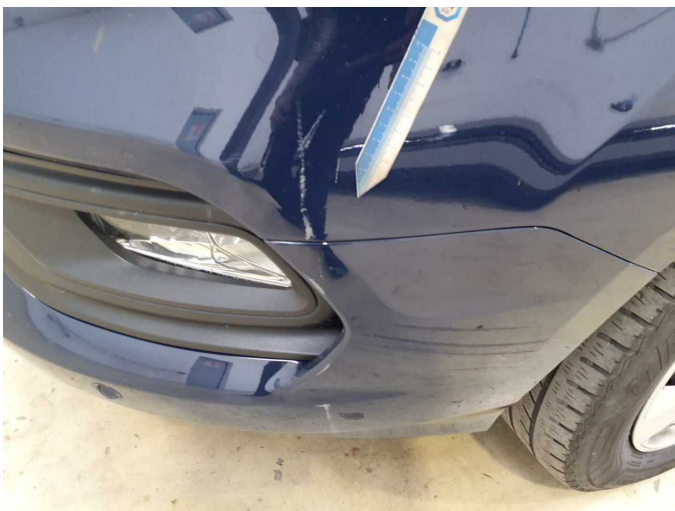

Damage 20: Front bumper: Front bumper - Scratch(es) - Paint




Damage 20: Front bumper: Front bumper - Scratch(es) - Paint



Damage 21: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 21: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

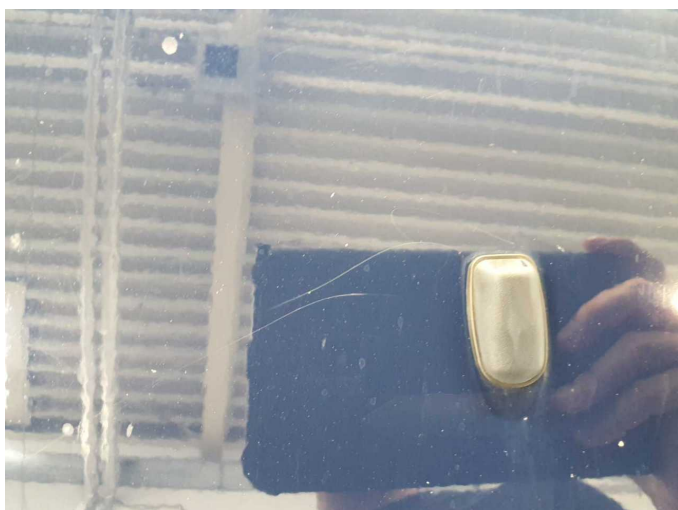

Damage 21: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 21: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 22: Roof: Roof - Dent / paintcoat damage - Repair and paint




Damage 22: Roof: Roof - Dent / paintcoat damage - Repair and paint




Damage 22: Roof: Roof - Dent / paintcoat damage - Repair and paint

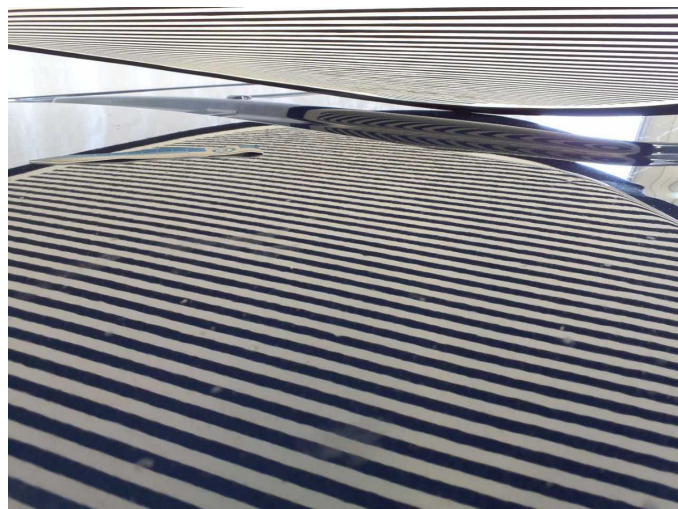

Damage 22: Roof: Roof - Dent / paintcoat damage - Repair and paint

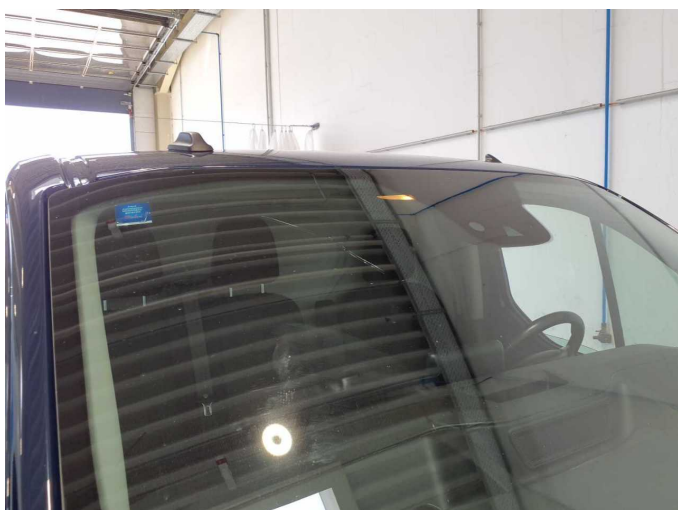

Damage 23: Vehicle glazing: Windscreen - Stone chips - Replace

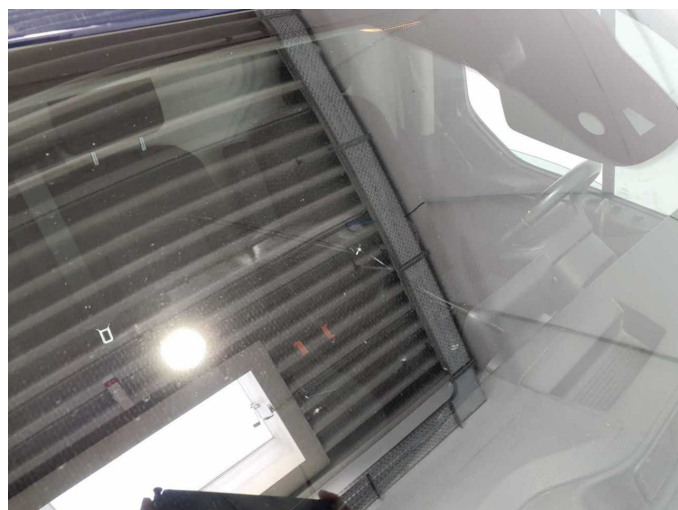

Damage 23: Vehicle glazing: Windscreen - Stone chips - Replace



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Repainting 2: Door - rear right side



Repainting 2: Door - rear right side