



Expertise

Protocol number: 46643335
Order No. / Reference: 26539219
Inspection date: 17 Jul 2026

Manufacturer: Ford

Model: Transit Custom 320 L2H1 LKW VA MH Basis

VIN: WF0ZXXTTGZPS39570



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Custom 320 L2H1 LKW VA MH Basis

Vehicle Identification number WF0ZXXTTGZPS39570

Mileage (Read) 181,843 km

First registration 19 Oct 2023

Number of holders 1

Fuel type Hybrid Diesel / E

Engine displacement / Cylinder 1,995 ccm / 4

Power 96 kW

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Frozen White

Doors / Seats 4 / 6

Upholstery type Cloth

Colour of upholstery Black

Vehicle with smoke odor no

readiness to drive Not roadworthy /
moveable



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	35,000 km
Last service on / at	08/2023 at 15 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GX196047
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BSG 01285		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Kumho	8mm / 8mm
2)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Goodyear	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres on Steel	Semperit	5mm / 5mm
2)	215/65 R16 109R	Winter tyres on Steel	Semperit	9mm / 9mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	Summer tyres on Steel	Goodyear	9 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- roof, flat
- Double-leaf rear door with 180° opening angle (without window)
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- FordPass Connect
- Transmission: 6-speed transmission
- Glove compartment with lid
- Fuel tank 70 l
- Cargo area lighting with activatable switch-off delay
- Steering column, adjustable in height and reach
- Particulate filter: diesel particulate filter
- Wheel hub covers
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 R tires
- Sliding door: Sliding door, right
- Mud flaps front and rear
- Power steering
- Seats: Seat package 4 - partition, without window (Custom truck base MH)
- Lashing eyes 8
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric

- Driver's side airbag
- Exterior mirrors, manually adjustable (2)
- On-board computer
- Headliner in driver's cab
- Tachometer
- Third brake light
- Front electric windows
- Ford Easy Fuel
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Interior lighting with delay circuit
- Paint finish: Solid color paint
- Cargo area floor: Vinyl floor covering omitted
- Emergency brake assist including emergency brake light
- Radio: Audio system 13 additionally with DAB/DAB+
- Wheels/Tires: Spare wheel, steel wheel
- Headlight low beam: Halogen headlights with daytime running lights
- Side protection strips
- Seat belts
- Start-stop system
- Power outlet: 12-volt connection
- Immobiliser
- Central locking with remote control

Extra equipment

- Adaptive cruise control including Pre-Collision Assist (distance display and warning system, collision warning system, active emergency braking assist - lane keeping assist - front and rear parking pilot system)
- Radio: Audio system 21: Ford audio system with 8" multifunction display plus DAB/DAB+ (Connected Radio - FordPass Connect Wi-Fi hotspot (up to 4G/LTE, for up to 10 mobile devices) - 8" touchscreen multifunction display (20.32 cm screen diagonal) - Four speakers, antenna - Integrated control panel and audio remote control on the steering wheel - Support for Android Auto and Apple CarPlay)
- Speed limiter 130 km/h

- Double-leaf rear door with 180° opening angle (with window)
- Exterior mirrors, electrically adjustable and heated
- Front air conditioning
- Grab handle on the B-pillar of the passenger side
- Headlights: Halogen projector headlights
- Package: Smoker (cigarette lighter and ashtray)
- Paintwork: Special paintwork in standard color
- Parking heater, programmable, with remote control
- Reversing camera with front and rear parking pilot system (reversing camera with image transmission of the rear driving path in the multifunction display and coupling aid)

Retrofitted equipment

- EUROVA logos and lettering according to corporate design
- Complete winter wheels (Semperit Van Grip2, 215/65 R1

- Warning marking according to DIN 30710 with 3M Scotchlite Si



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Engine	Engine - Leaking - Perform diagnosis
2	Interior	Interior - Soiled - Clean
3	Misc.	Vehicle (Folie) - Glued / labelled - De-glue / neutralise
4	Rear bumper	Rear bumper - Scratched - Paint
5	Front bumper	Front bumper - Scratch(es) - Paint
6	Bonnet	Bonnet - Dent / paintcoat damage - Replace
7	Vehicle glazing	Windscreen - Unprofessionally repaired - Replace
8	Boot lid / rear door	Rear door - left side (Inkl. Folie) - Dent / paintcoat damage - Replace

Missing parts

Description

Documents - Main inspection certificate

Accident damages

No. Accident

- 1 Underbody
- 2 Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

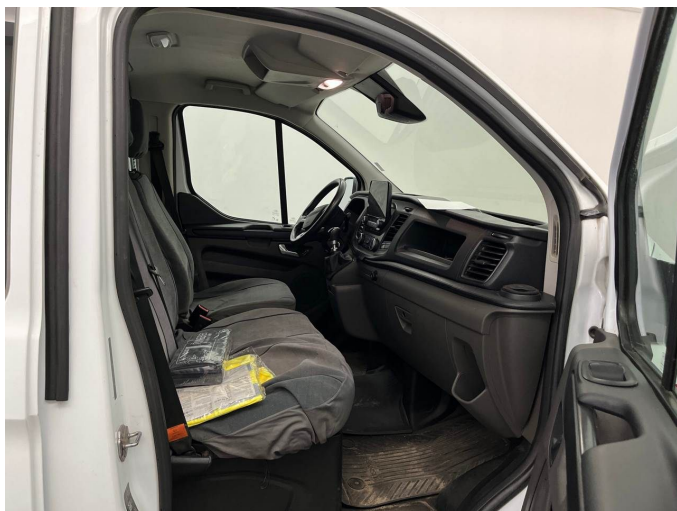


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

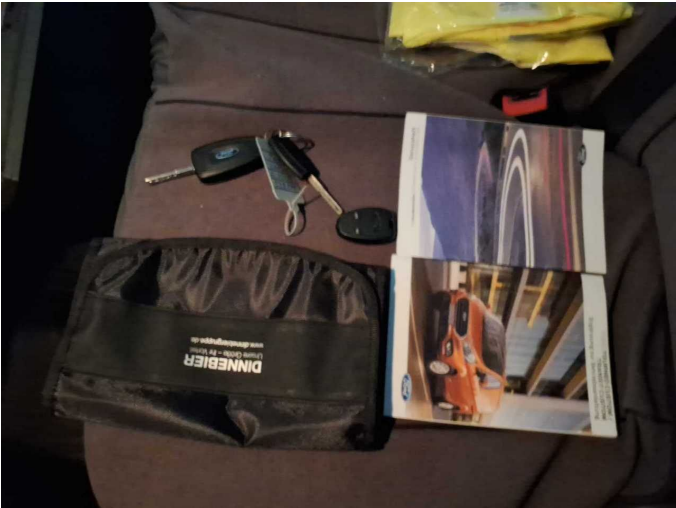


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Misc.

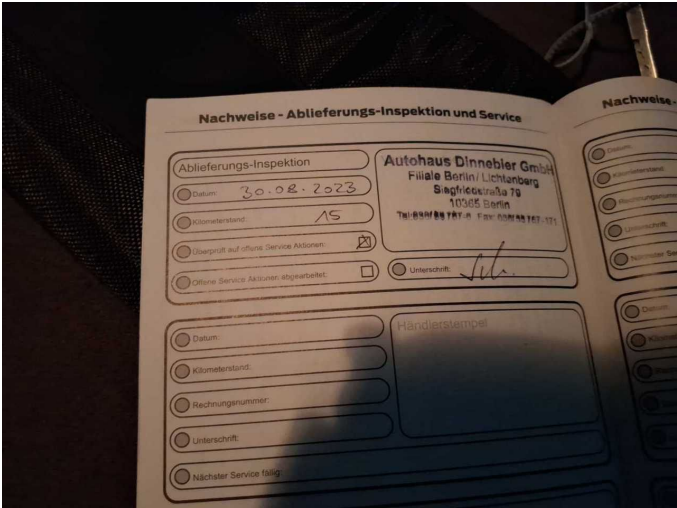


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.


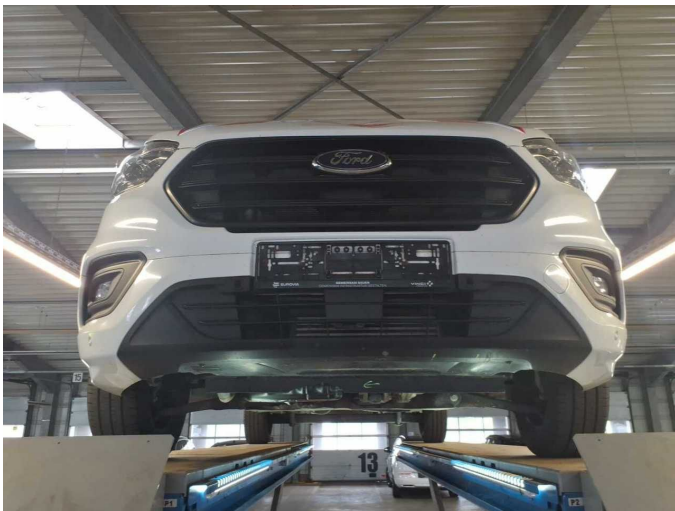



Figure 27: Misc.




Figure 28: Misc.

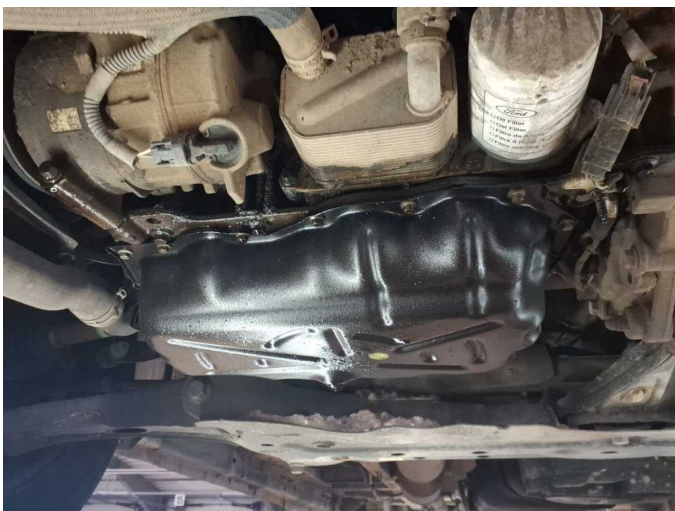

Damage 1: Engine: Engine - Leaking - Perform diagnosis

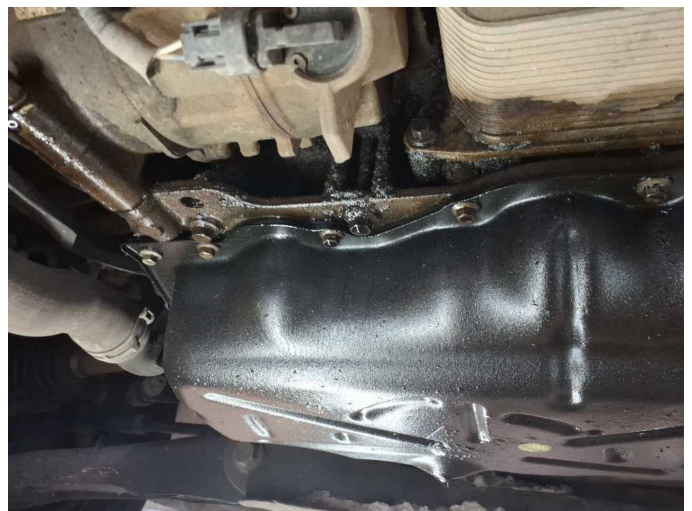


Damage 1: Engine: Engine - Leaking - Perform diagnosis

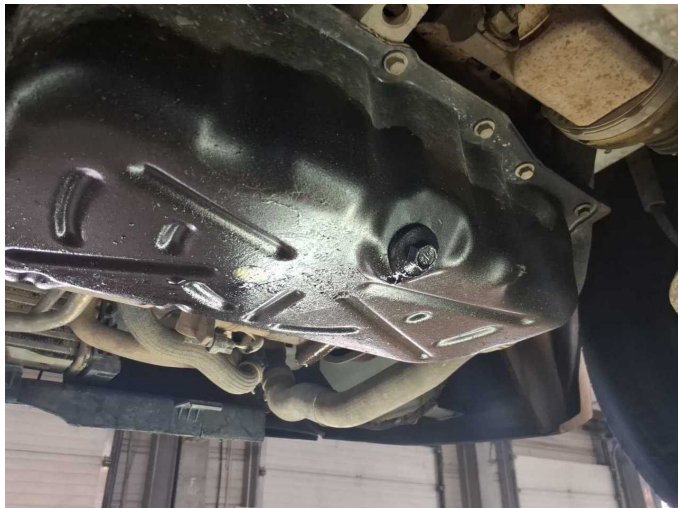

Damage 1: Engine: Engine - Leaking - Perform diagnosis



Damage 2: Interior: Interior - Soiled - Clean

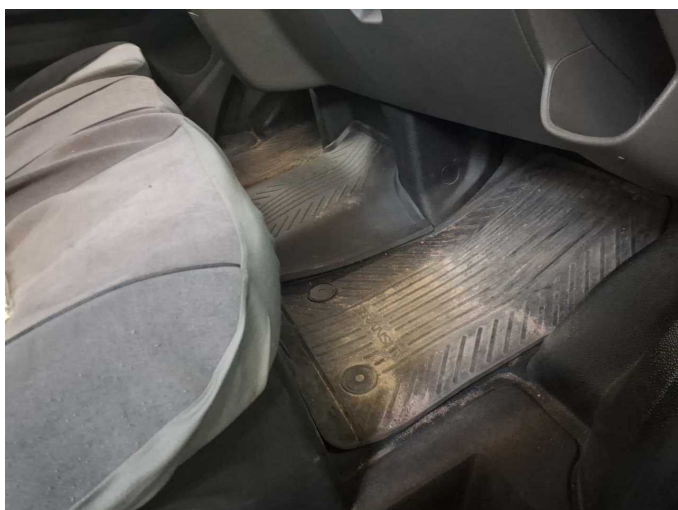

Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean




Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise




Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise



Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise

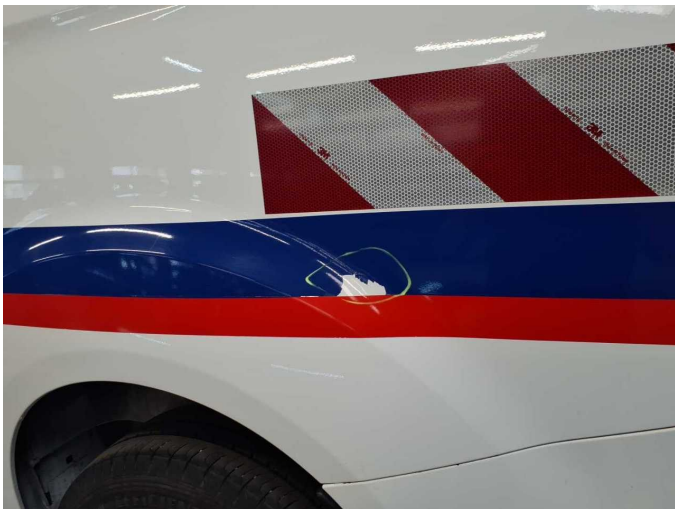


Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise

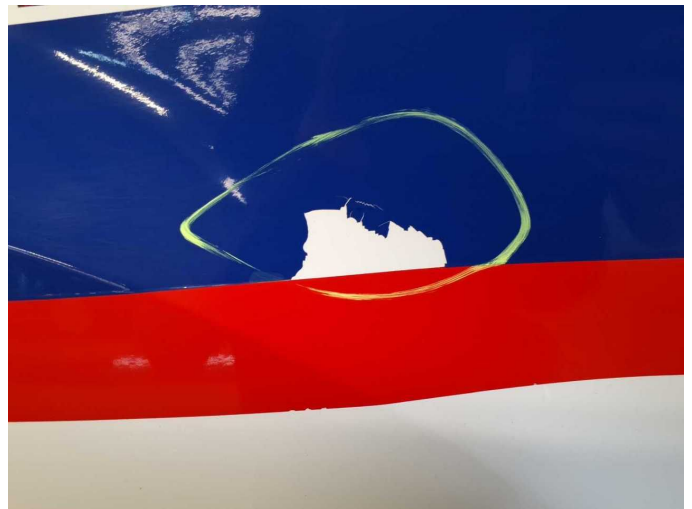

Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise



Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise

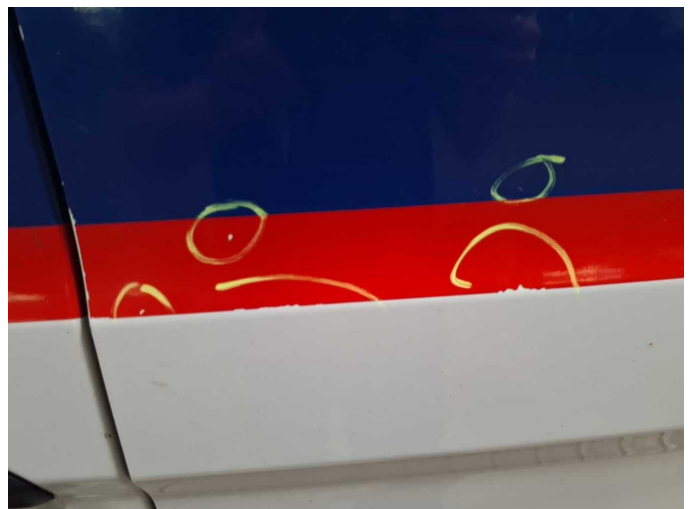

Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise



Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise




Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise



Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise



Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise

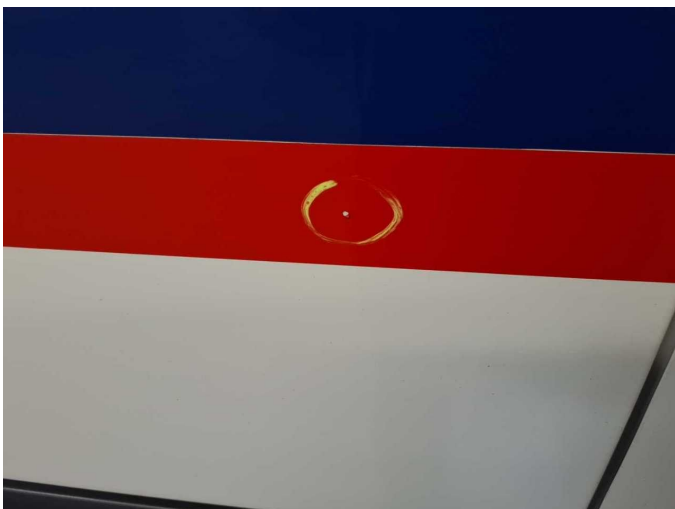


Damage 3: Misc.: Vehicle (Folie) - Glued / labelled - De-glue / neutralise



Damage 4: Rear bumper: Rear bumper - Scratched - Paint



Damage 4: Rear bumper: Rear bumper - Scratched - Paint

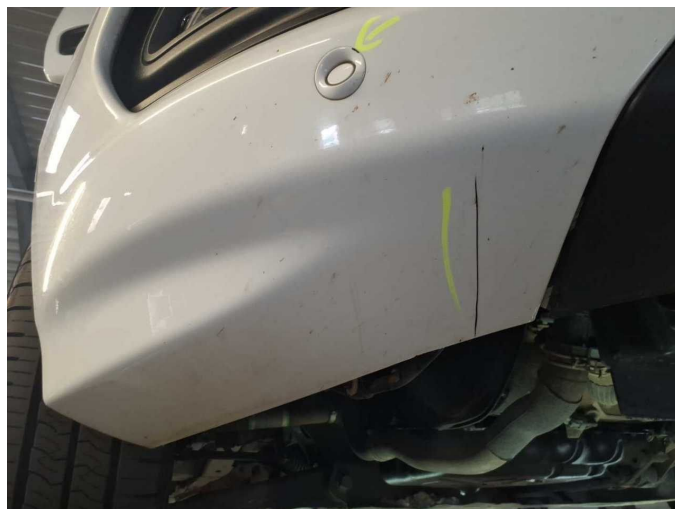

Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Replace



Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Replace



Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Replace




Damage 7: Vehicle glazing: Windscreen - Unprofessionally repaired - Replace



Damage 7: Vehicle glazing: Windscreen - Unprofessionally repaired - Replace



Damage 7: Vehicle glazing: Windscreen - Unprofessionally repaired - Replace

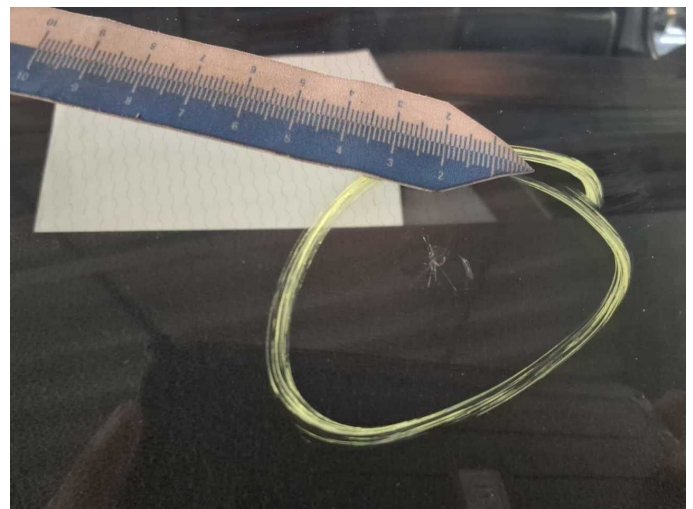

Damage 7: Vehicle glazing: Windscreen - Unprofessionally repaired - Replace



Damage 8: Boot lid / rear door: Rear door - left side (Inkl. Folie) - Dent / paintcoat damage - Replace



Damage 8: Boot lid / rear door: Rear door - left side (Inkl. Folie) - Dent / paintcoat damage - Replace



Damage 8: Boot lid / rear door: Rear door - left side (Inkl. Folie) - Dent / paintcoat damage - Replace



Damage 8: Boot lid / rear door: Rear door - left side (Inkl. Folie) - Dent / paintcoat damage - Replace



Accident 1: Underbody




Accident 1: Underbody



Accident 1: Underbody



Accident 1: Underbody

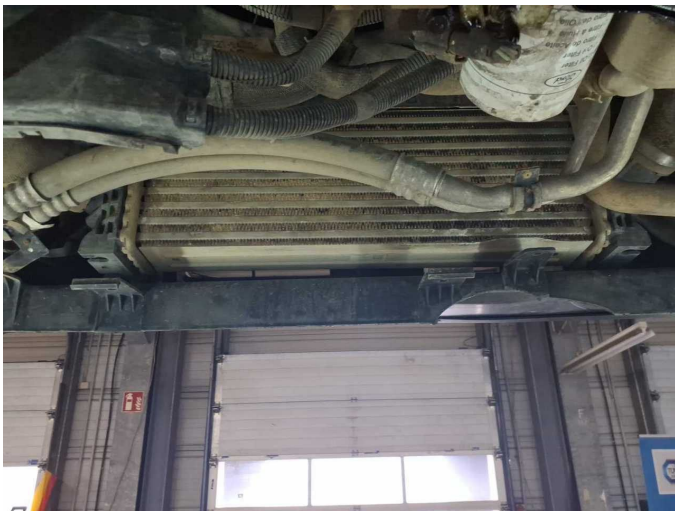

Accident 1: Underbody



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right