



Expertise

Protocol number: 46400646
Order No. / Reference: 26527946
Inspection date: 1 Jul 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1TZLW003129



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Comfortline	
Vehicle Identification number	WVGZZZ1TZLW003129
Mileage (Read)	135,200 km
First registration	30 Sept 2019
Number of holders	1
Next periodical technical inspection	09/2026
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Uranograu
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Grey-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	79 Tag(e)
Last service on / at	09/2025 at 115,696 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FJ479400
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWS 00324		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,340 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	205/60 R16 96H	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Electrically adjustable and heated exterior mirrors
- third brake light
- black roof rails
- Decorative inlays "Piano Black"
- Tachometer
- Electronic parking brake including auto-hold function
- Windscreen in heat-insulating glass
- Baggage management package
- Additional luggage compartment lighting
- Speed limiter
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- ISOFIX mounting points on rear seats
- LED license plate lighting
- Headrests (3) in the 2nd row of seats
- Front headrests
- Paint finish: Solid
- Illuminated makeup mirrors in the sun visors
- Multifunction display "Plus"
- Non-smoking version
- Upholstery: Cloth
- Tire pressure monitoring system (passive)
- Wheels: Tires 205/60 R16
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: 3 individual seats in the 2nd row
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Start-stop system
- 12V power outlet on the rear of the center console
- Daytime running light
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing
- Black trim strips on the side windows
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers
- Exterior mirror housings and door handles in body color
- Headliner in Storm Grey
- Decorative inlays "New Brushed Design"
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- luggage compartment cover
- Height-adjustable luggage compartment floor
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer
- Black radiator grille with chrome strip on the lower slat
- Headlight range control
- front center armrest
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Radio "Composition Colour"
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16
- Wheels: Tire Mobility Set
- electromechanical power steering
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Dust and pollen filter
- Bumpers in body color
- Textile floor mats
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys



Extra equipment

- Airbag: Side airbags for the outer rear seats (including front side airbags and head airbag system)
- Air conditioning "Air Care Climatronic" with 3-zone temperature control (controls in the 2nd row of seats - allergen filter)
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters (with control options for multifunction display, radio and telephone)
- Multimedia systems: 2 USB interfaces, also for iPod/iPhone for "Composition Media" (2 USB charging ports - multimedia port AUX-IN - 12V socket on the rear center console omitted)
- Mesh partition
- Package: Driver Assistance Package (DSG) (Adaptive Cruise Control ACC up to 210 km/h including speed limiter, "Front Assist" area monitoring system, City Emergency Braking function - Automatic headlight control with daytime running lights, "Leaving Home" function and manual "Coming Home" function - "Light Assist" high beam control - Automatically dimming interior mirror - LED headlights for low and high beam, with daytime running lights - Dynamic headlight range control - Rain sensor - "stop & go" function)
- Radio accessories: Digital radio reception DAB (reception of digitally broadcast radio stations and traffic information in addition to the analog station offerings - reception depends on the local availability of digital networks)
- Voice control and electronic voice amplification (the driver's voice is amplified via the hands-free system through the infotainment system or the speakers to the rear seats - the rear passengers can therefore understand the driver or front passenger better acoustically)
- Towbar, foldable with electric release
- App-Connect and "Volkswagen Media Control" in conjunction with the "Discover Media" navigation function (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system - MirrorLink, Android Auto from Google and Apple CarPlay - Volkswagen Media Control: Infotainment system and navigation can be operated with one app via smartphone or tablet)
- Navigation function "Discover Media" for "Composition Media" ("Guide & Inform" runtime 1 year - Volkswagen Media Control - Navigation system "Discover Media" with TFT touchscreen)
- Package: Family for Composition Media or Discover Media or Discover Pro (electric child safety lock for rear doors, operable from the driver's seat - sunshade on the rear door windows - electronic voice amplification and voice control)
- Package: Winter package (automatically heated front windshield washer nozzles - headlight cleaning system - heated front seats - washer fluid level warning lights)
- Radio "Composition Media" (8 speakers - Radio "Composition Media" - telephone interface - USB interface also for iPod/iPhone)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Seats: 2 individual seats in the 3rd row, foldable into the luggage compartment floor (3 individual seats in the 2nd row with armrest, 2 individual seats in the 3rd row, with headrests and "Easy Fold" folding function)
- Traffic sign recognition

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Rear bumper	Rear bumper (In Unfallschaden Berücksichtigt) - Deformed - No deduction
2	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
3	Door - front left side	Door - Dent / paintcoat damage - Smart repair
4	Door - front right side	Door - Scratch(es) - Smart repair
5	Front bumper	Front strip (Abdeckung) - Damaged - Replace
6	Interior	Interior - Soiled - Conditioning
7	Side panel - rear left side	Side panel - Scratch(es) - Paint
8	Boot lid / rear door	Boot lid - Scratch(es) - Paint
9	Door - rear left side	Door - Dent / paintcoat damage - Paint
10	Bonnet	Bonnet - Dent / paintcoat damage - Paint
11	Sill - right side	Sill (Teilersatz) - Deformed - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Side right
2	Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

-Der montierte Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden

Minderwerte höher als HEK



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

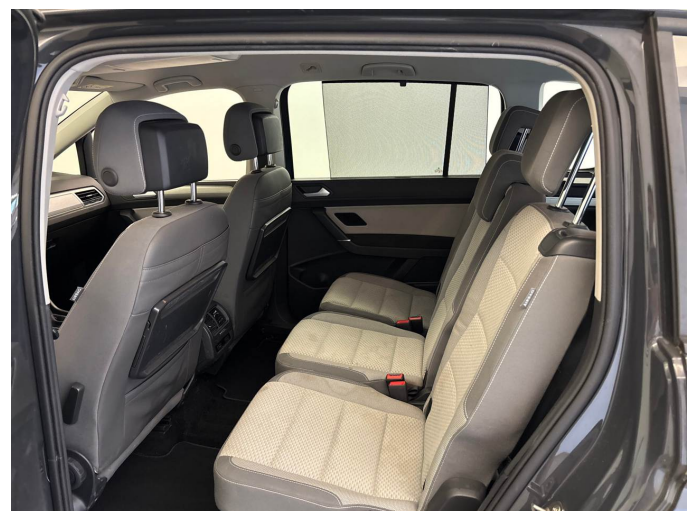


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

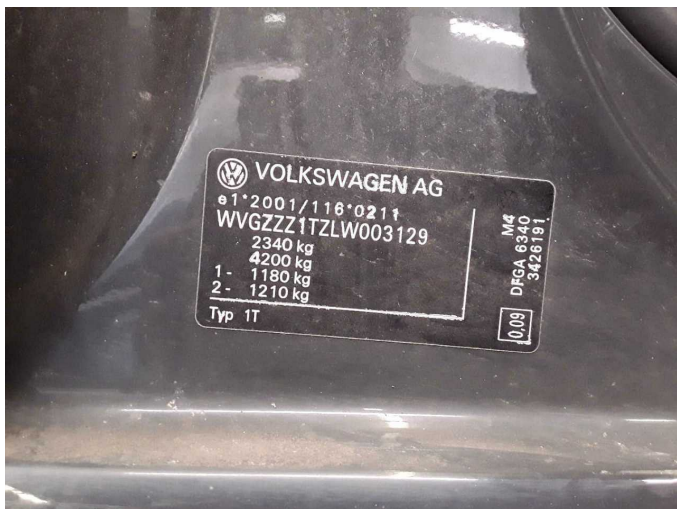


Figure 11: VIN



Figure 12: Mounted tyres

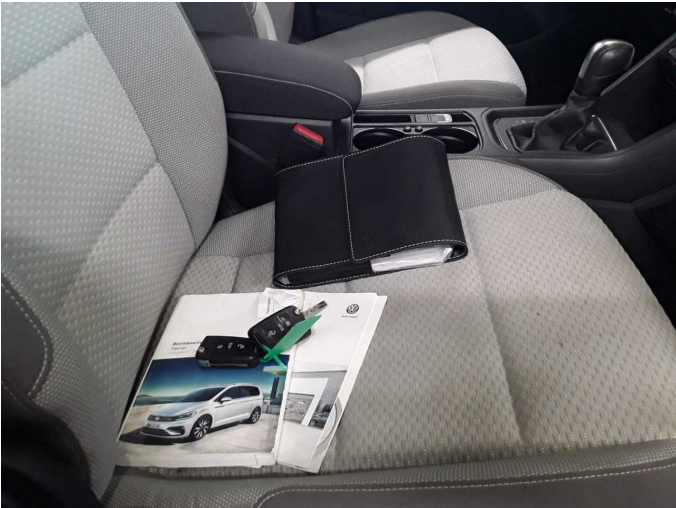


Figure 13: Documents

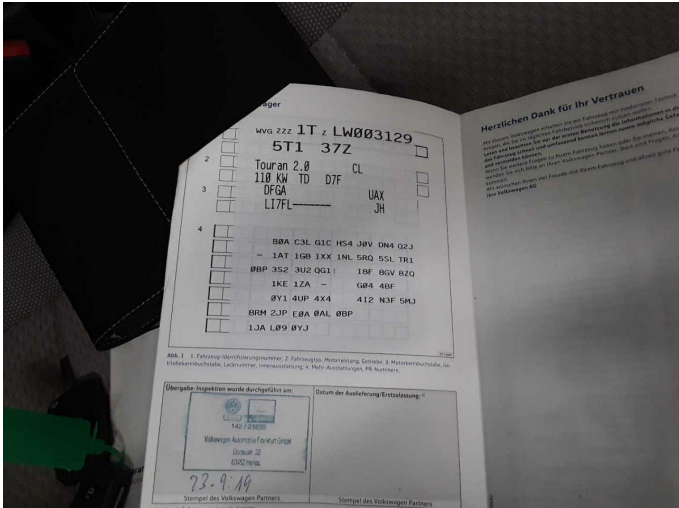


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

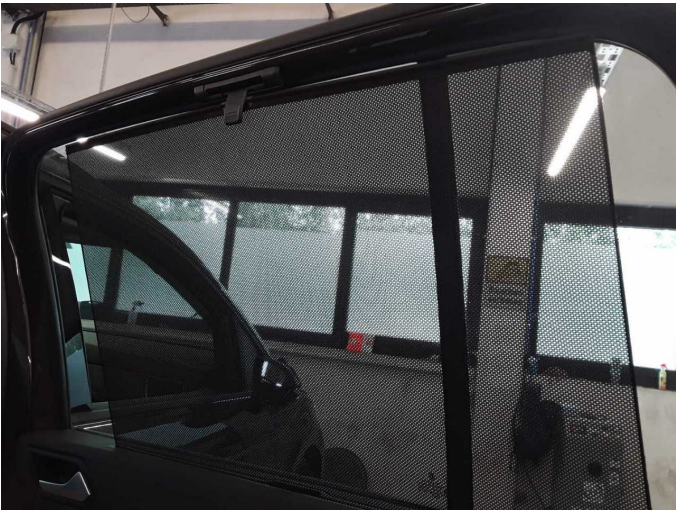


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

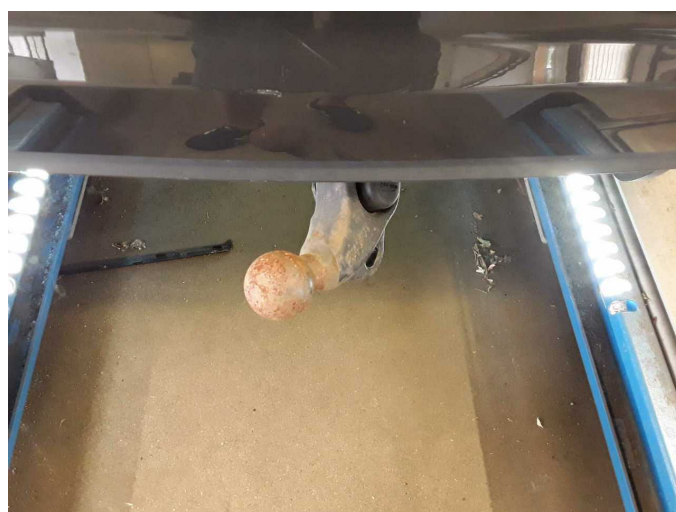


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Rear bumper: Rear bumper (In Unfallschaden Berücksichtigt)
- Deformed - No deduction



Damage 1: Rear bumper: Rear bumper (In Unfallschaden Berücksichtigt)
- Deformed - No deduction



Damage 2: Side panel - rear right side: Sill - Dent / paintcoat damage -
Smart repair




Damage 2: Side panel - rear right side: Sill - Dent / paintcoat damage -
Smart repair



Damage 3: Door - front left side: Door - Dent / paintcoat damage - Smart
repair



Damage 3: Door - front left side: Door - Dent / paintcoat damage - Smart repair

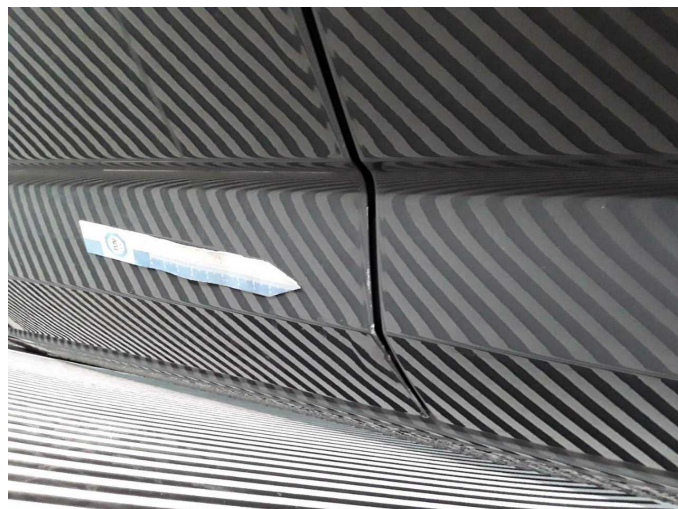

Damage 3: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - front right side: Door - Scratch(es) - Smart repair




Damage 4: Door - front right side: Door - Scratch(es) - Smart repair




Damage 5: Front bumper: Front strip (Abdeckung) - Damaged - Replace




Damage 5: Front bumper: Front strip (Abdeckung) - Damaged - Replace

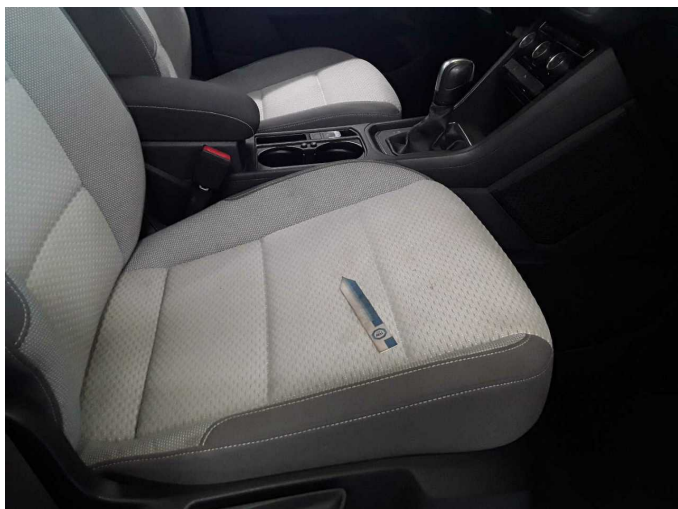


Damage 6: Interior: Interior - Soiled - Conditioning

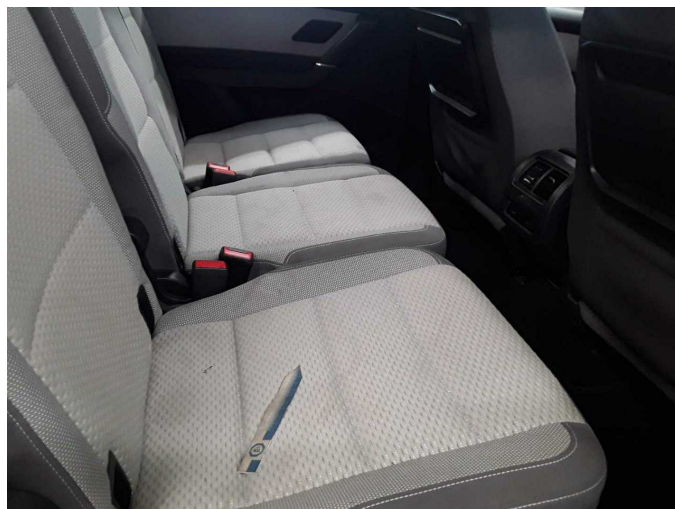

Damage 6: Interior: Interior - Soiled - Conditioning

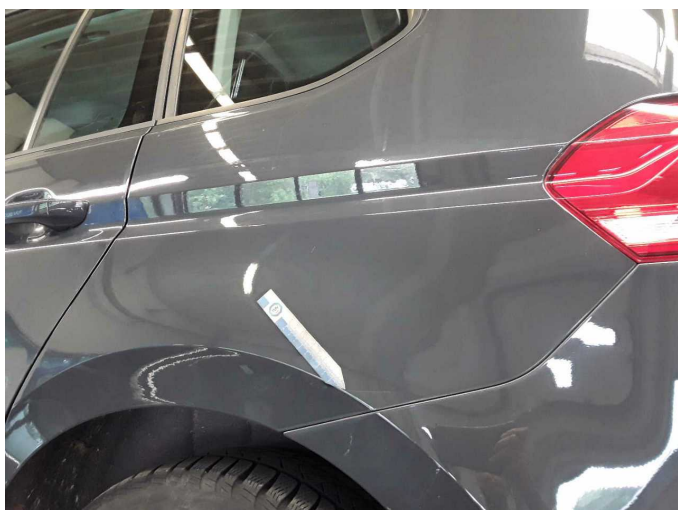

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint

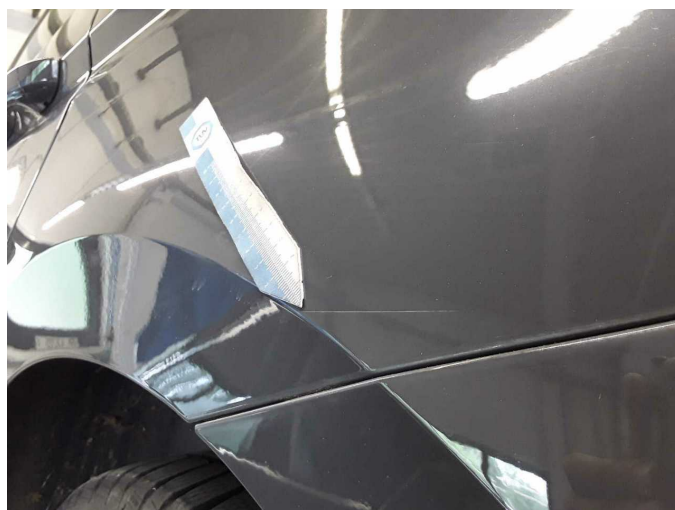

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Paint

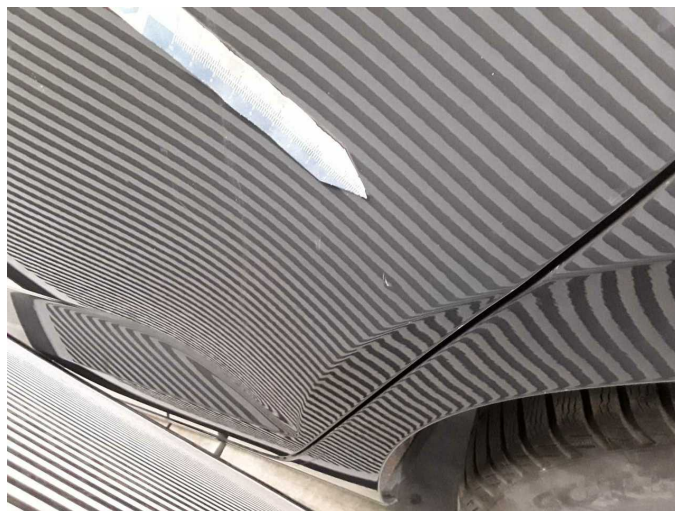

Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Paint




Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Paint

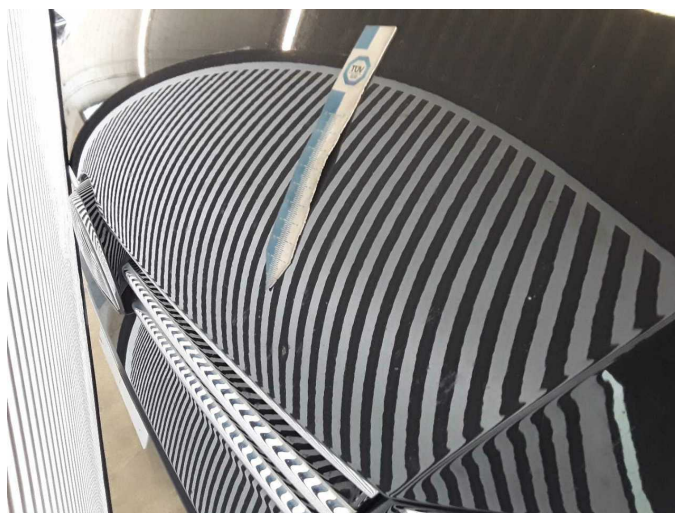

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace

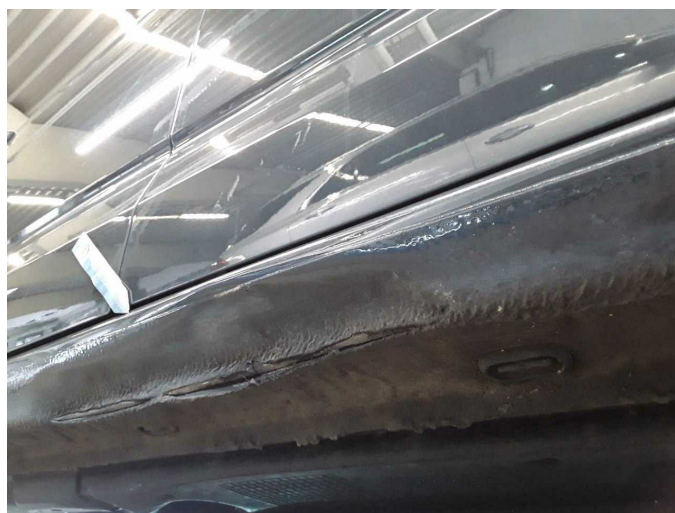

Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace



Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace



Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace



Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace



Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace



Damage 11: Sill - right side: Sill (Teilersatz) - Deformed - Replace



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 2: Side right




Accident 2: Side right



Accident 2: Side right




Accident 2: Side right

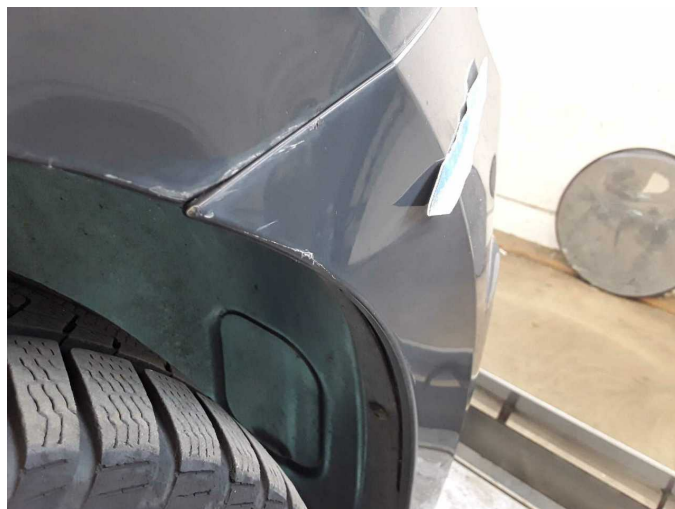


Accident 2: Side right



Accident 2: Side right

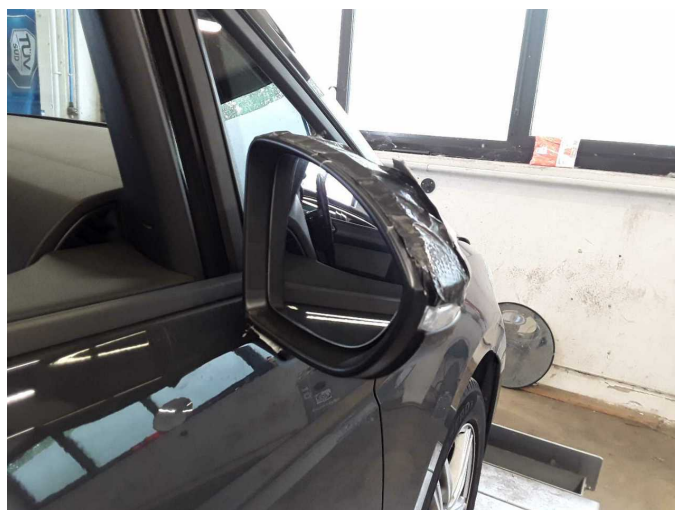

Accident 2: Side right

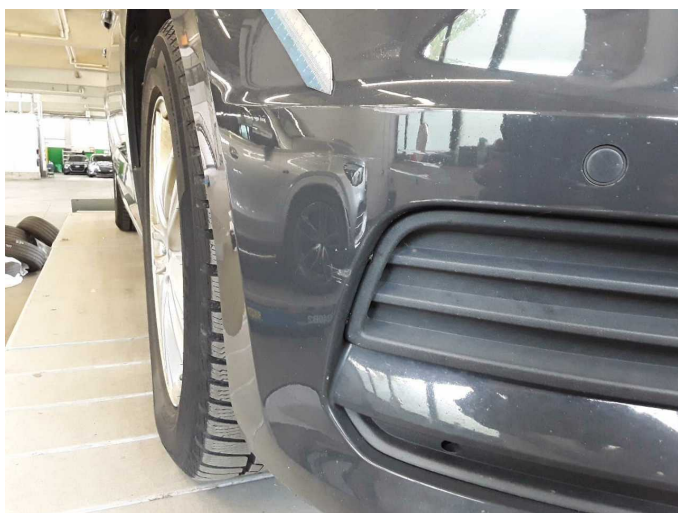

Accident 2: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZLW003129

Hersteller / Modell: VOLKSWAGEN VW Touran 2.0 TDI SCR DSG Comfortline

Datum	KM-Stand	Beschreibung
19.09.2025	115.696	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.09.2024	88.050	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
12.06.2024	0	HU + AU
10.08.2023	63.255	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.07.2022	45.206	Bremsflüssigkeit ern; HU + AU; Regelwartungsdienst
02.08.2021	31.978	Motoröl b. Wartung; Regelwartungsdienst