



Expertise

Protocol number: 46557958
Order No. / Reference: 26559442
Inspection date: 16 Jul 2026

Manufacturer: Peugeot

Model: 3008 BlueHDi 130 Stop & Start Allure

VIN: VF3MCYHZMMS267026



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 3008 BlueHDi 130 Stop & Start Allure	
Vehicle Identification number	VF3MCYHZMMS267026
Mileage (Read)	117,358 km
First registration	10 Feb 2022
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	TYPE HABILLAGE EXTERIEUR METALLISEE VERNIS
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,300 km
Last service on / at	01/2026 at 106,693 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA847122
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / AZI 00230		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	3mm / 3mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Continental	3mm / 3mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment: Illuminated glove compartment
- Active Safety Brake and Front Collision Warning
- Electrically folding exterior mirrors
- Exterior mirrors in Perla Nera Black
- Hill start assist
- On-board computer
- Chrome trim strips on the lower part of the doors
- Decorative inlays "Spray" with carbon look for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Misfueling protection
- Electric windows, front and rear
- electric parking brake
- Front collision warning
- Cruise control system with speed limiter
- Cup holder in the center console
- Heated rear window
- Interior mirror automatically dimming
- Automatic climate control (2-zone), with activated carbon filter
- LED ambient lighting in the front footwell
- LED taillights with 3D effect
- LED daytime running lights and LED turn signals at the front
- light sensor
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- rear fog lights
- Particulate filter: FAP diesel particulate filter
- Peugeot Connect Box
- Radio: RCC audio system
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Wheels: 18" "Detroit" alloy wheels, two-tone with grey
- Reversing camera with 180° surround view
- Shift point indicator
- Keyless start system
- Electric power steering
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Stop&Start system
- Doors lock automatically when driving off
- Tie-down points in the trunk (4 pieces)
- Central locking can be activated from inside using a remote control.
- ABS (Anti-lock Braking System)
- Airbags (6)
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Turn signals with lane change indicator function
- third brake light
- Chrome trim strips above the side windows
- Decorative trim on the dashboard and door panels in satin chrome
- Pressure tank system including switch for opening the tank flap
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- High beam assist
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Transmission: 6-speed manual transmission
- Seat belts: 3-point safety belts
- rear window wiper
- Manual child lock
- Headrests (2)
- Rear headrests (3)
- LED ceiling light and LED reading lamps
- LED headlights (Eco)
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- Rear center armrest with pass-through flap
- Fatigue warning
- Navigation system: 3D navigation system NAC
- Emergency brake assist with automatic activation of the hazard warning lights
- Upholstery: Fabric/faux leather (Colyn) in black with decorative stitching in mint
- Radio accessories: Mirror Screen
- Tire pressure monitoring system
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Rear seat backrest split 40/60 and automatically foldable, control element in the boot
- Side and rear windows are more heavily tinted.
- Seats: Passenger seat height adjustable
- Seats: Manual lumbar support, for driver's seat
- Socket (3) 12 Volt
- Blind spot assist
- Traffic sign recognition
- Immobiliser



Extra equipment

- Detachable towbar (with removable ball head without tools)
- Without PEUGEOT Connect Box
- Warning triangle
- Luggage compartment partition net
- Paint finish: Special metallic paint
- Seats: Heated front seats (adjustable in 3 stages)
- Warning triangle TJ01

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Steering system	Steering wheel - Abrasion - Smart repair
2	Sill - left side	Sill - Scratch(es) - Smart repair
3	Side panel - rear right side	Sill - dent(s) - Smooth repair work
4	Gearbox	Gear knob (Leder) - Abrasion - Replace
5	Door - rear right side	Door - Scratch(es) - Smart repair
6	Trim / covers	Boot sill cover (Nasen gebrochen) - Loose - Replace
7	Interior	Cargo area floor - Broken / torn - Replace
8	Seat - front	Seat cover - left side (Wange) - Broken / torn - Replace
9	Door - front left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 12 Mar 2026	3.154,60 €

Accident damages

No.	Accident
1	Side - left

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Bonnet

336 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

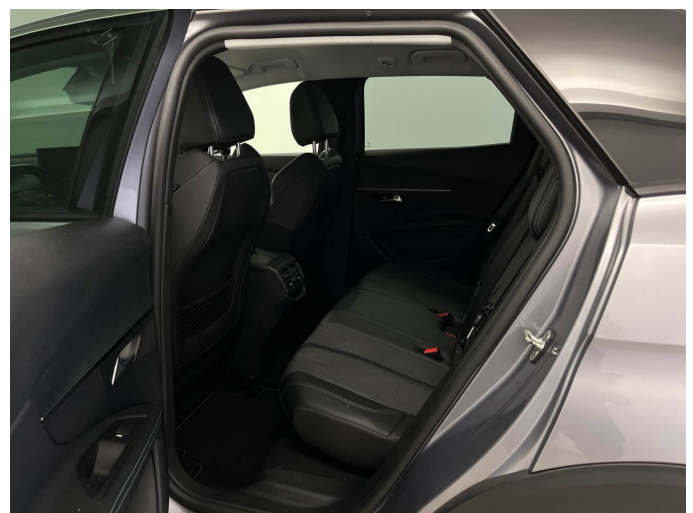


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

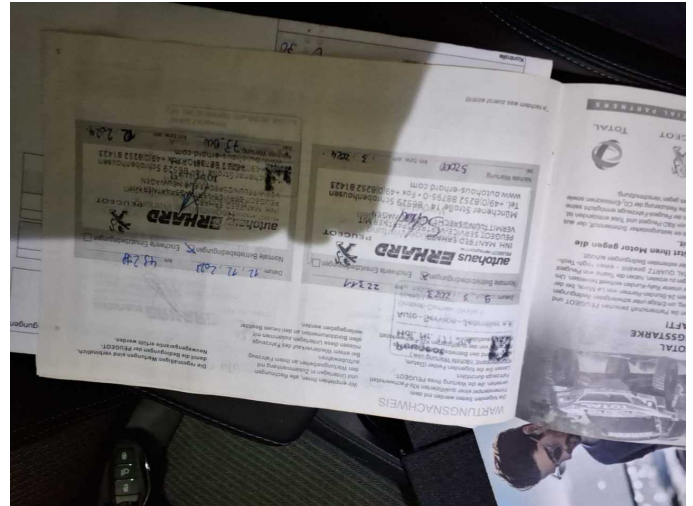


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

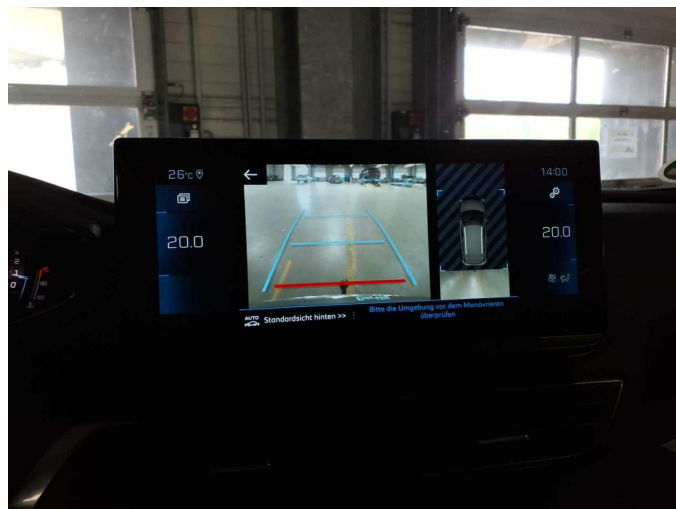


Figure 20: Misc.

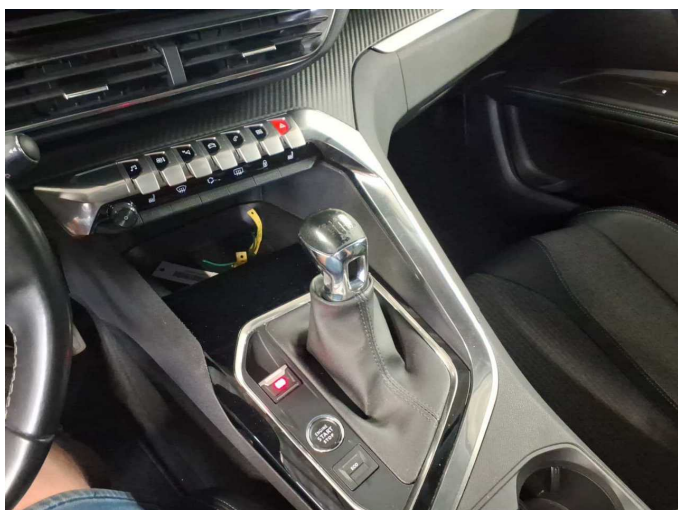


Figure 21: Misc.



Figure 22: Misc.

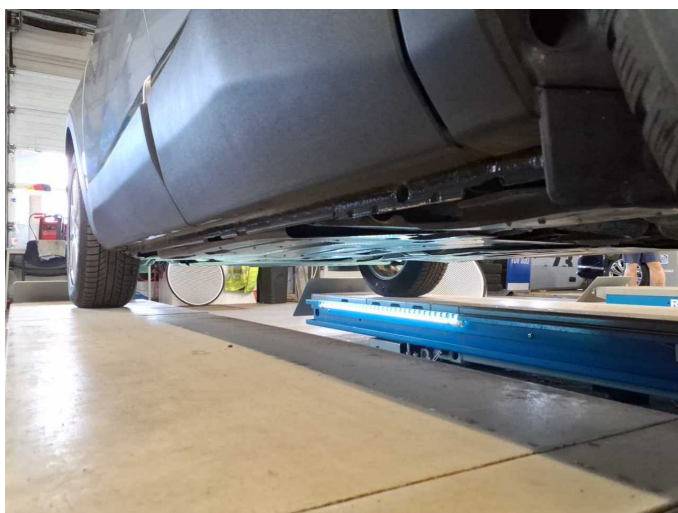


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

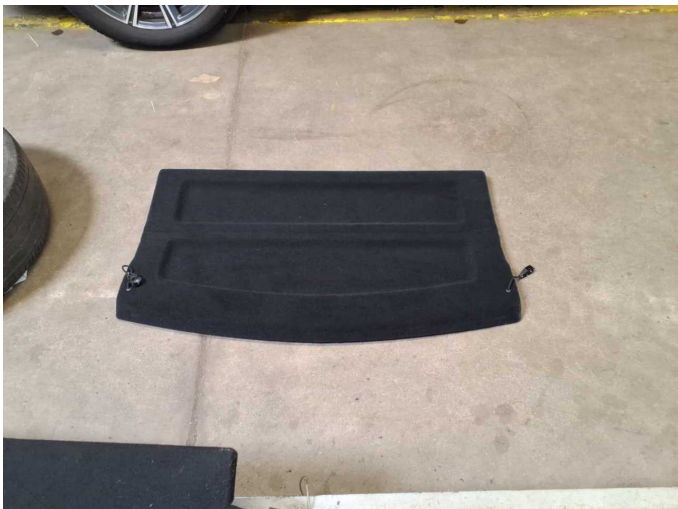


Figure 30: Misc.



Figure 31: Misc.



Damage 1: Steering system: Steering wheel - Abrasion - Smart repair



Damage 1: Steering system: Steering wheel - Abrasion - Smart repair



Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - dent(s) - Smooth repair work



Damage 3: Side panel - rear right side: Sill - dent(s) - Smooth repair work



Damage 4: Gearbox: Gear knob (Leder) - Abrasion - Replace



Damage 4: Gearbox: Gear knob (Leder) - Abrasion - Replace



Damage 5: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 5: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 6: Trim / covers: Boot sill cover (Nasen gebrochen) - Loose - Replace




Damage 6: Trim / covers: Boot sill cover (Nasen gebrochen) - Loose - Replace



Damage 7: Interior: Cargo area floor - Broken / torn - Replace




Damage 7: Interior: Cargo area floor - Broken / torn - Replace

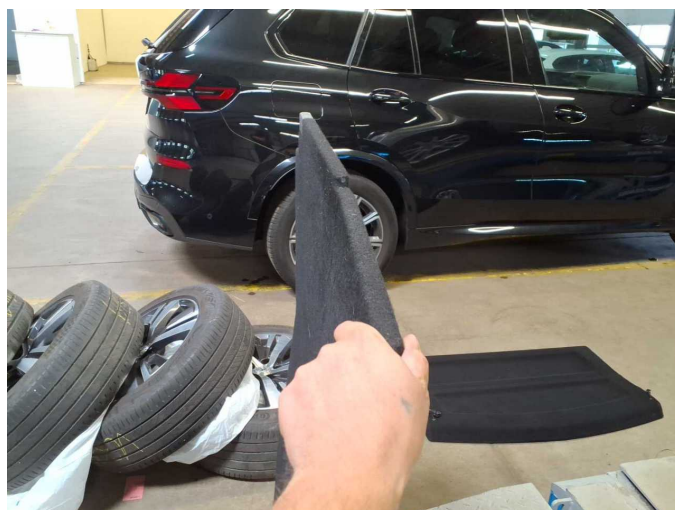

Damage 7: Interior: Cargo area floor - Broken / torn - Replace



Damage 7: Interior: Cargo area floor - Broken / torn - Replace

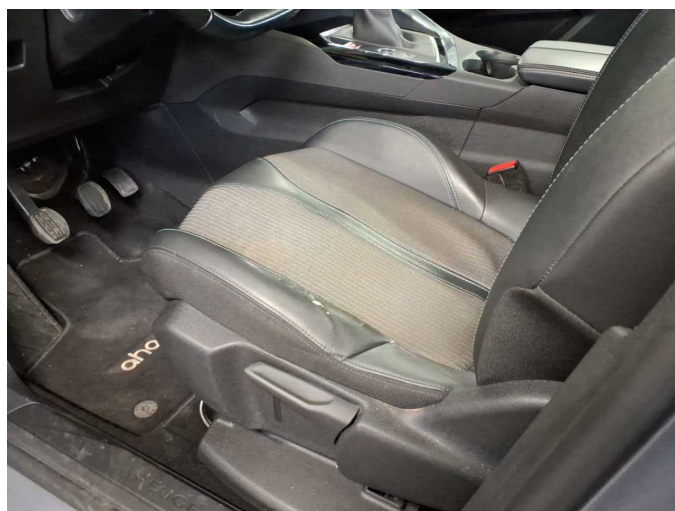

Damage 8: Seat - front: Seat cover - left side (Wange) - Broken / torn - Replace



Damage 8: Seat - front: Seat cover - left side (Wange) - Broken / torn - Replace



Damage 9: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left

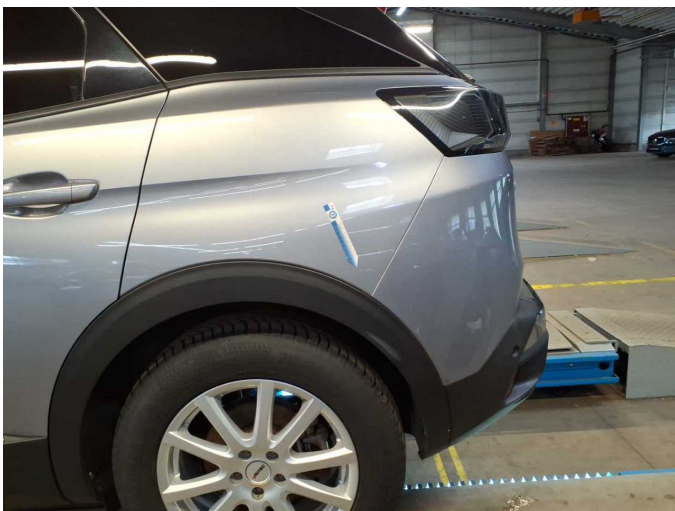

Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MCYHZMMS267026

Hersteller / Modell: PEUGEOT PEUGEOT 3008 BlueHDi 130 Stop & Start Allure

Datum	KM-Stand	Beschreibung
09.01.2026	106.693	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst
19.05.2025	87.302	Bremsinspektion vo + hi; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.01.2025	77.378	HU + AU
06.09.2024	67.457	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.12.2023	43.298	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.03.2023	22.311	Motoröl b. Wartung; Regelwartungsdienst