



Expertise

Protocol number: 46220707
Order No. / Reference: 26550262
Inspection date: 26 Jun 2026

Manufacturer: Skoda
VIN: TMBJJ7NX1NY014417

Model: Octavia Combi 2.0 TDI Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI Ambition	
Vehicle Identification number	TMBJJ7NX1NY014417
Mileage (Read)	158,465 km
First registration	25 Jan 2022
Number of holders	1
Next periodical technical inspection	02/2027
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	14,000 km
Last service on / at	06/2026 at 157,660 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG206470
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AWL 00085		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,960 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/60 R16 92V	Summer tyres on Light alloy	Goodyear	3mm / 3mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Glasses compartment in the headliner
- Roof rails, black
- Diesel particulate filter
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger and anti-allergen filter & activated carbon filter - air-conditioned and illuminated glove compartment)
- LED license plate lights
- Steering wheel: height and reach adjustable
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Rear parking sensors
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink (Apple CarPlay - Android Auto)
- Tire pressure monitoring
- Wheels: 16" alloy wheels Twister AERO (7J x 16, ET 46 with tires 205/60 R16)
- Seats: Height-adjustable driver and passenger seats (including lumbar support)
- Speed limiter
- Lane keeping assistant (Lane Assist)
- 12V socket in the trunk
- Phone: Wireless SmartLink for Apple CarPlay
- Lashing eyes in the trunk
- Immobiliser
- Central locking including remote control integrated into the key and EASY Start
- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- Traction control (ASR)
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative strip in silver square
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Transmission: 6-speed manual transmission
- Green tec: Start/stop system including brake energy recuperation
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Child safety lock for the rear doors and windows
- Removable boot cover
- Headrests (5) front and rear height adjustable
- LED fog lights
- LED taillights
- LED headlights with LED daytime running lights
- Steering wheel: Leather steering wheel with multifunction buttons (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Multifunction display in the instrument cluster
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Electromechanical power steering
- Seat belts (Three three-point seat belts in the rear)
- Seats: Rear seat backrest split 60:40, foldable
- SKODA Care Connect (SOS emergency call function (eCall+ including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection option for rapid assistance in case of breakdown) - Information service (connection option to the hotline for all questions relating to vehicle functions) - Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)



Extra equipment

- Paint finish: Pearl effect
- Panoramic sunroof, electric
- Auxiliary heater with radio remote control
- Steering wheel: Heated steering wheel including heated front seats
- Sunset (rear window and rear side windows tinted dark)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Bonnet	Insulation lining - Broken / torn - Replace
3	Trim / covers	Carpet - front left side - Burn hole (cigarettes) - Smart repair
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Door - rear left side	Door - Scratch(es) - Smart repair
7	Door - front left side	Door - Scratch(es) - Smart repair
8	Multimedia system	Navigation system - Functional / admissibility - Perform diagnosis
9	Door - front right side	Door - Scratch(es) - Loss in value
10	Side panel - rear left side	Side panel - Dent / paintcoat damage - Smart repair
11	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
12	Equipment	Vehicle key - Broken / torn - Replace
13	Door - rear right side	Door - Scratch(es) - Paint
14	Front bumper	Front bumper - Scratch(es) - Paint
15	Roof	Roof - Scratch(es) - Repair and paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Roof	Sun roof / glass - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres

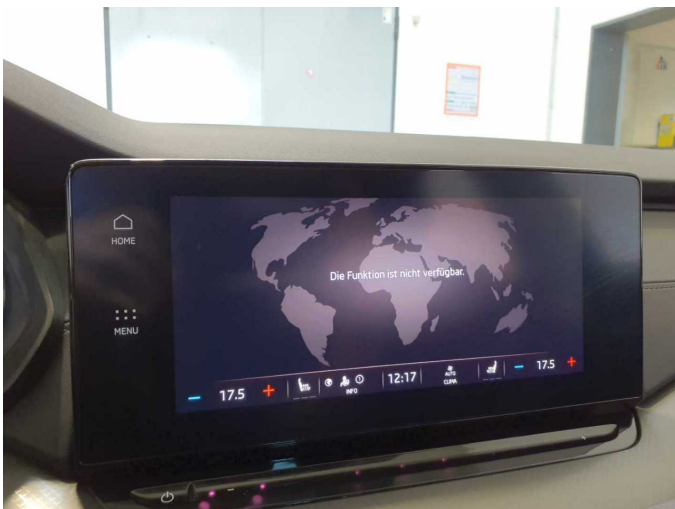


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

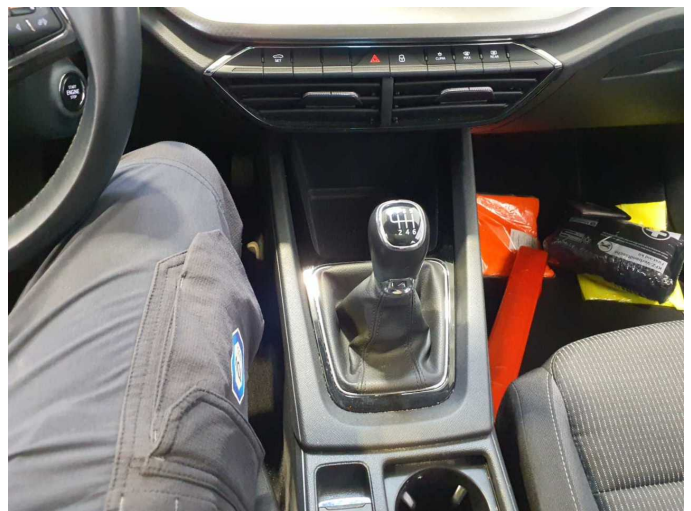


Figure 22: Misc.



Figure 23: Misc.

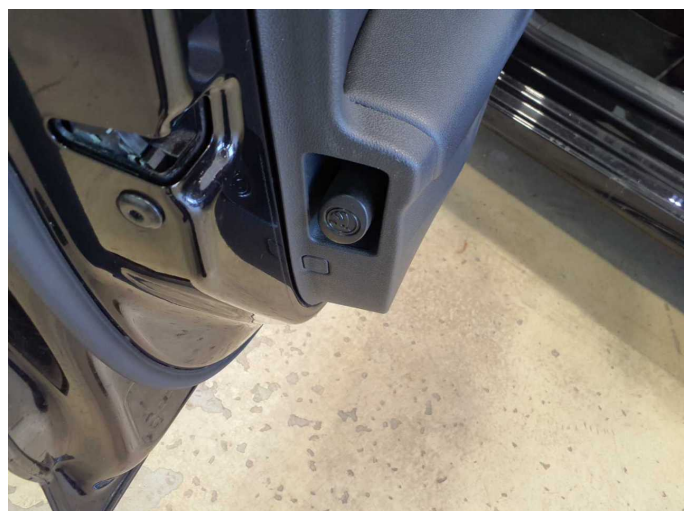


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Bonnet: Insulation lining - Broken / torn - Replace



Damage 2: Bonnet: Insulation lining - Broken / torn - Replace



Damage 3: Trim / covers: Carpet - front left side - Burn hole (cigarettes) - Smart repair




Damage 3: Trim / covers: Carpet - front left side - Burn hole (cigarettes) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

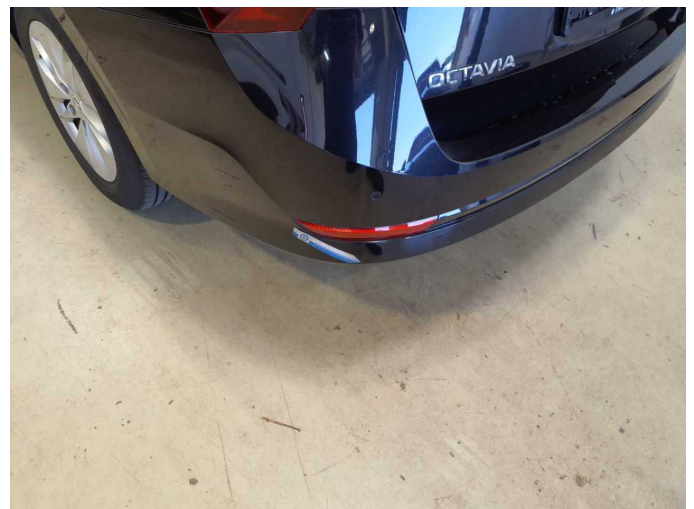

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Door - rear left side: Door - Scratch(es) - Smart repair




Damage 6: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 7: Door - front left side: Door - Scratch(es) - Smart repair




Damage 7: Door - front left side: Door - Scratch(es) - Smart repair

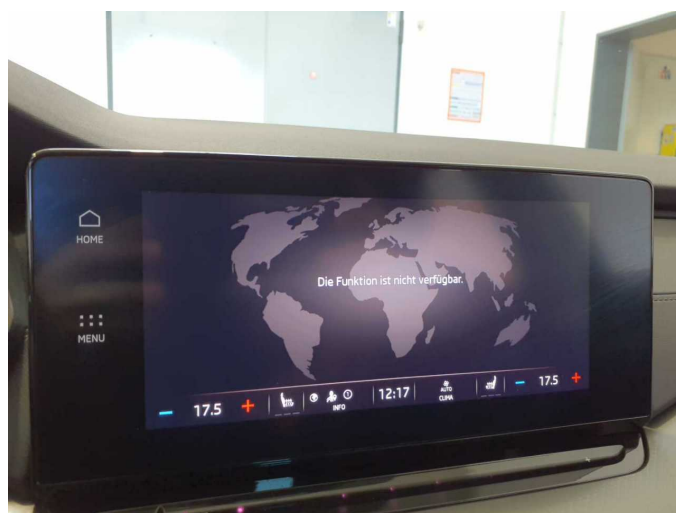


Damage 8: Multimedia system: Navigation system - Functional / admissibility - Perform diagnosis




Damage 9: Door - front right side: Door - Scratch(es) - Loss in value

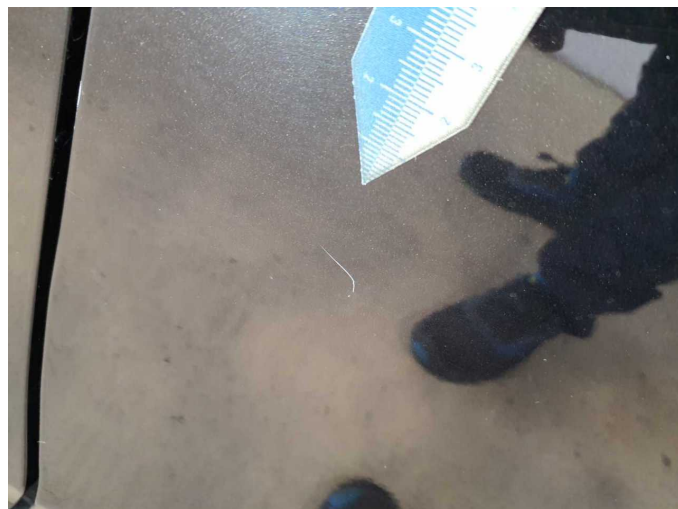

Damage 9: Door - front right side: Door - Scratch(es) - Loss in value

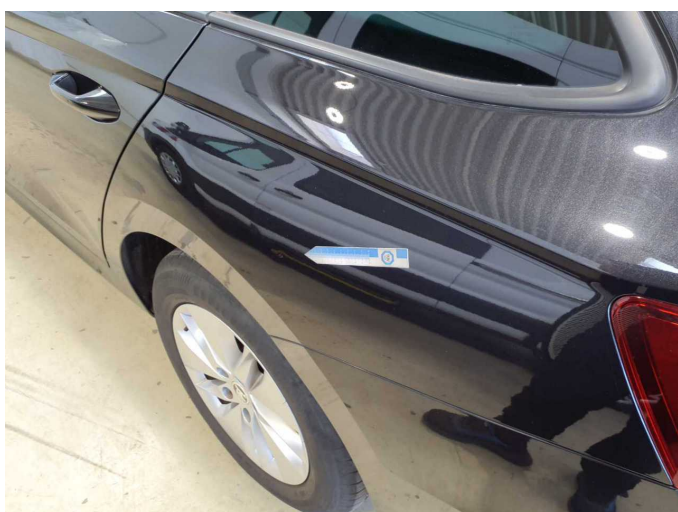

Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair

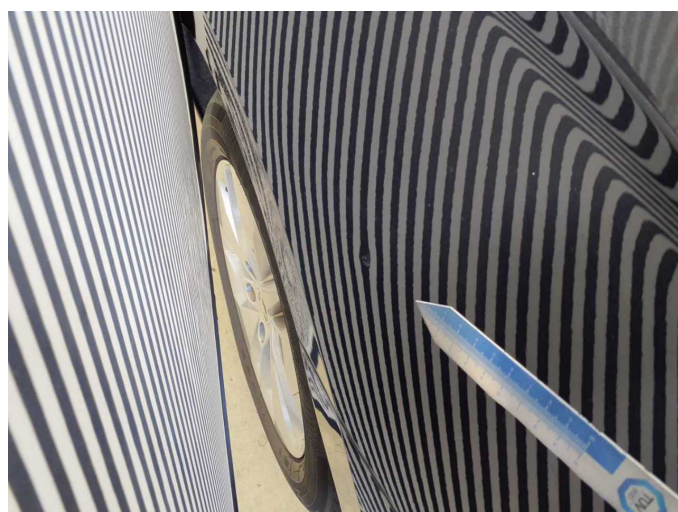


Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace

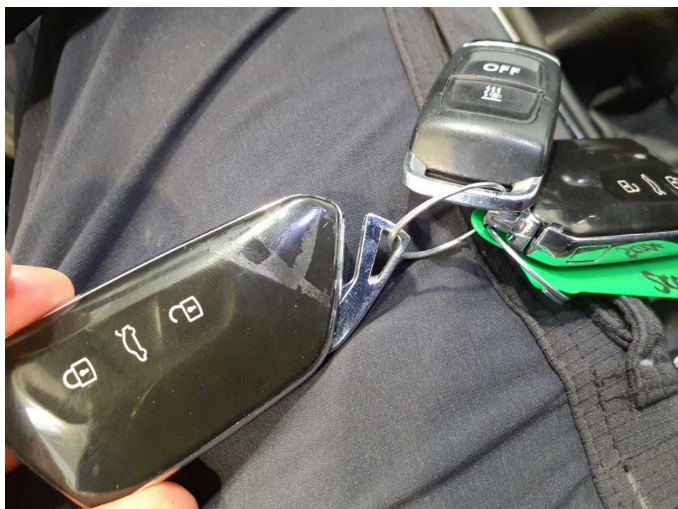


Damage 12: Equipment: Vehicle key - Broken / torn - Replace



Damage 13: Door - rear right side: Door - Scratch(es) - Paint



Damage 13: Door - rear right side: Door - Scratch(es) - Paint

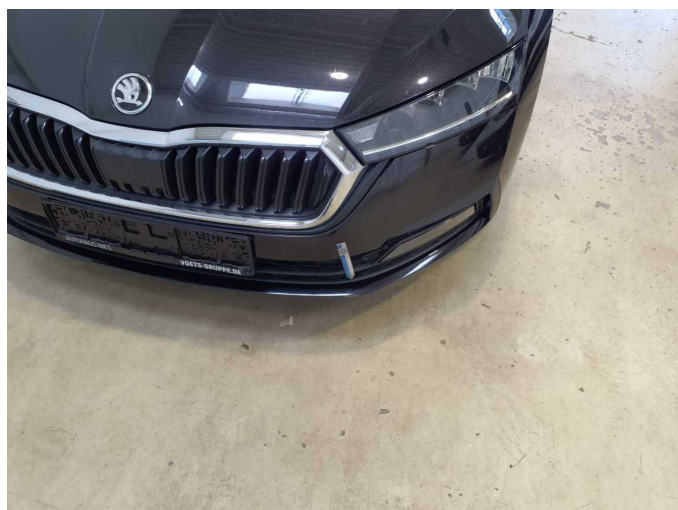

Damage 14: Front bumper: Front bumper - Scratch(es) - Paint




Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 15: Roof: Roof - Scratch(es) - Repair and paint

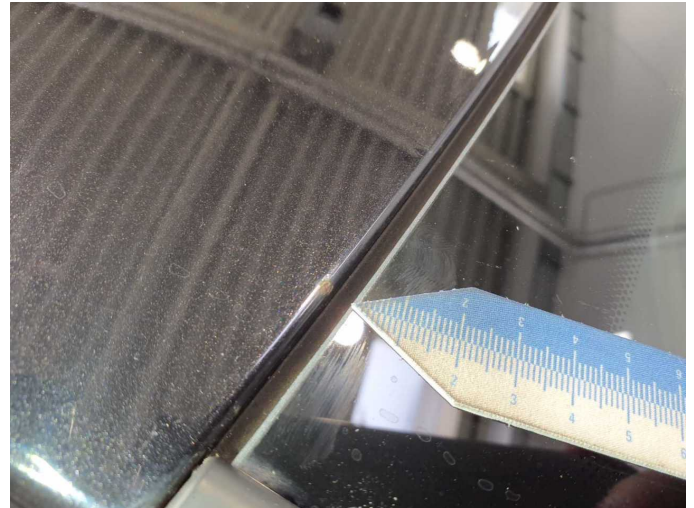

Damage 15: Roof: Roof - Scratch(es) - Repair and paint



Damage 15: Roof: Roof - Scratch(es) - Repair and paint