



Expertise

Protocol number: 46474177
Order No. / Reference: 26699646
Inspection date: 10 Jul 2026

Manufacturer: Ford

Model: Transit Courier S&S Trend

VIN: WF0WXXTACWPK10827



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Courier S&S Trend	
Vehicle Identification number	WF0WXXTACWPK10827
Mileage (Read)	43,167 km
First registration	3 May 2023
Number of holders	1
Power / Engine displacement	74 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	10/2025 at 40,163 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT883363
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BQD 00045		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	1,860 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R15 88V	Summer tyres on Steel rim with wheel cover	Goodyear	4mm / 4mm
2)	195/60 R15 88V	Summer tyres on Steel rim with wheel cover	Goodyear	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	195/60 R15 88V	Summer tyres on Steel	Goodyear	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, electrically adjustable and heated
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Car key, foldable (instead of conventional key)
- Ford Easy Fuel
- Transmission: 6-speed transmission
- Rubber mat in the driver's cab
- Front interior lighting with map reading lamp
- Front headrests (2)
- Cargo area lighting
- Front center console, open, with bottle compartment and ticket holder
- Package: -25° Starter Package
- Package: Wheel 3
- Upholstery - Fabric
- Spare wheel: Steel wheel 6 J x 15" with 195/60 R 15 tire
- Electro-mechanical power steering
- Start-stop system including battery, 60 AH 590 CCA
- Daytime running light
- Lashing eyes 6
- Immobiliser
- Central locking
- Driver's side airbag
- On-board computer
- Double-leaf rear doors without windows
- Third brake light
- Energy recovery (Smart Regenerative Charging)
- Front electric windows
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Glove compartment with lid
- Front air conditioning including manual recirculation
- Paint finish: Solid
- Steering column, adjustable in height and reach
- Fog light
- Emergency brake light
- Package: Function Package 3
- Pollen filter
- Radio: Audio system 15 - with digital radio reception DAB/DAB+
- Seats: Seat package 6 (Courier)
- Power outlet: 12-volt connection
- Partition: Mesh partition to the cargo area, rotatable around the driver's seat
- Heat-insulating glazing, lightly tinted
- Overhead console including grab handle on passenger side

Extra equipment

- Roof rails
- Electric front windows (with one-touch down function for driver and passenger side)
- Rear window, fixed (rear window wiper)
- BDIAU cargo area mat
- Package: Winter Package 2 (Courier) (Heated windscreen - Passenger seat manually adjustable in 2 directions - Driver's seat manually adjustable in 4 directions - Heated front seats - Interior armrest for driver - Manual lumbar support (driver's seat) - Passenger airbag - Front side airbags - Storage compartment under passenger seat - Seat belt warning system for driver and passenger.)
- Double locking mechanism for central locking
- Cruise control system (with steering wheel controls including adjustable speed limiter)
- Cargo area lighting, LED
- Package: Smoker
- Windscreen wipers with rain sensor (headlight assistant with day/night sensor, acoustic windscreen)
- Mud flaps front and rear
- Power outlet: 12-volt connection in the cargo area
- Partition wall to the cargo area with window
- Auxiliary electric heater (PTC), front

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Wheel cover - rear right side - Scratched - Replace
2	Wheel / tyres	Wheel cover - front left side - Scratch(es) - Replace
3	Wheel / tyres	Wheel cover - front right side - Scratched - Replace
4	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - Smart repair
5	Front bumper	Spoiler - Scratch(es) - Loss in value
6	Rear bumper	Rear bumper - Scratch(es) - Replace
7	Body	Body - Glued / labelled - De-glue / neutralise
8	Sliding door, right	Sliding door - dent(s) - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratch(es) - No deduction
2	Boot lid / rear door	Rear door - left side - Dent / paintcoat damage - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key with remote control

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

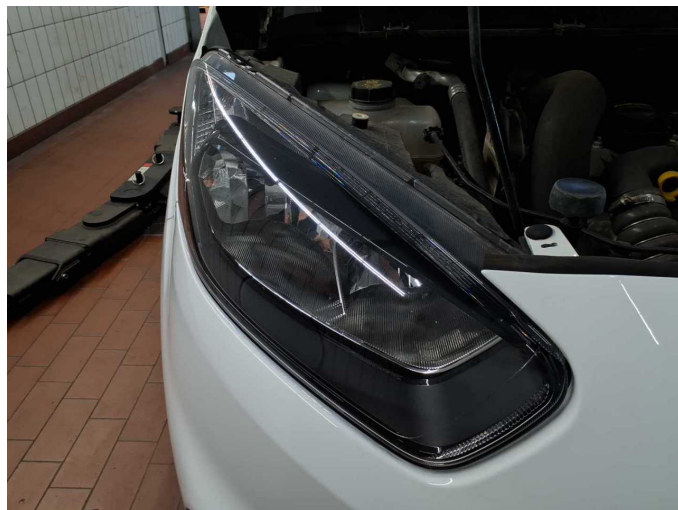


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

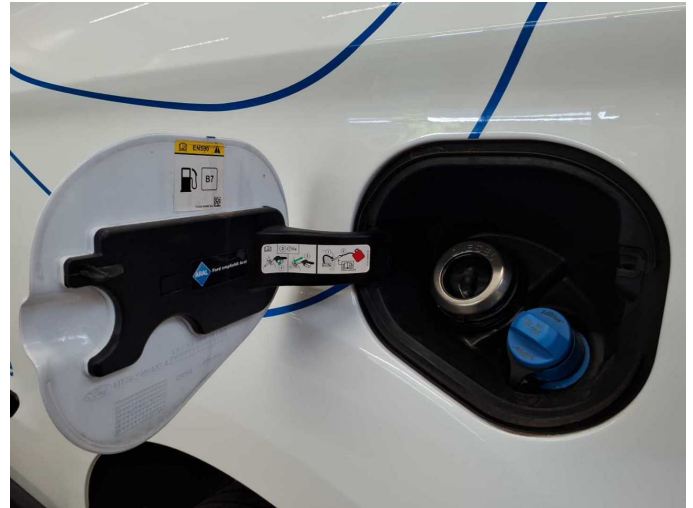


Figure 26: Misc.



Damage 1: Wheel / tyres: Wheel cover - rear right side - Scratched - Replace



Damage 1: Wheel / tyres: Wheel cover - rear right side - Scratched - Replace



Damage 2: Wheel / tyres: Wheel cover - front left side - Scratch(es) - Replace




Damage 2: Wheel / tyres: Wheel cover - front left side - Scratch(es) - Replace



Damage 3: Wheel / tyres: Wheel cover - front right side - Scratched - Replace



Damage 3: Wheel / tyres: Wheel cover - front right side - Scratched - Replace

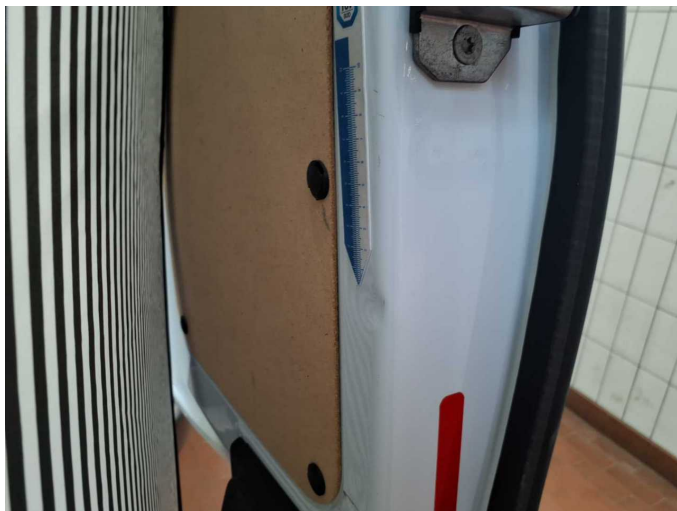

Damage 4: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Smart repair



Damage 4: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Smart repair



Damage 4: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Smart repair



Damage 5: Front bumper: Spoiler - Scratch(es) - Loss in value



Damage 5: Front bumper: Spoiler - Scratch(es) - Loss in value



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Replace



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Replace



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Replace



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Replace



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Replace



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Replace



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 7: Body: Body - Glued / labelled - De-glue / neutralise



Damage 8: Sliding door, right: Sliding door - dent(s) - Repair and paint




Damage 8: Sliding door, right: Sliding door - dent(s) - Repair and paint



Wear and tear 2: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - No deduction



Wear and tear 2: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - No deduction

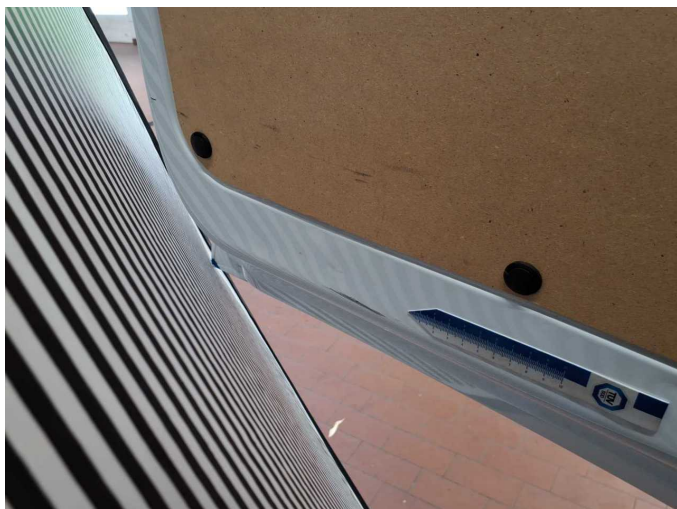

Wear and tear 2: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0WXXTACWPK10827
Hersteller / Modell: FORD FORD Transit Courier S&S Trend

Datum	KM-Stand	Beschreibung
31.10.2025	40.163	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.11.2024	31.206	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.04.2024	13.198	Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges