



Expertise

Protocol number: 46885855
Order No. / Reference: 26816672
Inspection date: 4 Aug 2026

Manufacturer: Opel

Model: Insignia Sports Tourer 2.0 Diesel 4x4 Aut. Ultimate

VIN: W0VZS8GP2N1001984



ALPHABET



ALPHABET

Vehicle details

Manufacturer / Type / Model / Equipment

Opel Insignia Sports Tourer 2.0 Diesel 4x4 Aut. Ultimate

Vehicle Identification number	W0VZS8GP2N1001984
Mileage (Read)	137,149 km
First registration	9 May 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report not on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Mondstein Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	15 %
Last service on / at	01/2026 at 125,844 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ639598
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMJ 00061		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,330 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	245/35 R20 95W	Summer tyres on Light alloy	4mm / 4mm
2)	245/35 R20 95W	Summer tyres on Light alloy	5mm / 5mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 08/2029	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Ambient lighting (dashboard and doors (front))
- Electrically adjustable and heated exterior mirrors for driver and passenger side (electrically folding with ambient lighting)
- Glasses compartment in the headliner
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Luggage compartment cover (extendable with comfort operation)
- Transmission: 8-speed automatic transmission
- Back window, heater
- rear window wiper
- Child safety lock in the rear doors, manual
- Automatic climate control, two zones
- Front headrests (height adjustable)
- Rear headrests (3 pieces) (height adjustable)
- LED headlights (automatic headlight range control)
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Package: Innovations 1 (IntelliLux LED Pixel Light - Adaptive LED Matrix Headlights: City Light, Highway Light, Country Road Light, Static Cornering Light, Turning Light, Parking Light, High Beam: Traffic-Dependent Dimming Taking into Account of Oncoming and Ahead Vehicles, Automatic Headlight Range Control - Traffic Sign Assist)
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto)
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Wheels: Alloy wheels 8.5 J x 20 in 5-twin-spoke design (BiColor with tires 245/35 R 20)
- Visibility equipment (rain sensor, front)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Adaptive brake light
- Airbag: Front and side airbags, driver and front passenger (front and side airbag, passenger, deactivatable)
- Airbag: Front and rear outer head airbags
- All-wheel drive 4x4
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- third brake light
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection including active hood
- Noise-reducing, laminated front side windows
- Speed controller
- GS Line interior equipment (GS Line sport leather steering wheel, heated - aluminum - sport pedals - black headliner)
- High Gloss Black Exterior Equipment (Sports Tourer) (Window trim strips in high gloss black, all around the sides - Radiator grille frame in high gloss black - Fog light surrounds in high gloss black - Roof rails in high gloss black)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Easy-Access (Keyless locking and starting system (Keyless Open & Start) - Sensor-controlled tailgate, electric - Loading sill protection, stainless steel)
- Electric parking brake (including 12-volt socket)
- Parkpilot, front and rear parking aid
- Upholstery: Alcantara trim, black (Ergonomic active seat (AGR), driver and front passenger (length, height, backrest angle manually adjustable, seat angle electrically adjustable, electro-pneumatic lumbar support adjustable in height and length, extendable thigh support, manually adjustable, headrest, height and tilt adjustable) - Seat contact surfaces partially in Alcantara/leatherette - Side airbags, rear outer - Center armrest, rear, with cup holders and pass-through - Rear seat backrest with FlexFold, 40:20:40 split-folding)
- Radio accessories: 2 USB ports (rear center console)
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Power steering (speed-dependent)
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- 12-volt power outlet in the trunk



- Wireless Charging

- Bumpers painted in body color
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Immobiliser
- Central locking with remote control (and interior switches)

Extra equipment

- Package: Winter 3 (Seat Comfort Equipment 1: Driver's seat 8-way electrically adjustable, memory function for driver's seat and exterior mirrors, electro-pneumatic adjustment of side bolsters, driver's seat massage function, driver's seat heating, multi-stage, driver and front passenger exterior mirrors with ambient lighting, electrically adjustable, heated and folding, 40:20:40 split-folding rear seat, charging package with wireless charging, 2 USB ports in the rear center console, heated ThermoTec windshield, heated rear seats (on the outer seats))
- Package: Innovations 2 (automatic) 9A7,ZQ3
- Package: Sound (Bose sound system)
- Paint finish: Metallic
- Panoramic glass sliding/tilting roof, electric C3U
- Swiveling trailer hitch (including trailer stability program)
- Wheels: Additional set of 17" alloy winter wheels SFP

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Trim / covers - Malposition - Repair
2	Trim / covers	Trim / covers - Loose - Repair
3	Trim / covers	Floor mats - Broken / torn - Replace
4	Roof	Sun roof / glass (Öffnet nicht) - Functional / admissibility - Perform diagnosis
5	Door - front left side	Door - Scratch(es) - Smart repair
6	Sill - left side	Trim - Scratch(es) - Smart repair
7	Trim / covers	Door trim - rear right side - dent(s) - Loss in value
8	Door - rear right side	Door - Corrosion - Repair and paint
9	Roof	Roof (Anätzung) - Paint defect - Repair and paint

Wear and tear

No.	Component group	Description
1	Roof	Roof rail - right side - dent(s) - No deduction
2	Boot lid / rear door	Boot lid - dent(s) - No deduction
3	Roof	Sun roof / glass - Scratch(es) - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description

2nd wheel set - 2nd wheel set (Winter auf 17" LM SFP)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 30 Apr 2024	1.611,18 €
2	Roof, Front, Rear, Side - left, Side right, Provided by user / customer, from 19 Jul 2023	1.874,34 €
3	Rear, Provided by user / customer, from 4 Nov 2025	2.228,98 €

Repainting

No. Repainting

1 Roof, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof 289 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument panel



Figure 8: Interior 360° view



Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres



Figure 12: Documents



Figure 13: Navigation



Figure 14: Misc.



Figure 15: Misc.

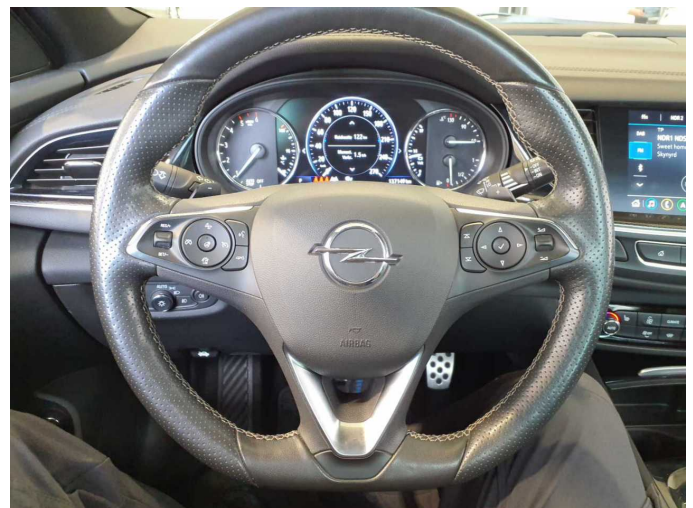


Figure 16: Misc.

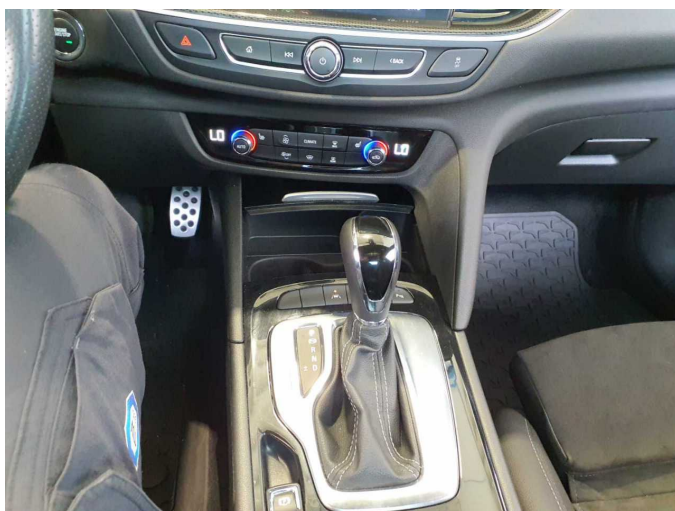


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

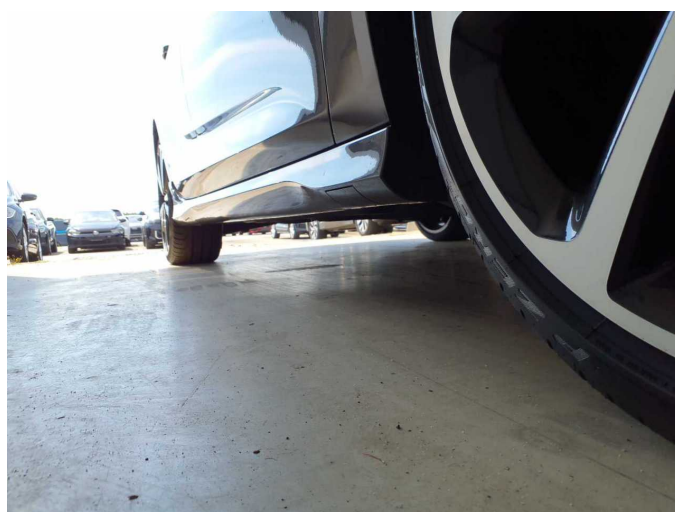


Figure 22: Misc.

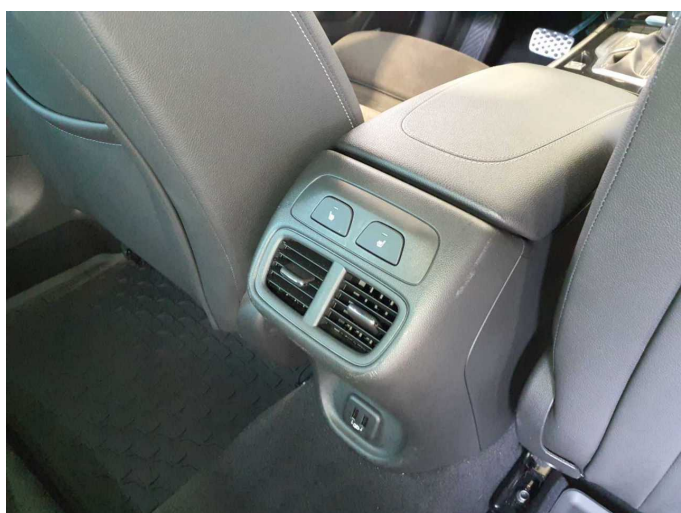


Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.



Damage 1: Trim / covers: Trim / covers - Malposition - Repair

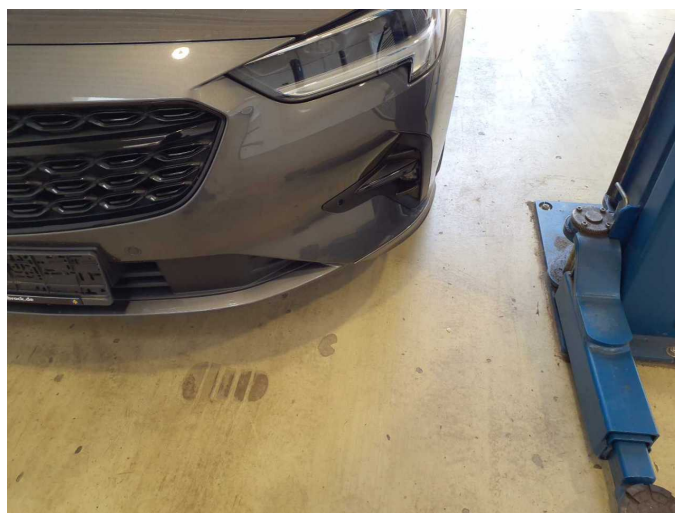

Damage 2: Trim / covers: Trim / covers - Loose - Repair

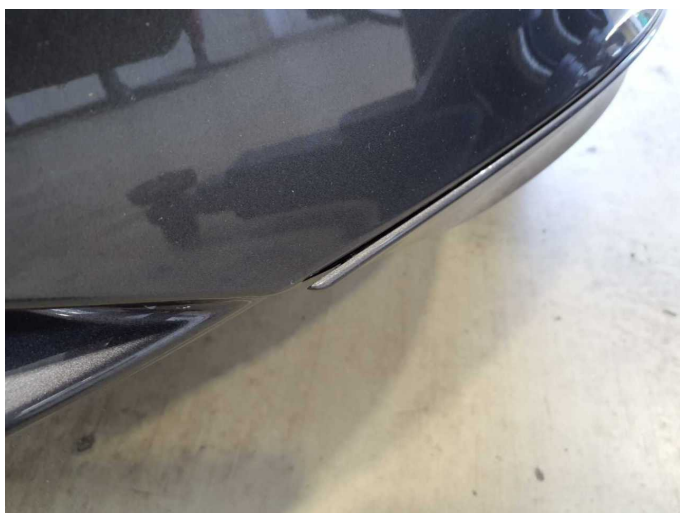

Damage 2: Trim / covers: Trim / covers - Loose - Repair



Damage 3: Trim / covers: Floor mats - Broken / torn - Replace



Damage 5: Door - front left side: Door - Scratch(es) - Smart repair



Damage 5: Door - front left side: Door - Scratch(es) - Smart repair



Damage 6: Sill - left side: Trim - Scratch(es) - Smart repair



Damage 6: Sill - left side: Trim - Scratch(es) - Smart repair




Damage 7: Trim / covers: Door trim - rear right side - dent(s) - Loss in value



Damage 7: Trim / covers: Door trim - rear right side - dent(s) - Loss in value



Damage 8: Door - rear right side: Door - Corrosion - Repair and paint

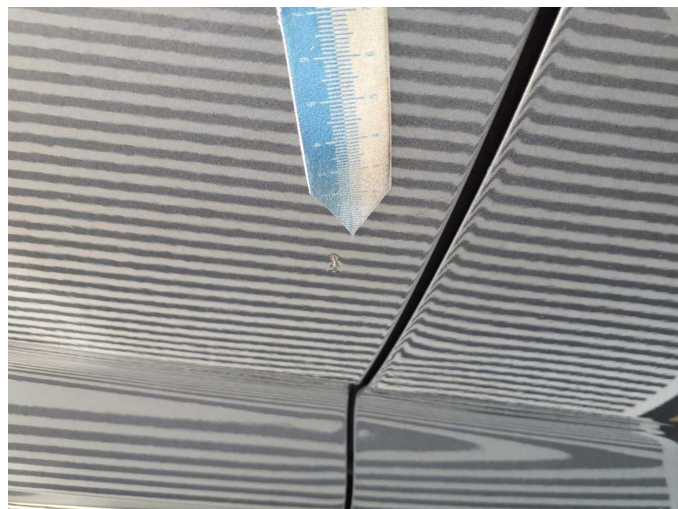

Damage 8: Door - rear right side: Door - Corrosion - Repair and paint



Damage 8: Door - rear right side: Door - Corrosion - Repair and paint



Damage 9: Roof: Roof (Anätzung) - Paint defect - Repair and paint



Damage 9: Roof: Roof (Anätzung) - Paint defect - Repair and paint




Damage 9: Roof: Roof (Anätzung) - Paint defect - Repair and paint



Damage 9: Roof: Roof (Anätzung) - Paint defect - Repair and paint



Damage 9: Roof: Roof (Anätzung) - Paint defect - Repair and paint

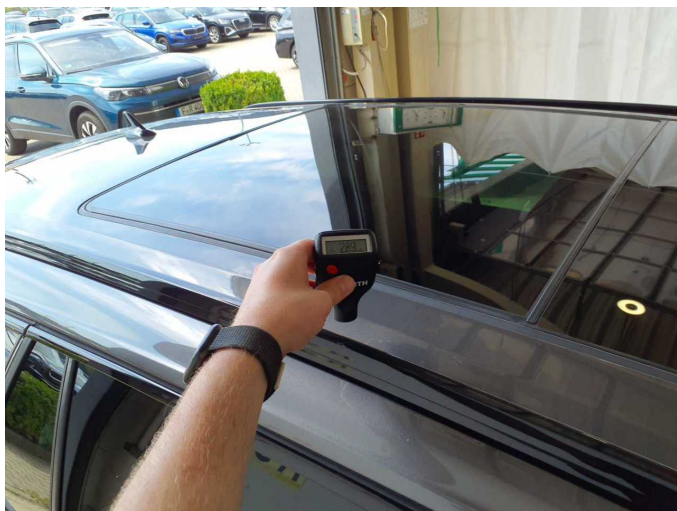

Repainting 1: Roof



Repainting 1: Roof