



Expertise

Protocol number: 46865961
Order No. / Reference: 26622594
Inspection date: 17 Jul 2026

Manufacturer: Opel

Model: Grandland 1.5 D Automatik Elegance

VIN: W0VZCYHZ7P6015866



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Grandland 1.5 D Automatik Elegance	
Vehicle Identification number	W0VZCYHZ7P6015866
Mileage (Read)	112,096 km
First registration	22 May 2023
Number of holders	2
Next periodical technical inspection	05/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Rubin Rot Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	25,100 km
Last service on / at	02/2026 at 90,479 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS831435
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / AHG 00256		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 98V	Summer tyres on Light alloy	Continental	7mm / 7mm
2)	225/55 R18 98V	Summer tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Winter tyres on Light alloy	Semperit	6mm / 6mm
2)	215/65 R17 99V	Winter tyres on Light alloy	Semperit	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 2 ignition keys, both foldable
- Driver and passenger side airbags
- Airbag: Front and side airbags
- Airbag: Head airbags, front and rear outer
- Ambient lighting, center console and in the front door pockets
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag and seatbelt tensioner)
- Hill Start Assist
- Roof design line in chrome
- Decorative strips, Erino/Palladium Medium
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Luggage compartment cover
- Cruise control with intelligent speed limiter (The intelligent speed limiter, in conjunction with traffic sign recognition, allows for rapid speed adjustment)
- Transmission: 8-speed automatic
- Rear window wiper
- Interior lighting, front and rear (with reading lights front and rear - luggage compartment lighting)
- Dual-zone automatic climate control including rear footwell heating (with separate temperature control for driver and front passenger - manual recirculation - automatic air distribution - sun sensor - particle and odor filter)
- Leather steering wheel, flat-bottomed, with steering wheel remote control
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Package: Comfort package (Park pilot, front and rear parking aid with acoustic warning signal - electrically folding exterior mirrors)
- Automatic parking assistant (detection of parallel and perpendicular parking spaces at a driving speed below 20 km/h - exiting from parallel parking spaces, automatic steering of the vehicle - incl. park pilot, front and rear parking aid, with audiovisual warning)
- Front and rear parking sensors
- Radio accessories: Digital radio reception DAB+ (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack))
- Speed-sensitive power steering
- Seats: Ergonomic active seat with AGR seal of approval, driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Track Black fabric)
- Storage compartments (storage compartment in the instrument panel, driver's side - storage compartment in the center console, front - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 1.0-liter beverage bottles - illuminated glove compartment with cooling and heating function - bag hooks, on the side in the luggage compartment - lashing eyes in the luggage compartment)
- Exterior mirrors, electrically adjustable and heated, electrically folding (exterior mirror housing in black)
- On-board computer
- Decor: Opel Vizor with chrome frame
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Forward Collision Warning (monitors the distance (close, medium, far) to the vehicle ahead; if the vehicle approaches a vehicle ahead or a pedestrian too quickly, a warning tone is sounded and a message appears in the driver information display. - with automatic emergency braking and pedestrian detection - Lane Keeping Assist: warns if the vehicle unintentionally leaves its lane - Traffic Sign Recognition - Driver Drowsiness Detection)
- Interior rearview mirror, automatically dimming
- Child safety lock in the rear doors, manual
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- Paint finish: Metallic Ruby Red
- LED headlights (LED taillights - LED front turn signals - manual headlight range control - high beam assist)
- Steering wheel, height and reach adjustable
- Center armrest, sliding, front, including storage compartment and cup holder
- Park & Go (reversing camera - automatic parking assistant (recognition of parallel and perpendicular parking spaces at speeds below 20 km/h, exiting parallel parking spaces, automatic steering of the vehicle), including parking pilot, front and rear parking aid with audiovisual warning - electrically folding exterior mirrors - blind spot warning in both exterior mirrors (active between 12 km/h and 140 km/h))
- Quickheat heating system
- Rain sensor
- Tire pressure warning
- Wheels: Light alloy 7.5 J x 18 with 5 double spokes in BiColor/Black (with tires 225/55 R 18)
- Rear view camera
- Seat belts (three-point seat belts in all seats - height-adjustable seat belts, front - belt force limiters, front and rear outer seats - double belt tensioners, front - belt tensioners, rear outer seats - warning tone and light for unfastened seat belts, front and rear)
- Seats: Rear seat backrest split 40:60 and foldable
- Solar Protect heat-insulating glazing (heavily tinted, in the rear)



- Lane departure warning (warning in case of unintentional lane departure from 60 km/h via warning tone and indicator light in the driver information display)
- 12-volt power outlet (in the center console, front)
- Bumpers and side panels in high-gloss black
- Blind spot warning system
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer (and for ISOFIX child seat mounting system on the front passenger seat)

- Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function)
- Phone: Wireless Charging (Wireless charging of smartphones in the center console)
- Immobiliser
- Central locking with remote control and interior switches

Extra equipment

- Package: Business Premium Package (IntelliLux LED Pixel Matrix Light: Adaptive LED matrix headlights with individual light distribution and the following functions: City light, motorway light, country road light, static cornering light, turning light, parking function light, high beam: traffic-dependent dimming taking into account preceding and oncoming road users, automatic headlight range control, fog lights - Navi 5.0 Intellilink)
- safety net
- Seats: Ergonomic active seats with AGR seal of approval, driver and front passenger (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Taxa fabric, black)
- Winter equipment (Heated leather steering wheel - Heated seats, multi-stage, driver and front passenger - Heated ThermoTec windshield - FlexFold rear seat backrest split and foldable in a 40:60 ratio and center armrest, rear, with pass-through from the luggage compartment)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Bonnet	Bonnet - dent(s) - Smooth repair work
3	Mudguard - left side	Wheel well extension - Scratched - Smart repair
4	Door - front left side	Door - Scratch(es) - Smart repair
5	Door - rear left side	Door - Scratch(es) - Smart repair
6	Door - rear left side	Door edge - Scratch(es) - Smart repair
7	Roof	Roof (30 Dellen auf dem dach mit 2cm Durchmesser) - Damage by hail - Repair



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Interior	Interior - Soiled - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

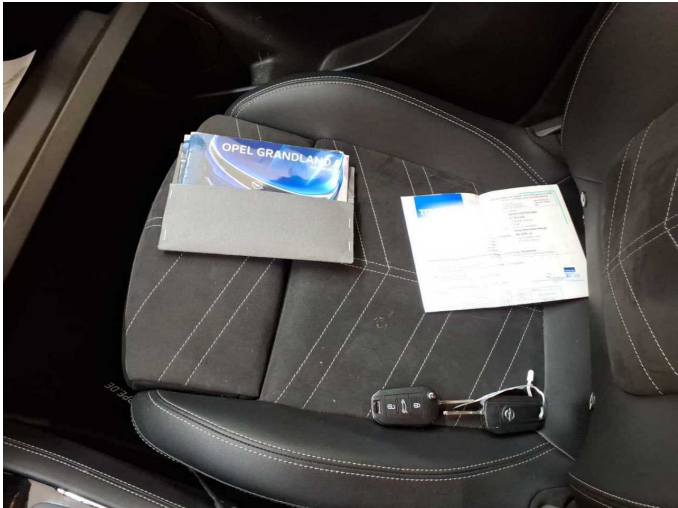


Figure 14: Documents

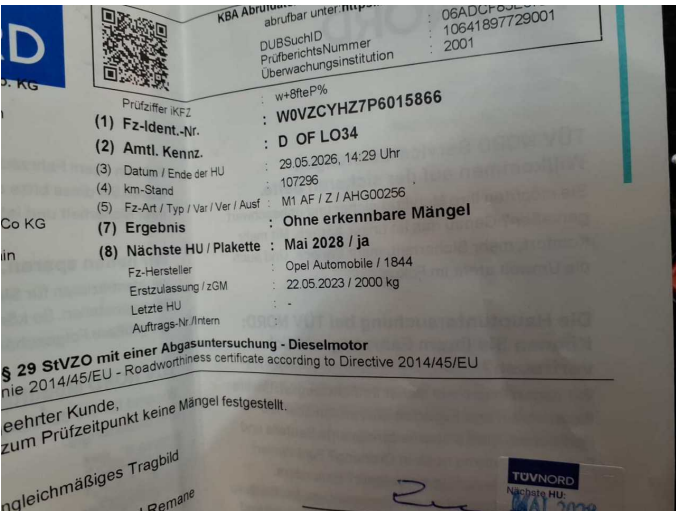


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

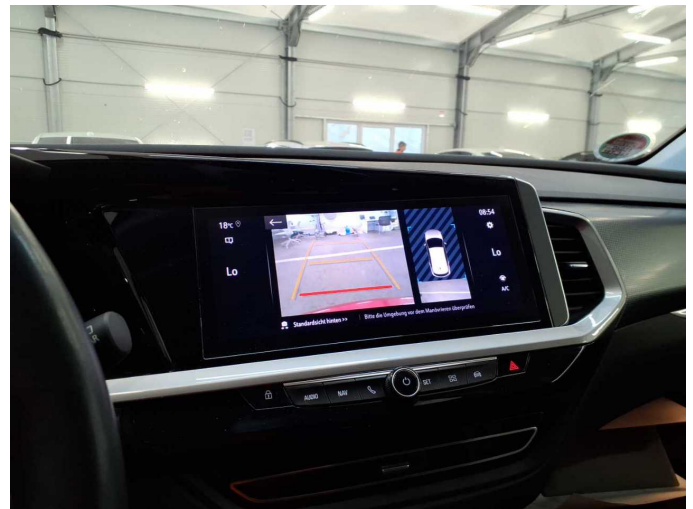


Figure 22: Misc.

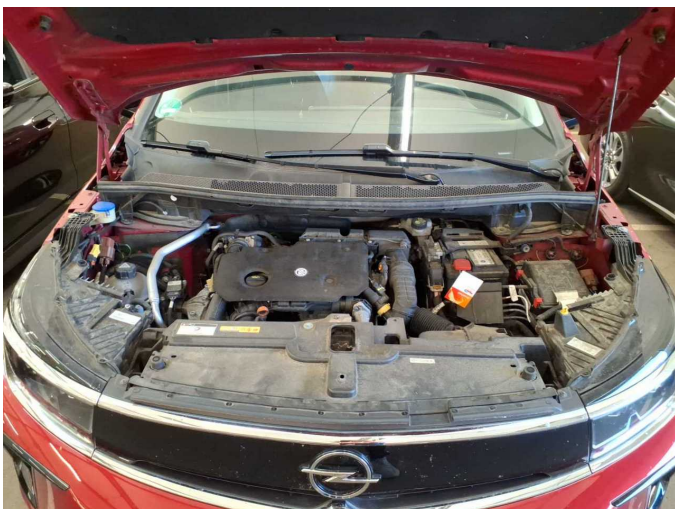


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

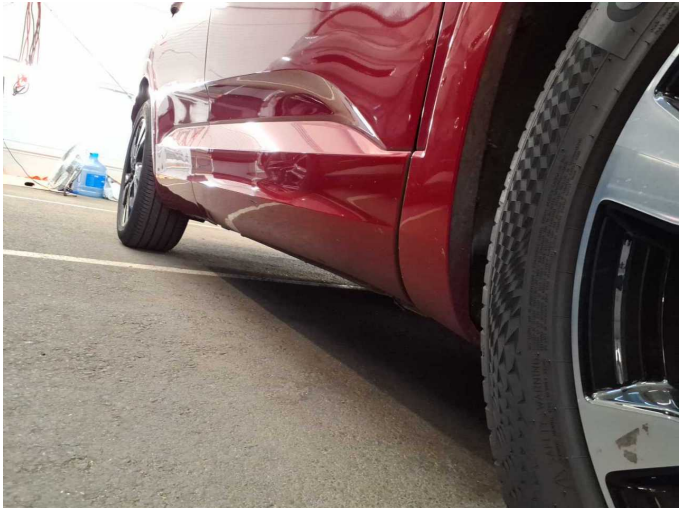


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




Damage 2: Bonnet: Bonnet - dent(s) - Smooth repair work

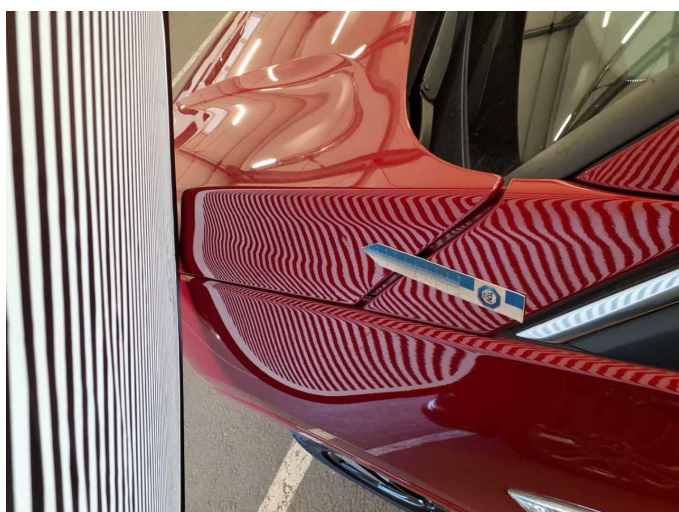

Damage 2: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 3: Mudguard - left side: Wheel well extension - Scratched - Smart repair

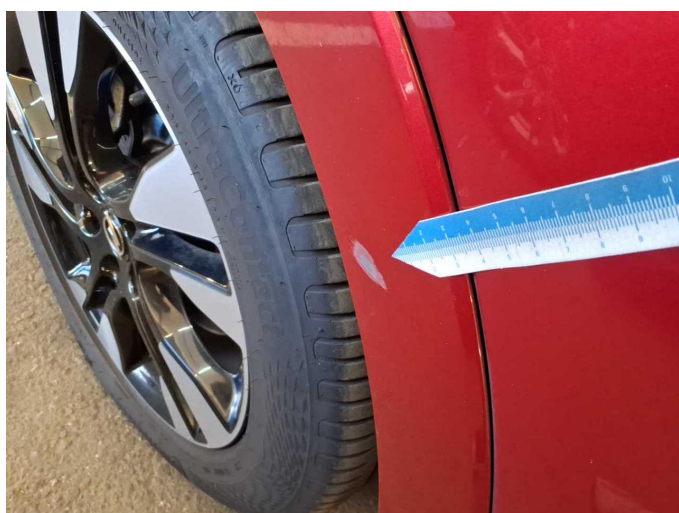

Damage 3: Mudguard - left side: Wheel well extension - Scratched - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - Scratch(es) - Smart repair



Damage 5: Door - rear left side: Door - Scratch(es) - Smart repair




Damage 5: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 6: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 6: Door - rear left side: Door edge - Scratch(es) - Smart repair

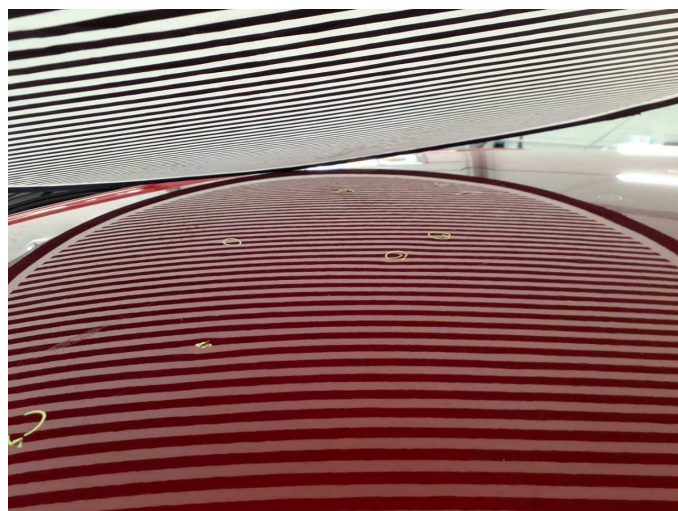

Damage 7: Roof: Roof (30 Dellen auf dem dach mit 2cm Durchmesser) - Damage by hail - Repair



Damage 7: Roof: Roof (30 Dellen auf dem dach mit 2cm Durchmesser) -
Damage by hail - Repair



Damage 7: Roof: Roof (30 Dellen auf dem dach mit 2cm Durchmesser) -
Damage by hail - Repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZCYHZ7P6015866

Hersteller / Modell: OPEL OPEL Grandland 1.5 D Automatik Business Elegance

Datum	KM-Stand	Beschreibung
18.02.2026	90.479	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.05.2025	62.729	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.03.2025	57.047	Systemtest/Eigendiagnose
20.08.2024	41.837	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.03.2024	20.998	Motoröl b. Wartung; Ölfilter ern; Wartung Sonstiges