



Expertise

Protocol number: 46346892
Order No. / Reference: 26638320
Inspection date: 2 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR DSG Life

VIN: WVGZZZ5NZNM031094



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZ5NZNM031094
Mileage (Read)	93,000 km
First registration	18 Feb 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Petrol Blue Metallic (R5Q)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	400 km
Last service on / at	07/2025 at 69,743 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF425048
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZG 20345		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm
2)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Continental	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 100T	Winter tires (with run-flat tires) on Light alloy	Continental	7mm / 7mm
2)	255/45 R19 100T	Winter tires (with run-flat tires) on Light alloy	Continental	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Decorative inlays "Horizon Black"
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic Stability Program with counter-steering support
- Driving profile selection
- High beam control Light Assist
- Pedestrian detection
- Luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED headlights
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version
- Emergency call service
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire Mobility Set omitted
- Wheels: Light alloy (4) "Frankfurt" 7 J x 18
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag for driver and front passenger including knee airbag on the driver's side
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings painted silver
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Diesel particulate filter
- Parking assistance
- Electronic parking brake including auto-hold function
- Automatic headlight control, with daytime running lights
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment floor height adjustable in 2 stages
- Tailgate with electric opening and closing, adjustable opening angle
- Interior mirror automatically dimming
- LED license plate lighting
- Rear headrests (3)
- Paint finish: Solid
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Upholstery: Cloth
- Radio
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: AirStop tires 235/55 R 18, optimized for low rolling resistance
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Bumpers in body color
- Textile floor mats front and rear
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



Extra equipment

- Airbag: Side airbags for the outer seats of the 2nd row.
- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering function)
- Wirelessly heated windshield (infrared-reflective)
- Paint finish: Metallic
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - Dynamic headlight range control with dynamic cornering lights - LED taillights, dark red - Bad weather light and cornering light - IQ.LIGHT - LED matrix headlights with LED daytime running lights, cornering lights and dynamic turn signals)
- Package: Ambient lighting package (30-color ambient lighting - chrome applications on mirror adjustment and window switches, door pull handles; matte chrome door controls - "Barrel Craft" decorative inlays for instrument panel and front door trim - illuminated door sill trims)
- Package: Winter additionally with heated outer rear seats (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - windshield washer nozzles automatically heated at the front - front seats and outer rear seats heated)
- Tire pressure monitoring system (informs the driver about the current tire pressure before and during the journey - the driver is informed if the tire pressure is too low or if there is a rapid loss of pressure)
- Windows: Rear side windows and rear window tinted
- Foldable towbar (electric release)
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Navigation system "Discover Media" incl. "Streaming & Internet"
- Mesh partition
- Package: "Easy Open & Close" with safe locking mechanism ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking mechanism)
- Package: Business Premium (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Panoramic tilt/slide sunroof with panoramic roof at the rear (2 LED reading lights at the front and 2 at the rear - panoramic tilt/slide sunroof with panoramic roof at the rear)
- Räder: Leichtmetall (4) "Kingston" 7 J x 18 (Reifen 235/55 R 18, - Radsicherungen mit erweitertem Diebstahlschutz)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Door - front left side	Door handle - outside - Scratch(es) - Smart repair
3	Wing mirror - left side	Cap - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
5	Mudguard - right side	Wheel well extension - Scratch(es) - Smart repair
6	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
7	Wheel / tyres	Tyre - rear right side (nicht fahrbereit) - Broken / torn - Replace
8	Door - rear right side	Door (Einschlüsse und Spachtel rissig) - dent(s) - Smart repair
9	Trim / covers	Door trim - front left side (Kratzer) - Differs from the original configuration - Replace
10	Engine	Engine (Motorkonntrolle leuchtet, nicht fahrbereit) - Specify findings - Perform diagnosis
11	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
12	Headlight	Headlight - right side (nicht im Lichtschein) - Scratch(es) - Loss in value
13	Side panel - rear left side	Side panel - Scratch(es) - Paint
14	Rear bumper	Rear bumper - Scratch(es) - Paint
15	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
16	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
17	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint
18	Vehicle glazing	Windscreen - Broken / torn - repair according to calculation

Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - dent(s) - No deduction
2	Front bumper	Spoiler - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Trim / covers	Floor mats - Broken / torn - No deduction
5	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
6	Door - rear left side	Door handle - outside - Scratch(es) - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 11 Jan 2025	1.814,96 €
2	Side - left, Provided by user / customer, from 22 Aug 2022	2.943,46 €

Repainting

No.	Repainting
1	Roof rail - left side, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
3	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
4	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
5	Door - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Roof rail - left side	182 µm	Side panel - rear left side	521 µm
Side panel - rear right side	213 µm	Door - rear right side	946 µm
Door - front left side	193 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

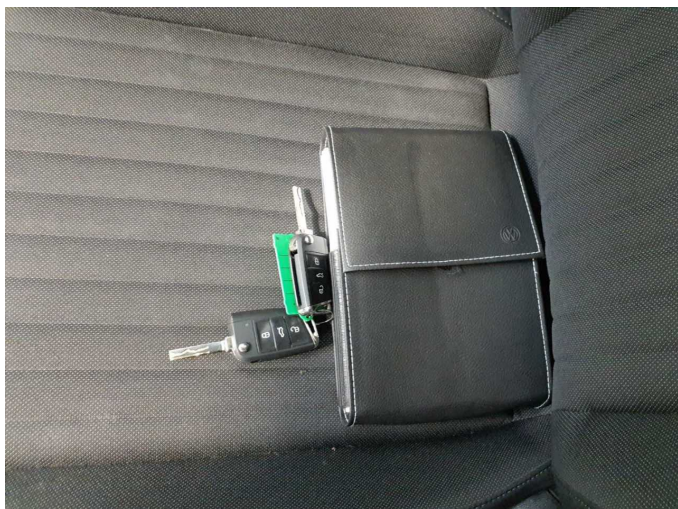


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

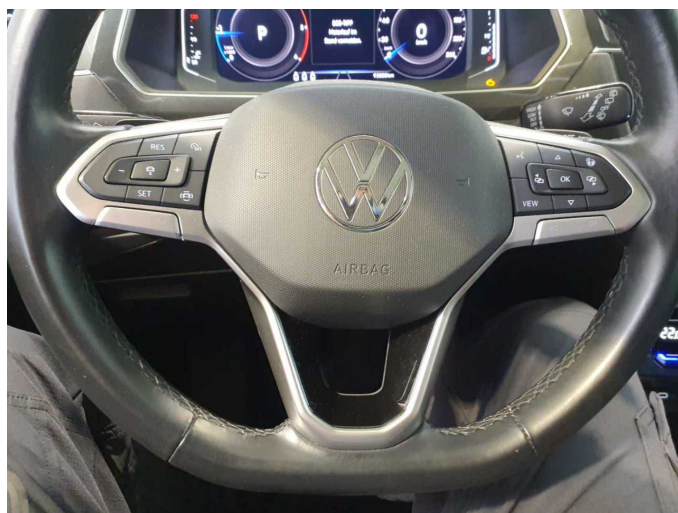


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

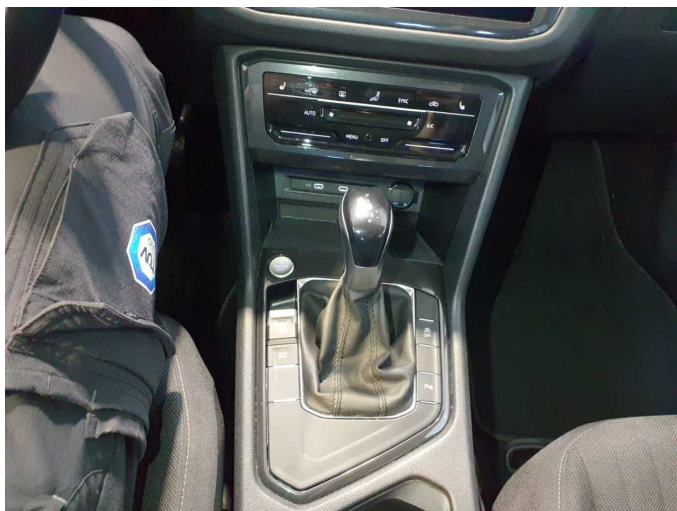


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

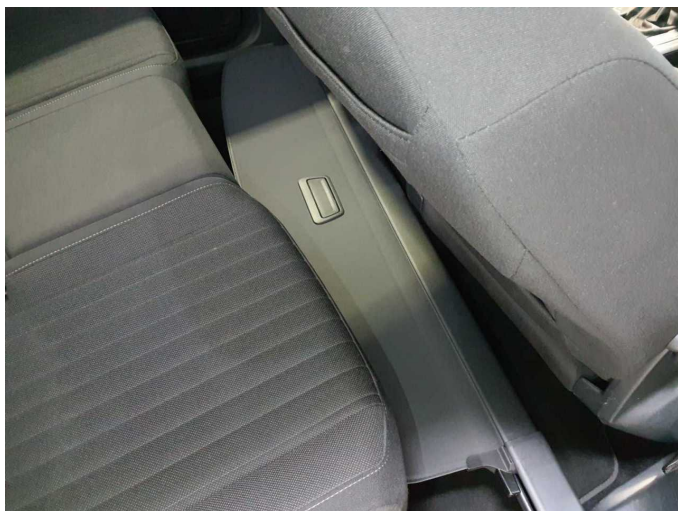


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


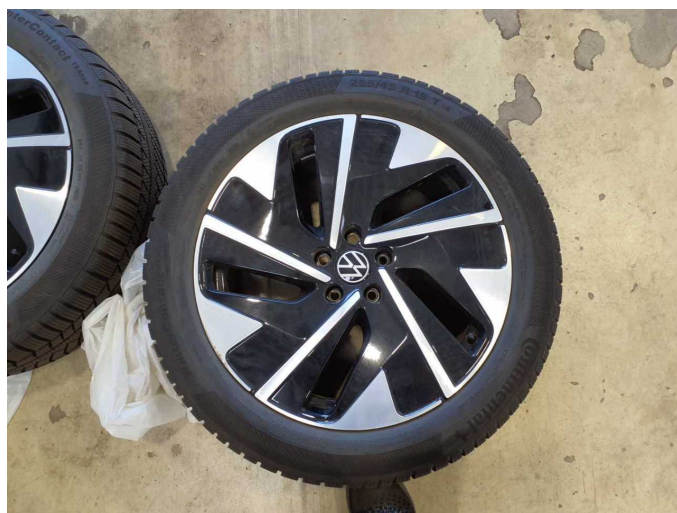


Figure 30: Misc.



Damage 2: Door - front left side: Door handle - outside - Scratch(es) - Smart repair

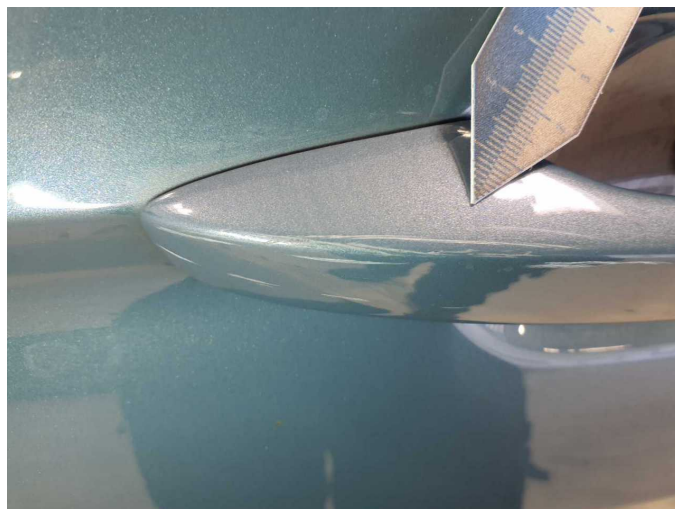

Damage 2: Door - front left side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair




Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair




Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




Damage 5: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair

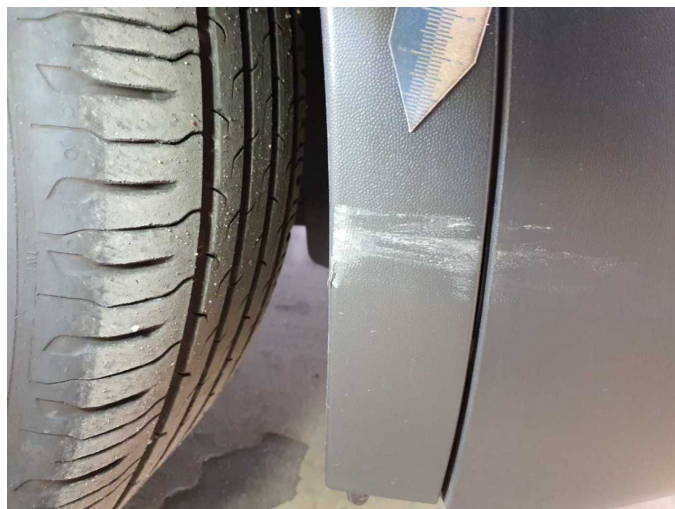

Damage 5: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair

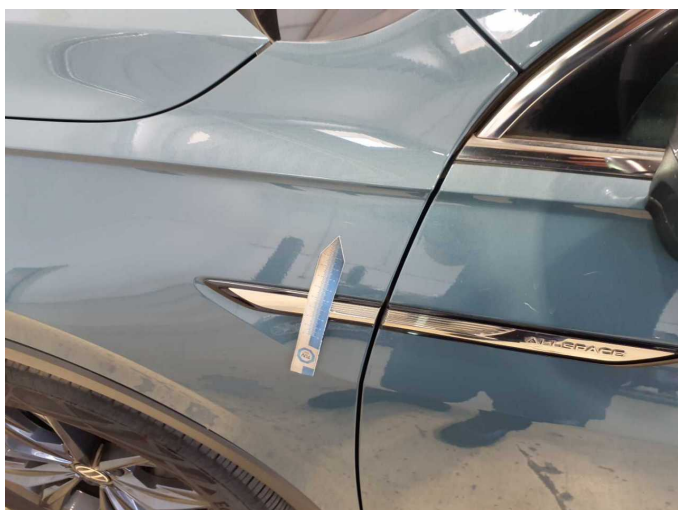

Damage 6: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair

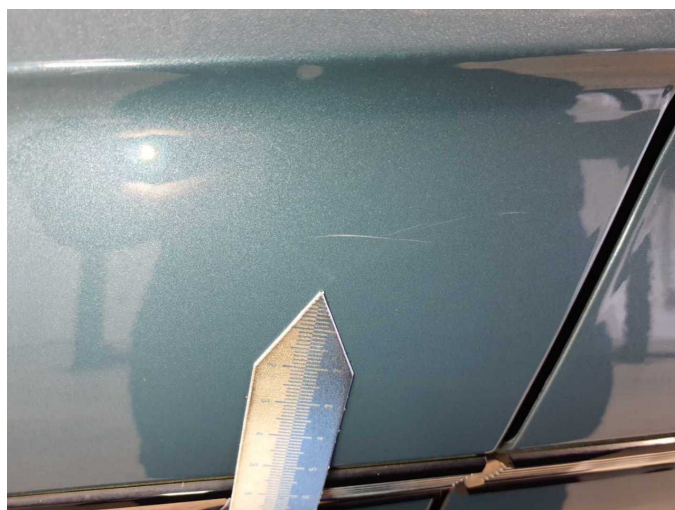

Damage 6: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 6: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 7: Wheel / tyres: Tyre - rear right side (nicht fahrbereit) - Broken / torn - Replace



Damage 7: Wheel / tyres: Tyre - rear right side (nicht fahrbereit) - Broken / torn - Replace




Damage 8: Door - rear right side: Door (Einschlüsse und Spachtel rissig) - dent(s) - Smart repair



Damage 8: Door - rear right side: Door (Einschlüsse und Spachtel rissig) - dent(s) - Smart repair



Damage 8: Door - rear right side: Door (Einschlüsse und Spachtel rissig) - dent(s) - Smart repair

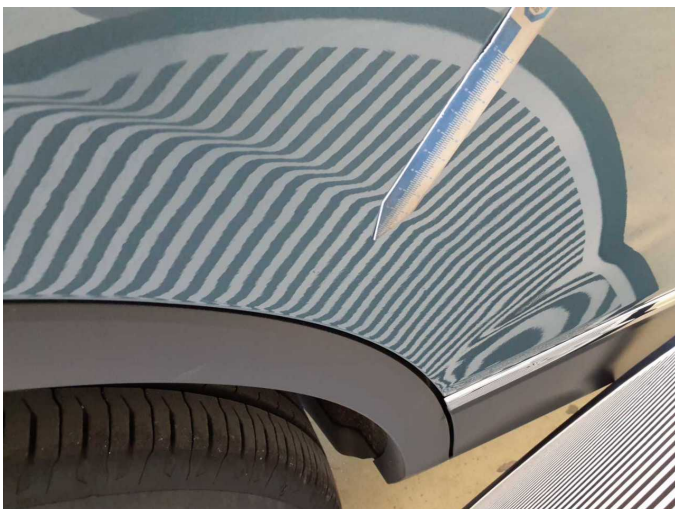

Damage 8: Door - rear right side: Door (Einschlüsse und Spachtel rissig) - dent(s) - Smart repair



Damage 8: Door - rear right side: Door (Einschlüsse und Spachtel rissig) - dent(s) - Smart repair



Damage 9: Trim / covers: Door trim - front left side (Kratzer) - Differs from the original configuration - Replace



Damage 9: Trim / covers: Door trim - front left side (Kratzer) - Differs from the original configuration - Replace



Damage 9: Trim / covers: Door trim - front left side (Kratzer) - Differs from the original configuration - Replace




Damage 10: Engine: Engine (Motorkontrolle leuchtet, nicht fahrbereit) - Specify findings - Perform diagnosis



Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

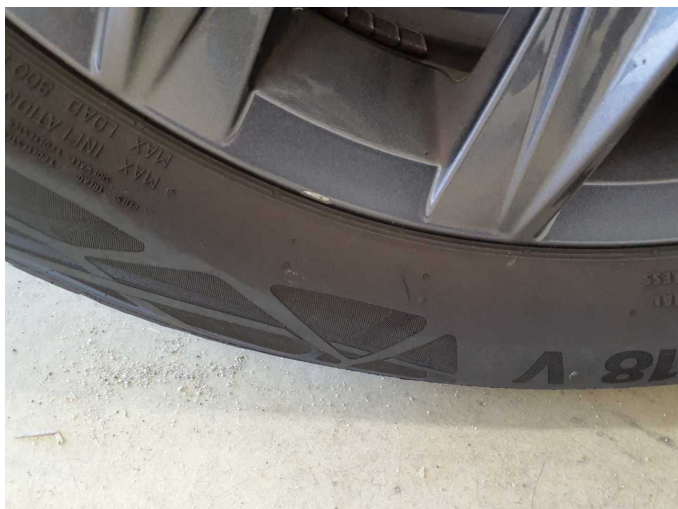


Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

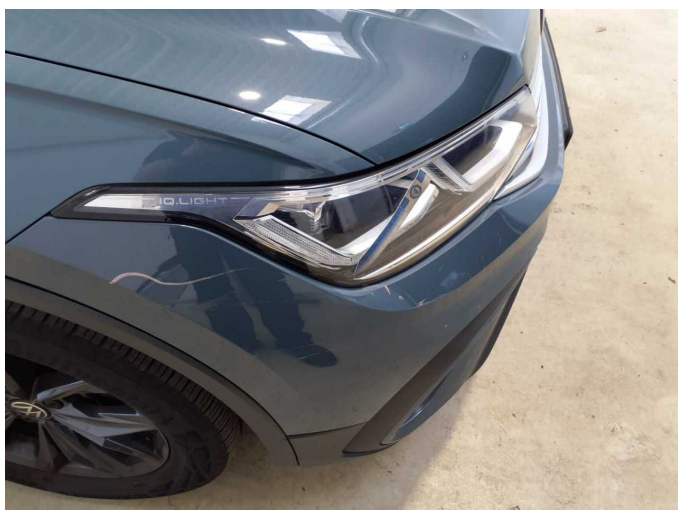

Damage 12: Headlight: Headlight - right side (nicht im Lichtschein) - Scratch(es) - Loss in value

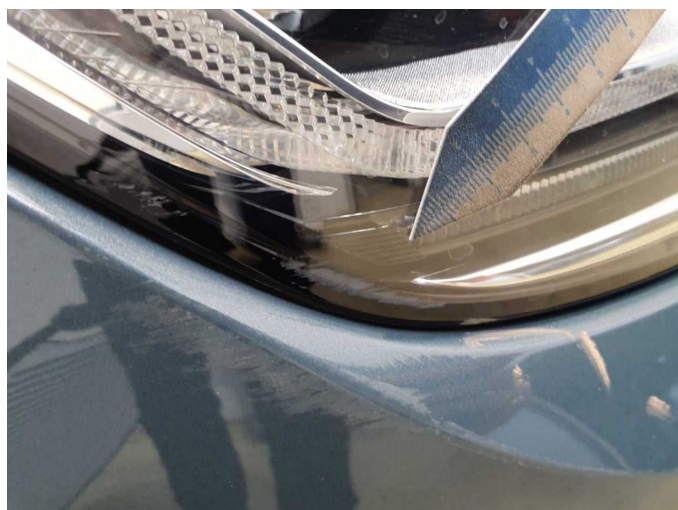

Damage 12: Headlight: Headlight - right side (nicht im Lichtschein) - Scratch(es) - Loss in value




Damage 13: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 13: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint

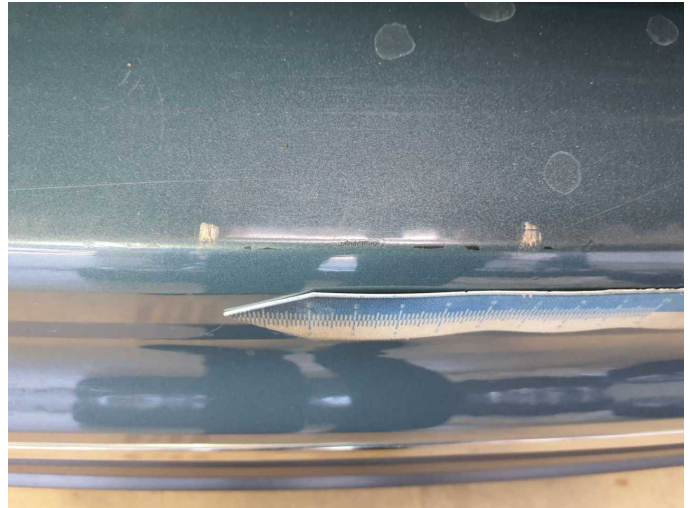

Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

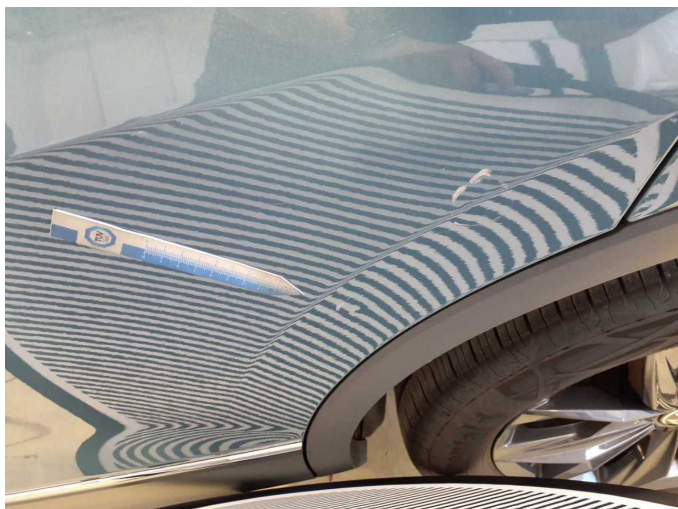

Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 16: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 16: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 16: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 16: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 16: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 17: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 17: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

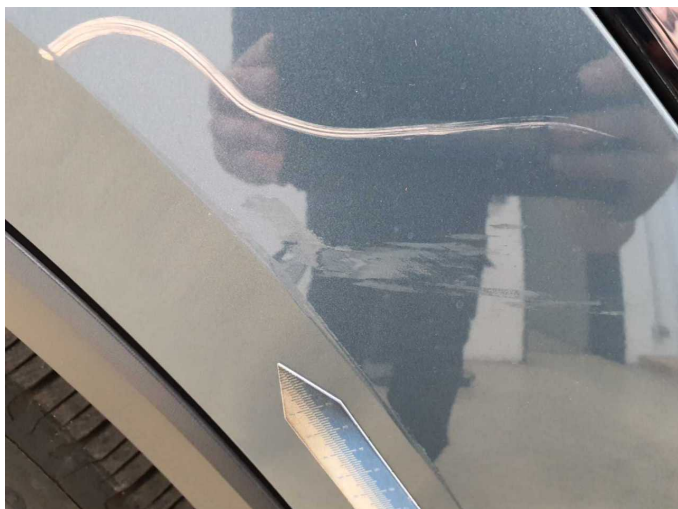

Damage 17: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 17: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 17: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 18: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Damage 18: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation




Wear and tear 4: Trim / covers: Floor mats - Broken / torn - No deduction



Wear and tear 5: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 5: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction

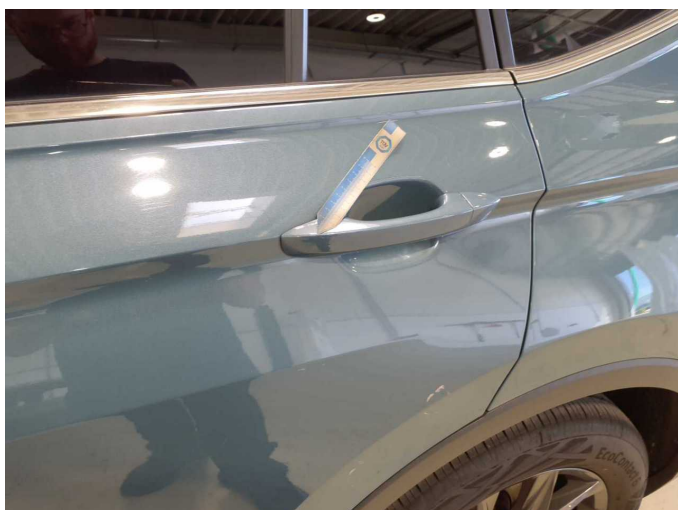

Wear and tear 6: Door - rear left side: Door handle - outside - Scratch(es) - Smart repair



Wear and tear 6: Door - rear left side: Door handle - outside - Scratch(es) - Smart repair



Repainting 1: Roof rail - left side



Repainting 1: Roof rail - left side



Repainting 2: Side panel - rear left side




Repainting 2: Side panel - rear left side



Repainting 3: Side panel - rear right side



Repainting 3: Side panel - rear right side

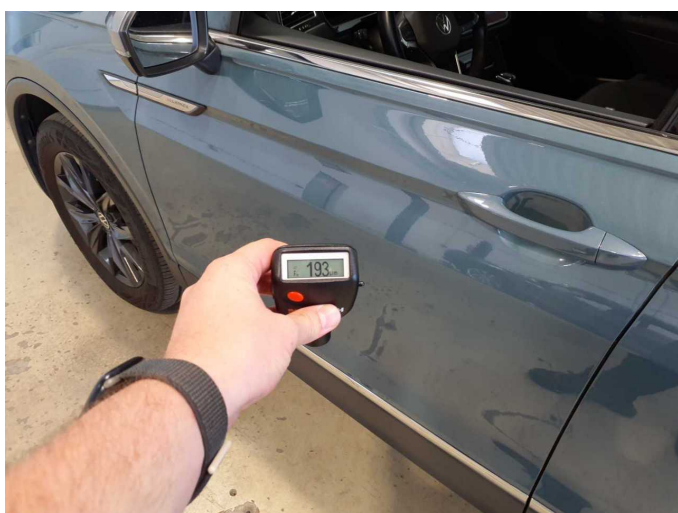

Repainting 4: Door - front left side



Repainting 4: Door - front left side



Repainting 5: Door - rear right side



Repainting 5: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZNM031094

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
DSG Life

Datum	KM-Stand	Beschreibung
30.04.2026	86.057	Reparatur Sonstiges; Systemtest/Eigendiagnose
03.07.2025	69.743	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
02.04.2025	63.339	HU + AU; Regelwartungsdienst; Wartung Sonstiges
13.06.2024	47.370	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
06.11.2023	32.173	Regelwartungsdienst; Wartung Sonstiges
06.06.2023	23.657	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges