



Expertise

Protocol number: 46352087
Order No. / Reference: 26617485
Inspection date: 2 Jul 2026

Manufacturer: Mercedes-Benz

Model: EQA 250 Progressive

VIN: W1N2437011J034524



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQA 250 Progressive	
Vehicle Identification number	W1N2437011J034524
Mileage (Read)	107,380 km
First registration	21 Jun 2022
Number of holders	1
Power / Engine displacement	80 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	NACHTSCHWARZ UNILACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	236 Tag(e)
Last service on / at	02/2026 at 99,765 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF800427
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BBR 00006		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,470 kg	Empty weight	
Dimensions	4465 x 1849 x 1622		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104Y	Summer tyres on Light alloy	Falken	5mm / 5mm
2)	235/55 R18 104T	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tyres on Light alloy	Michelin	6mm / 6mm
2)	235/55 R18 104H	Winter tyres on Light alloy	Bridgestone	7mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Acoustic environmental protection
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- outdoor thermometer
- Roof rails in polished aluminum
- Third brake light in LED technology
- EASY-Pack tailgate with electric operation for opening and closing
- Velour floor mats in black
- Speed Limit Assistant
- rear window wiper
- Climate: THERMATIC automatic climate control
- Headrests (5)
- Paint finish: Solid
- Chrome-look loading sill protector
- Charging system: Direct current charging system (DC charging)
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Cargo space
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote and Charging Services Premium
- Rear view camera
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Rear seat backrests foldable
- Cruise control
- High-visibility vest for drivers
- Central locking
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Ambient lighting
- Rear armrest
- Electrically adjustable exterior mirrors
- Color glass
- Double cup holder
- DYNAMIC SELECT
- Chassis: Comfort chassis with lowered suspension
- Electric windows, front and rear
- Luggage net on driver and passenger seatbacks
- Transmission: Direct drive
- Black fabric headliner
- Communication module (LTE) for the use of Mercedes me connect services
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW (3-phase)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/fabric
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design
- Windscreen wipers with rain sensor
- Seats: Comfort seats
- Power outlet: 12V socket in the luggage compartment
- TIREFIT with tire inflation compressor
- Immobiliser
- Decorative elements spiral look



Extra equipment

- Airbag: Side airbags in the rear
- Exit warning function
- Package: Advanced (Fully digital instrument display, high resolution 10.25" - Media display, high resolution 10.25" - Mirror package: interior and exterior mirrors automatically dimming, exterior mirrors electrically folding, ambient lighting of the exterior mirrors to illuminate the entry area - Parking package with reversing camera - Active Parking Assist with PARKTRONIC)
- Package: Parking package with reversing camera
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design, in conjunction with Night Package
- Sunroof: Panoramic sunroof (electrically operated in glass design with comfort and automatic rain closing - electric sunshade - anti-pinch protection and PRE-SAFE closing function)
- Active Speed Limit Assist
- Paint finish: Special paint finish, solid color
- Package: Business Package (Connectivity Package Navigation - Traffic Sign Assist - Heated Seats for Driver and Front Passenger - Smartphone Integration - Preparation for Digital Key Handover)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Speed Limit Assist - Extended Automatic Restart on Highways - Route-Based Speed Adaptation with Traffic Jam Definition - Active Steering Assist - Active Emergency Stop Assist with SOS Function - Emergency Lane Radio - Active Brake Assist - Turning and Intersection Function - Traffic Jam Emergency Braking Function - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - Exit Warning Function - Pedestrian Warning Function)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Boot lid / rear door	Boot lid (Ruckelt beim öffnen) - Specify findings - Perform diagnosis
3	Seat - front	Seat cover - left side - Scratch(es) - Smart repair
4	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
5	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
6	Body	A-pillar - left side - Scratch(es) - Smart repair
7	Body	A-pillar - right side - Scratch(es) - Smart repair
8	Door - front right side	Door - Scratch(es) - Smart repair
9	Door - front left side	Door - Dent / paintcoat damage - Smart repair
10	Mudguard - left side	Wheel well extension - Scratch(es) - Replace
11	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
12	Tail light	Tail light - Scratch(es) - Replace
13	Boot lid / rear door	Boot lid - dent(s) - Repair and paint
14	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint
15	Rear bumper	Bumper - rear right side - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Dent / paintcoat damage - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

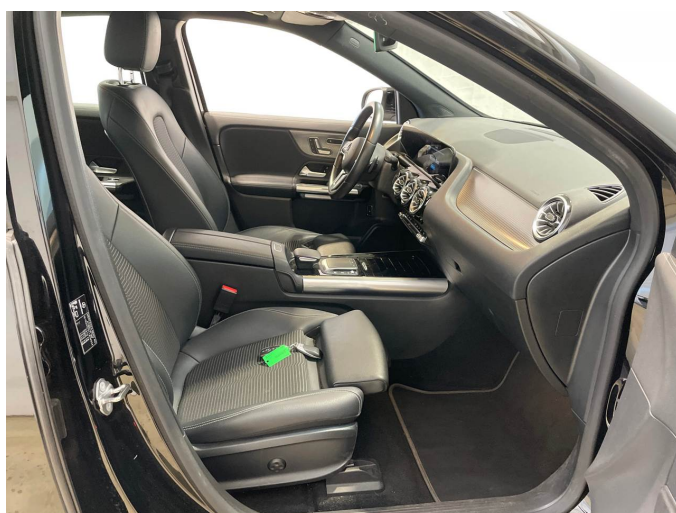


Figure 5: Interior - front

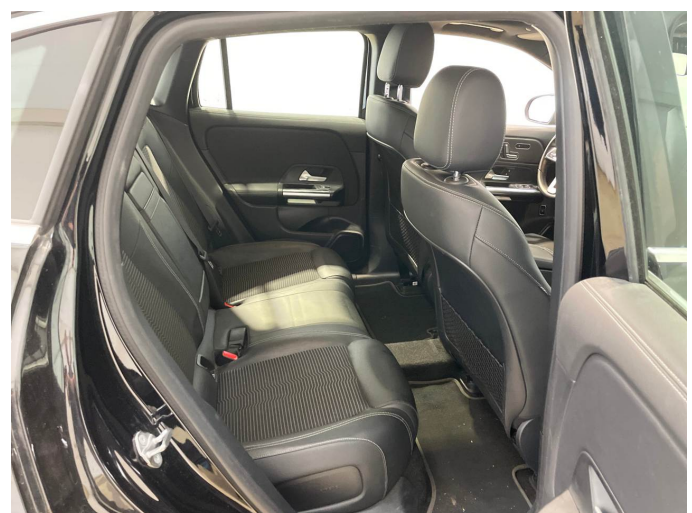


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

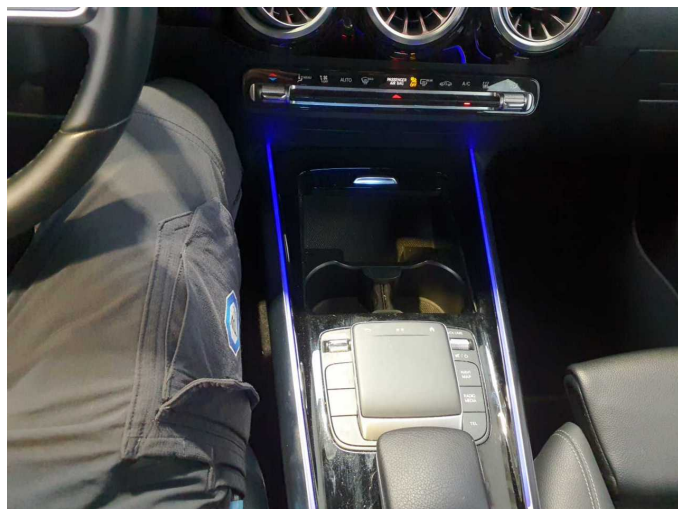


Figure 20: Misc.

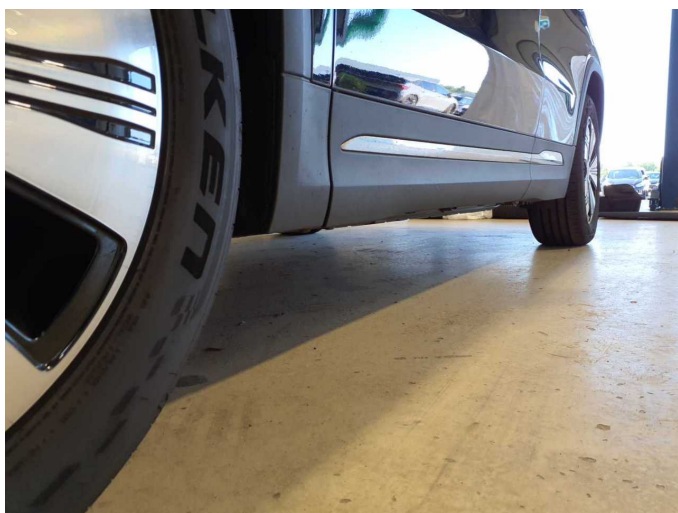


Figure 21: Misc.

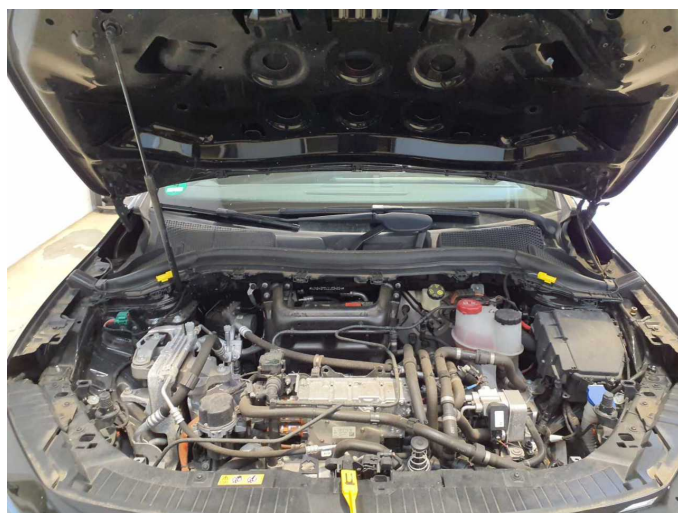


Figure 22: Misc.

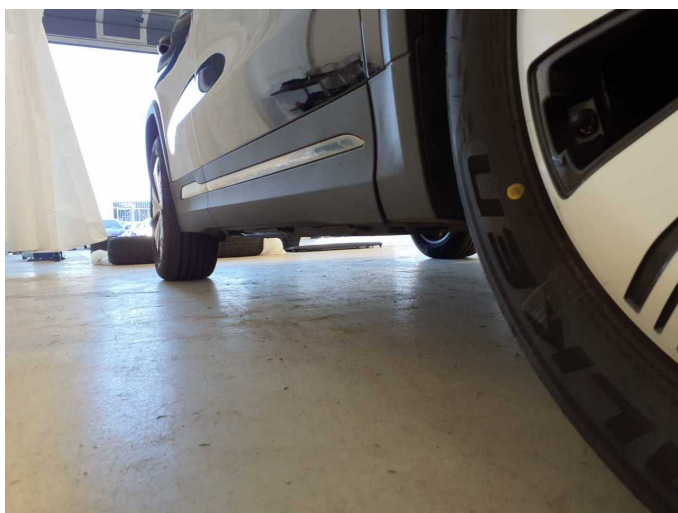


Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.

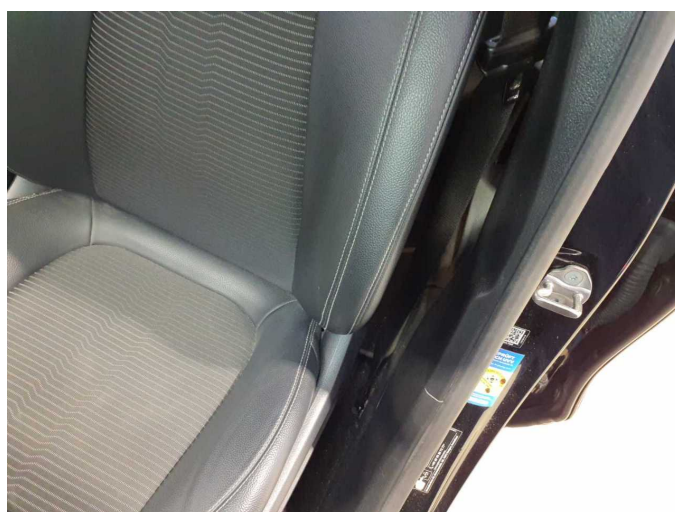


Damage 3: Seat - front: Seat cover - left side - Scratch(es) - Smart repair

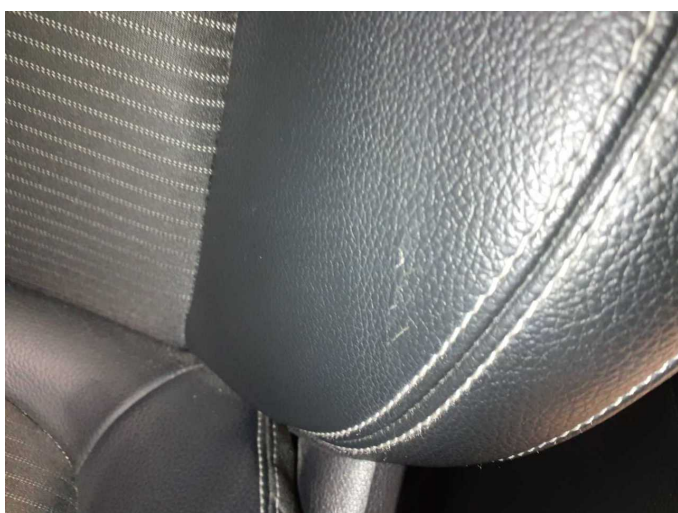

Damage 3: Seat - front: Seat cover - left side - Scratch(es) - Smart repair

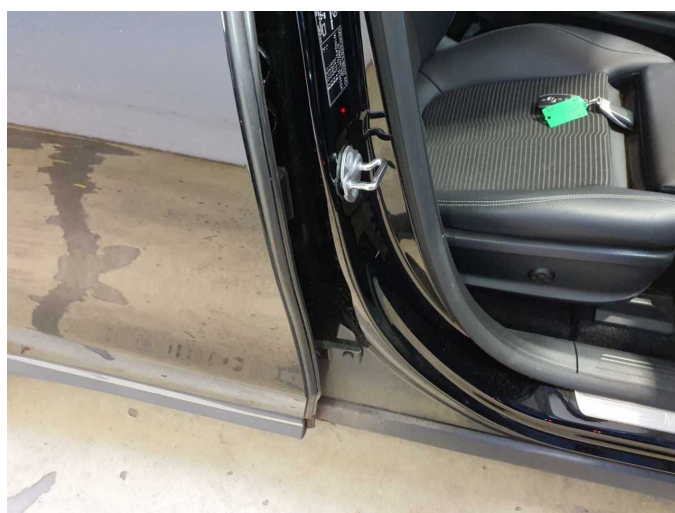


Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

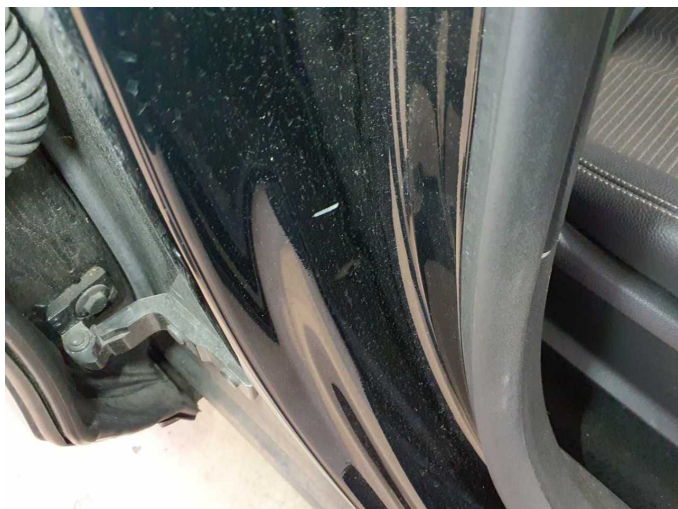

Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair




Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

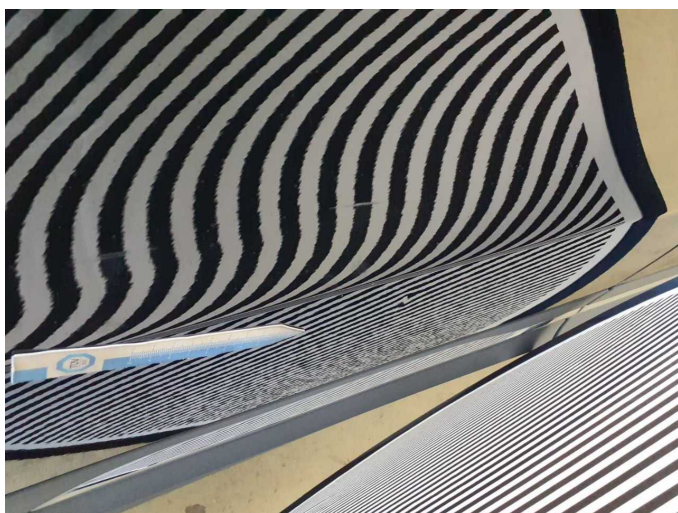


Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 6: Body: A-pillar - left side - Scratch(es) - Smart repair

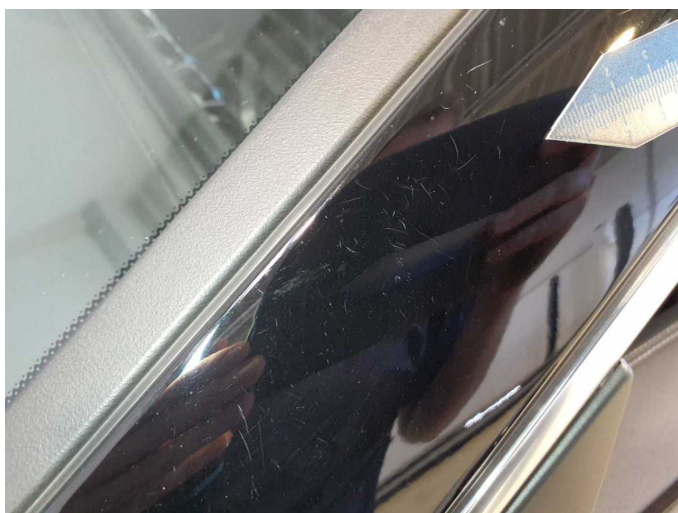

Damage 6: Body: A-pillar - left side - Scratch(es) - Smart repair

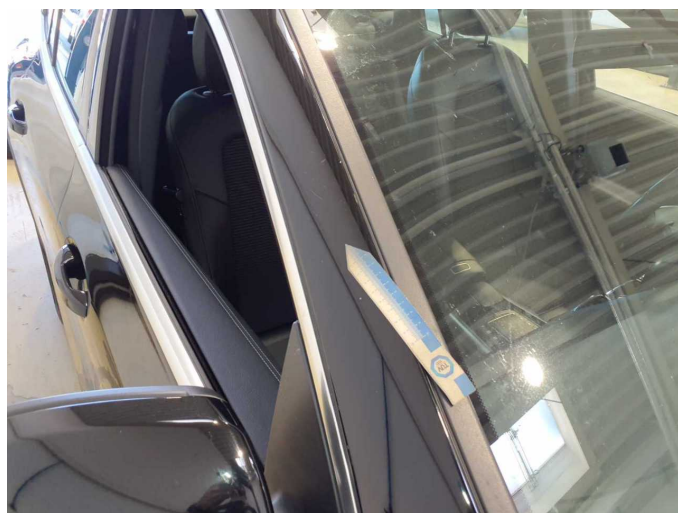

Damage 7: Body: A-pillar - right side - Scratch(es) - Smart repair

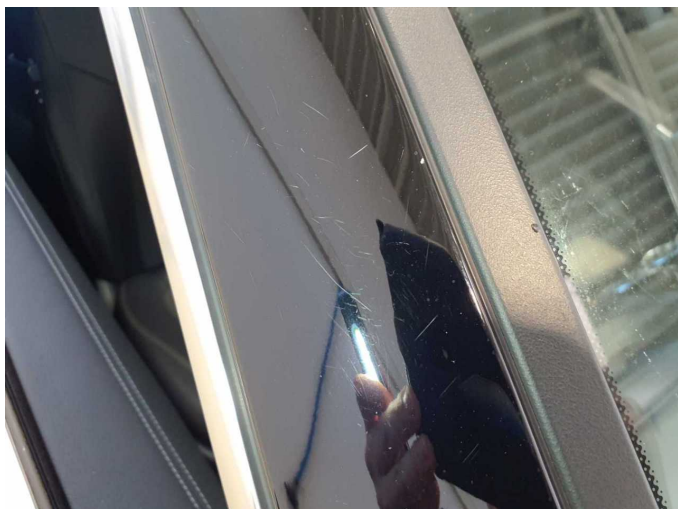

Damage 7: Body: A-pillar - right side - Scratch(es) - Smart repair




Damage 8: Door - front right side: Door - Scratch(es) - Smart repair



Damage 8: Door - front right side: Door - Scratch(es) - Smart repair




Damage 9: Door - front left side: Door - Dent / paintcoat damage - Smart repair

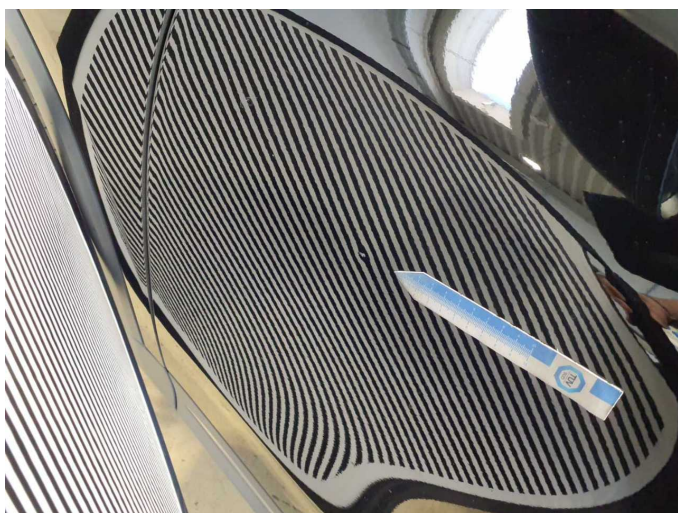


Damage 9: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 10: Mudguard - left side: Wheel well extension - Scratch(es) - Replace

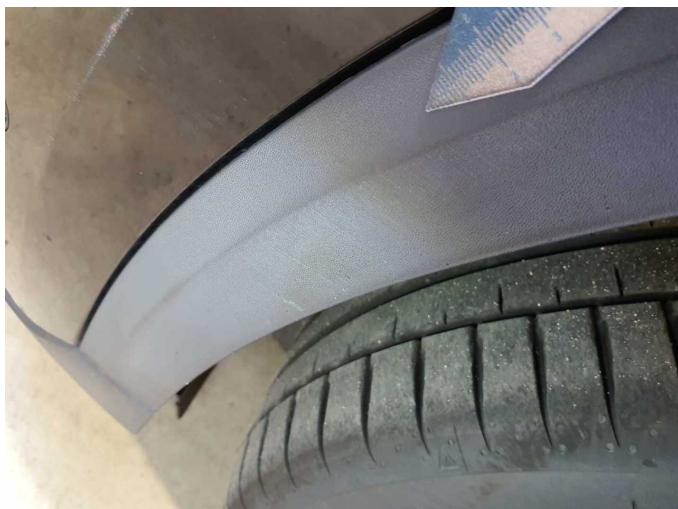

Damage 10: Mudguard - left side: Wheel well extension - Scratch(es) - Replace

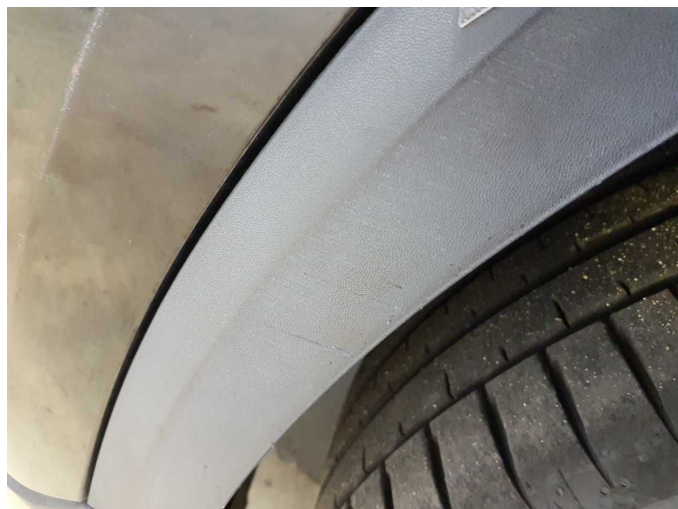

Damage 10: Mudguard - left side: Wheel well extension - Scratch(es) - Replace




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 12: Tail light: Tail light - Scratch(es) - Replace

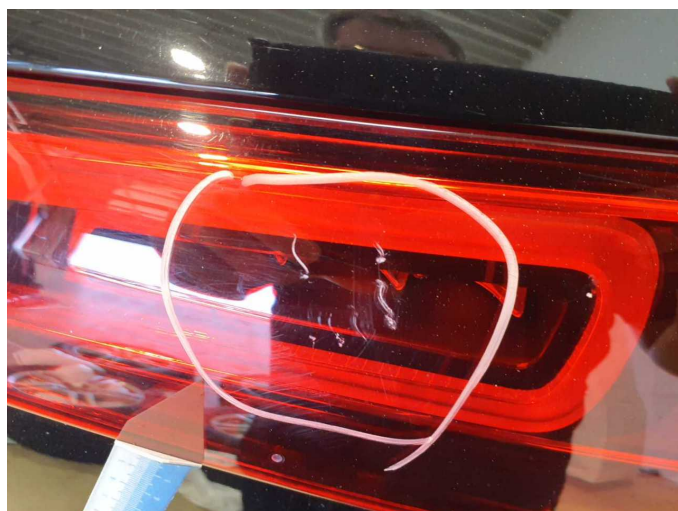

Damage 12: Tail light: Tail light - Scratch(es) - Replace

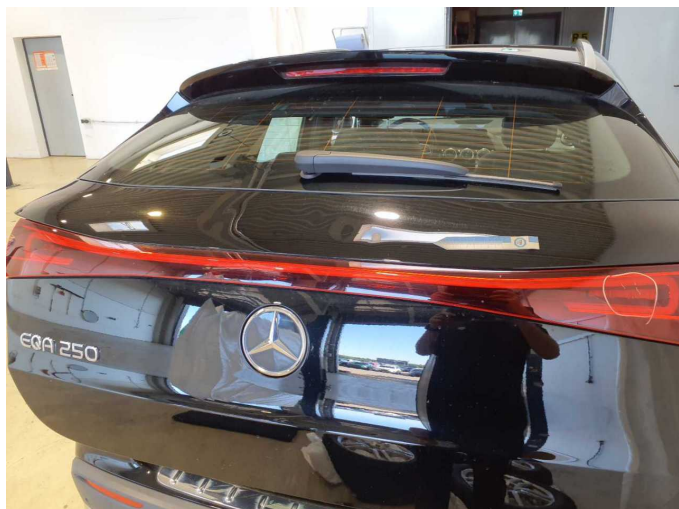


Damage 13: Boot lid / rear door: Boot lid - dent(s) - Repair and paint

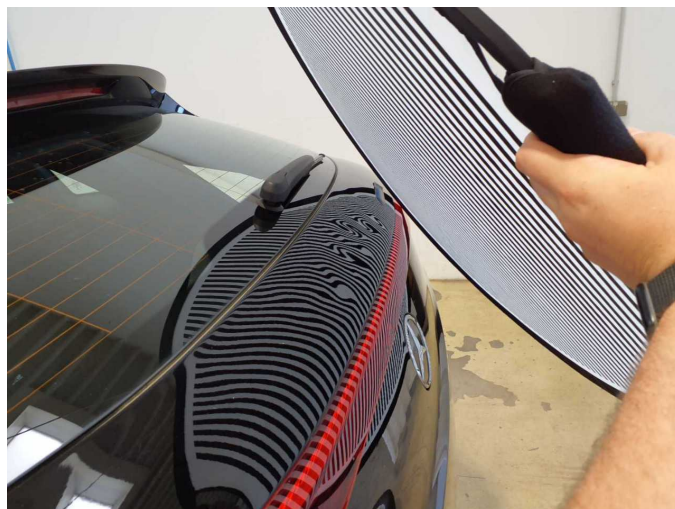


Damage 13: Boot lid / rear door: Boot lid - dent(s) - Repair and paint




Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

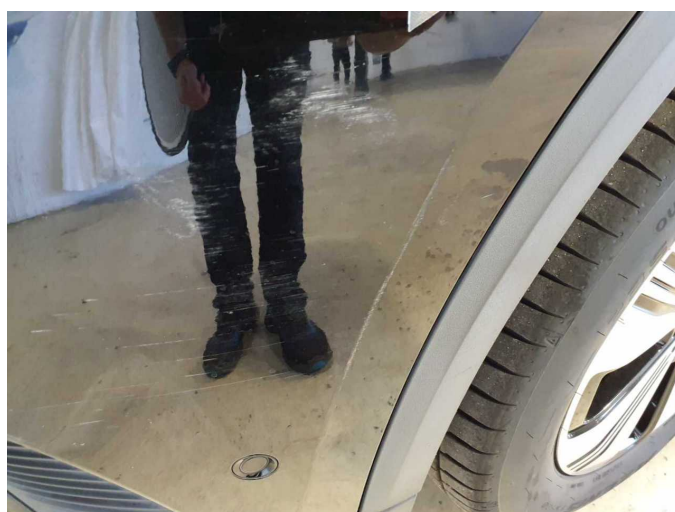

Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

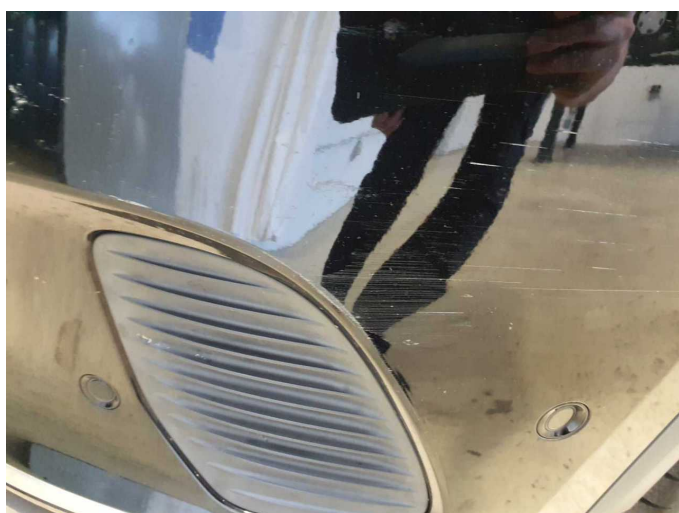

Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

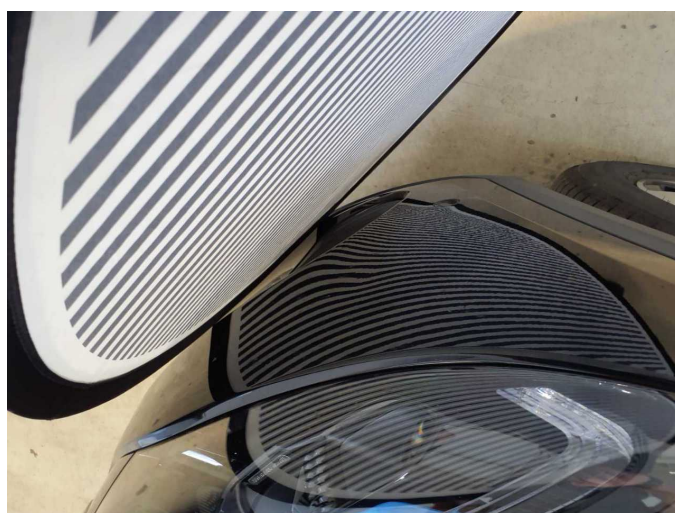


Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Bumper - rear right side - Scratch(es) - Paint



Damage 15: Rear bumper: Bumper - rear right side - Scratch(es) - Paint

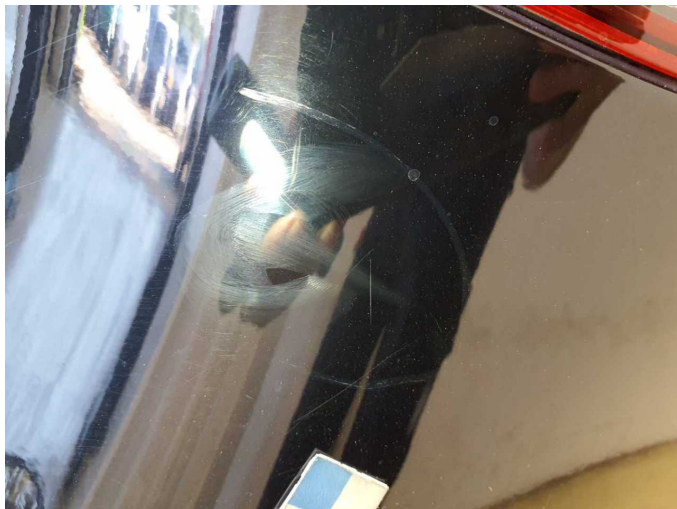

Damage 15: Rear bumper: Bumper - rear right side - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2437011J034524

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQA 250 Progressive

Datum	KM-Stand	Beschreibung
17.02.2026	99.765	Regelwartungsdienst
19.03.2025	75.859	Regelwartungsdienst
16.09.2024	60.550	Reparatur Sonstiges; Systemtest/Eigendiagnose
23.04.2024	51.973	Regelwartungsdienst
02.06.2023	26.526	Regelwartungsdienst