



Expertise

Protocol number: 46527558
Order No. / Reference: 26733639
Inspection date: 10 Jul 2026

Manufacturer: Opel

Model: Astra Sports Tourer 1.5 D Automatik GS

VIN: VVKFCYHZXR1033532



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra Sports Tourer 1.5 D Automatik GS	
Vehicle Identification number	VVKFCYHZXR1033532
Mileage (Read)	108,999 km
First registration	28 May 2024
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Kardio Rot Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	Available / incomplete	Next maintenance in	
Last service on / at	06/2025 at 49,701 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB462299
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2525 / ABT 00008		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R18 92Y	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	225/40 R18 92Y	Summer tyres on Light alloy	Continental	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, in the front doors suitable for 1.5-liter beverage bottles, in the rear doors suitable for 0.5-liter beverage bottles, glove compartment with LED lighting)
- Airbag: Front and rear outer head airbags
- Aluminum pedals
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag or seatbelt pretensioner)
- On-board computer
- Roof design line, in black
- Diesel particulate filter (DPF) maintenance-free (exhaust aftertreatment via SCR (Selective Catalytic Reduction) catalyst with AdBlue (urea injection). Vehicles with BlueInjection technology require refilling of the AdBlue fluid between regular service intervals. A display in the vehicle informs the driver in good time when refilling is necessary.)
- Forward Collision Warning with Automatic Emergency Braking and Pedestrian Detection (automatic transmission) (The automatic emergency braking system brakes the vehicle or brings it to a standstill - Lane Keeping Assist: warning via indicator light and gentle counter-steering - Traffic Sign Recognition - Driver Alert System - Automatic Speed Assist (activation from 30 km/h to 180 km/h) with stop function; the vehicle is then automatically braked to a standstill and can automatically follow the vehicle in front, even in traffic jams)
- Front headrests and 3 rear headrests, height adjustable
- LED ambient lighting (front doors, adjustable in 8 colors)
- LED headlights (LED headlights - LED daytime running lights - LED taillights - LED turn signals - manual headlight range control - high beam assist - automatic low beam - rain sensor)
- Steering wheel heating
- Illuminated makeup mirrors in both sun visors
- Multimedia Infotainment System (with 10" color touchscreen display and 10" driver information display, automatic music recognition, Bluetooth audio streaming, hands-free calling, simultaneous pairing of 2 mobile phones, wireless smartphone integration via Apple CarPlay and Android Auto, personalization options, 4x20 watts, favorite station memory (24 per profile), speed-dependent volume control, FM/AM, DAB+, RDS-EON, 2 USB-C ports)
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Reversing camera: 360-degree reversing camera
- Rear seat backrest folds forward in a 40:20:40 split
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Heated seats for driver and front passenger (multi-stage adjustable)
- Start/Stop system (Driving assistant - Reinforced starter - AGM high-performance battery - eco switch to deactivate the start/stop function - Brake energy recuperation)
- Electronic immobilizer
- Airbag: Chest-pelvis side airbags, driver and front passenger (side airbag, front passenger can be manually deactivated)
- Airbag: Front airbags, driver and front passenger (front passenger airbag can be manually deactivated)
- Anti-lock braking system (ABS) (including brake assist)
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirror housings in black
- Hill Start Assist
- third brake light
- Headliner, Black
- Tachometer
- Electronic brake force distribution (EBD)
- Electronic Stability Program (ESP) and Traction Control with engine and brake intervention (TCPlus)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Transmission: 8-speed automatic transmission
- Back window, heater
- rear window wiper
- Interior rearview mirror, automatically dimming
- Cable set for trailer hitch
- Dual-zone automatic climate control (dual-zone automatic climate control with separate temperature control for driver and front passenger - recirculation mode, manual - particle/activated carbon filter - automatic air distribution - sun position sensor - humidity sensor)
- Paint finish: Roof in carbon black
- LED interior lighting (including reading lights, front and rear, as well as trunk lighting and lighting in the front footwell)
- Steering wheel: Leather steering wheel, flat-bottomed, perforated, with steering wheel remote control and paddle shifters
- Center armrest, front and rear (front center armrest with USB port and 2 USB chargers - front and rear cup holders - storage compartments - rear center armrest with pass-through)
- Fog light
- Opel Blitz logo, Astra lettering on the rear (high-gloss black surround for air intakes)
- Opel Vizor with frame in high-gloss black
- Electric parking brake
- Parkpilot, front and rear parking aid
- Tire pressure monitoring system
- Wheels: Alloy wheels 7.5 J x 17 (5 spokes) in silver/black (with tires 225/45 R 17)
- Keyless locking and starting system Keyless Open & Start
- Seats: Ergonomic sport active seat driver Greta fabric/premium leather look (Ergonomic sport active seat (AGR), driver - Greta fabric/premium leather look, black, - driver's seat 10-way adjustable (length, height, tilt, backrest tilt, seat cushion tilt) - front passenger seat 6-way adjustable (length, height, tilt) - 4-way front headrests - pockets on the back of the front seats)



- Central locking with remote control (and interior switch)

- 12V power outlet in the center console
- Pre-installation for ISOFIX child seat mounting system (incl. top tether attachment points, rear outer)

Extra equipment

- Paint finish: Metallic Cardio Red
- Package: Infotainment Package GS (Navigation system and voice control also for audio and telephone, Hi-Fi sound system, head-up display, heated ThermoTec windshield, integrated memory, navigation, 3D map display for Europe and Russia, dynamic route guidance, personalization options, shortcut keys for 6 functions, emergency/breakdown call, Connected Navigation Package incl. Connect Plus: - TomTom Online Traffic - Online POI search and route guidance - Over-the-air map updates - Remote control via myOpel app)
- Package: Comfort Package GS Sports Tourer (electric glass sliding/sunroof - Heated ThermoTec windshield - Sensor-controlled tailgate, electric, self-opening and -closing via foot gesture)
- Navigation system (with 10" color touchscreen display and 10" driver information display, Pure Panel Pro and voice control for audio, telephone and navigation; navigation system with integrated memory; 3D map display for Europe and Russia; dynamic route guidance; personalization options; quick access buttons for 6 functions; emergency/breakdown call; Connected Navigation Package incl. Connect Plus: - TomTom Online Traffic - Online POI search and route guidance - Over-the-air map updates - Remote control via myOpel app)
- Seats: Ergonomic sport active seats for driver and front passenger, Alcantara upholstery (Ergonomic sport active seats, certified by the German Campaign for Healthy Backs (AGR), driver and front passenger - Alcantara, black, including seat contact surfaces and door panels partially in Alcantara - adjustable length, height, tilt, backrest tilt, and seat cushion tilt - memory function for driver's seat - electro-pneumatically adjustable lumbar support in height and length - extendable thigh support - pocket on the front seat backs - heated front seats and heated steering wheel)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Engine	Engine cover - top / cover - Damage caused by marten / rodent - Replace
5	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
6	Tail light	Tail lamp - left side (Innen) - Broken / torn - Replace
7	Wheel / tyres	Alloy rim - rear left side - Scratched - Replace
8	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Boot lid / rear door	Rear spoiler - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

- 1 Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - front right side

264 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

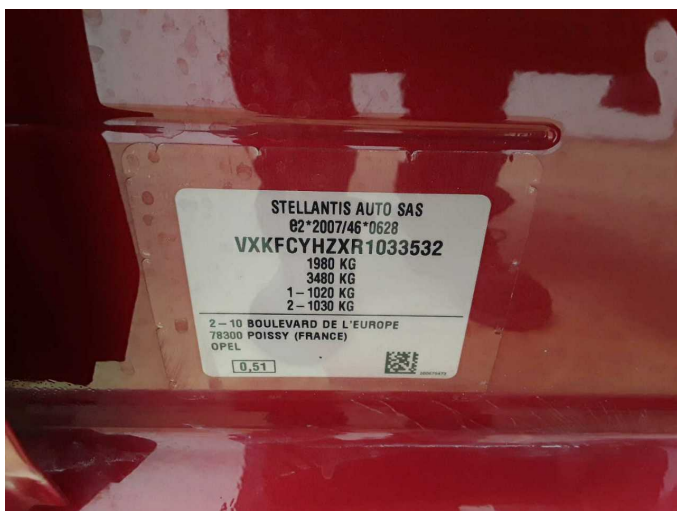


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

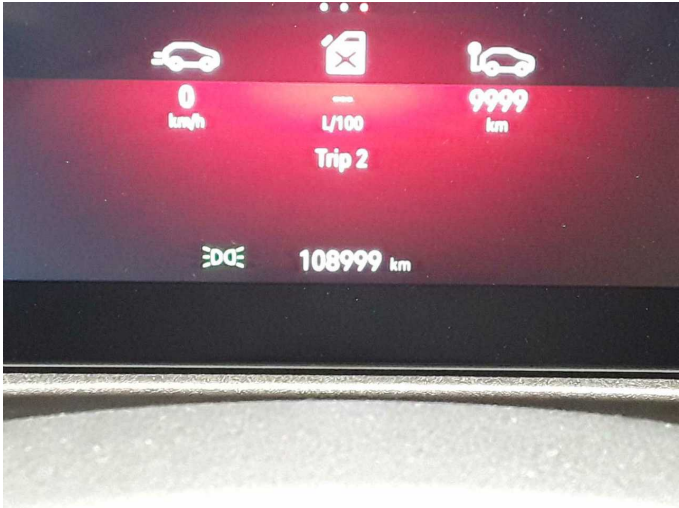


Figure 14: Documents

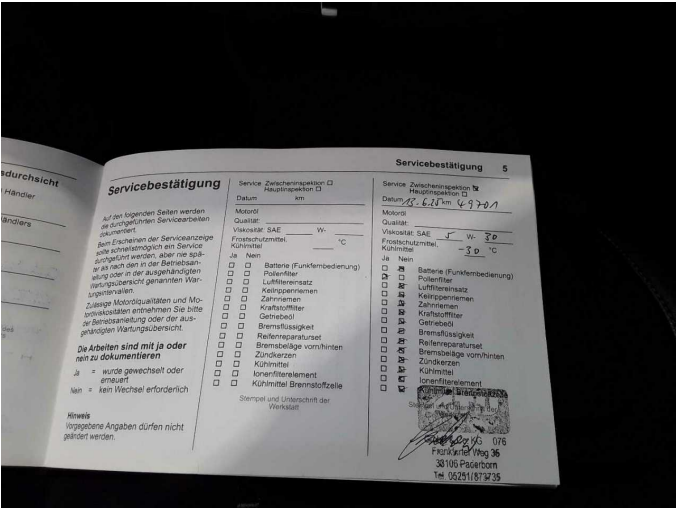


Figure 15: Documents

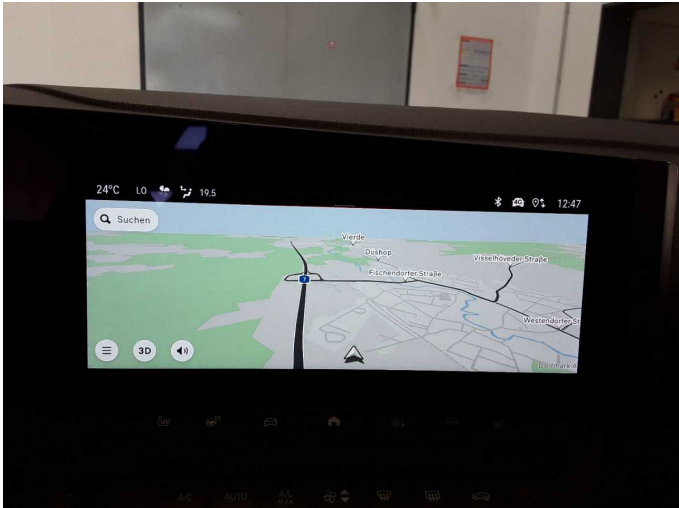


Figure 16: Navigation



Figure 17: Misc.

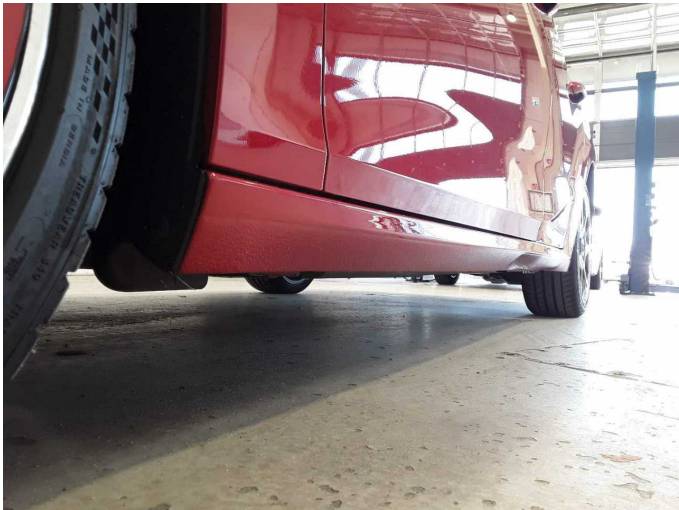


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.




Figure 22: Misc.



Figure 23: Misc.



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value

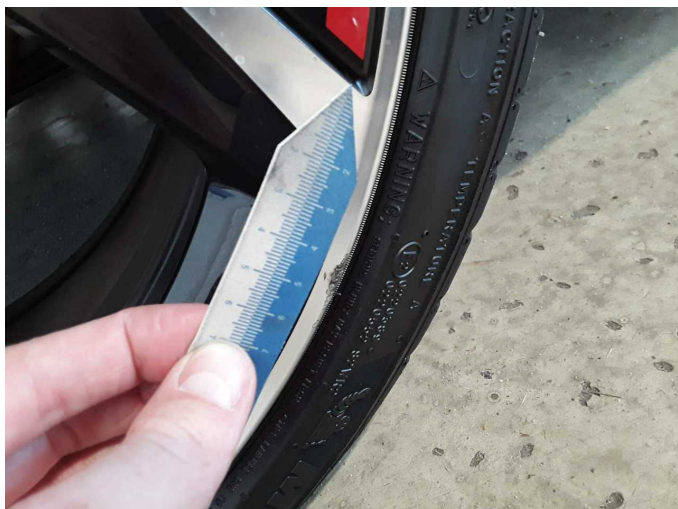

Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Engine: Engine cover - top / cover - Damage caused by marten / rodent - Replace



Damage 5: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 5: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 6: Tail light: Tail lamp - left side (Innen) - Broken / torn - Replace



Damage 6: Tail light: Tail lamp - left side (Innen) - Broken / torn - Replace



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace




Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace

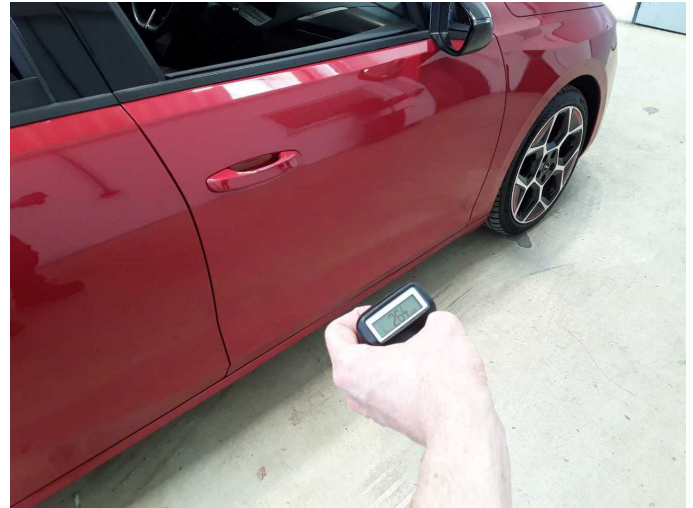

Repainting 1: Door - front right side



Repainting 1: Door - front right side