



Expertise

Protocol number: 46324629
Order No. / Reference: 26628768
Inspection date: 3 Jul 2026

Manufacturer: Opel

Model: Combo Cargo 1.5 D Edition

VIN: W0VEFYHT2MJ910137



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Combo Cargo 1.5 D Edition

Vehicle Identification number W0VEFYHT2MJ910137

Mileage (Read) 96,712 km

First registration 24 Jan 2022

Number of holders 1

Next periodical technical inspection 06/2028
(Report not on hand)

Power / Engine displacement 75 kw / 1,499 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Jade Weiß

Doors / Seats 4 / 3

Upholstery type Cloth

Colour of upholstery Grey-Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	29,960 km
Last service on / at	03/2026 at 95,145 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF954992
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AIQ 00869		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,390 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel	Michelin	3mm / 3mm
2)	205/60 R16 96H	Summer tyres on Steel	Michelin	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Cover strip for sliding door track
- ABS including brake assist and adaptive brake light
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirror housings in black
- Battery discharge protection
- Floor covering: Cargo area floor, painted
- Diesel particulate filter, maintenance-free
- Three-point seat belts in all seats
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Speed controller
- Air conditioning, front, with particle and odor filter
- Paint finish: Solid color paint
- Steering column, adjustable for reach and height
- Upholstery: Cloth
- Wheels: Tire repair kit
- Side impact protection
- Speed-sensitive power steering
- Start/Stop System
- 12-volt power outlet in the center console
- Traction control with engine and brake intervention (TC Plus)
- Immobiliser
- Central locking with remote control

Extra equipment

- Towbar with ball head
- Trailer hitch preparation
- Rear wing doors, asymmetrically split, glazed, 180° opening angle (rear window wiper - rear window heater)
- Cable set
- LI, , Increased payload
- Seats: Double passenger seat (Electric parking brake - storage compartment on the backrest of the middle seat of the double passenger seat)
- FlexCargo partition wall with window (with pass-through function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable)
- Doors: Sliding door, passenger side with fixed window

- Storage compartments (edition)
- Driver's side airbag
- Automatic dipped headlights
- Exterior mirrors, electrically adjustable, heated and manually folding
- Hill Start Assist
- On-board computer
- Tachometer
- Third brake light
- Driver information display - LCD, black surround
- Speed limiter
- Transmission: 6-speed transmission
- Headrests (2), front, height adjustable
- Steering wheel remote control
- Rear parking pilot
- Radio BT
- Wheels: Steel wheels 6.5 J x 15
- Side protection strips
- Seats: Driver's seat adjustable in 6 ways: length, height and backrest angle
- Daytime running light
- Doors: Sheet metal insert, driver's side
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- Central locking: Ignition keys (2), one of which is foldable

- Driver and passenger side airbags
- Electric windows, front, with one-touch function and anti-pinch protection (as well as comfort closing function via remote control of the central locking system - electrically adjustable, heated and folding exterior mirrors)
- Radio: Multimedia radio with 8" color touchscreen display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, display of phonebook and call lists, up to 10 mobile phones can be paired, display of pictures/films/videos via USB interface, smartphone integration via Apple CarPlay and Android Auto, USB interface, dual tuner, graphic equalizer, 4 speakers, cruise control, steering wheel remote control)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Engine	Engine - Leaking - Diagnosed and repair if necessary
2	Sill - left side	Sill - Deformed - Repair and paint
3	Sill - right side	Sill - Deformed - Repair and paint
4	Seat - front	Seat cover - left side - Porous / cracked - Replace
5	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Trim / covers - Floor mats

Documents - Log book

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

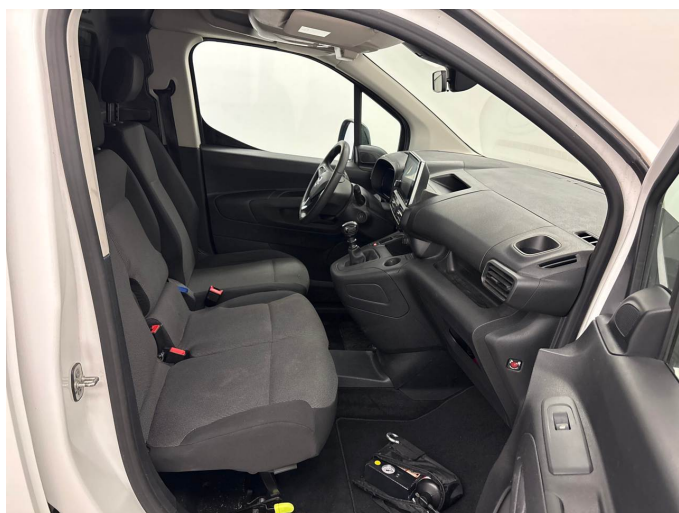


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

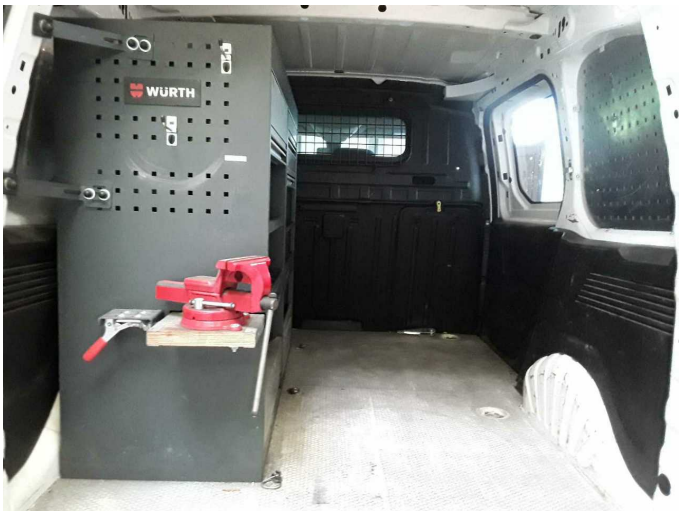


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

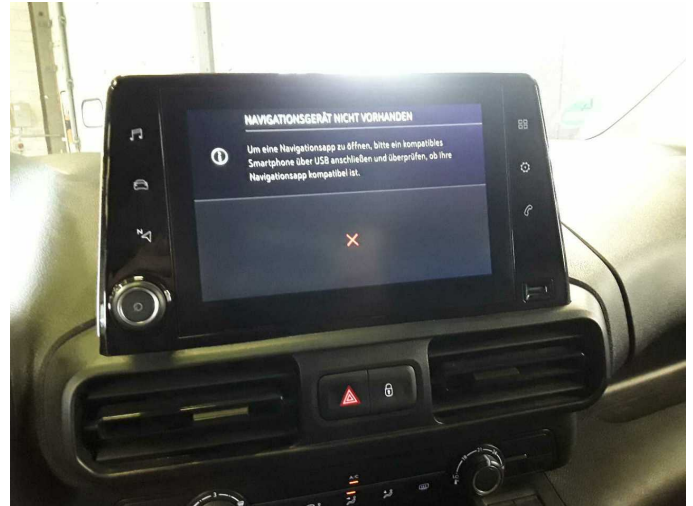


Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

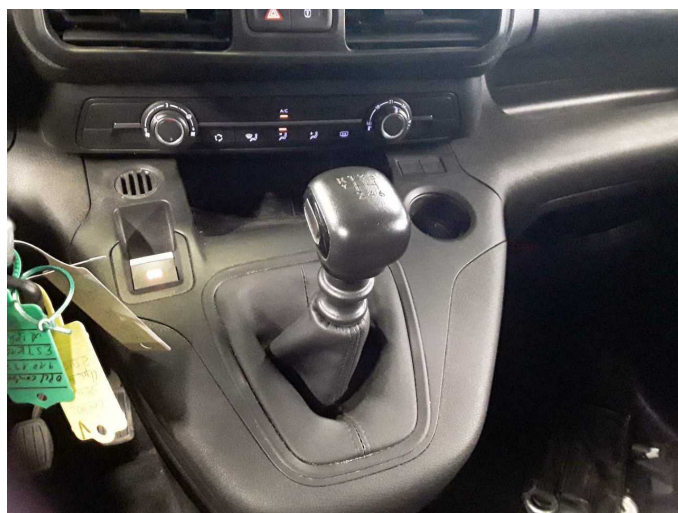


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 1: Engine: Engine - Leaking - Diagnosed and repair if necessary



Damage 2: Sill - left side: Sill - Deformed - Repair and paint




Damage 2: Sill - left side: Sill - Deformed - Repair and paint



Damage 2: Sill - left side: Sill - Deformed - Repair and paint



Damage 2: Sill - left side: Sill - Deformed - Repair and paint

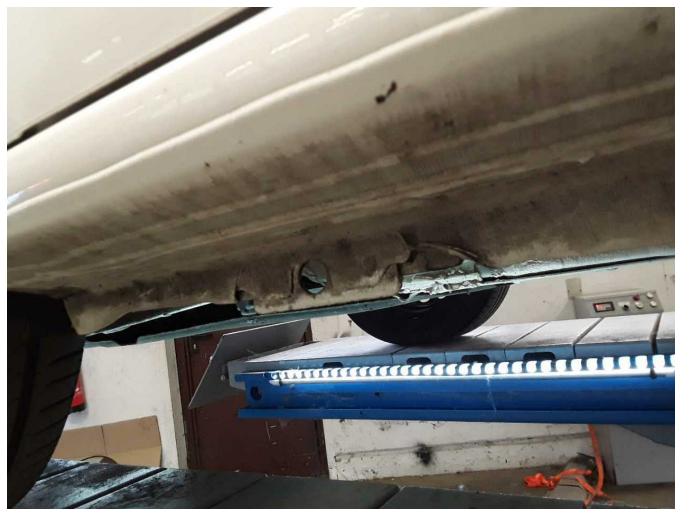

Damage 2: Sill - left side: Sill - Deformed - Repair and paint



Damage 3: Sill - right side: Sill - Deformed - Repair and paint



Damage 3: Sill - right side: Sill - Deformed - Repair and paint



Damage 3: Sill - right side: Sill - Deformed - Repair and paint



Damage 3: Sill - right side: Sill - Deformed - Repair and paint



Damage 3: Sill - right side: Sill - Deformed - Repair and paint



Damage 4: Seat - front: Seat cover - left side - Porous / cracked - Replace



Damage 4: Seat - front: Seat cover - left side - Porous / cracked - Replace



Damage 4: Seat - front: Seat cover - left side - Porous / cracked - Replace



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Missing part 1: Trim / covers: Floor mats - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHT2MJ910137
Hersteller / Modell: OPEL OPEL Combo Cargo 1.5 D Edition

Datum	KM-Stand	Beschreibung
05.06.2026	96.676	AU
12.03.2026	95.145	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Wartung Sonstiges
01.10.2025	78.658	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.09.2025	78.637	Druckschlauch Klima ern; Klimaanlage inst.
21.02.2025	59.182	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.04.2024	39.303	AU; Bremsklötze vorne; Bremsscheiben vorne
22.03.2024	38.871	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst
28.06.2023	22.261	Motoröl b. Wartung; Ölwechsel