



Expertise

Protocol number: 46930835
Order No. / Reference: 26852162
Inspection date: 5 Aug 2026

Manufacturer: Opel	Model: Crossland 1.5 Diesel Automatik Ultimate
VIN: W0V7H9EJ2M4379584	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Crossland 1.5 Diesel Automatik Ultimate	
Vehicle Identification number	W0V7H9EJ2M4379584
Mileage (Read)	93,918 km
First registration	28 Jan 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	88 kW
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Quarz Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	7 Monat(e)
Last service on / at	03/2026 at 84,442 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF970095
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AKJ 00285		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,860 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R17 95H	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	215/50 R17 95H	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R16 89H	Winter tyres on Light alloy	Dunlop	4mm / 4mm
2)	195/60 R16 89H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (storage compartment in the instrument panel, driver's side; storage compartment in the center console; storage compartment in the front doors, suitable for 1.5-liter beverage bottles; storage compartment in the rear doors, suitable for 0.5-liter beverage bottles; 2 cup holders in the center console; lashing eyes in the luggage compartment; bag hooks, on the side in the luggage compartment)
- Electrically adjustable, heated and folding exterior mirrors for driver and passenger side (exterior mirror housing in black)
- Roof design line, above, in chrome
- Roof spoiler
- Tachometer
- Electronic brake force distribution (EBD)
- Electronic Stability Program (ESP Plus)
- Electric rear windows (one-touch function - anti-pinch protection - comfort closing function via remote control of the central locking system)
- Functional equipment (rear seats sliding in a 60:40 ratio - rear seat backrest, tilt-adjustable - rear center armrest with pass-through from the luggage compartment - luggage compartment floor, 2-way height-adjustable)
- Head-Up Display (projects speed, cruise control and limiter settings, traffic signs with speed limits, front collision warning and navigation into the driver's direct line of sight on request)
- Rear headrests (3) (height adjustable)
- Front headrests (height adjustable)
- LED ambient lighting (in the center console and in the front doors)
- LED daytime running lights
- Steering wheel: Leather steering wheel with chrome elements and steering wheel remote control
- Center armrest, front
- Fog light
- OpelConnect (with telematics services: - Emergency call/breakdown call - Vehicle status and information - Route and journey information, additionally with live navigation services, e.g.: - Real-time traffic information - Online POI search - Map updates (via USB))
- Upholstery: Alcantara trim (seat contact surfaces, seat cushions and door panels in Alcantara, headrests and outer seat cushions in premium leather look, ergonomic active seats (AGR), driver/front passenger (manually adjustable length, height and backrest angle, electrically adjustable seat angle, electro-reinforced lumbar support adjustable in height and length, manually adjustable thigh support, storage compartment with roller blind in the rear center console, 12V socket) Functional equipment (60:40 sliding rear seats, adjustable rear seat backrest angle, rear center armrest with pass-through, 3rd rear center headrest, 2-section luggage compartment floor)
- Tire pressure warning
- Wheels: Alloy wheels 6.5 J x 17 with tires 215/50 R17, in BiColor/Black (5 double spokes)
- Power steering (speed-dependent)
- Airbag for driver and front passenger side (front passenger airbag can be manually deactivated)
- Airbag: Front and rear outer head airbags
- Airbag: Side airbag for driver and front passenger side (side airbag, front passenger, deactivatable)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Armrest, driver
- Hill Start Assist
- On-board computer
- third brake light
- Roof rails, silver
- Diesel particulate filter (DPF) maintenance-free (exhaust aftertreatment via SCR (Selective Catalytic Reduction) catalyst with AdBlue (urea injection). Vehicles with BlueInjection technology require refilling of the AdBlue fluid between regular service intervals. A display in the vehicle informs the driver in good time when refilling is necessary.)
- Electric front windows (one-touch function - anti-pinch protection - comfort closing function via remote control of the central locking system)
- Speed controller with limiter
- Transmission: 6-speed automatic transmission
- Back window, heater
- rear window wiper
- Interior lighting (front and rear)
- Automatic climate control, two zones (with separate temperature control for driver and front passenger), recirculation mode, manual, automatic air distribution, sun position sensor, activated carbon filter)
- LED taillights
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and passenger
- Headlight range adjustment, manual
- Navigation system: Multimedia Navi Pro with 8" color touchscreen display, voice control for audio, telephone, and navigation (Bluetooth audio streaming, hands-free calling via Bluetooth interface, phonebook and call list display, FM/AM radio, Autostore, RDS-EON, automatic music recognition, image display via USB port, Apple CarPlay, Android Auto, text message reading and dictation, up to 10 mobile phones can be paired, navigation with integrated memory, European road map (including Russia and Turkey), 3D map display, dynamic route guidance, 2 USB ports, 3.5" color driver information display).
- Proactive driver assistance system (front collision warning with automatic emergency braking and pedestrian detection - drowsiness detection)
- Quickheat rapid heating system
- Radio: Digital radio reception DAB/DAB+/DMB-R (reception of digital radio stations - reception of digital traffic information (TPEG))



- Visibility equipment (rain sensor, front - automatic dimming headlights with tunnel detection - interior rearview mirror, automatically dimming - illuminated make-up mirrors in both sun visors - reading lights, rear - high beam assist)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- Lane departure warning (warning in case of unintentional lane departure from 60 km/h via warning tone and indicator light in the driver information display)
- 12V power outlet in the center console
- Traction control (TC Plus)
- Underride protection look, front and rear, in silver
- Pre-installation for child seat restraint system "ISOFIX" (incl. top tether attachment points, rear outer)
- Immobiliser
- Heated windscreen, ThermoTec
- Central locking with remote control (and interior switch)

- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Keyless locking and starting system (for driver and passenger doors as well as the luggage compartment)
- Seat belts: Three-point seat belts in all seats (belt force limiter, front and rear outer seats - Double belt tensioners, front seats - Belt tensioners, rear outer seats - Warning tone and light for unfastened seat belts, front and rear seats)
- Seats: Seat backrest split 60:40, foldable (and sliding, tilt-adjustable - with center armrest, rear, - with load-through option from the luggage compartment - luggage compartment floor adjustable to 2 different heights)
- Start/Stop system (reinforced starter motor - high-performance battery - switch to deactivate the start/stop function)
- Traffic sign assistant (recognition of speed limits and their cancellation, as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions))
- Heat-insulating glazing, tinted

Extra equipment

- IntelliGrip
- LED headlights
- Radio accessories: Premium Sound System (6 speakers, 1 subwoofer box in the luggage compartment)
- Wheels: Alloy wheels 6.5 J x 17 with all-weather tires 215/50 R17, BiColor/Black (5 double spokes)

- Paint finish: Metallic
- Panoramic sunroof (electrically operated sunshade roller blind, roof rails in silver)
- Wheels: Alloy wheels 6.5 J x 17 with all-weather tires 215/50 R17, black (5 double spokes)
- Wheels: Alloy wheels 6.5 J x 17 with tires 215/50 R17, in black (5 double spokes)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Trim / covers	Cargo area - lining - right side - Scratch(es) - Loss in value
3	Body	Body - Glued / labelled - De-glue / neutralise
4	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
5	Rear bumper	Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value
6	Door - front left side	Door (Zierleiste unten, verfärbt) - Paint defect - Replace



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Roof	Roof (Dachkante) - Stone chips - No deduction
3	Headlight	Headlight - right side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 29 Jul 2025	3.806,44 €

Repainting

No.	Repainting
1	Side panel - rear left side, Professionally carried out
2	Door - rear left side, Professionally carried out
3	Door - front left side, Professionally carried out

Paint coat thickness measurement

Side panel - rear left side	163 µm	Door - rear left side	168 µm
Door - front left side	181 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

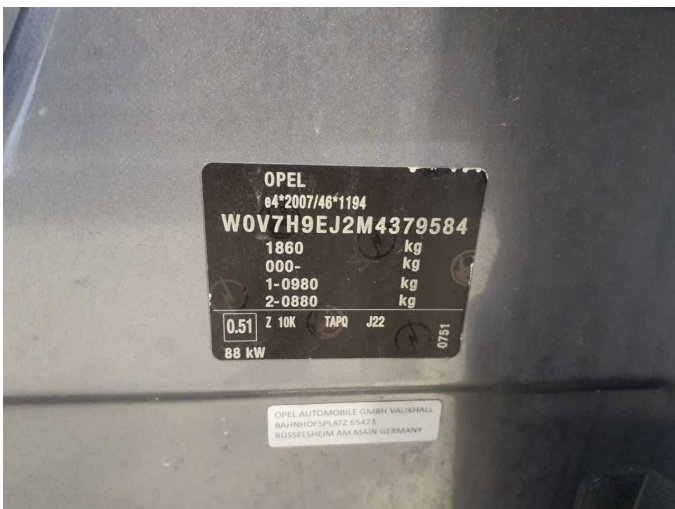


Figure 11: VIN



Figure 12: Mounted tyres

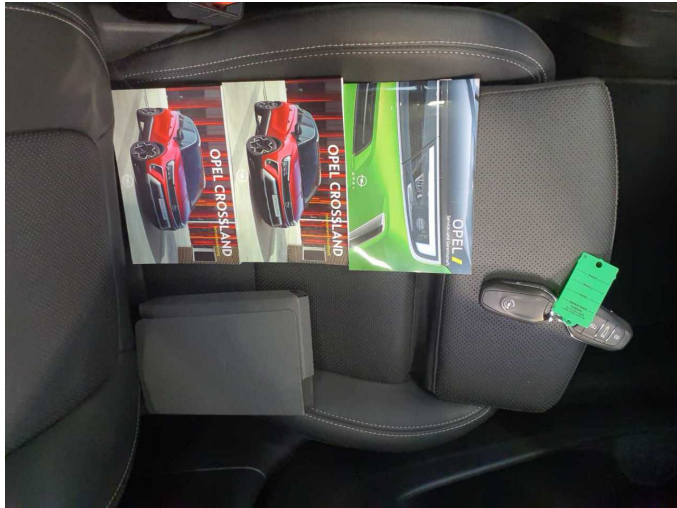


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres

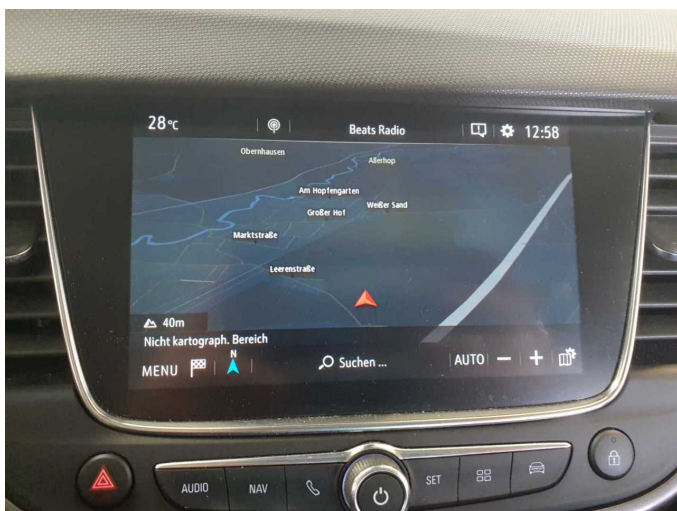


Figure 17: Navigation

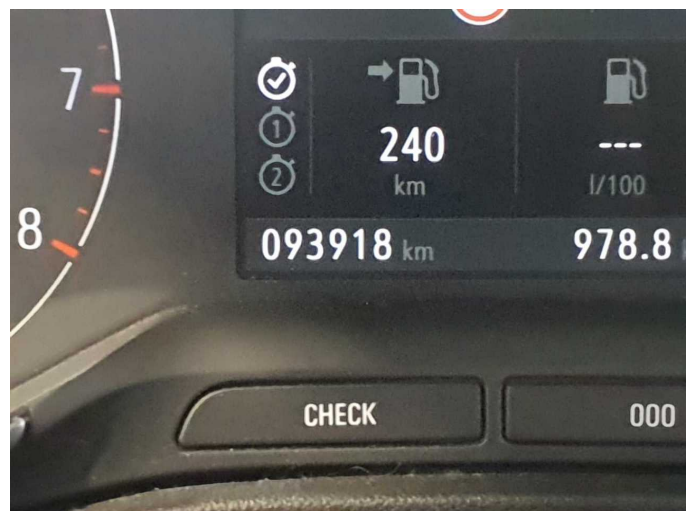


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

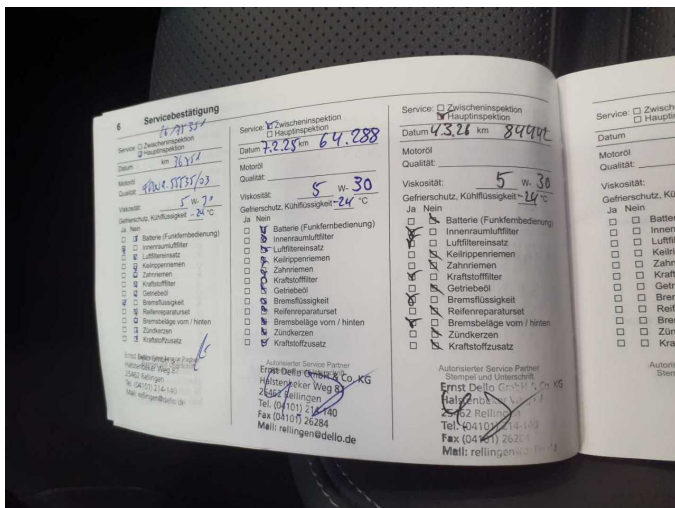


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

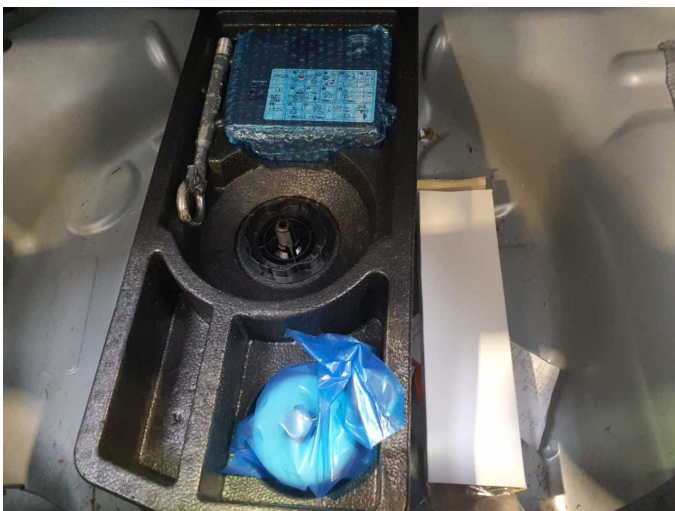


Figure 29: Misc.




Figure 30: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Trim / covers: Cargo area - lining - right side - Scratch(es) - Loss in value

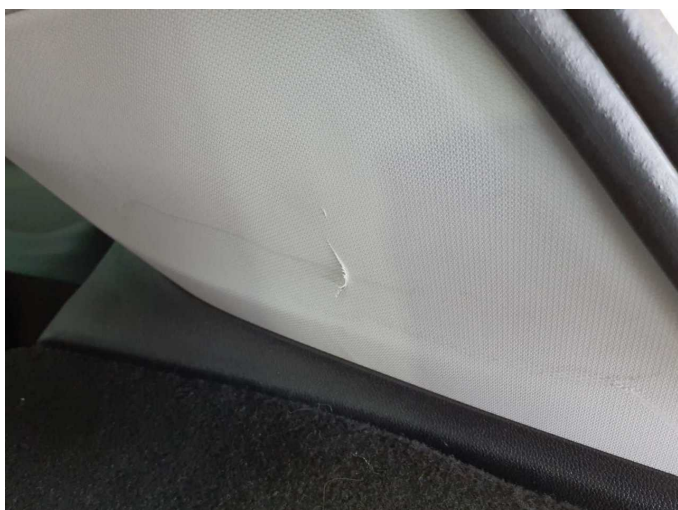

Damage 2: Trim / covers: Cargo area - lining - right side - Scratch(es) - Loss in value



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

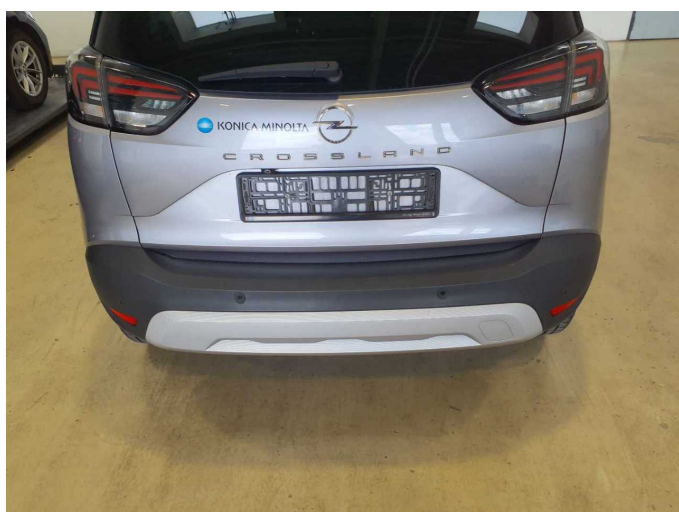

Damage 5: Rear bumper: Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value



Damage 5: Rear bumper: Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value




Damage 5: Rear bumper: Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value



Damage 5: Rear bumper: Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value



Damage 5: Rear bumper: Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value

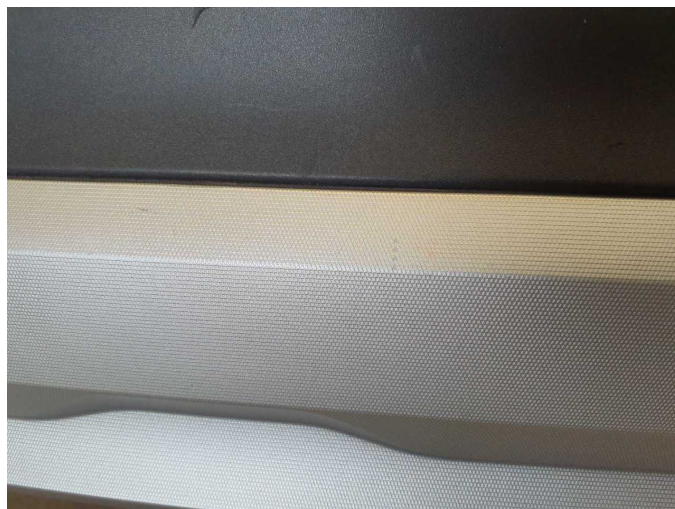

Damage 5: Rear bumper: Rear bumper (Zusätzlich Spoiler Kratzer) - Scratch(es) - Loss in value



Damage 6: Door - front left side: Door (Zierleiste unten, verfärbt) - Paint defect - Replace



Damage 6: Door - front left side: Door (Zierleiste unten, verfärbt) - Paint defect - Replace



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 2: Door - rear left side



Repainting 2: Door - rear left side



Repainting 3: Door - front left side



Repainting 3: Door - front left side