



Expertise

Protocol number: 46727947
Order No. / Reference: 26663459
Inspection date: 27 Jul 2026

Manufacturer: Opel	Model: Astra 1.5 D Start/Stop Sports Tourer Automatik Edition
VIN: W0VBD8EV9N8042861	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra 1.5 D Start/Stop Sports Tourer Automatik Edition	
Vehicle Identification number	W0VBD8EV9N8042861
Mileage (Read)	167,986 km
First registration	7 Jun 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,496 ccm / 3
Power	90 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Silver metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17 %
Last service on / at	01/2026 at 152,180 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ665636
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / ALL 00261		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	205/55 R16 91V	Summer tyres on Steel rim with wheel cover	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • 2 ignition keys • Airbag for driver and passenger side • Airbag: Head airbags, 1st and 2nd row (outer seats) • Anti-lock braking system (ABS) • Electrically adjustable and heated exterior mirrors for driver and passenger side • third brake light • black roof rails • Diesel particulate filter (DPF) • Electronic Stability Program Plus (ESP Plus) • Speed controller with limiter • Back window, heater • Interior lighting, front and rear • Air conditioning • trunk light • Front headrests • LED daytime running lights • Steering column, height and reach adjustable • Sliding center armrest, front • Pedals: Disengaging safety pedals • Quickheat rapid heating system • Radio: Multimedia radio with 7" touchscreen color display • Tire pressure monitoring system • Rear seat backrest folds forward in a 60:40 split • Seat belts: Three-point seat belts in all seats • Visibility equipment • Start/Stop System • Traction Control (TC) Plus • Immobiliser • Central locking with remote control and interior switches | <ul style="list-style-type: none"> • Storage compartments • Airbag: Chest-pelvis side airbag for driver and front passenger side • Automatic activation of the hazard warning lights • Hill Start Assist • On-board computer • Roof design line, above in black • Decorative trim strips Antelao Sand/Polar Silver • Tachometer • Electric windows front and rear • Transmission: 9-speed automatic transmission • rear window wiper • Instruments, black, with high-gloss chrome rings, 3.5" driver information display • Rear headrests (3) • Cargo area cover • Steering wheel: Leather steering wheel • Lighting equipment • Parkpilot, rear parking aid • Upholstery: Cloth • Radio: Digital radio reception DAB/DAB+/DMB-R • Tire repair kit • Wheels: Designer wheels, 7 J x 16 with tires 205/55 R16 • Power steering • Luggage compartment safety net • Seats: Comfort seats, front • 12V power outlet in the center console • Pre-installation for child seat mounting system "ISOFIX" • Heat-insulating glazing, green tinted, and windshield |
|---|---|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • LED headlights • Package: Premium Edition Package (Ergonomic active seat, certified by the Campaign for Healthy Backs (AGR), driver - Two-zone automatic climate control - Solar Protect heat-insulating glazing in the rear) | <ul style="list-style-type: none"> • Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including rear footwell heating) • Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards) |
|--|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Empty - Replace
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Mudguard - left side	Mudguard - left side - Stone chips - Smart repair
4	Door - front left side	Door edge - Scratch(es) - Smart repair
5	Side panel - rear right side	Side panel (3x) - dent(s) - Smooth repair work
6	Rear of vehicle	Boot floor - Damaged - Replace
7	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
8	Front bumper	Front bumper - Scratch(es) - Paint
9	Door - front right side	Door - Scratch(es) - Paint
10	Bonnet	Bonnet - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Mudguard - right side	Mudguard - right side - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Door - rear left side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Separation net

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

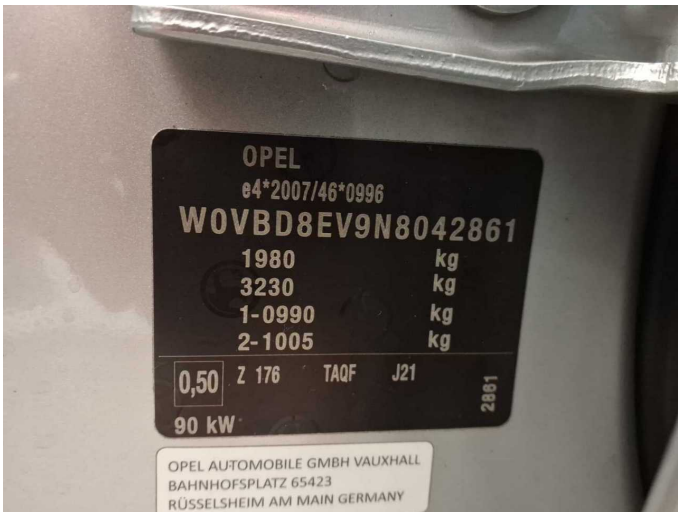


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

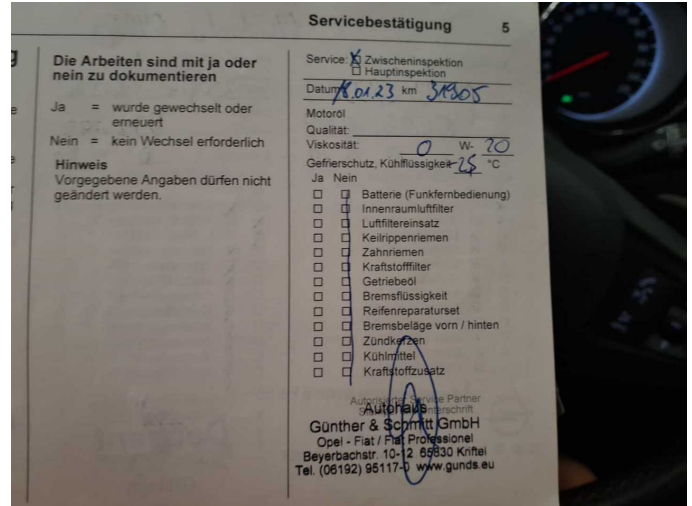


Figure 14: Documents

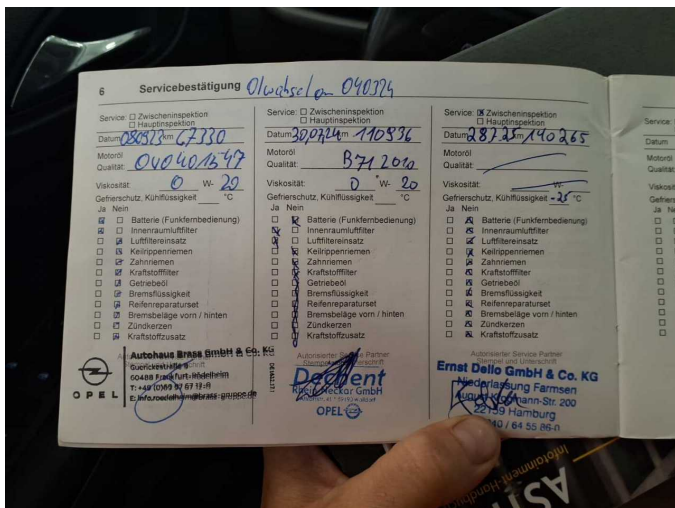


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 1: Equipment: Tirefit filler - Empty - Replace



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 3: Mudguard - left side: Mudguard - left side - Stone chips - Smart repair



Damage 3: Mudguard - left side: Mudguard - left side - Stone chips - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair

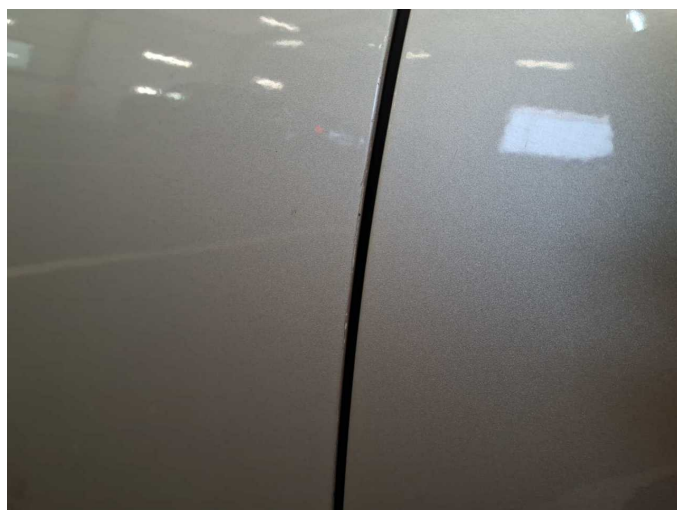

Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 5: Side panel - rear right side: Side panel (3x) - dent(s) - Smooth repair work



Damage 5: Side panel - rear right side: Side panel (3x) - dent(s) - Smooth repair work

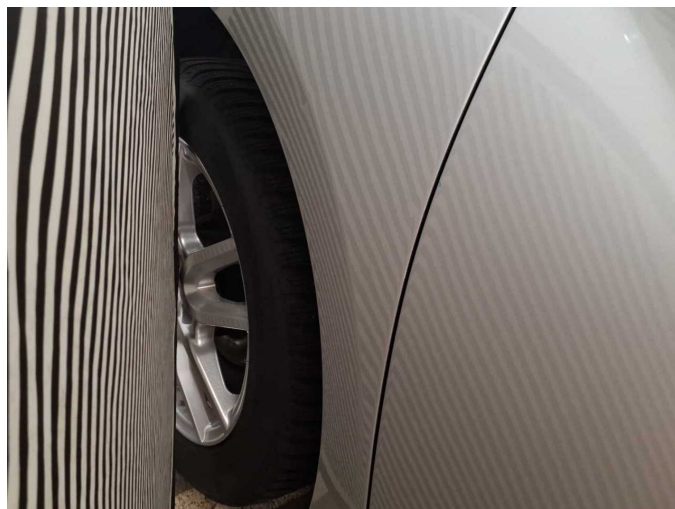

Damage 5: Side panel - rear right side: Side panel (3x) - dent(s) - Smooth repair work



Damage 6: Rear of vehicle: Boot floor - Damaged - Replace




Damage 6: Rear of vehicle: Boot floor - Damaged - Replace



Damage 6: Rear of vehicle: Boot floor - Damaged - Replace



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

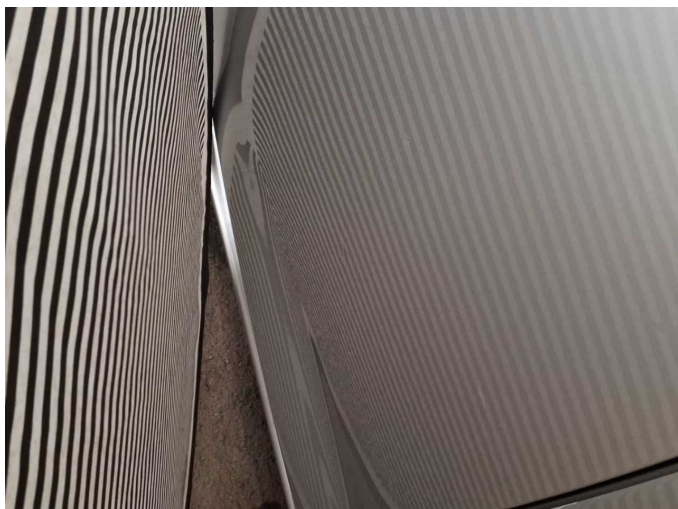

Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 8: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Front bumper: Front bumper - Scratch(es) - Paint




Damage 8: Front bumper: Front bumper - Scratch(es) - Paint



Damage 9: Door - front right side: Door - Scratch(es) - Paint




Damage 9: Door - front right side: Door - Scratch(es) - Paint

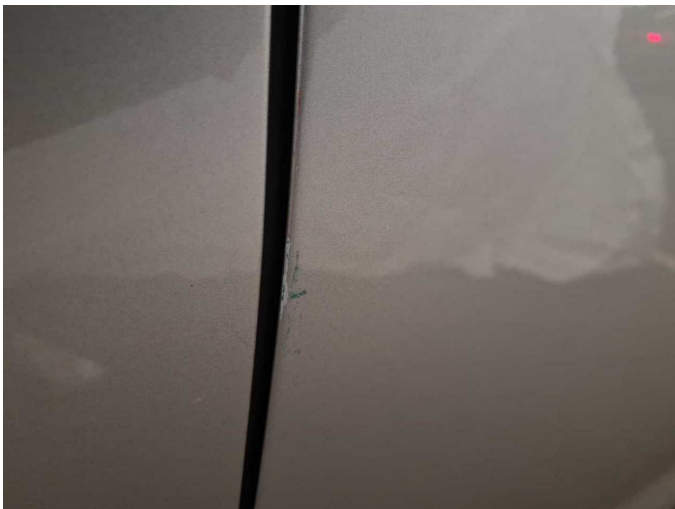

Damage 9: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Bonnet: Bonnet - Scratch(es) - Paint

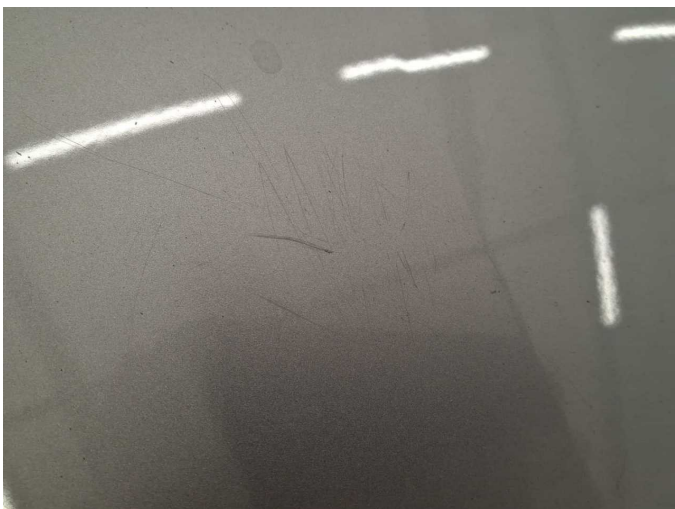

Damage 10: Bonnet: Bonnet - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBD8EV9N8042861

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Automatik Edition

Datum	KM-Stand	Beschreibung
06.01.2026	152.180	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.07.2025	140.265	Regelwartungsdienst
12.06.2025	133.024	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze v; Bremsscheiben vorne; HU + AU; Systemtest/Eigendiagnose
13.05.2025	132.729	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
31.01.2025	119.476	Ladeluftschlauch ern; Systemtest/Eigendiagnose
20.12.2024	117.361	Motor ern; Reparatur Sonstiges
28.08.2024	117.361	Getriebeöl ern/prüfen; Motor ern; Motoröl b. Wartung; Reparatur Sonstiges; Systemtest/Eigendiagnose
30.07.2024	110.936	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
04.03.2024	89.650	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.09.2023	67.330	Bremsinspektion vo + hi; Bremse Sonstiges; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.01.2023	31.905	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges