



Expertise

Protocol number: 46303373
Order No. / Reference: 26645603
Inspection date: 3 Jul 2026

Manufacturer: Ford

Model: Transit Connect 210 L2 S&S Trend

VIN: WF0SXXWPGSNL56774



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect 210 L2 S&S Trend

Vehicle Identification number	WF0SXXWPGSNL56774
Mileage (Read)	89,847 km
First registration	14 Mar 2022
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	

Power / Engine displacement	73 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frozen White
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 %
Last service on / at	07/2025 at 59,742 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH421653
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BUU 00725		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Semperit	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	3mm / 2mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, electrically adjustable and heated
- Battery, reinforced
- Rubberized flooring, front
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Ford Easy Fuel
- Heated windshield
- Transmission: 6-speed transmission
- Glove compartment with lid
- Front air conditioning including semi-electronic recirculation system
- Cargo area lining, side, half-height
- Alternator/Generator
- Fog light
- Wheels: Tire repair kit
- Sliding door at rear, right
- Side protection strips, plastic
- Safety brake assist
- Automatic door locking mechanism (45 sec.)
- Start-stop system
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection in storage compartment on dashboard (driver's side)
- Daytime running light
- Child safety lock on sliding doors
- Electronic immobilizer (EPATS)
- Central locking with remote control
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Hill start assist
- On-board computer including outside temperature display
- Double-leaf rear doors without windows
- Third brake light
- Front electric windows
- FordPass Connect
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Front interior lighting with delay function
- Paint finish: Solid
- Cargo area floor protection plastic, molded
- Steering column, adjustable in height and reach
- Center console, front
- Emergency brake light
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering
- Front seat belts are height-adjustable
- Front spoiler lip
- Dust and pollen filter
- Power outlet: 12-volt connection on the front center console
- Front bumper and rear bumper end caps painted in body color
- Partition wall to the cargo area without window
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front

Extra equipment

- Airbag: Front airbag for passenger
- Cargo area lighting, LED
- DPF regenerator, manual
- Floor covering: FIDAE all-weather floor mats at the front
- Floor covering: Front floor mats, all-weather floor mats (2-piece set)
- Front and rear parking pilot system
- Partition wall to the cargo area with pass-through opening, no window
- Radio: Ford Audio System 10 (Ford SYNC 3 with AppLink, 6" touchscreen radio, DAB/DAB+, 2 USB ports, 4 front speakers, Bluetooth hands-free calling and audio streaming, Emergency Call Assistance, SMS text-to-speech/send function, audio remote control on the steering wheel, voice control for audio and telephony, Android Auto and Apple CarPlay support, 14 languages (graphical and audible), reversing camera including rear parking assist system, phase diversity antenna)
- Crosswind Assist and Roll Stability Control (RSC)
- Electrically adjustable and heated exterior mirrors with blind spot assist
- Package: Industry package Service Line AALA7
- Pre-Collision Assist, radar and camera based (with pedestrian and cyclist detection including Automatic Emergency Braking (AEB), Dynamic Brake Support (DBS), Forward Collision Warning (FCW), Lane Keeping Assist including Lane Departure Warning and Driver Alert System)
- Remote control: 2nd remote control key for central locking
- Seats: Seat Package 20 ("Capitol/City" fabric in Ebony (black) - Double passenger seat (with storage compartment under the smaller seat section), variably foldable and collapsible - Driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - Height-adjustable headrests - Manual lumbar support (driver's seat) - Airbag package (front airbag for passenger, front head/shoulder airbags, side airbags for driver and passenger) - Heated driver's seat - Seatbelt warning system for driver)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Wheel cover - rear right side - Scratched - Replace
2	Equipment	Tirefit filler - Due - Replace
3	Roof	Roof rail - right side - Stone chips - Smart repair
4	Body	Body - Glued / labelled - De-glue / neutralise
5	Boot lid / rear door	Rear door - right side - dent(s) - Smart repair
6	Body	Underbody panelling (Motor/Getriebe) - Leaking - Perform diagnosis
7	Door - front right side	Door - Dent / paintcoat damage - Smart repair
8	Rear bumper	Rear bumper (unpainted) - Scratched - Replace
9	Misc.	Inspection / maintenance - Due - Perform
10	Front bumper	Front bumper - Scratched - Repair and paint
11	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
3	2nd wheel set	2 tyres - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual

Equipment - Vehicle key with remote control

Repainting

No. Repainting

- 1 Roof, Professionally carried out

Paint coat thickness measurement

Roof 201 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

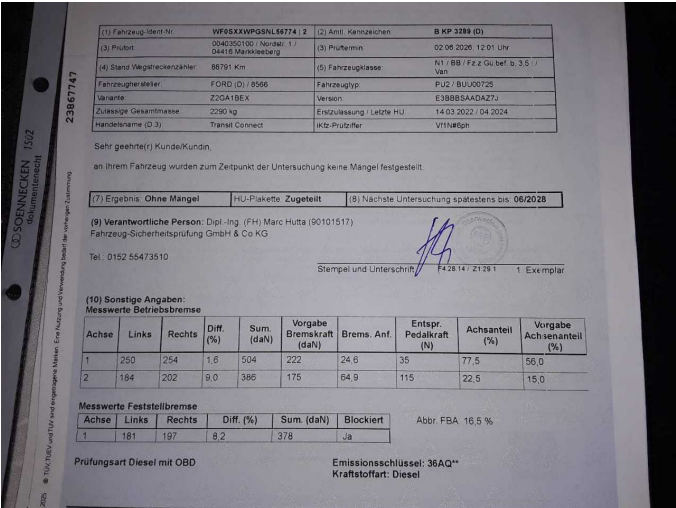


Figure 13: Documents

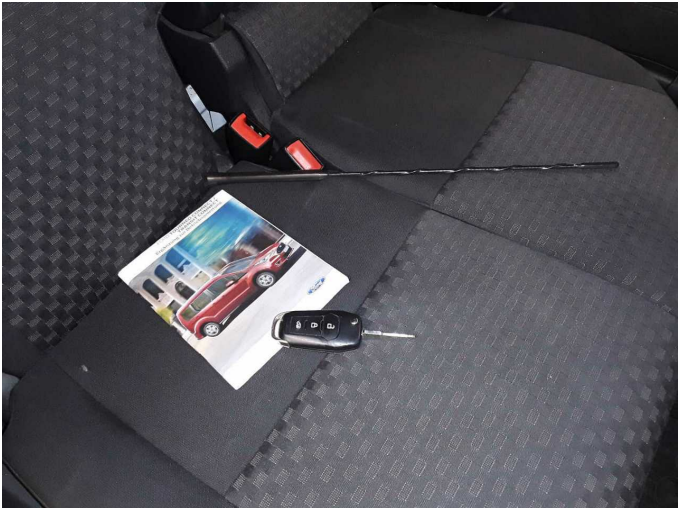


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

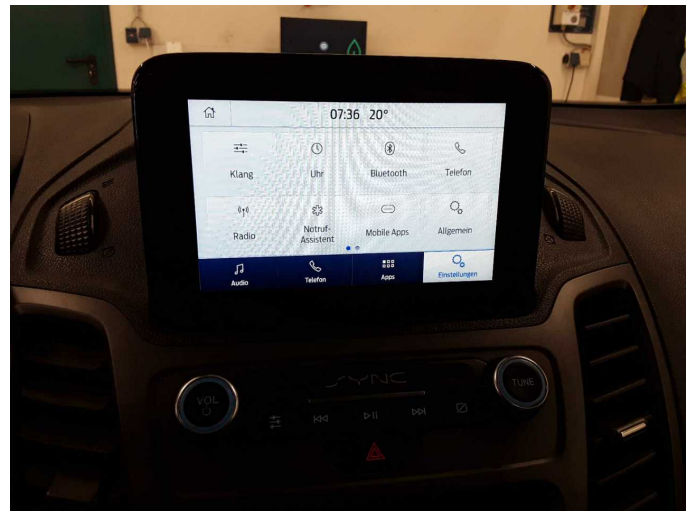


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

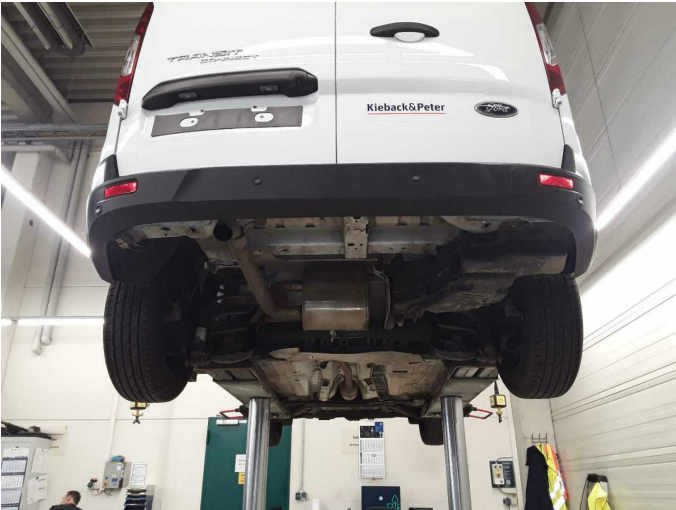


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

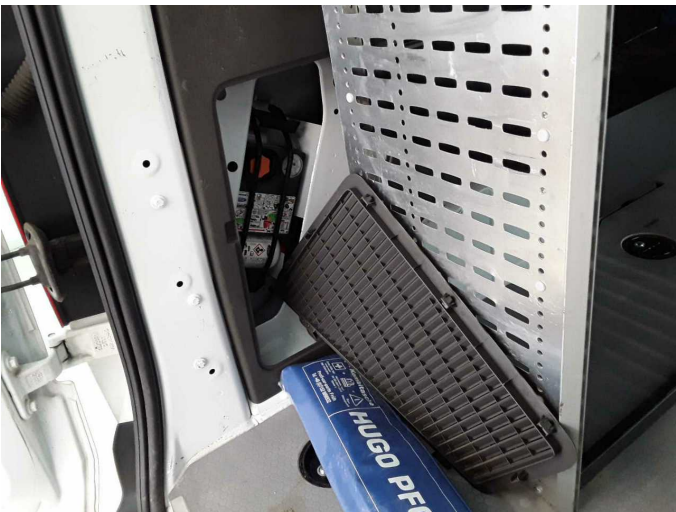


Figure 29: Misc.



Figure 30: Misc.



Damage 1: Wheel / tyres: Wheel cover - rear right side - Scratched - Replace



Damage 1: Wheel / tyres: Wheel cover - rear right side - Scratched - Replace



Damage 2: Equipment: Tirefit filler - Due - Replace



Damage 3: Roof: Roof rail - right side - Stone chips - Smart repair



Damage 3: Roof: Roof rail - right side - Stone chips - Smart repair



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Boot lid / rear door: Rear door - right side - dent(s) - Smart repair



Damage 5: Boot lid / rear door: Rear door - right side - dent(s) - Smart repair




Damage 6: Body: Underbody panelling (Motor/Getriebe) - Leaking - Perform diagnosis



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Smart repair

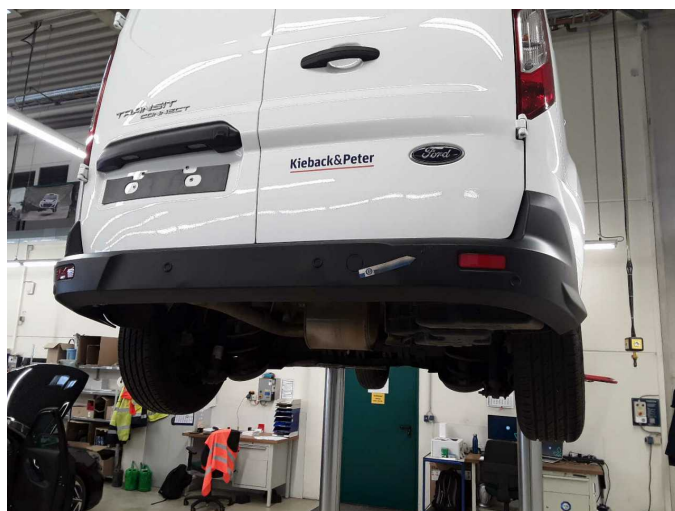

Damage 8: Rear bumper: Rear bumper (unpainted) - Scratched - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) - Scratched - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) - Scratched - Replace



Damage 9: Misc.: Inspection / maintenance - Due - Perform



Damage 9: Misc.: Inspection / maintenance - Due - Perform



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint




Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace

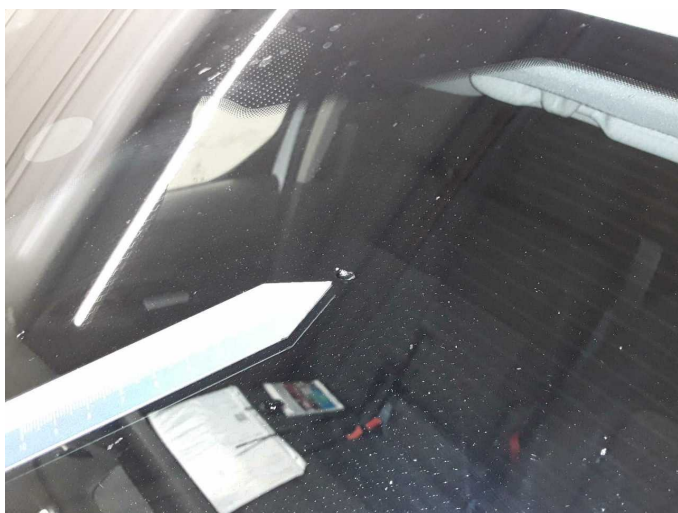

Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction




Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction

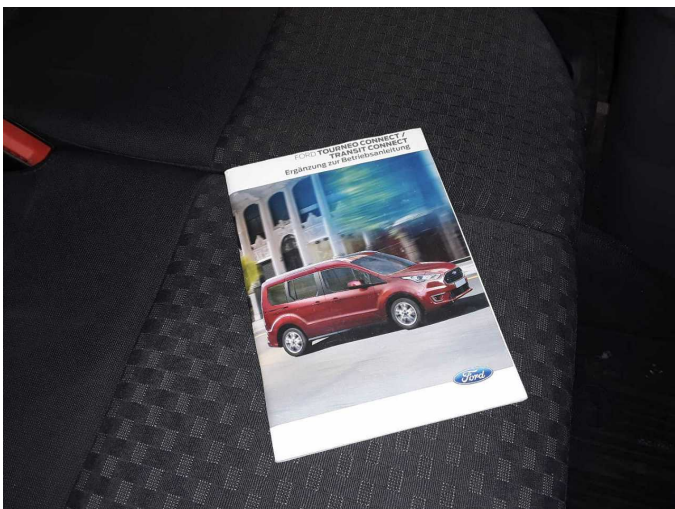

Missing part 1: Documents: Owner's manual - Missing - Replace



Roof: 201 µm



Roof: 201 µm



Roof: 201 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0SXXWPGSNL56774

Hersteller / Modell: FORD FORD Transit Connect 210 L2 S&S Trend

Datum	KM-Stand	Beschreibung
17.03.2026	80.545	Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
11.07.2025	59.742	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.06.2025	57.801	Druckschlauch Klima ern; Klimaanlage inst.
03.04.2024	31.106	AU
14.12.2023	29.981	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges