



Expertise

Protocol number: 46850927
Order No. / Reference: 26836657
Inspection date: 3 Aug 2026

Manufacturer: Toyota
VIN: YARECYHT2GJ019007

Model: Proace City Verso 1.5 D-4D L1 Shuttle



Vehicle details	
Manufacturer / Type / Model / Equipment	
Toyota Proace City Verso 1.5 D-4D L1 Shuttle	
Vehicle Identification number	YARECYHT2GJ019007
Mileage (Read)	183,401 km
First registration	21 Feb 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	75 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	ORANGE OCRE
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	21,760 km
Last service on / at	05/2026 at 175,178 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ408370
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	5013 / AOH 00318		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,120 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Pirelli	5mm / 5mm
2)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Semperit	1mm / 1mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Automatic low beam
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD) and brake assist BA)
- Hill Start Assist (HAC)
- Brake lights with LED technology
- Tachometer
- electric front windows
- Textile floor mats (in all rows of seats)
- Luggage compartment lighting
- Cruise control
- Tailgate with window
- rear window wiper
- air conditioning, manual
- Headrests: rear (3) height adjustable (second row of seats)
- Fatigue detection (Coffee Cup Alarm)
- Radio: Toyota ProTouch multimedia audio system (8" color monitor with touchscreen function - smartphone connectivity (Apple CarPlay/Android Auto TM/MirrorLink) - 6 speakers - hands-free system for mobile phones - USB/Bluetooth)
- Sliding door on the left, driver's side
- Sliding door, right
- Power steering
- Seats: 2nd row of seats foldable in a 40:60 ratio
- Seats: Passenger single seat
- Seats: Driver's seat height adjustable
- Stability control (S-VSC)
- 12V socket
- Daytime running light
- Toyota Safety Sense (Pre-Collision System with forward collision warning, emergency braking assist and autonomous emergency braking function as well as pedestrian detection, lane keeping assist with active steering support, emergency call assist)
- Airbags: 6 airbags (driver, passenger, side and head airbags)
- Electrically adjustable and heated exterior mirrors
- Brake Assist (BA)
- Diesel particulate filter
- Electronic Stability Control (VSC) including Traction Control (ASR)
- luggage compartment cover
- Speed limiter
- Transmission: 6-speed manual transmission
- Heated rear window
- Child lock, manual
- Front headrests (2), height adjustable
- Paint finish: Solid
- Steering wheel adjustable for height and reach
- Upholstery: Cloth
- Radio accessories: DAB/DAB+ (Digital Audio Broadcasting)
- Tire Pressure Monitoring System (TPWS)
- Tire repair kit
- Wheels: 16" steel rims (with 205/60 R16 92H tires, full wheel cover)
- Side protection painted in vehicle color
- Seat belts (3-point automatic on all seats, height-adjustable at the front - belt tensioners and belt force limiters at the front)
- Seats: ISOFIX child seat attachment
- Start-stop system
- Bumpers and door handles painted in body color
- 3.5-inch TFT display
- Traction control (TRC)
- Traffic Sign Recognition (RSA)
- Tie-down points 4 in the luggage compartment
- Electronic immobilizer
- Central locking with remote control

Extra equipment

- Navigation: Toyota ProTouch&Go navigation system (3D/2D navigation - DAB radio - WiFi - fog lights - rain sensor - audio controls integrated into the steering wheel)
- Package: Protection Package 2 (Load securing net - Underbody engine protection - Rear acoustic parking aid - Fog lights)
- Package: Comfort Package 1 (Comfort driver's seat with lumbar support and armrest - Heated driver and front passenger seats - Electric front windows with automatic up/down function and anti-pinch protection - Electric windows in the 2nd row of seats - Electric child safety locks for rear doors)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Roof	Roof rail - right side - dent(s) - Smooth repair work
3	Trim / covers	Boot lining - Scratch(es) - Loss in value
4	Bonnet	Bonnet (Matt) - Paint defect - Conditioning
5	Body	A-pillar - left side - Scratch(es) - Smart repair
6	Front bumper	Spoiler - Scratch(es) - Smart repair
7	Door - front right side	Brightware - lower - Scratch(es) - Smart repair
8	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
9	Body	Underbody panelling - Broken / torn - Replace
10	Sill - right side	Sill - Deformed - Smart repair
11	Sill - left side	Sill - Deformed - Smart repair
12	Sliding door, right	Sliding door - Dent / paintcoat damage - Smart repair
13	Body	Body - Glued / labelled - De-glue / neutralise
14	Interior	Boot cover / roller cover (unfachmännisch repariert) - Differs from the original configuration - Replace
15	Rear bumper	Rear bumper - Scratch(es) - Paint
16	Vehicle glazing	Windscreen - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Seat - rear	Back seat (Sitz schöner) - Differs from the original configuration - No deduction
2	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
3	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
4	Wheel / tyres	Wheel cover - front left side - Scratch(es) - No deduction
5	Vehicle glazing	Rear window - Scratch(es) - No deduction
6	2nd wheel set	2 tyres (gehören nicht zur Ausstattung) - Worn - No deduction
7	Equipment	Vehicle key (Startet nicht mit dem Schlüssel, nur f. Kofferraum) - Functional / admissibility - No deduction
8	Wheel / tyres	Wheel cover - rear right side - Scratch(es) - No deduction
9	Seat - front	Seat cover - left side - Scratch(es) - No deduction
10	Trim / covers	Floor mats - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

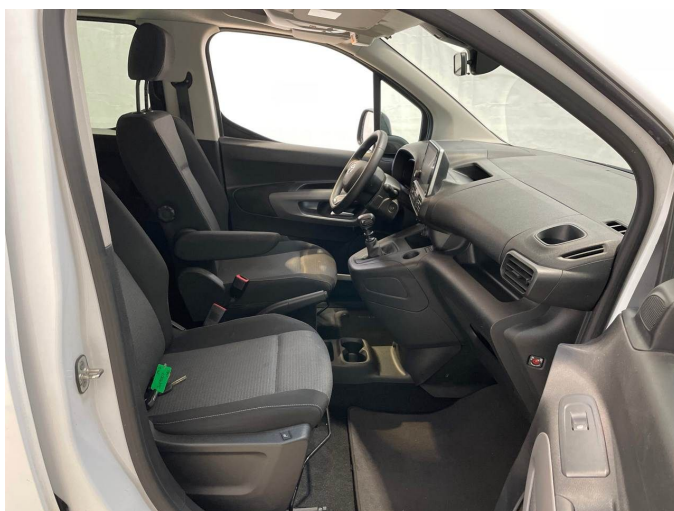


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

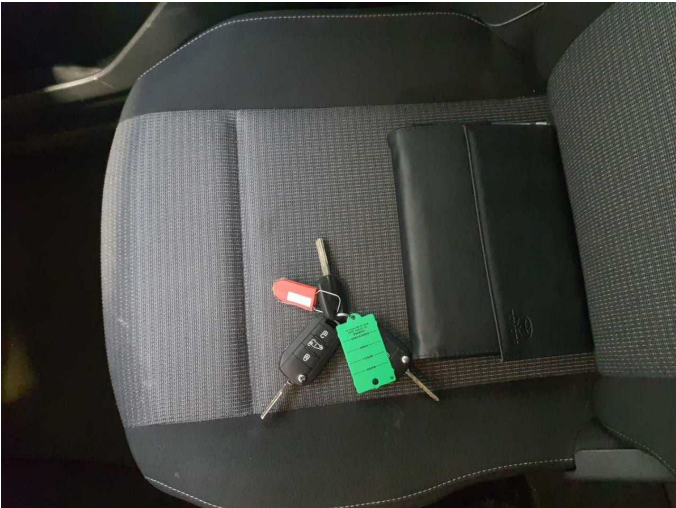


Figure 13: Documents

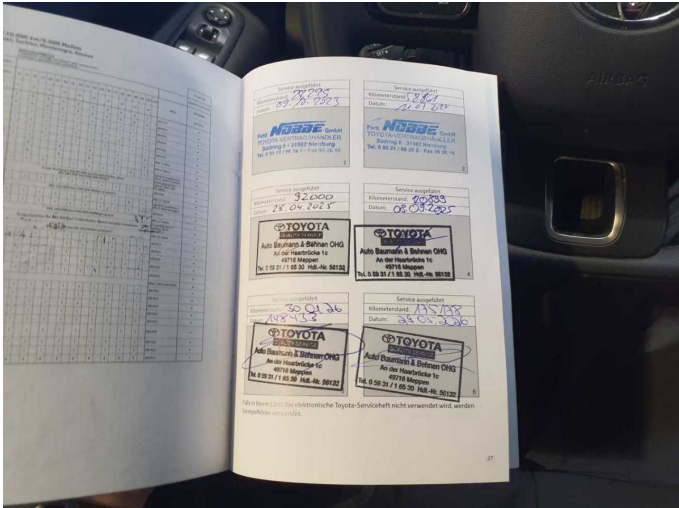


Figure 14: Documents

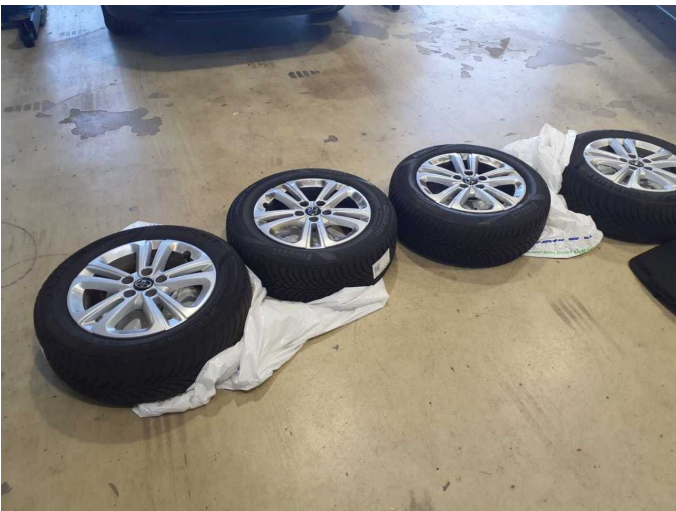


Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

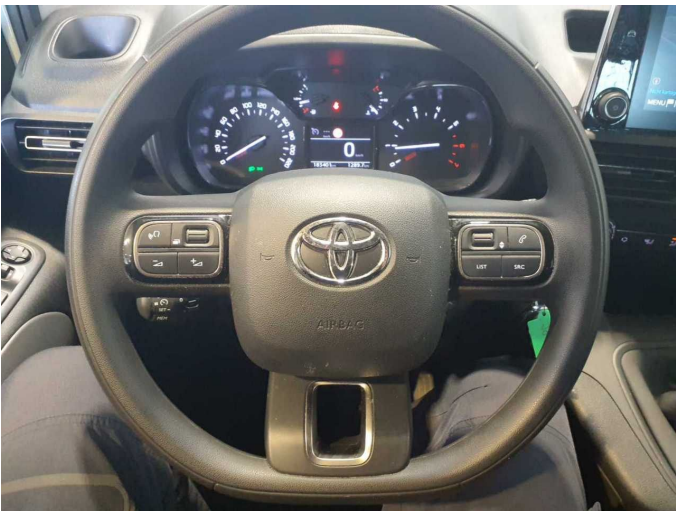


Figure 21: Misc.

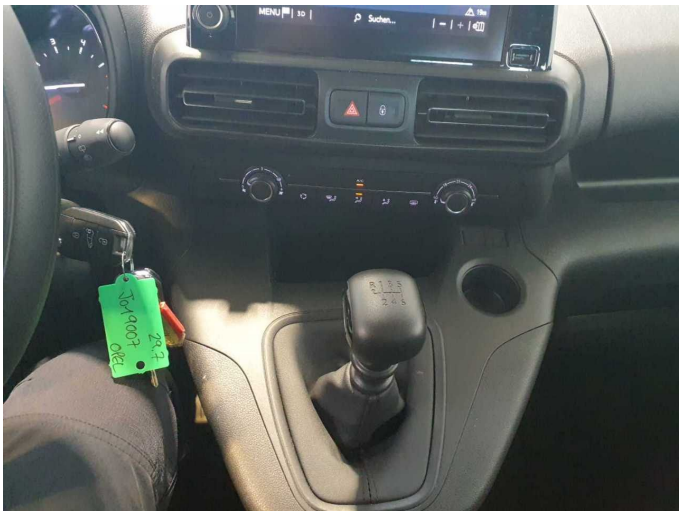


Figure 22: Misc.



Figure 23: Misc.

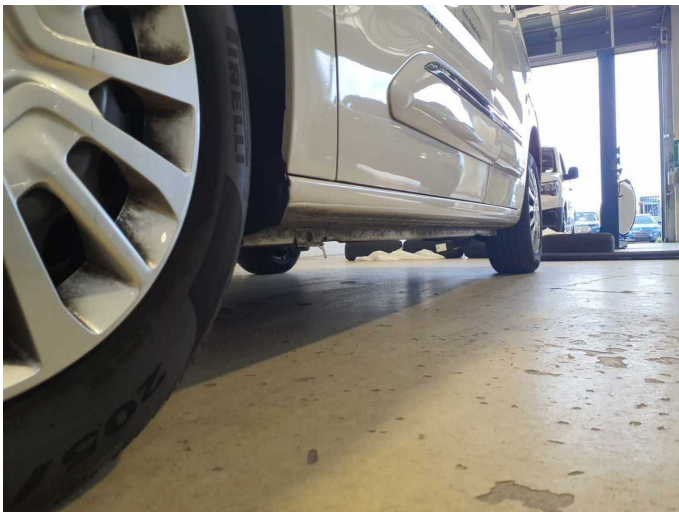


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

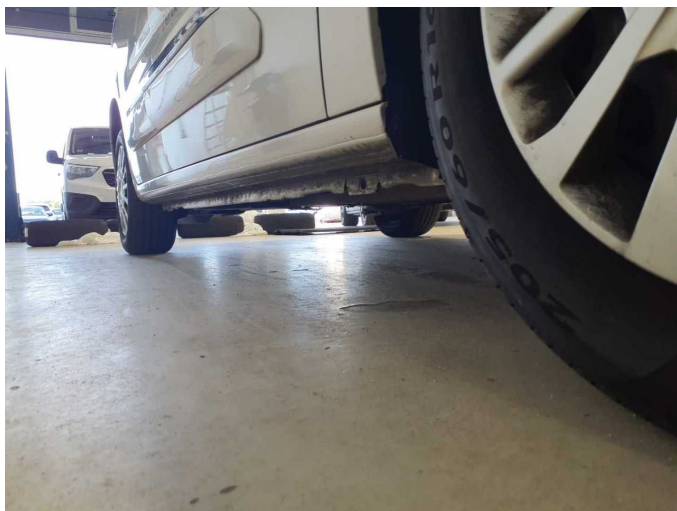


Figure 27: Misc.



Figure 28: Misc.

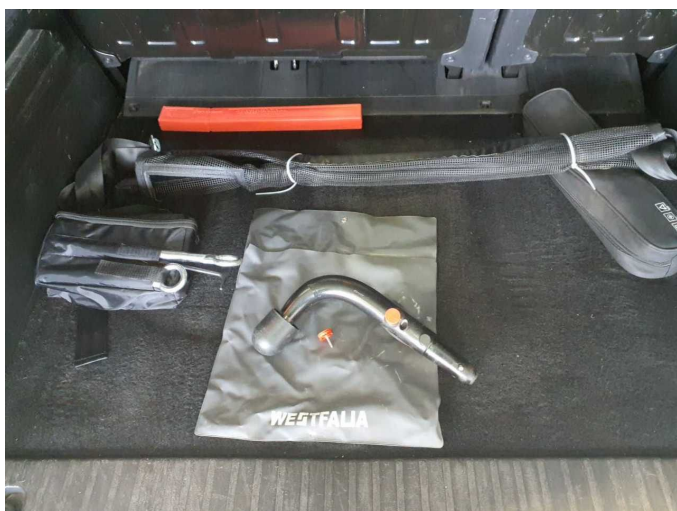


Figure 29: Misc.



Figure 30: Misc.



Damage 2: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 2: Roof: Roof rail - right side - dent(s) - Smooth repair work




Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value




Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value



Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value

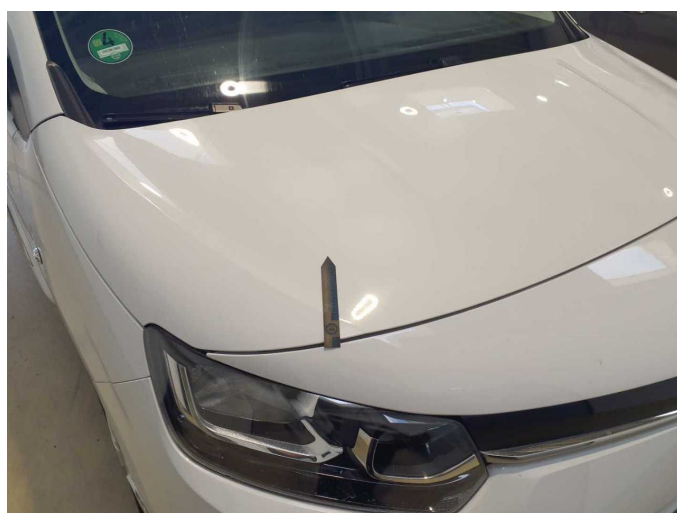

Damage 4: Bonnet: Bonnet (Matt) - Paint defect - Conditioning

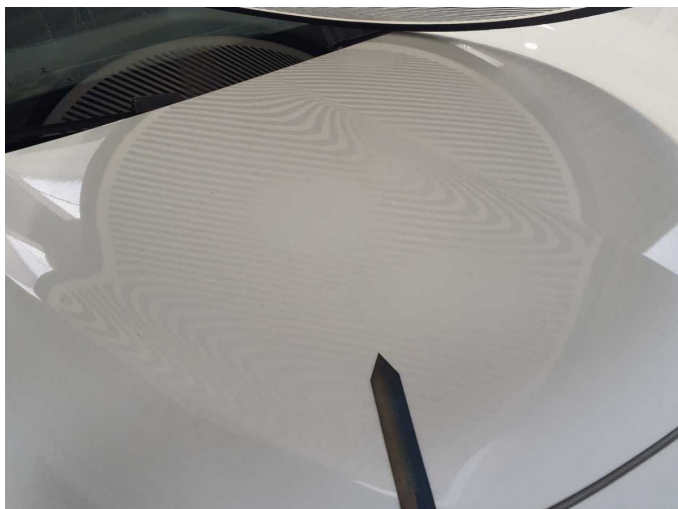


Damage 4: Bonnet: Bonnet (Matt) - Paint defect - Conditioning



Damage 5: Body: A-pillar - left side - Scratch(es) - Smart repair



Damage 5: Body: A-pillar - left side - Scratch(es) - Smart repair

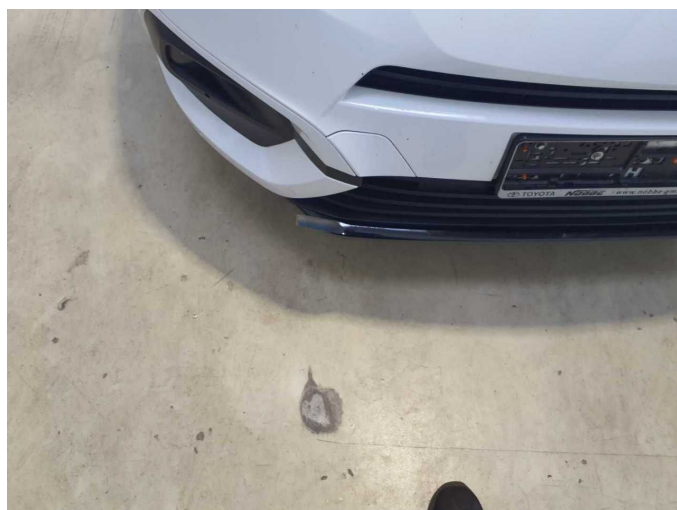

Damage 6: Front bumper: Spoiler - Scratch(es) - Smart repair




Damage 6: Front bumper: Spoiler - Scratch(es) - Smart repair




Damage 7: Door - front right side: Brightware - lower - Scratch(es) - Smart repair




Damage 7: Door - front right side: Brightware - lower - Scratch(es) - Smart repair

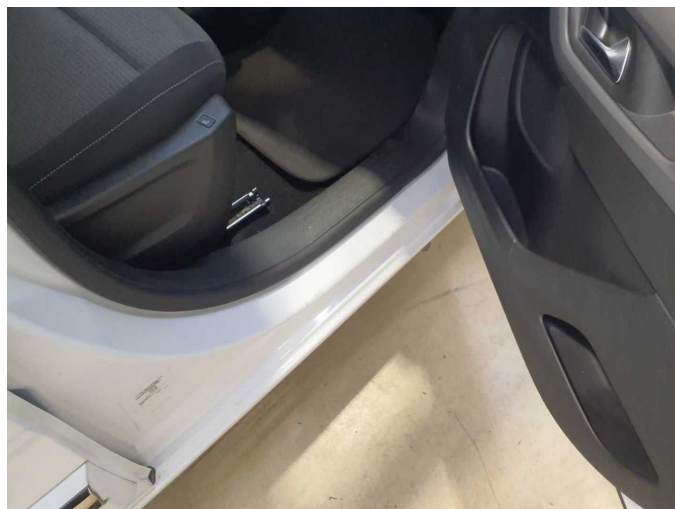

Damage 8: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

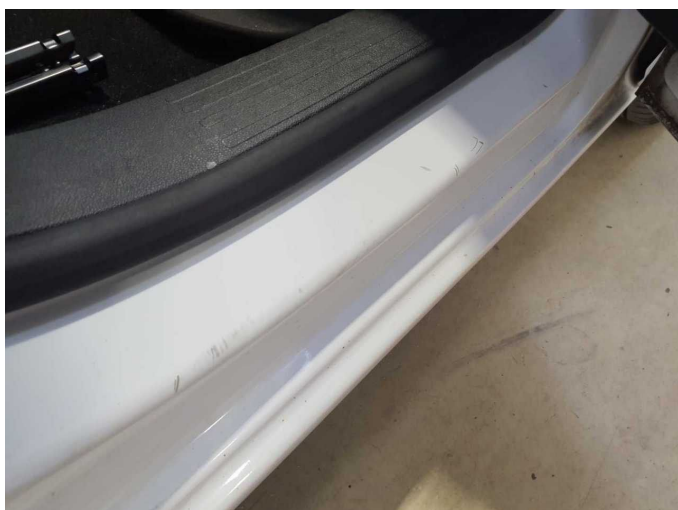

Damage 8: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

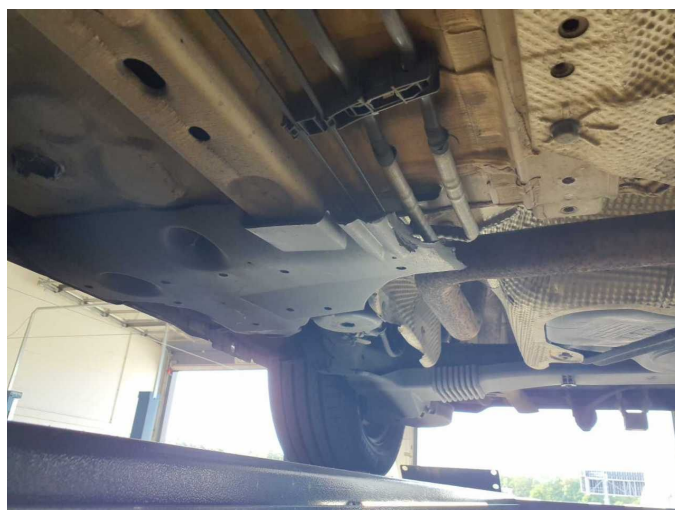

Damage 9: Body: Underbody panelling - Broken / torn - Replace



Damage 9: Body: Underbody panelling - Broken / torn - Replace



Damage 10: Sill - right side: Sill - Deformed - Smart repair



Damage 10: Sill - right side: Sill - Deformed - Smart repair



Damage 10: Sill - right side: Sill - Deformed - Smart repair



Damage 11: Sill - left side: Sill - Deformed - Smart repair




Damage 11: Sill - left side: Sill - Deformed - Smart repair



Damage 12: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair



Damage 12: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair

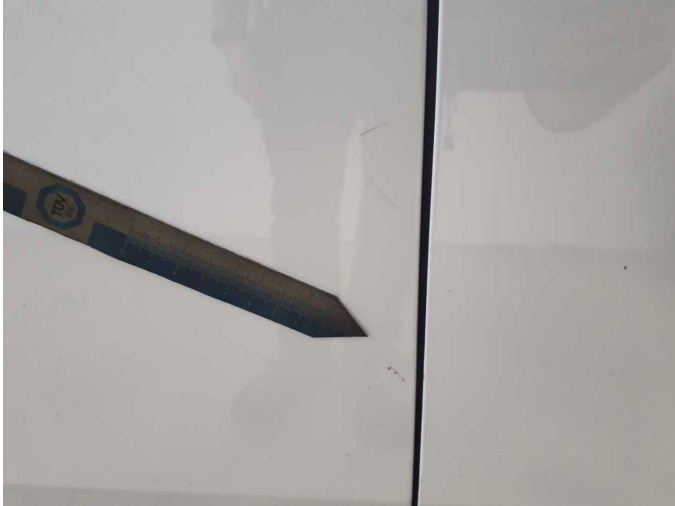

Damage 12: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair



Damage 13: Body: Body - Glued / labelled - De-glue / neutralise




Damage 13: Body: Body - Glued / labelled - De-glue / neutralise



Damage 14: Interior: Boot cover / roller cover (unfachmännisch repariert) - Differs from the original configuration - Replace



Damage 14: Interior: Boot cover / roller cover (unfachmännisch repariert) - Differs from the original configuration - Replace

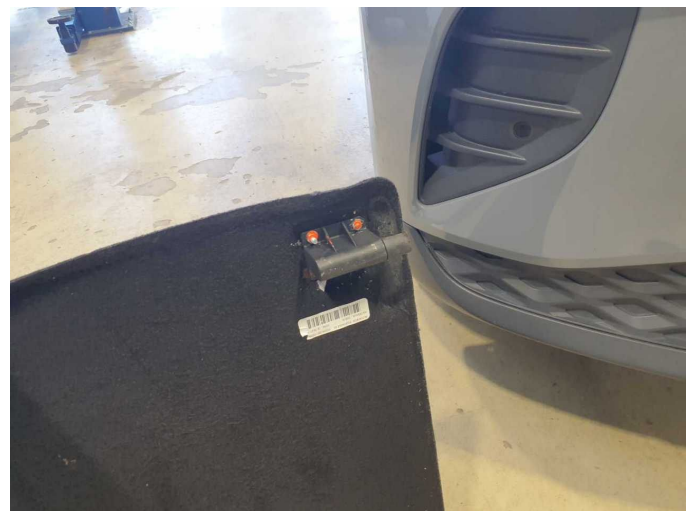

Damage 14: Interior: Boot cover / roller cover (unfachmännisch repariert) - Differs from the original configuration - Replace



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 16: Vehicle glazing: Windscreen - Scratched - Replace



Damage 16: Vehicle glazing: Windscreen - Scratched - Replace




Wear and tear 2: Trim / covers: Boot lid - interior trim - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 2 tyres (gehören nicht zur Ausstattung) - Worn - No deduction



Wear and tear 6: 2nd wheel set: 2 tyres (gehören nicht zur Ausstattung) - Worn - No deduction

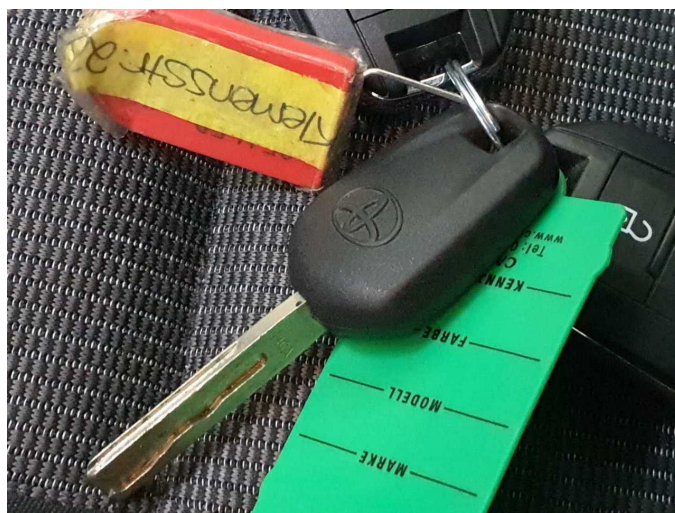

Wear and tear 7: Equipment: Vehicle key (Startet nicht mit dem Schlüssel, nur f. Kofferraum) - Functional / admissibility - No deduction




Wear and tear 8: Wheel / tyres: Wheel cover - rear right side - Scratch(es) - No deduction




Wear and tear 8: Wheel / tyres: Wheel cover - rear right side - Scratch(es) - No deduction



Wear and tear 9: Seat - front: Seat cover - left side - Scratch(es) - No deduction

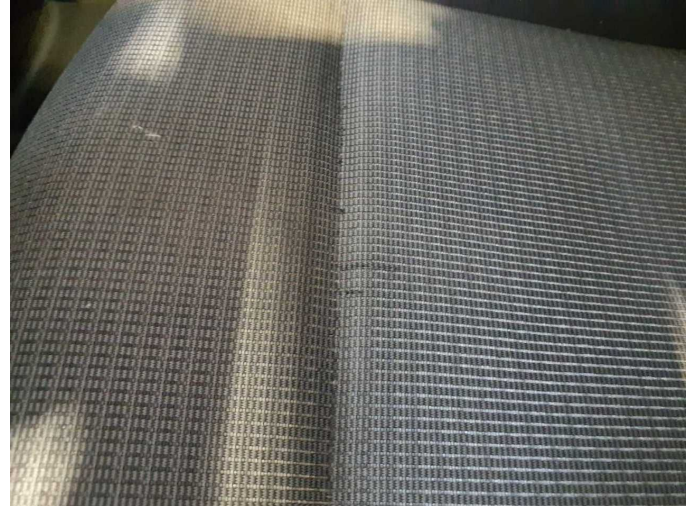

Wear and tear 9: Seat - front: Seat cover - left side - Scratch(es) - No deduction

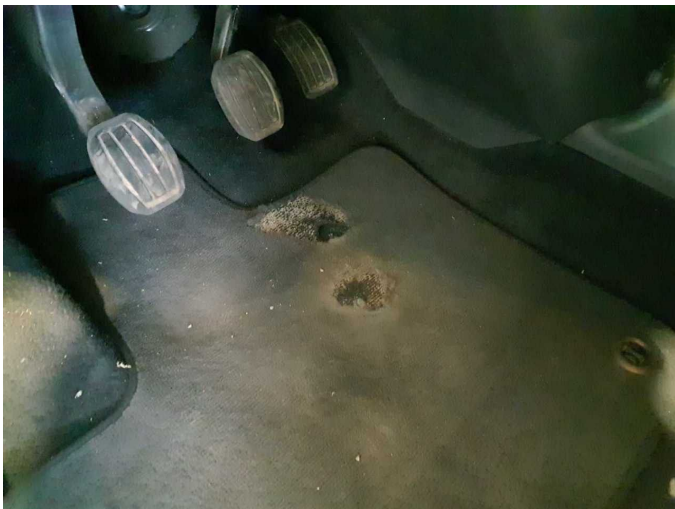

Wear and tear 10: Trim / covers: Floor mats - Broken / torn - No deduction