



Expertise

Protocol number: 46907980
Order No. / Reference: 26811263
Inspection date: 4 Aug 2026

Manufacturer: Toyota
VIN: YARECYHT2GJ018815

Model: Proace City Verso 1.5 D-4D L1 Shuttle



Vehicle details	
Manufacturer / Type / Model / Equipment	
Toyota Proace City Verso 1.5 D-4D L1 Shuttle	
Vehicle Identification number	YARECYHT2GJ018815
Mileage (Read)	185,991 km
First registration	21 Feb 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 3
Power	75 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	ORANGE OCRE
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,200 km
Last service on / at	09/2025 at 151,529 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS896778
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	5013 / AOH 00319		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,120 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Steel rim with wheel cover	Dunlop	3mm / 3mm
2)	205/60 R16 96V	Summer tyres on Steel rim with wheel cover	Dunlop	2mm / 2mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Fulda	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Automatic low beam
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD) and brake assist BA)
- Hill Start Assist (HAC)
- Brake lights with LED technology
- Tachometer
- electric front windows
- Textile floor mats (in all rows of seats)
- Luggage compartment lighting
- Cruise control
- Tailgate with window
- rear window wiper
- air conditioning, manual
- Headrests: rear (3) height adjustable (second row of seats)
- Fatigue detection (Coffee Cup Alarm)
- Radio: Toyota ProTouch multimedia audio system (8" color monitor with touchscreen function - smartphone connectivity (Apple CarPlay/Android Auto TM/MirrorLink) - 6 speakers - hands-free system for mobile phones - USB/Bluetooth)
- Sliding door on the left, driver's side
- Sliding door, right
- Power steering
- Seats: 2nd row of seats foldable in a 40:60 ratio
- Seats: Passenger single seat
- Seats: Driver's seat height adjustable
- Stability control (S-VSC)
- 12V socket
- Daytime running light
- Toyota Safety Sense (Pre-Collision System with forward collision warning, emergency braking assist and autonomous emergency braking function as well as pedestrian detection, lane keeping assist with active steering support, emergency call assist)
- Airbags: 6 airbags (driver, passenger, side and head airbags)
- Electrically adjustable and heated exterior mirrors
- Brake Assist (BA)
- Diesel particulate filter
- Electronic Stability Control (VSC) including Traction Control (ASR)
- luggage compartment cover
- Speed limiter
- Transmission: 6-speed manual transmission
- Heated rear window
- Child lock, manual
- Front headrests (2), height adjustable
- Paint finish: Solid
- Steering wheel adjustable for height and reach
- Upholstery: Cloth
- Radio accessories: DAB/DAB+ (Digital Audio Broadcasting)
- Tire Pressure Monitoring System (TPWS)
- Tire repair kit
- Wheels: 16" steel rims (with 205/60 R16 92H tires, full wheel cover)
- Side protection painted in vehicle color
- Seat belts (3-point automatic on all seats, height-adjustable at the front - belt tensioners and belt force limiters at the front)
- Seats: ISOFIX child seat attachment
- Start-stop system
- Bumpers and door handles painted in body color
- 3.5-inch TFT display
- Traction control (TRC)
- Traffic Sign Recognition (RSA)
- Tie-down points 4 in the luggage compartment
- Electronic immobilizer
- Central locking with remote control

Extra equipment

- Navigation: Toyota ProTouch&Go navigation system (3D/2D navigation - DAB radio - WiFi - fog lights - rain sensor - audio controls integrated into the steering wheel)
- Package: Protection Package 2 (Load securing net - Underbody engine protection - Rear acoustic parking aid - Fog lights)
- Package: Comfort Package 1 (Comfort driver's seat with lumbar support and armrest - Heated driver and front passenger seats - Electric front windows with automatic up/down function and anti-pinch protection - Electric windows in the 2nd row of seats - Electric child safety locks for rear doors)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Interior	Sun visor - left side (Spiegel angebracht) - Differs from the original configuration - No deduction
2	Interior	Sun visor - right side (Spiegel angebracht) - Differs from the original configuration - No deduction
3	Misc.	Main inspection - No evidence - No deduction
4	Door - rear right side	Brightware - lower - Scratch(es) - Loss in value
5	Body	Body - Glued / labelled - De-glue / neutralise
6	Sill - right side	Sill - dent(s) - Smart repair
7	Sill - left side	Sill - dent(s) - Smart repair
8	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
9	Door - front right side	Door - Dent / paintcoat damage - Smart repair
10	Vehicle glazing	Windscreen (kein Staubschutz) - Broken / torn - Replace
11	Front bumper	Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Sill - right side	Sill - Scratch(es) - No deduction
2	Side panel - rear left side	Sill - Dent / paintcoat damage - No deduction
3	Wheel / tyres	Tyre - right (Über 2mm) - No deduction
4	Boot lid / rear door	Rear spoiler - Scratch(es) - No deduction
5	Vehicle glazing	Rear window - Scratch(es) - No deduction
6	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
7	Roof	Roof - Soiled - No deduction
8	Bonnet	Bonnet - Stone chips - No deduction
9	Mudguard - right side	Mudguard - right side - Scratch(es) - Cover / polish
10	Trim / covers	Floor mats - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Accident damages

No. Accident

1 Rear, Side right



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkter Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

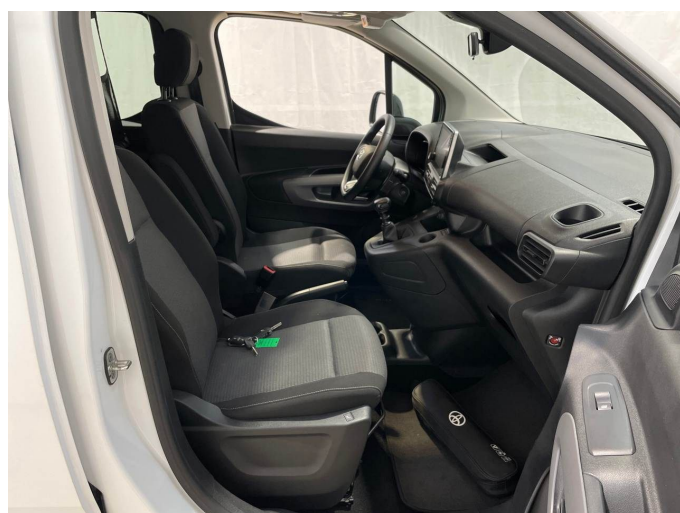


Figure 5: Interior - front

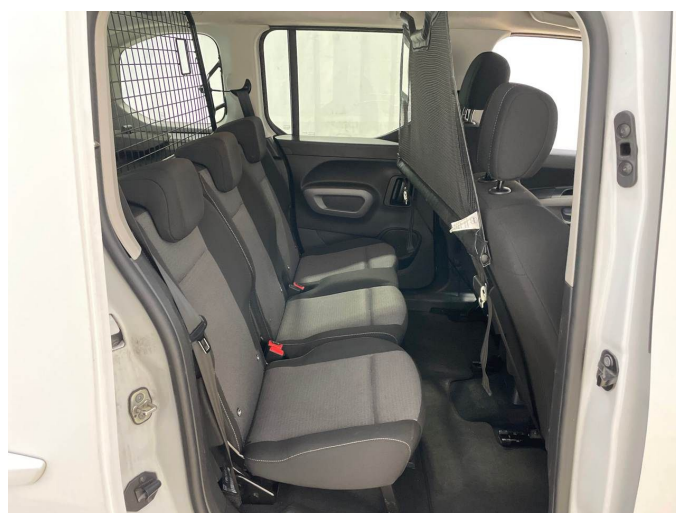


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

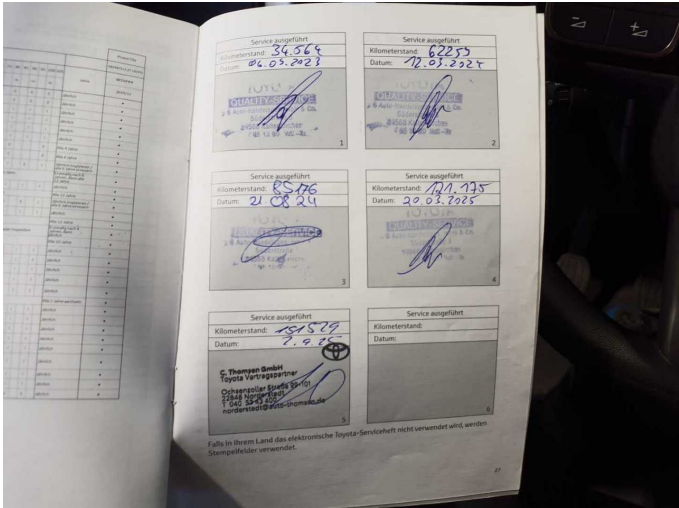


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

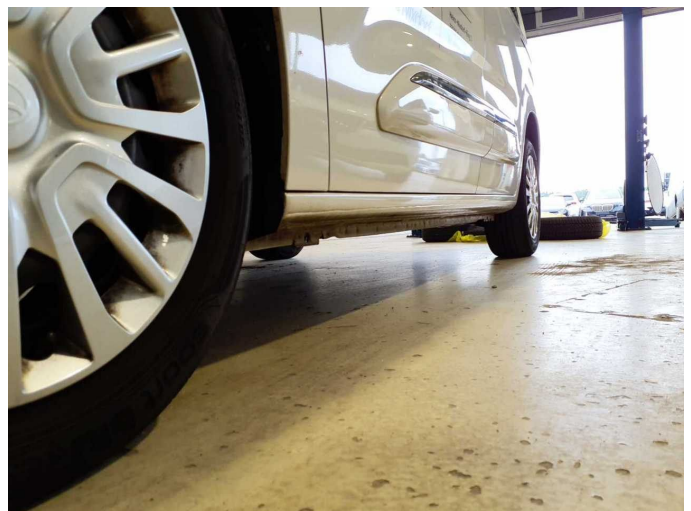


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

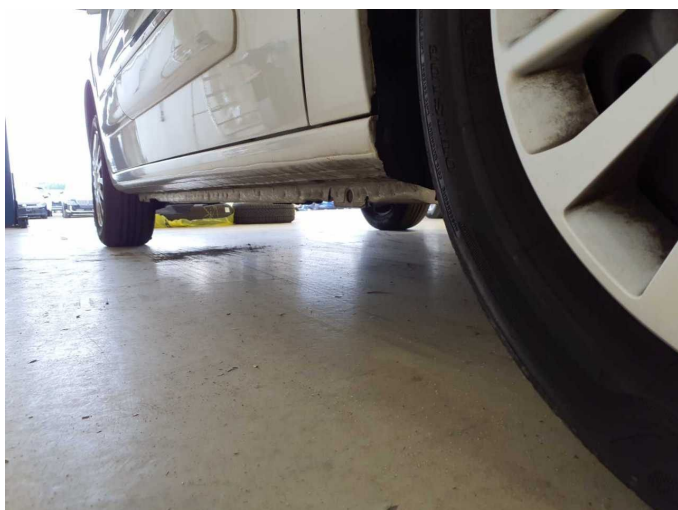


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Interior: Sun visor - left side (Spiegel angebracht) - Differs from the original configuration - No deduction



Damage 2: Interior: Sun visor - right side (Spiegel angebracht) - Differs from the original configuration - No deduction



Damage 4: Door - rear right side: Brightware - lower - Scratch(es) - Loss in value




Damage 4: Door - rear right side: Brightware - lower - Scratch(es) - Loss in value



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise

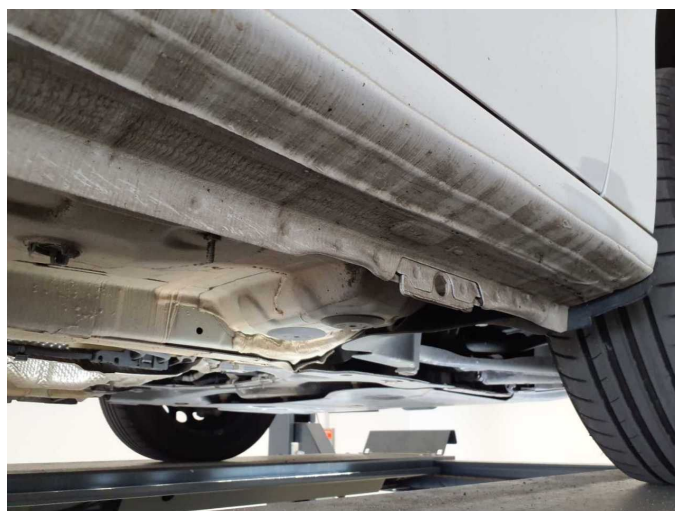

Damage 6: Sill - right side: Sill - dent(s) - Smart repair



Damage 6: Sill - right side: Sill - dent(s) - Smart repair



Damage 7: Sill - left side: Sill - dent(s) - Smart repair



Damage 7: Sill - left side: Sill - dent(s) - Smart repair



Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 8: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 9: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 9: Door - front right side: Door - Dent / paintcoat damage - Smart repair




Damage 9: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 10: Vehicle glazing: Windscreen (kein Staubschutz) - Broken / torn - Replace



Damage 10: Vehicle glazing: Windscreen (kein Staubschutz) - Broken / torn - Replace

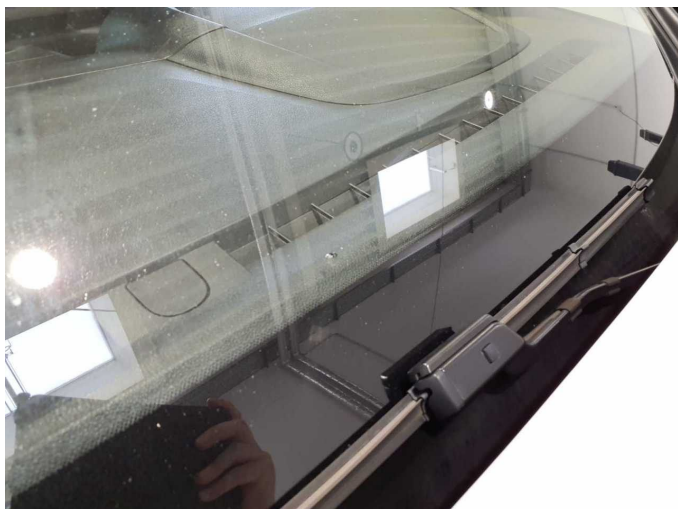

Damage 10: Vehicle glazing: Windscreen (kein Staubschutz) - Broken / torn - Replace



Damage 10: Vehicle glazing: Windscreen (kein Staubschutz) - Broken / torn - Replace



Damage 11: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint



Damage 11: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 11: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 11: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint



Wear and tear 9: Mudguard - right side: Mudguard - right side - Scratch(es) - Cover / polish

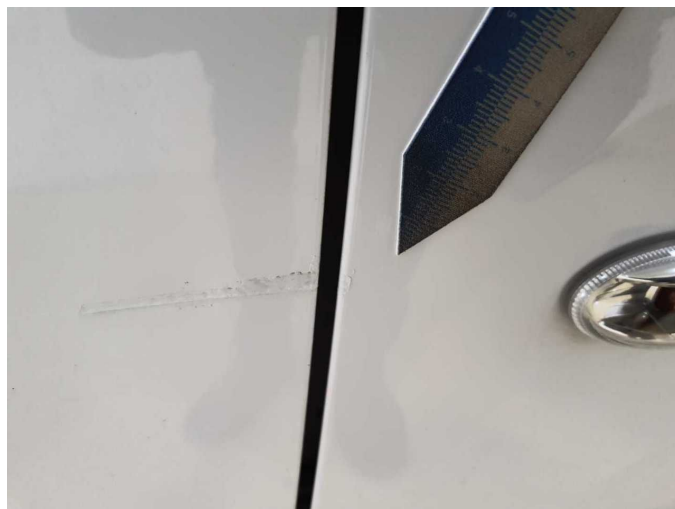


Wear and tear 9: Mudguard - right side: Mudguard - right side - Scratch(es) - Cover / polish

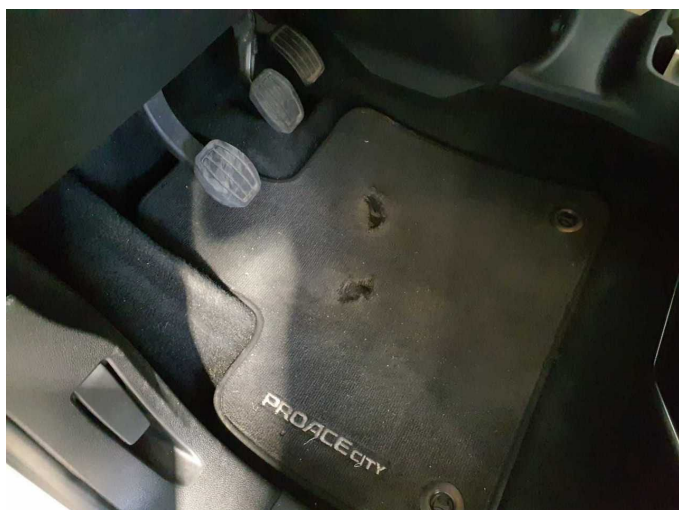

Wear and tear 10: Trim / covers: Floor mats - Broken / torn - No deduction



Accident 1: Rear, Side right

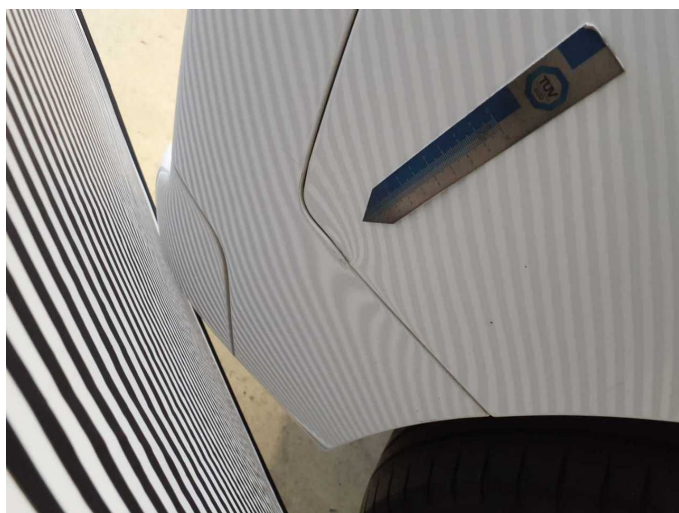

Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right