



Expertise

Protocol number: 46407092
Order No. / Reference: 26539918
Inspection date: 8 Jul 2026

Manufacturer: Volkswagen

Model: Caddy 2.0 TDI BMT (7-Si.) DSG Life Maxi

VIN: WV2ZZZSK7PX002993



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Caddy 2.0 TDI BMT (7-Si.) DSG Life Maxi

Vehicle Identification number WV2ZZZSK7PX002993

Mileage (Read) 245,551 km

First registration 1 Sept 2022

Number of holders 1

Power / Engine displacement 90 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 7

Type of drive Front drive

Type of vehicle Van

Colour / colour code Deep Black Perleffekt

Doors / Seats 5 / 7

Upholstery type Cloth

Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	22,100 km
Last service on / at	05/2026 at 240,488 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM583119
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLI 00663		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,450 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	215/55 R17 94W	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Dunlop	4mm / 4mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Dunlop	4 mm
	215/55 R17 98V	All-season tyres on Light alloy	Continental	7 mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Waste container with removable lid
- Storage compartments: Storage tray on the headliner with 2 roof grab handles in the driver's cab
- Airbag: Side and head airbags for driver and front passenger
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- third brake light
- Three-phase generator 140 A
- Electronic parking brake including auto-hold function
- Automatic headlight control with daytime running lights
- Window: Side window in the passenger/cargo compartment, rear left, permanently installed
- Window: Side window in the passenger/cargo compartment, front left, permanently installed
- Windows: Laminated glass front pane in heat-insulating glazing
- Luggage compartment cover, foldable and removable
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Tailgate with window cutout
- Interior lighting: in the passenger compartment
- Instrument usage (km/h)
- Child seat anchorage (I-Size) and top tether
- Headrests (2), height adjustable
- Steering wheel: Multifunction steering wheel in leather (DSG)
- front center armrest
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Particulate filter: Soot particle filter for diesel engines
- Radio accessories: Digital radio reception DAB+
- Wheels: Tire Mobility Set
- Gearshift lever DSG
- Sliding door, left side in the passenger/cargo area
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- Seat belts: Three-point automatic seat belts
- dimmable interior safety mirror
- Seats in the driver's cab: Backrest release for the right front seat
- Seats in the passenger compartment: 3-seater bench in the 2nd row (foldable, rollable and removable)
- Seats: Seat left and right, in the 1st row
- Sun visors with mirrors, airbag label on passenger sun visor
- Power outlets: 12-volt socket in the cargo area
- Telephone: Mobile phone interface
- Lashing points: 6 lashing points for securing cargo
- Electronic immobilizer
- Auxiliary heating: Electric auxiliary air heater
- Storage and stowage boxes
- Towing eye front and rear, screw-in
- Airbag for driver and front passenger
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirror housings in black, door handles in body color and sliding door rail in silver
- Floor coverings, carpeting in the driver's cab and passenger compartment
- Roof rails, black
- Electrical interface for external use
- Electronic Stability Program with Brake Assist
- Windows: Heated rear window
- Window: Side window in the passenger/cargo compartment, rear right, permanently installed
- Window: Side window in the passenger/cargo compartment, front right, permanently installed
- Windows: Green heat-insulating glass
- electric window regulator
- Cruise control system including speed limiter
- Halogen dual headlights-H7
- Glove compartment with lid, illuminated
- Rear window wiper/washer system with intermittent function
- Electric child safety lock for sliding doors
- Air conditioning with manual control
- Paint protection/transport protection film
- Steering column adjustable in height and tilt
- Headlight range control
- Multifunction display "Plus"
- Multi-collision brake
- Non-smoking version
- eCall emergency call system
- Upholstery: Fabric, "Trialog" design
- Wheels/Tires: Tire pressure monitoring system
- reversing light
- Windscreen wiper intermittent control with light sensor
- Sliding door, on the right in the passenger/cargo area
- Side paneling for comfort in the passenger compartment
- Speed-sensitive power steering (Servotronic)
- Seat belts: in the passenger compartment
- Driver's cab seats: Height adjustment for both front seats, manual
- Seats in the driver's cab: Lumbar support manually adjustable, left and right
- Seats: Folding tables on the backrests of the seats in the 1st row.
- Lane keeping assistant "Lane Assist"
- Start-stop system
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Central locking with remote control and interior operation
- Additional dust protection seal on the outside



Extra equipment

- Rigid towbar (including trailer stabilization)
- Paint finish: Pearl effect
- Navigation system "Discover Pro" (Life, PanAmericana, Style) (25.4 cm (10 inch) color touchscreen - Streaming & Internet - Voice control - "Comfort" phone interface with inductive charging function - App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto - Traffic sign recognition)
- Central locking with keyless start system "Keyless Start" without safe locking
- Operating voltage 12 V with 230 V socket (Schuko socket)
- Multifunction display: Digital cockpit, multicolor, various information profiles selectable
- Wheels/Tires: "Barahona" alloy wheels 6.5 J x 17, in brilliant silver
- Driver's cab seats: AGR ergoComfort seat, left (Life, Move, Style)
- Partition net: Luggage net in the cargo/passenger compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Digitaler Nachweis unvollständig, mehrere Nachweise fehlen) - No evidence - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Door - front left side	Door edge - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid - dent(s) - Paint
5	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
6	Sliding door - left side	Sliding door with glass panel - Scratch(es) - Paint
7	Sliding door, right	Sliding door with glass panel - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Door - front right side	Door edge (+ Korrosion) - Paint defect - Repair and paint
10	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
11	Bonnet	Bonnet - Scratch(es) - Paint

Missing parts

Description

Interior - Separation net

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 24 Nov 2022	2.613,10 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

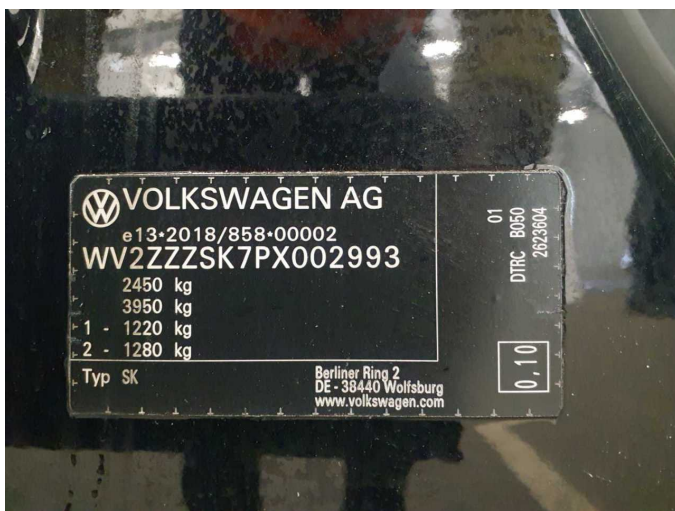


Figure 11: VIN



Figure 12: Mounted tyres

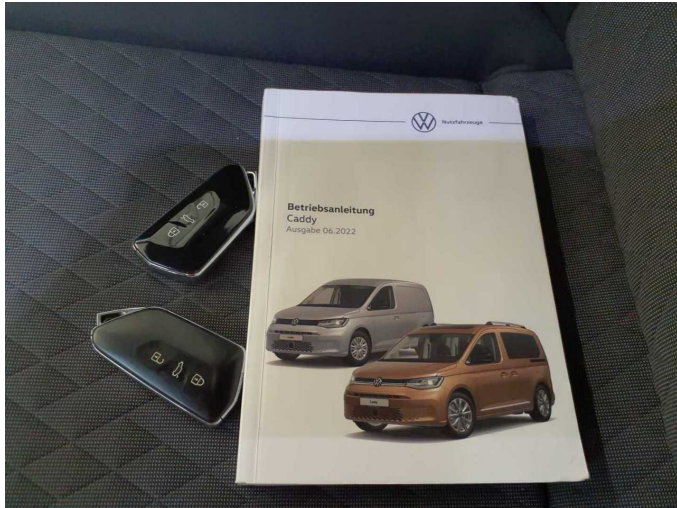


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

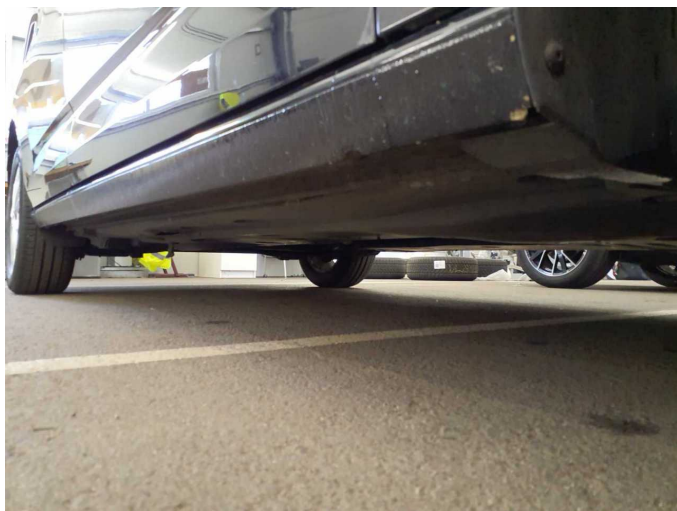


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

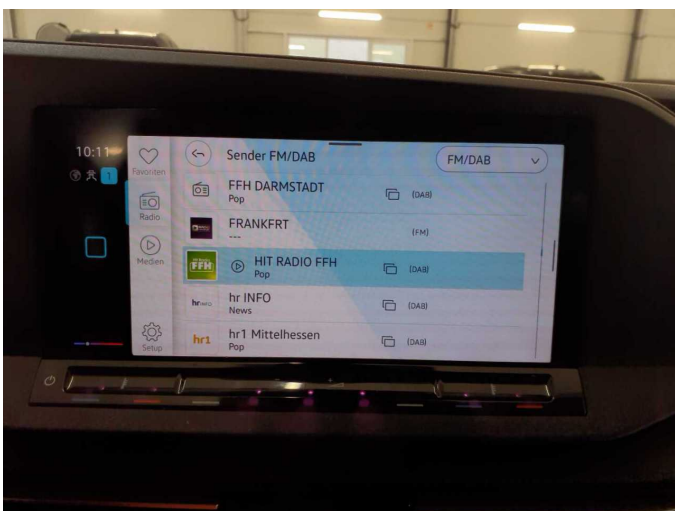


Figure 23: Misc.

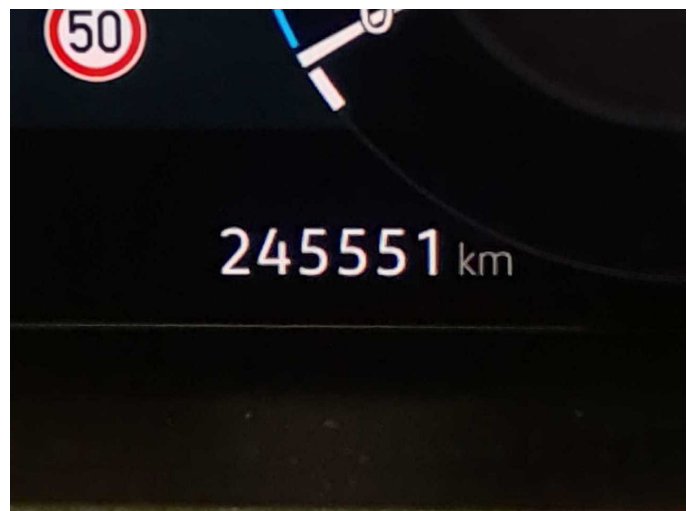


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

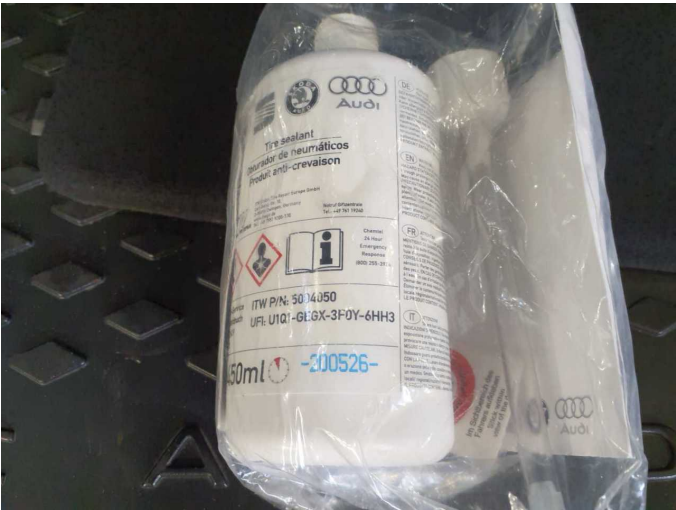


Figure 29: Misc.



Figure 30: Misc.



Damage 2: Equipment: Tirefit filler - Expired - Replace




Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair

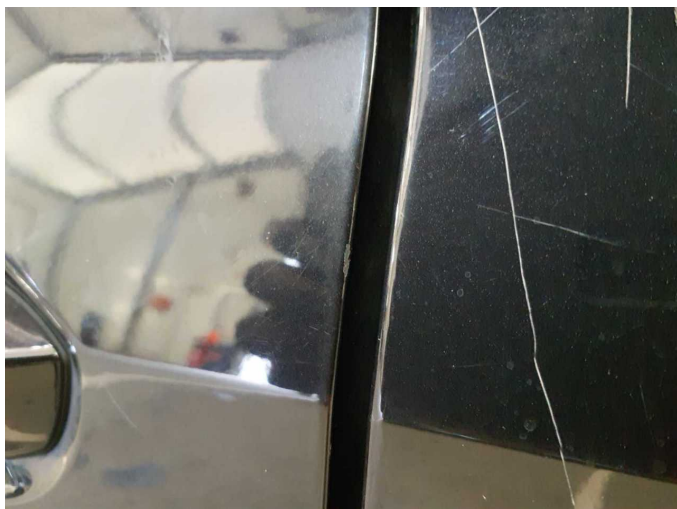


Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 4: Boot lid / rear door: Boot lid - dent(s) - Paint

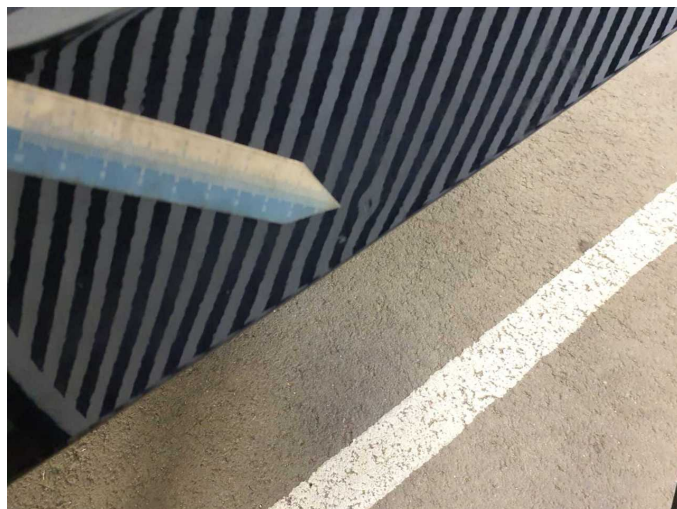

Damage 4: Boot lid / rear door: Boot lid - dent(s) - Paint




Damage 4: Boot lid / rear door: Boot lid - dent(s) - Paint

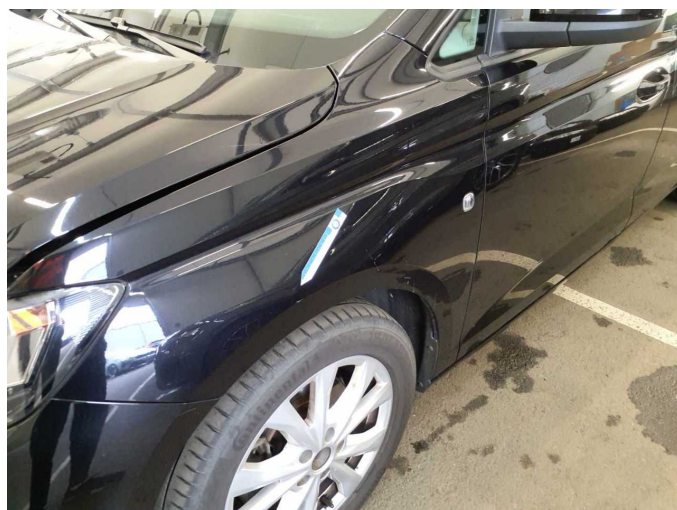

Damage 5: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage 5: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

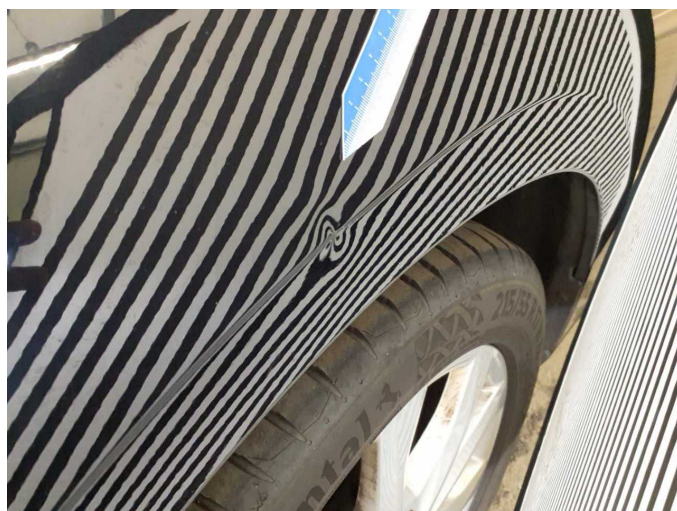

Damage 5: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint




Damage 6: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint



Damage 6: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint




Damage 6: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint

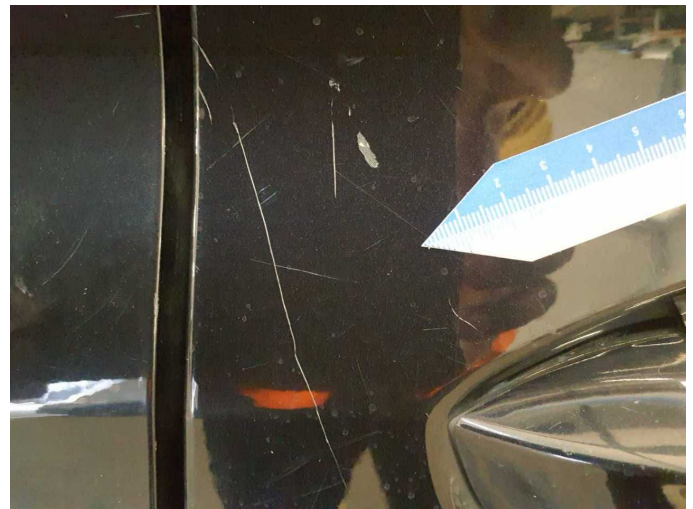

Damage 6: Sliding door - left side: Sliding door with glass panel - Scratch(es) - Paint



Damage 7: Sliding door, right: Sliding door with glass panel - Scratch(es) - Paint

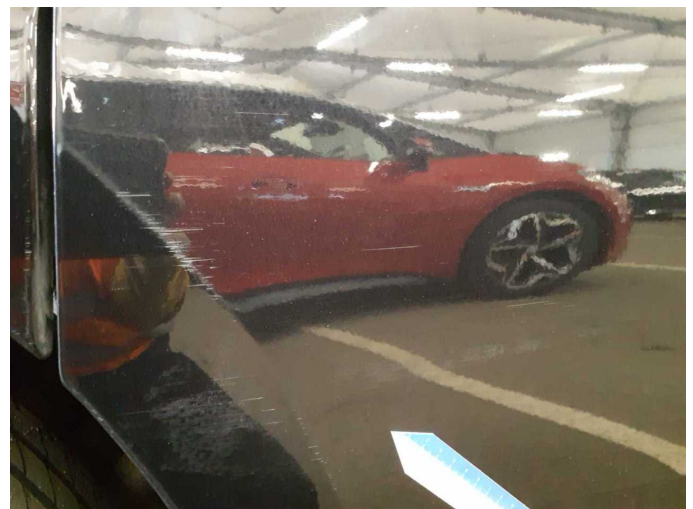

Damage 7: Sliding door, right: Sliding door with glass panel - Scratch(es) - Paint



Damage 7: Sliding door, right: Sliding door with glass panel - Scratch(es) - Paint



Damage 7: Sliding door, right: Sliding door with glass panel - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

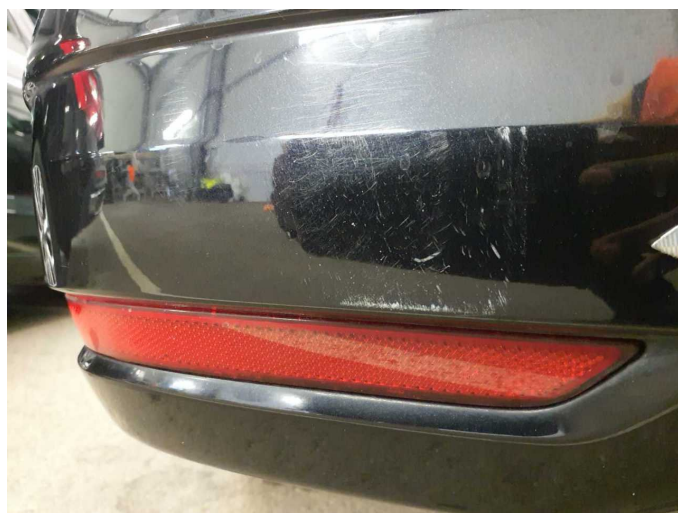

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 9: Door - front right side: Door edge (+ Korrosion) - Paint defect
- Repair and paint



Damage 9: Door - front right side: Door edge (+ Korrosion) - Paint defect
- Repair and paint




Damage 9: Door - front right side: Door edge (+ Korrosion) - Paint defect
- Repair and paint

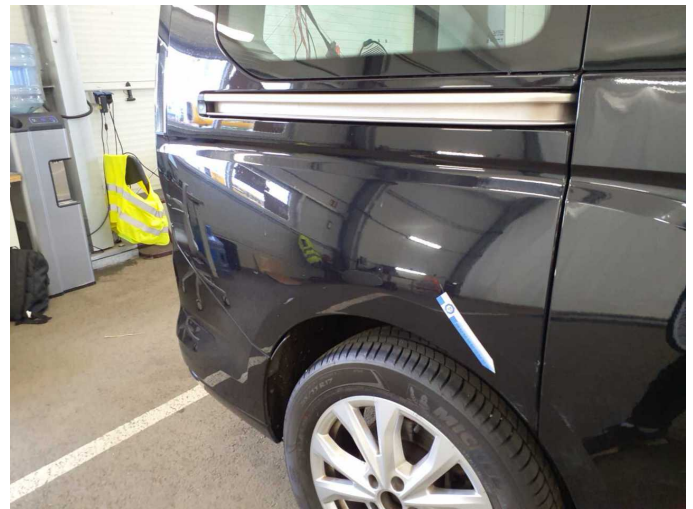

Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat
damage - Repair and paint



Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat
damage - Repair and paint

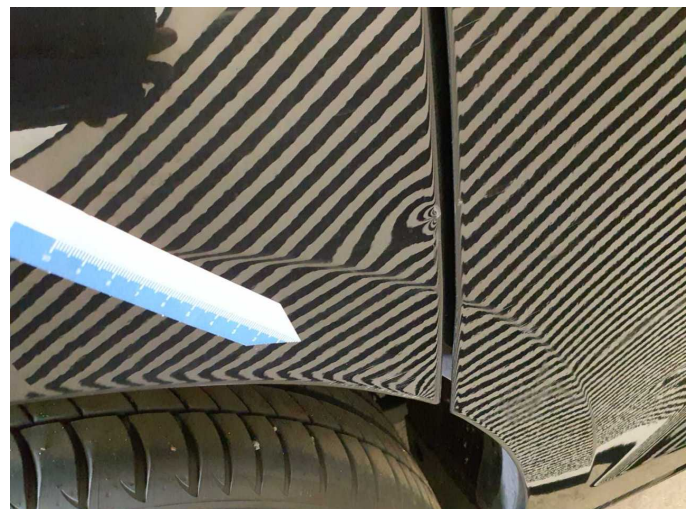


Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat
damage - Repair and paint



Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

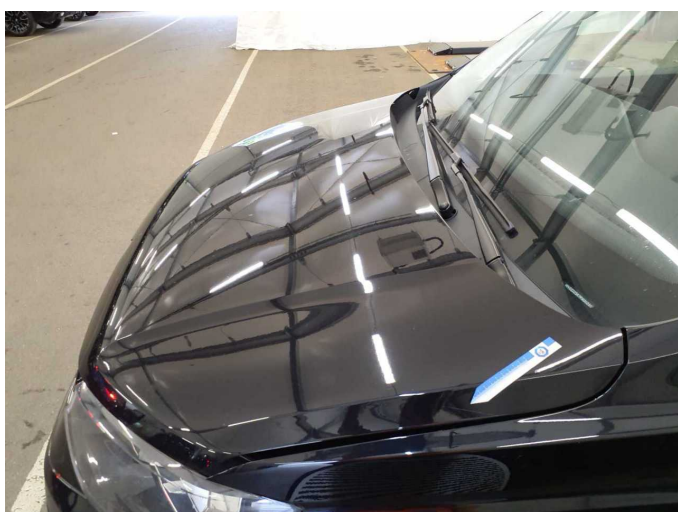

Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZSK7PX002993

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy 2.0 TDI BMT (7-Si.) DSG
Life Maxi

Datum	KM-Stand	Beschreibung
08.05.2026	240.488	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Systemtest/Eigendiagnose; Wartung Sonstiges
30.09.2025	208.196	AU; Keilrippenriemen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Spannrolle ern; Systemtest/Eigendiagnose; Wartung Sonstiges; Wasserpumpe ern; Zahnriemen/Steuerkett ern
27.02.2025	177.032	Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges