



Expertise

Protocol number: 46599198
Order No. / Reference: 26689039
Inspection date: 13 Jul 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1TXPW014078



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Comfortline	
Vehicle Identification number	WVGZZZ1TXPW014078
Mileage (Read)	144,534 km
First registration	28 Mar 2023
Number of holders	1
Next periodical technical inspection	02/2028
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	21,200 km
Last service on / at	02/2026 at 136,783 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS386529
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / BWR 00468		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Continental	7mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger (with front passenger airbag deactivation, including driver's side knee airbag)
- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- Exterior mirror housings and door handles in body color
- third brake light
- black roof rails
- Decorative inlays "Piano Black" (for center console)
- Diesel particulate filter
- Tachometer
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Automatic headlight control with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage management package (with luggage net that can be fixed to rails)
- Additional luggage compartment lighting (removable and usable as a flashlight)
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats (device for attaching child seats to the rear seats)
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery in fabric
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16 (tires 205/60 R 16)
- Gearshift knob in leather
- Keyless start system without safe locking
- Electromechanical power steering (speed-dependent control)
- Seats: 3 individual seats in the 2nd row (longitudinal adjustment, backrest tilt adjustment, armrest and "EasyFold" folding function)
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- Start-stop system (with brake energy recuperation)
- 12V power outlet on the rear center console (and in the luggage compartment)
- Bumpers in body color
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- Electrically folding exterior mirrors (dimming on the driver's side, ambient lighting and passenger-side mirror lowering)
- Headliner in Storm Grey
- Decorative inserts "New Brushed Design" (for instrument panel and front door trim)
- Digital Cockpit, multi-colored (various info profiles selectable)
- Electronic parking brake including auto-hold function
- Electronic Stability Program (ESP) with counter-steering support (Incl. ABS with brake assist, ASR (traction slip control), EDS (electronic differential lock), MSR (engine drag torque control) and trailer stabilization)
- Pedestrian and cyclist detection as well as active front hood
- Luggage compartment cover (with comfort opening, extendable, removable and stowable)
- Luggage compartment floor height adjustable (with fixing element)
- Glove compartment with cooling option
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Air conditioning (with active combination filter)
- Headrests (3) in the 2nd row of seats (height adjustable)
- Black radiator grille with chrome strips on the slats
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Front center armrest (height and length adjustable - with removable storage box - 2 rear air vents)
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio "Composition"
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: Tire pressure monitoring system
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear (and seat belt tensioners in the rear)
- Seats: Front passenger seat backrest folds down completely (with table and pass-through function)
- Seats: Folding tables on the backs of the front seats (tilt adjustable)
- Seats: Front seats are height-adjustable



- Telephone interface
- Textile floor mats (front and rear)
- USB-C interface (charging power up to 45 W)
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus" (online information is transmitted directly to the car (e.g. navigation with point-of-interest search, online traffic information, parking information, etc.))
- Central locking without safe locking, with remote control and 2 remote folding keys

- Lane change assistant "Side Assist" and parking assistant (warns the driver of vehicles that could pose a danger during lane changes by means of visual signals in the respective exterior mirror - monitors the area behind and beside the vehicle when reversing out of a parking space - issues visual and acoustic warning signals when a vehicle is detected crossing the parking space path - can initiate emergency braking to reduce the severity of a collision or to prevent a collision altogether)
- Warning tone and light for unfastened front seat belts (warning light for unfastened rear seat belts)
- Electronic immobilizer
- Green heat-insulating glazing (sides and rear)
- Black trim strips on the side windows

Extra equipment

- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Air conditioning system "Air Care Climatronic"
- Paint finish: Pearl effect
- "Discover Media" navigation system including "Streaming & Internet" (radio)
- Package: Business (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - cargo net partition - automatically heated front windshield washer nozzles - headlight cleaning system - heated front seats - washer fluid level warning light)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Rear side windows and rear window tinted
- Seats: ergoActive seat with 14-way adjustment and massage function in the front in conjunction with the Business Package Premium
- Voice control
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Traffic sign recognition
- High beam assistant "Light Assist"
- Reversible luggage compartment mat, foldable and removable
- Steering wheel: Multifunction leather steering wheel, heated, with paddle shifters
- Mesh partition
- Package: Business Premium incl. Navigation (DSG) (Air Care Climatronic air conditioning - Lumbar support front, electrically adjustable on driver's side, massage function driver's side - Multifunction leather steering wheel with shift paddles - Cargo net partition - Automatically heated windshield washer nozzles front - Headlight cleaning system - Drawer under the right front seat - Microfleece seat center panels "ArtVelours" - Top comfort seats front - Heated front seats - Height-adjustable front seats, ergoActive seat on the driver's side - Washer fluid level warning light)
- Seats: Heated front seats
- 230V power outlet in the luggage compartment on the left (additional luggage compartment lighting, removable and usable as a flashlight)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smart repair
2	Instrument panel	Air nozzle - centre (Hinten) - Broken / torn - Replace
3	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
4	Side panel - rear right side	Side panel - Deformed - Repair and paint
5	Side panel - rear left side	Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint
6	Door - rear left side	Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint
7	Interior	Cargo area floor (fester Boden verbaut, Rückrüsten, Mehrkosten möglich) - Differs from the original configuration - Replace
8	Bonnet	Bonnet (Anätzung) - Paint defect - Repair and paint
9	Rear bumper	Rear bumper - Paint defect - Repair and paint
10	Roof	Roof - Corrosion - Repair and paint

Wear and tear

No.	Component group	Description
1	Interior	Cargo area floor (Holzboden verschraubt) - No deduction
2	Sill - right side	Sill - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 18 Sept 2025	3.205,97 €
2	Side - left, Provided by user / customer, from 20 Mar 2025	3.446,93 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - rear left side, Unprofessionally carried out

Paint coat thickness measurement

Side panel - rear left side	1,360 µm	Door - rear left side	504 µm
-----------------------------	-------------	-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Tirefit aufgrund verschraubten Ladebodens nicht prüfbar.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

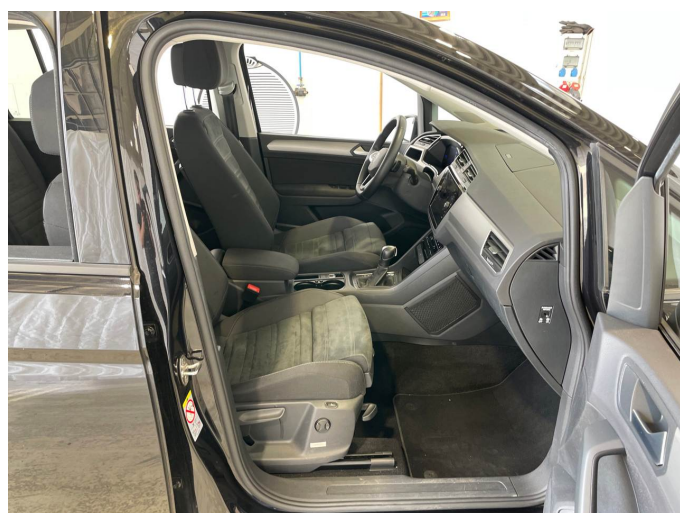


Figure 5: Interior - front

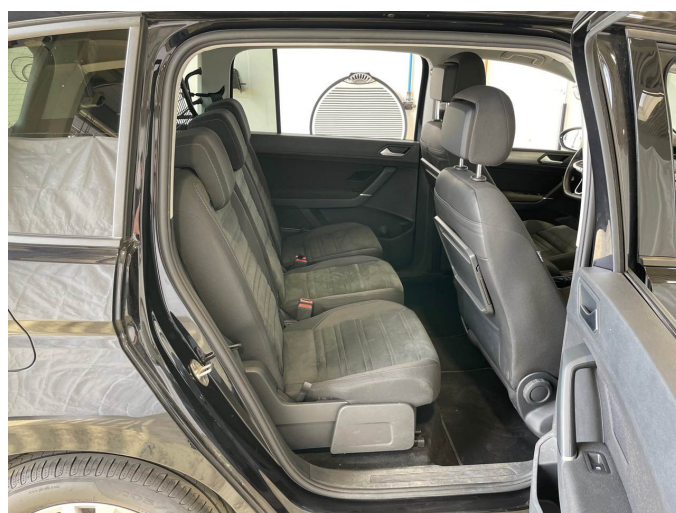


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

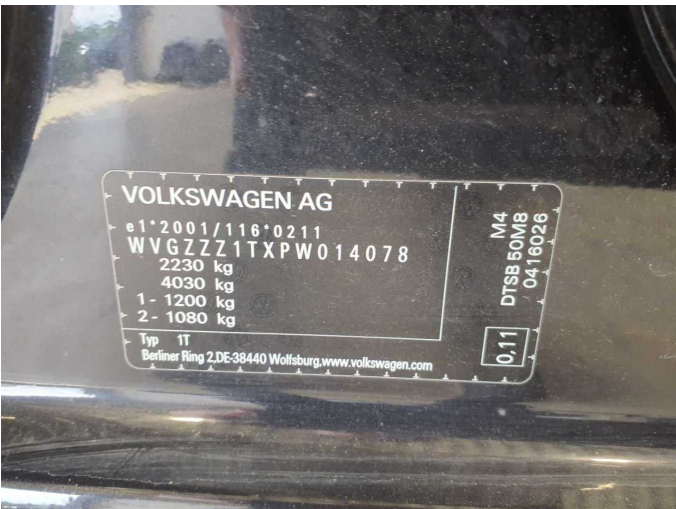


Figure 11: VIN



Figure 12: Mounted tyres

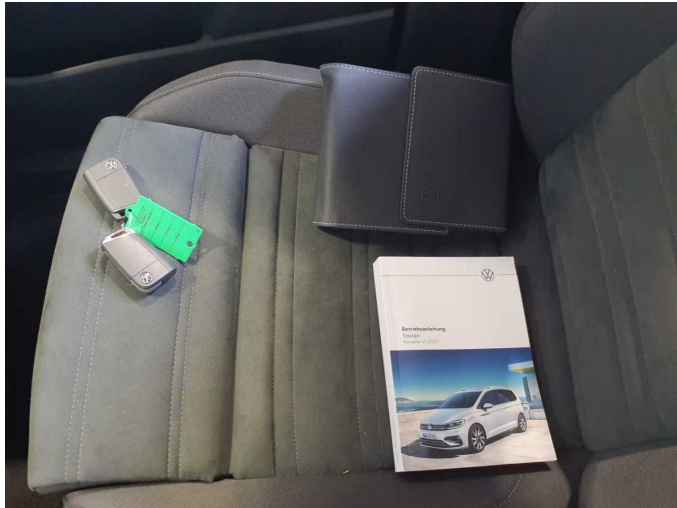


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

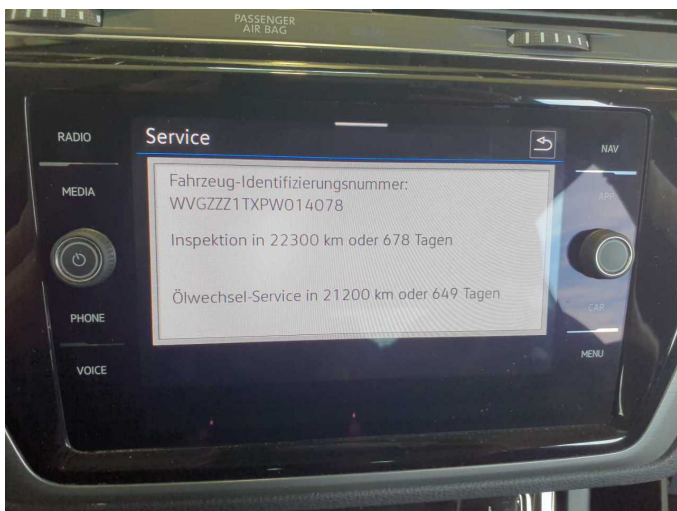


Figure 17: Misc.

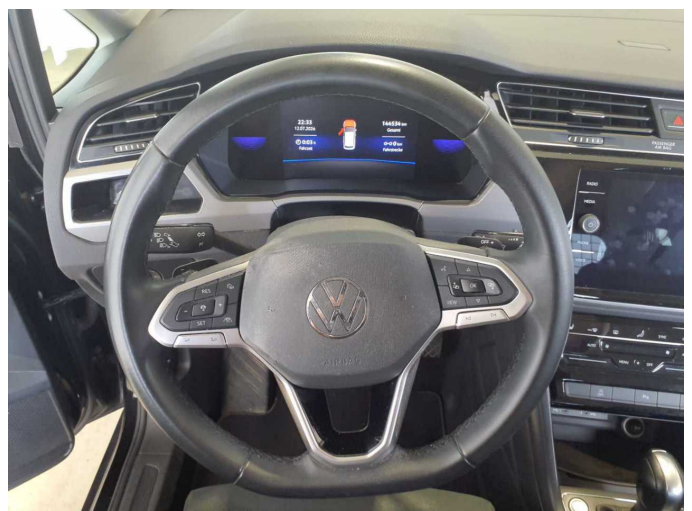


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

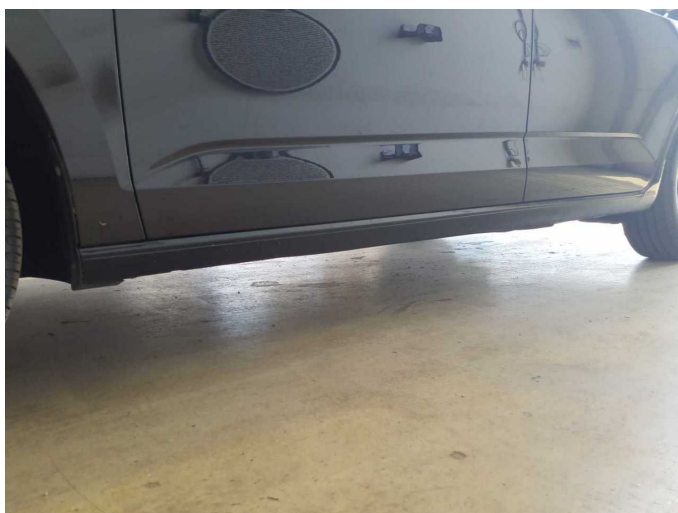


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Damage 1: Door - front right side: Door - dent(s) - Smart repair



Damage 1: Door - front right side: Door - dent(s) - Smart repair

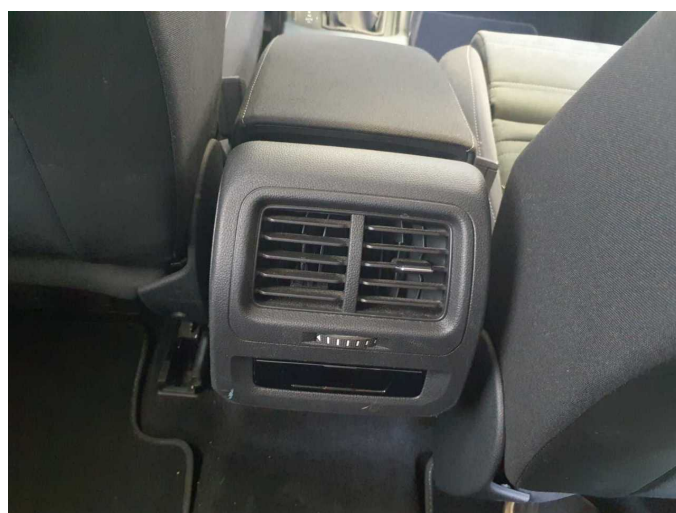

Damage 2: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 2: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 5: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint




Damage 5: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint




Damage 5: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint




Damage 5: Side panel - rear left side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

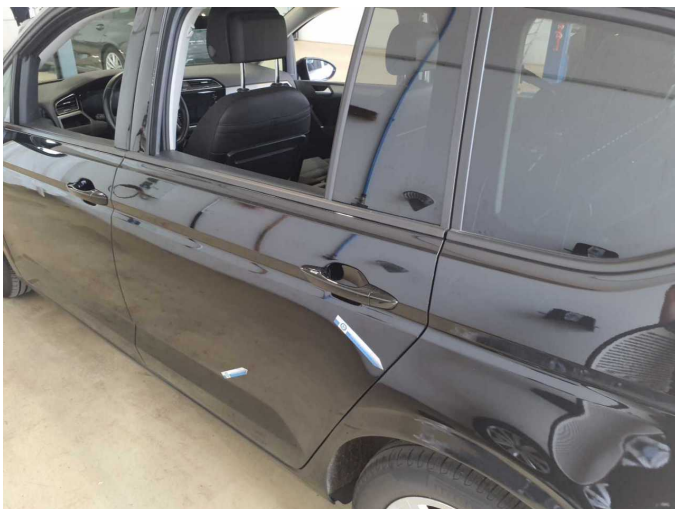


Damage 6: Door - rear left side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

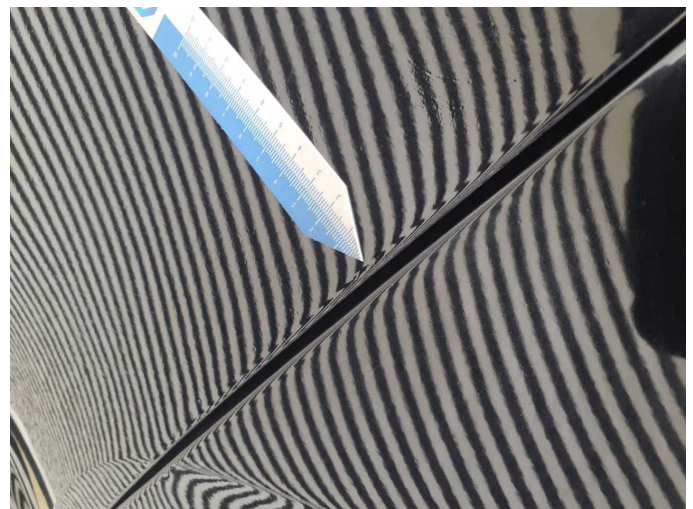


Damage 6: Door - rear left side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

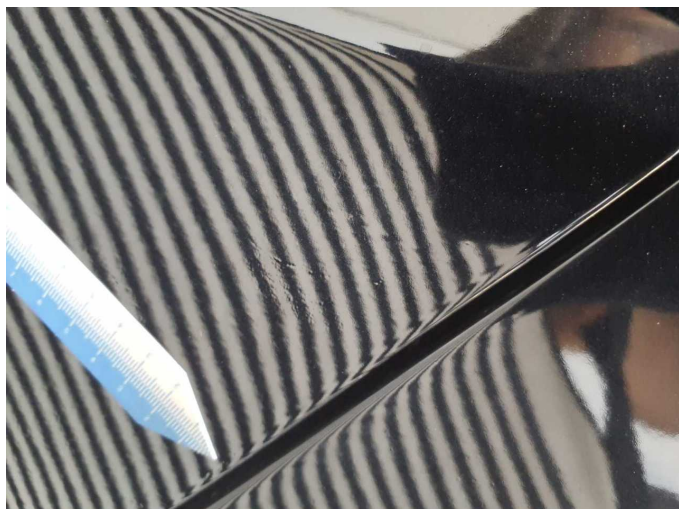


Damage 6: Door - rear left side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

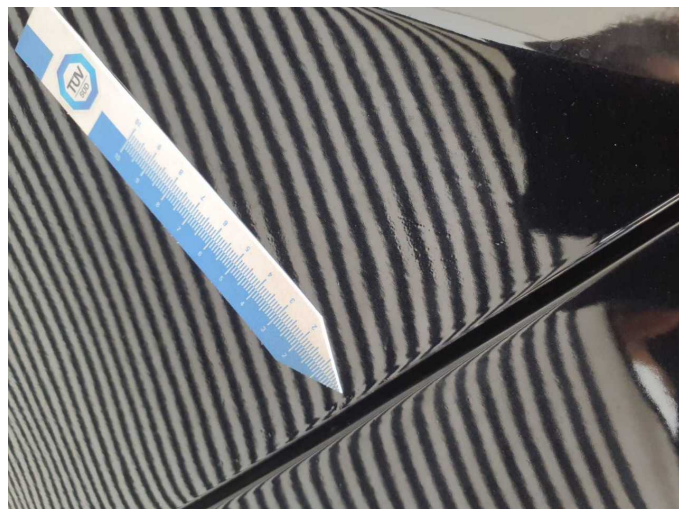


Damage 6: Door - rear left side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

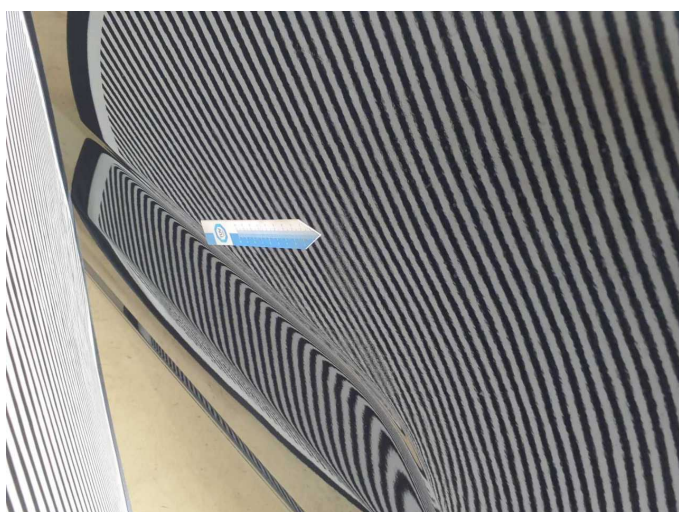

Damage 6: Door - rear left side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

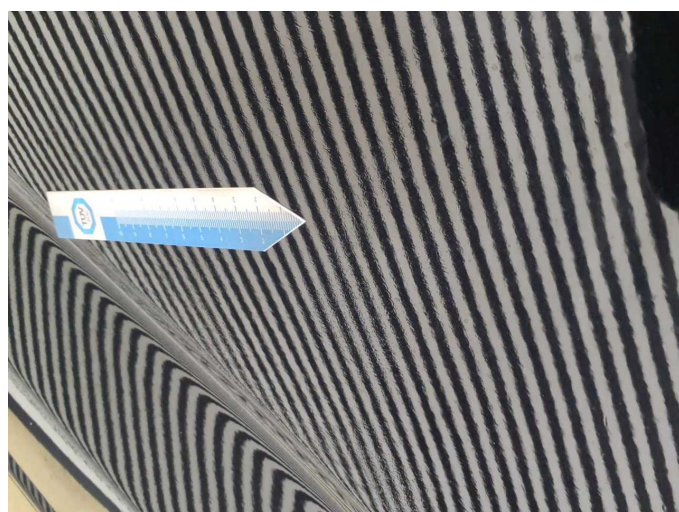


Damage 6: Door - rear left side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

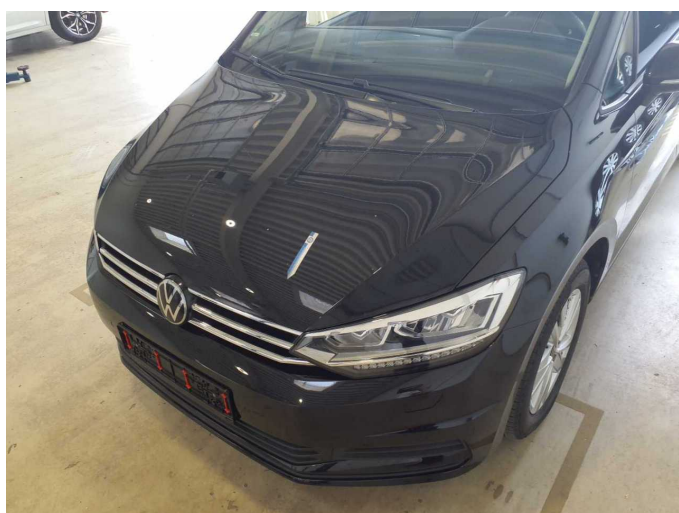

Damage 8: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 8: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

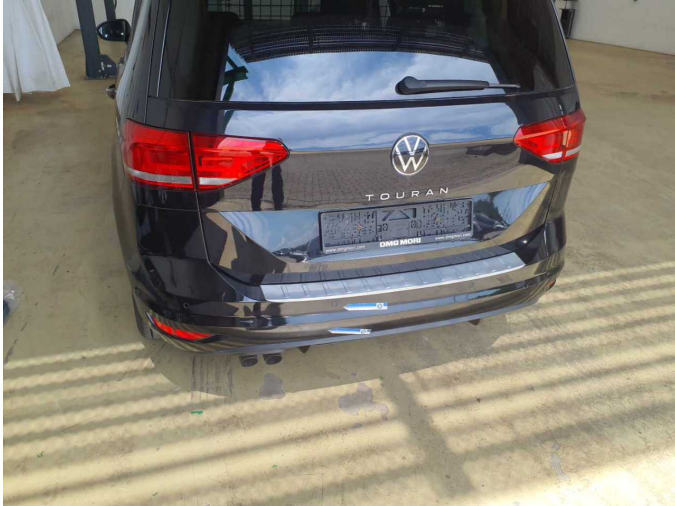

Damage 9: Rear bumper: Rear bumper - Paint defect - Repair and paint




Damage 9: Rear bumper: Rear bumper - Paint defect - Repair and paint



Damage 9: Rear bumper: Rear bumper - Paint defect - Repair and paint




Damage 9: Rear bumper: Rear bumper - Paint defect - Repair and paint

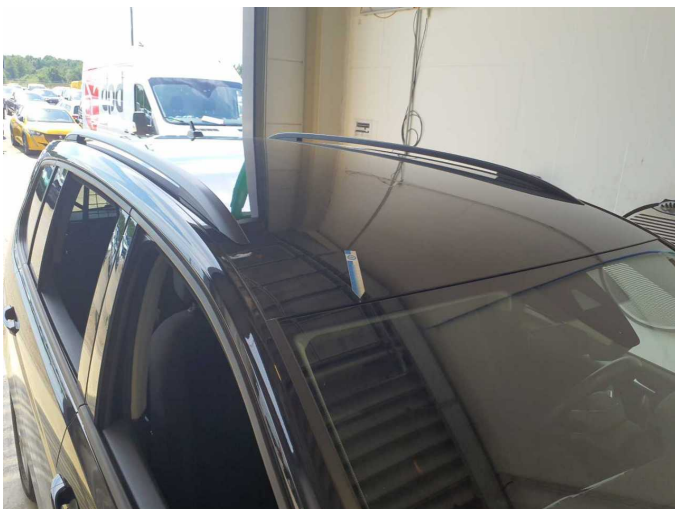

Damage 10: Roof: Roof - Corrosion - Repair and paint




Damage 10: Roof: Roof - Corrosion - Repair and paint

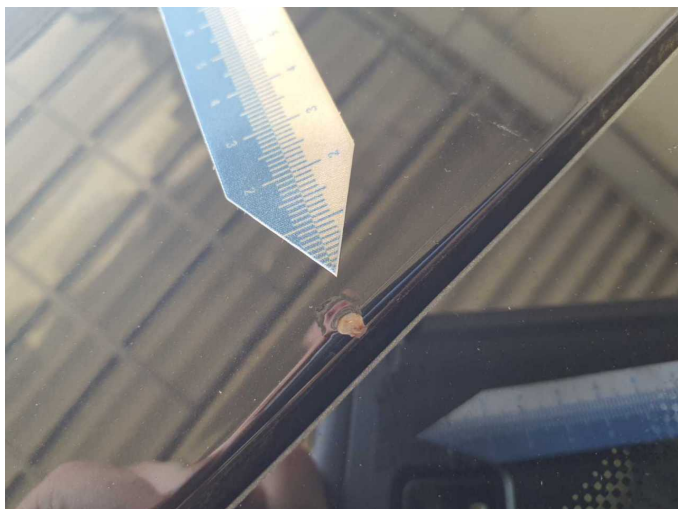

Damage 10: Roof: Roof - Corrosion - Repair and paint



Wear and tear 1: Interior: Cargo area floor (Holzboden verschraubt) - No deduction

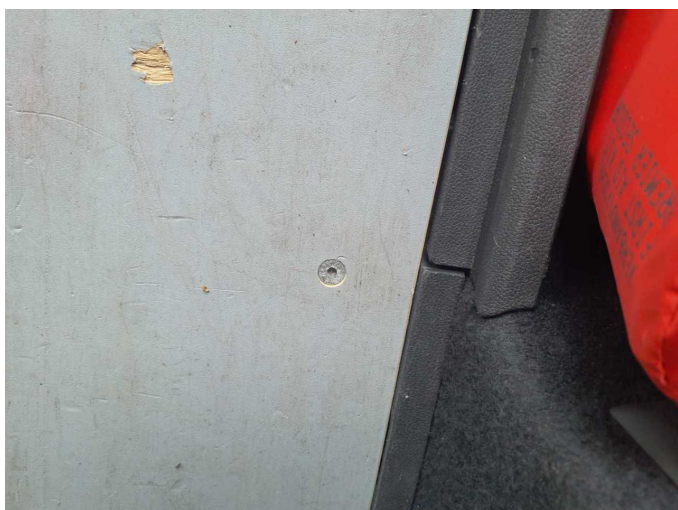

Wear and tear 1: Interior: Cargo area floor (Holzboden verschraubt) - No deduction



Wear and tear 1: Interior: Cargo area floor (Holzboden verschraubt) - No deduction



Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TXPW014078

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
Comfortline

Datum	KM-Stand	Beschreibung
04.05.2026	144.326	Batterie ern; Keilrippenriemen; Systemtest/Eigendiagnose
19.02.2026	136.783	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.12.2025	127.852	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen
17.11.2025	124.341	Systemtest/Eigendiagnose
04.08.2025	100.811	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.01.2025	83.603	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
13.06.2024	54.682	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.11.2023	27.533	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges