



Expertise

Protocol number: 46522375
Order No. / Reference: 26689280
Inspection date: 13 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 1.5 Diesel Automatik Business
VIN: W0VZT8ENXN1003531	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 1.5 Diesel Automatik Business	
Vehicle Identification number	W0VZT8ENXN1003531
Mileage (Read)	167,337 km
First registration	17 Mar 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report not on hand)	
Power / Engine displacement	90 kw / 1,496 ccm
Fuel type / Cylinder	Diesel / 3
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mondstein Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	24 %
Last service on / at	02/2026 at 149,075 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ647765
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / AME 00234		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments: Storage compartment in the center console; Pockets in the front doors, suitable for 1.5-liter beverage bottles; Pockets in the rear doors, suitable for 1-liter beverage bottles; Cup holder in the center console; Illuminated glove compartment
- Electrically adjustable and heated exterior mirrors for driver and passenger side - manually foldable
- third brake light
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Extendable luggage compartment cover with comfort operation
- Back window, heater
- Child safety lock in the rear doors, manual
- Front headrests - height adjustable
- LED headlights - automatic headlight range control
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake including 12-volt socket
- Parkpilot, front and rear parking aid
- Upholstery: Billy fabric, black
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Radio: Multimedia Navi Pro with 8" color touchscreen display, voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto
- Wheels: 7.5 J x 17 alloy wheels in a 5 double-spoke design - tires 215/55 R 17
- Seat belts: Three-point seat belts in all seats - belt force limiters and belt tensioners in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats
- Start/Stop system, reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function
- Bumpers painted in body color
- Traction Control (TC) Plus - Traction control with engine and brake intervention
- Immobiliser
- Central locking with remote control and interior switches
- Airbag: Front and side airbags, driver and front passenger; front and side airbag, front passenger, deactivatable
- Airbag: Front and rear outer head airbags
- Ambient lighting on dashboard and doors (front)
- Anti-lock braking system (ABS) with cornering brake control (CBC) and brake assist
- Hill Start Assist
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear - with one-touch function and anti-pinch protection
- Pedestrian protection including active hood
- Speed controller
- Transmission: 8-speed automatic transmission
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces) - height adjustable
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1 (AGR, driver) - Multi-stage heated seats for driver and front passenger - Heated leather steering wheel - 60:40 split-folding rear seat backrest - Ergonomic active seat (AGR), driver (manually adjustable length, height, and backrest angle; electrically adjustable seat tilt; electro-pneumatically adjustable lumbar support (height and length); manually extendable thigh support; height- and tilt-adjustable headrest) - Heated ThermoTec windshield
- Tire repair kit including tire sealant and 12-volt compressor (without jack)
- Tire pressure display - with tire pressure warning - direct system with automatic calibration after wheel change
- Rear seat backrest folds forward in a 60:40 split
- Power steering - speed-dependent
- Safety net for mounting behind the 1st or 2nd row of seats
- Visibility features include a rain sensor, front.
- Lane Keeping Assist warns the driver if they unintentionally leave their lane (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.
- Pre-installation for child seat mounting system "ISOFIX" at the rear
- Thermal insulation glazing, green tinted
- Second folding ignition key



Extra equipment

- Package: Easy-Access - Keyless locking and starting system (Keyless Open & Start) - Sensor-controlled electric tailgate - Stainless steel loading sill protector
- Package: Innovations 1 - IntelliLux LED Pixel Light - Adaptive LED Matrix Headlights: City Light, Highway Light, Country Road Light, Static Cornering Light, Turning Light, Parking Light, High Beam: Traffic-dependent dimming taking into account preceding and oncoming traffic, Automatic Headlight Range Control - Traffic Sign Assist
- Park & Go with digital reversing camera - Digital reversing camera - Reversing assistant - Lane change assistant - Blind spot warning in both exterior mirrors
- Package: Business Premium - Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign recognition - Solar Protect heat-insulating glass, heavily tinted, in the rear
- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front right side - Scratched - Smart repair
2	Wheel / tyres	Alloy rim - front left side - Scratched - Smart repair
3	Roof	Roof - dent(s) - Smart repair
4	Engine	Engine - Leaking - Diagnosed and repair if necessary
5	Body	Underbody panelling (VM) - Broken / torn - Replace
6	Seat - front	Backrest cover - left side (Inkl. Polster) - Broken / torn - Replace
7	Sill - right side	Sill - Deformed - Repair and paint
8	Sill - left side	Sill - Deformed - Repair and paint

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Professionally repaired, Invoice of repair done Non-existent, from 29 Sept 2024	3.853,72 €

Repainting

No.	Repainting
1	Side panel - rear right side, Door - rear right side, Door - front right side



Paint coat thickness measurement

Side panel - rear right side	2,050 µm	Door - rear right side	502 µm
Door - front right side	228 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

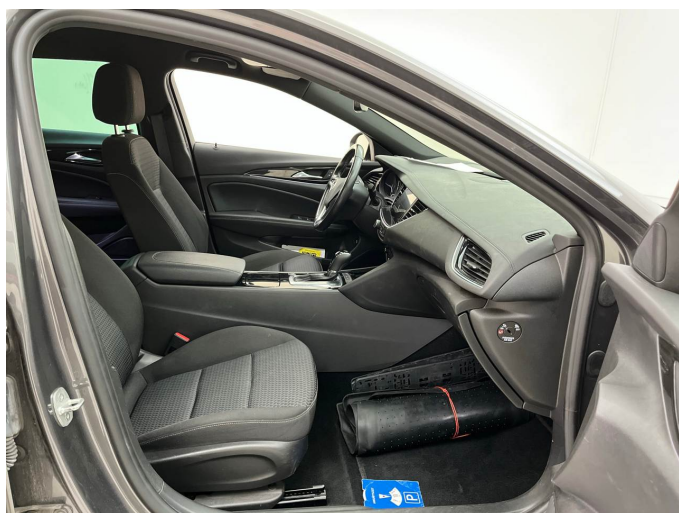


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

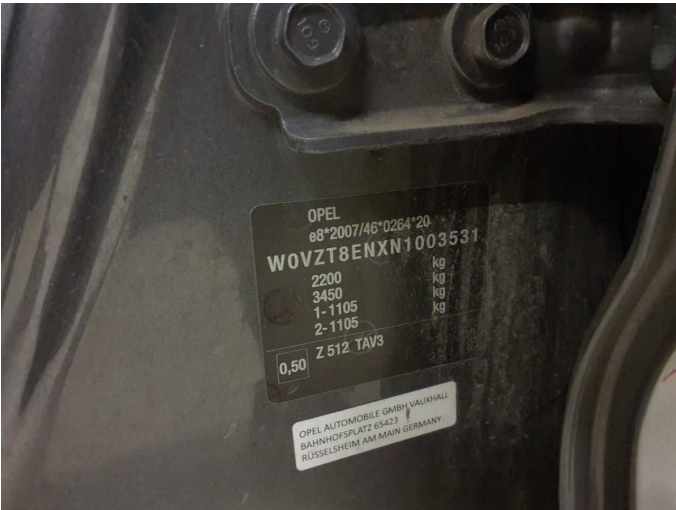


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

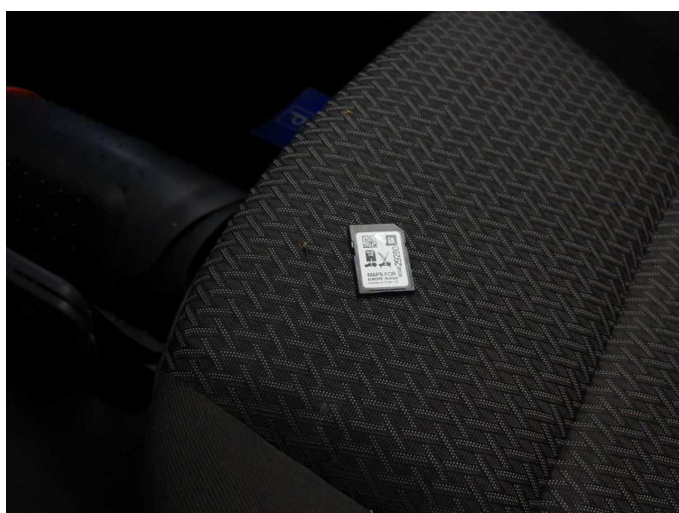


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

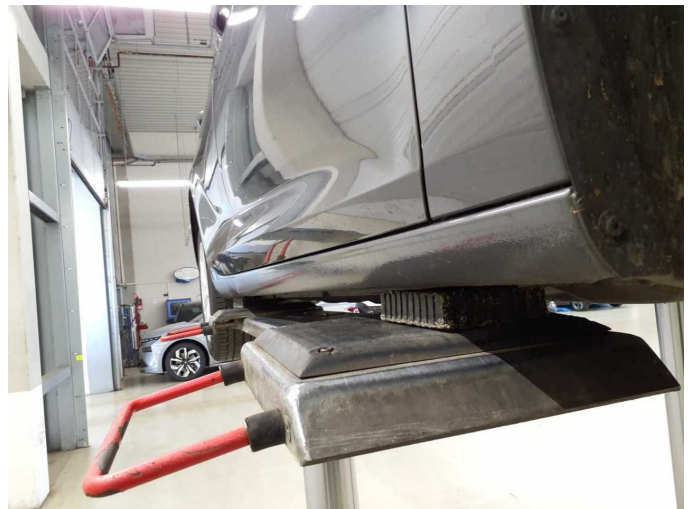


Figure 22: Misc.



Figure 23: Misc.



Damage 1: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 1: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 1: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Smart repair



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Smart repair




Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Smart repair



Damage 3: Roof: Roof - dent(s) - Smart repair



Damage 3: Roof: Roof - dent(s) - Smart repair

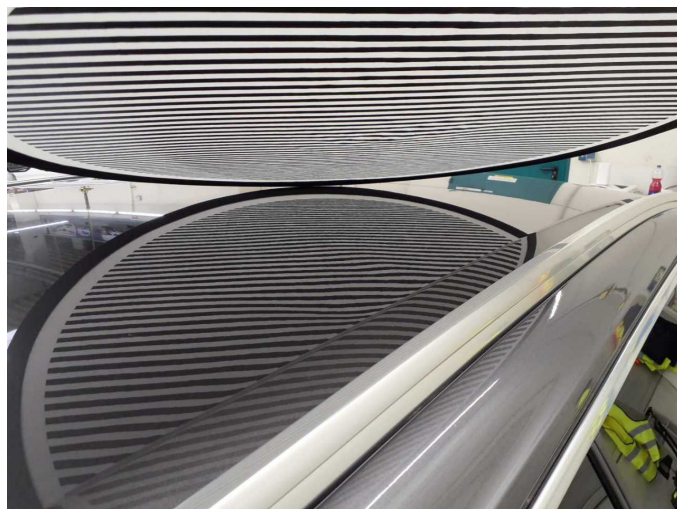

Damage 3: Roof: Roof - dent(s) - Smart repair




Damage 4: Engine: Engine - Leaking - Diagnosed and repair if necessary




Damage 5: Body: Underbody panelling (VM) - Broken / torn - Replace




Damage 5: Body: Underbody panelling (VM) - Broken / torn - Replace

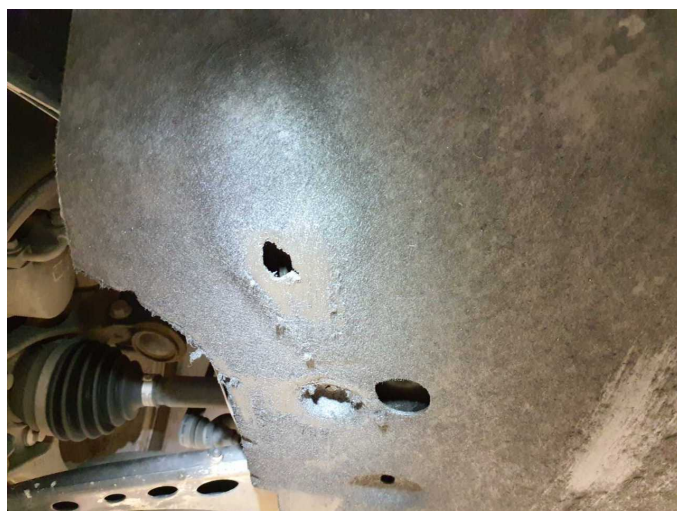

Damage 5: Body: Underbody panelling (VM) - Broken / torn - Replace

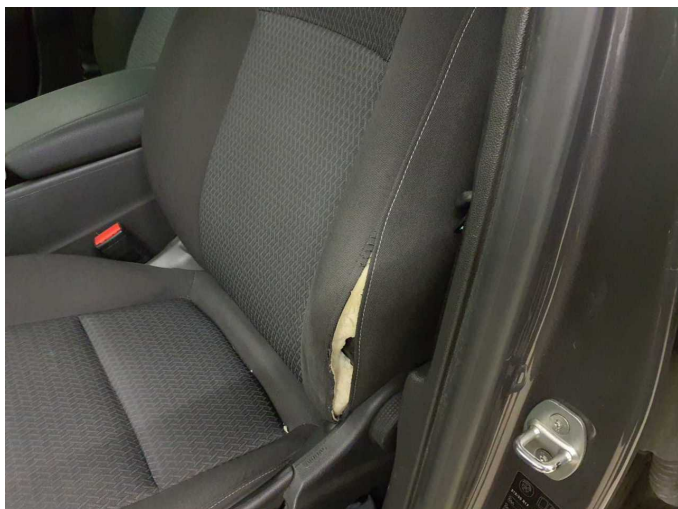

Damage 6: Seat - front: Backrest cover - left side (Inkl. Polster) - Broken / torn - Replace

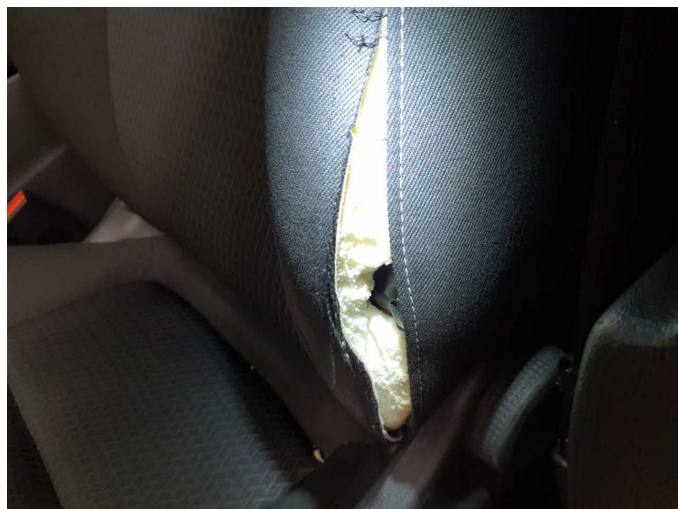

Damage 6: Seat - front: Backrest cover - left side (Inkl. Polster) - Broken / torn - Replace



Damage 7: Sill - right side: Sill - Deformed - Repair and paint



Damage 7: Sill - right side: Sill - Deformed - Repair and paint



Damage 8: Sill - left side: Sill - Deformed - Repair and paint



Damage 8: Sill - left side: Sill - Deformed - Repair and paint



Side panel - rear right side: 2,050 µm



Door - rear right side: 502 µm



Door - front right side: 228 µm