



Expertise

Protocol number: 46536184
Order No. / Reference: 26649007
Inspection date: 15 Jul 2026

Manufacturer: Opel

Model: Astra Sports Tourer 1.5 D Automatik Elegance

VIN: VXXKFCYHZTP1082394



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra Sports Tourer 1.5 D Automatik Elegance	
Vehicle Identification number	VXXKFCYHZTP1082394
Mileage (Read)	68,658 km
First registration	29 Nov 2023
Number of holders	1
Next periodical technical inspection	11/2026
(Report not on hand)	
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Karbon Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	22,900 km
Last service on / at	12/2025 at 61,656 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY764489
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / AEY 00087		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	225/45 R17 91Y	Summer tyres on Light alloy	5mm / 5mm
2)	225/45 R17 91Y	Summer tyres on Light alloy	6mm / 6mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 07/2028	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag: Front airbags, driver and front passenger
- Airbag: Front and rear outer head airbags
- Automatic activation of the hazard warning lights
- Exterior mirror housings in black
- On-board computer
- Roof rails
- Tachometer
- Electronic Stability Program (ESP) and Traction Control with engine and brake intervention (TCPlus)
- Transmission: 8-speed automatic transmission
- rear window wiper
- Cable set for trailer hitch
- Front headrests and 3 rear headrests, height adjustable
- LED ambient lighting
- LED headlights
- Illuminated makeup mirrors in both sun visors
- Center armrest, front and rear
- Multimedia infotainment system
- Electric parking brake
- Tire pressure monitoring system
- 180-degree reversing camera
- Keyless locking and starting system Keyless Open & Start
- safety net
- Start/Stop System
- Pre-wiring for ISOFIX child seat mounting system
- Central locking with remote control
- Airbag: Chest-pelvis-side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors, electrically adjustable, heated and folding
- Hill Start Assist
- third brake light
- Diesel particulate filter (DPF) maintenance-free
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Front collision warning system
- Back window, heater
- Interior rearview mirror, automatically dimming
- Dual-zone automatic climate control
- Paintwork: Roof in car color
- LED interior lighting
- Steering wheel: Leather steering wheel, flat-bottomed, perforated, with steering wheel remote control and paddle shifters
- Fog light
- Tire repair kit
- Wheels: Alloy wheels 7.5 J x 17 (5 spokes) in silver/black
- Rear seat backrest folds forward in a 40:20:40 split
- Seat belts: Three-point seat belts in all seats
- Solar Protect thermal insulation glazing
- 12V power outlet in the center console
- Electronic immobilizer

Extra equipment

- Paint finish: Metallic
- Seats: Ergonomic active driver's seat in Isabella fabric/premium leatherette (Elegance) (certified by the German Campaign for Healthy Backs (AGR) - adjustable length, height, tilt, backrest angle, and seat cushion angle - electro-pneumatically adjustable lumbar support (height and length adjustable) - extendable thigh support - pockets on the backs of the front seats, driver and front passenger - Isabella fabric/premium leatherette, black - heated front seats and steering wheel - heated ThermoTec windshield)
- Heated windscreen, ThermoTec
- Navigation system (Multimedia infotainment system with 10" color touchscreen display and 10" driver information display; navigation system with integrated memory; 3D map display for Europe and Russia; dynamic route guidance via map and/or arrow display and voice prompts; TomTom Online Traffic; online POI search and route guidance; parking information; fuel price information; live weather; over-the-air map updates; intelligent voice control; "Hey Opel" shortcut button; 6 functions; active route suggestions)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Door - rear right side	Door - dent(s) - Smooth repair work
3	Sill - left side	Sill - Scratch(es) - Smart repair
4	Door - front left side	Door edge - Scratched - Smart repair
5	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace
6	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
7	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratched - Replace
8	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace
9	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Rear shelf

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer	1.581,07 €

Repainting

No.	Repainting
1	Mudguard - left side

Paint coat thickness measurement

Mudguard - left side	236 µm
----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand.
Schadenausweitung möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

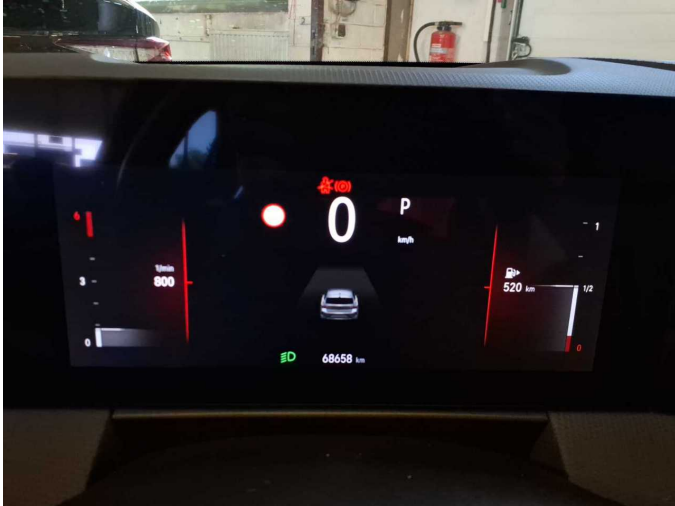


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

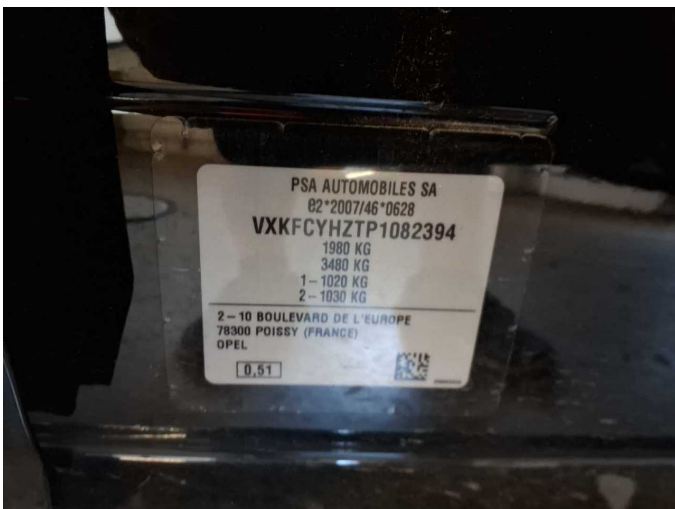


Figure 11: VIN



Figure 12: Mounted tyres

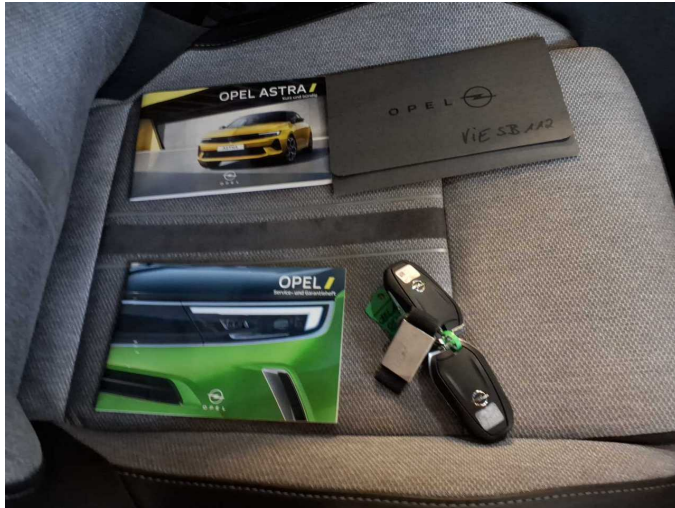


Figure 13: Documents

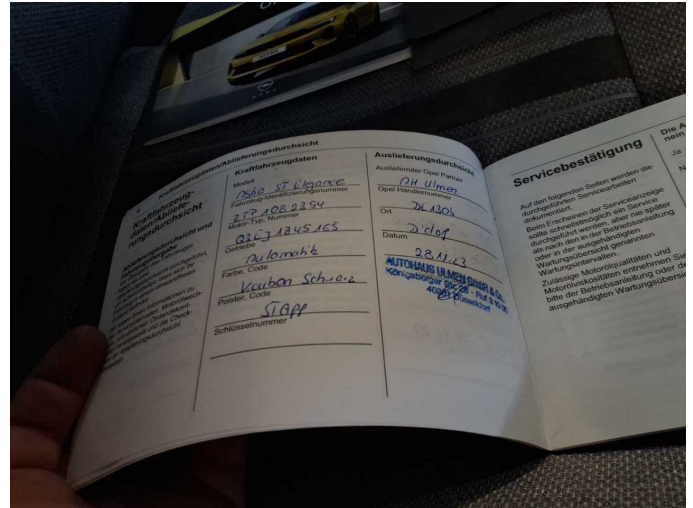


Figure 14: Documents

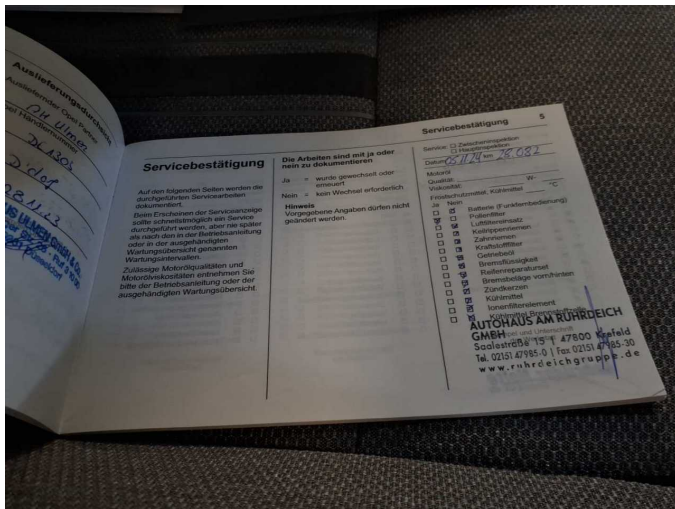


Figure 15: Documents

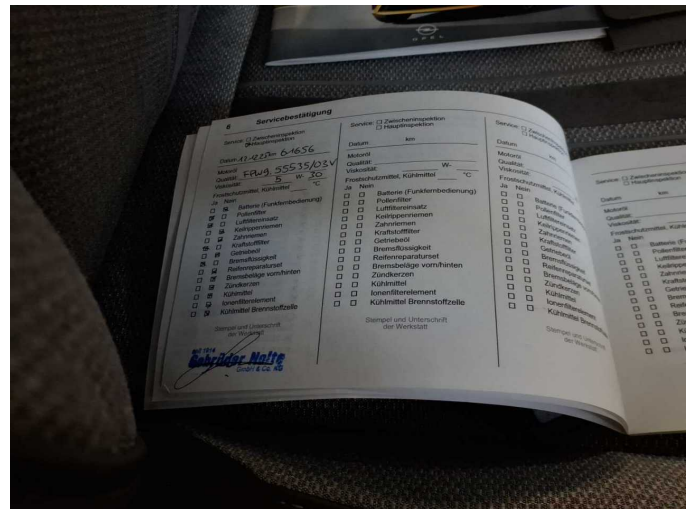


Figure 16: Documents

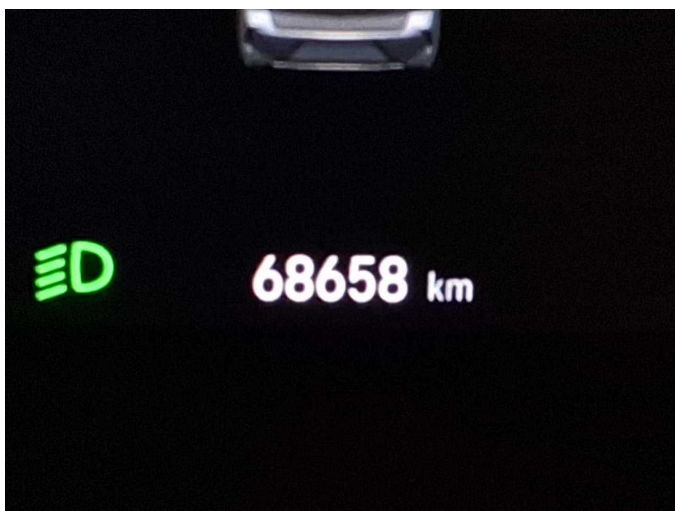


Figure 17: Documents



Figure 18: Documents

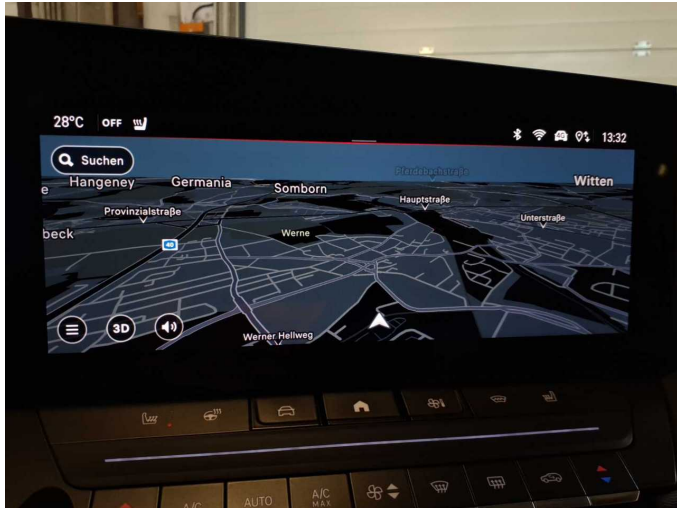


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

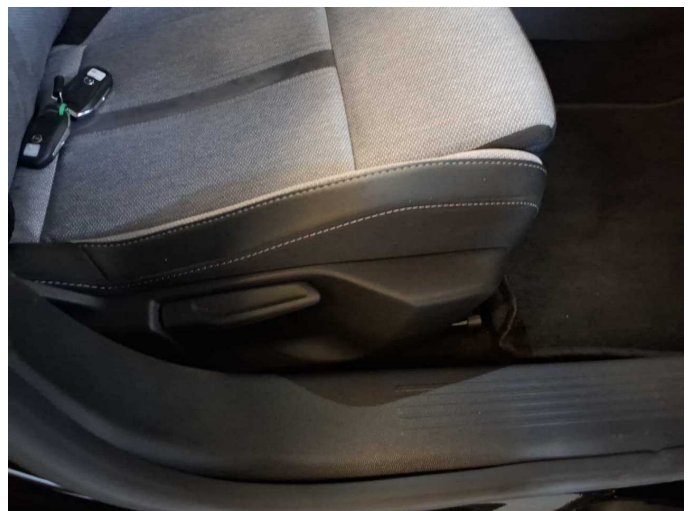


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.




Damage 1: Roof: Roof - dent(s) - Smooth repair work



Damage 1: Roof: Roof - dent(s) - Smooth repair work

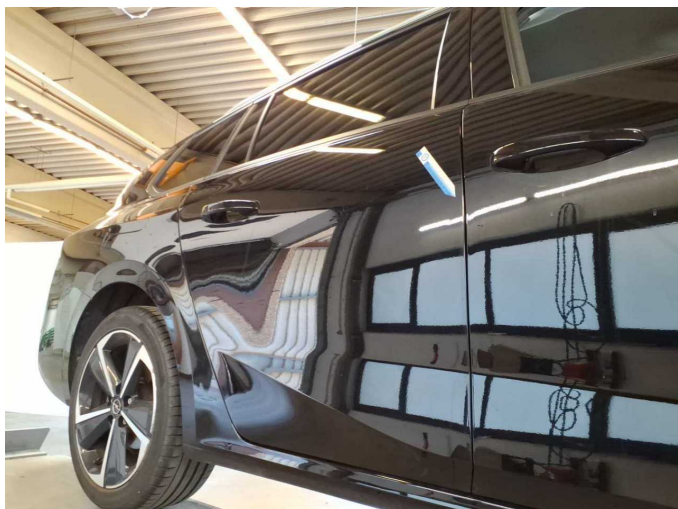


Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work

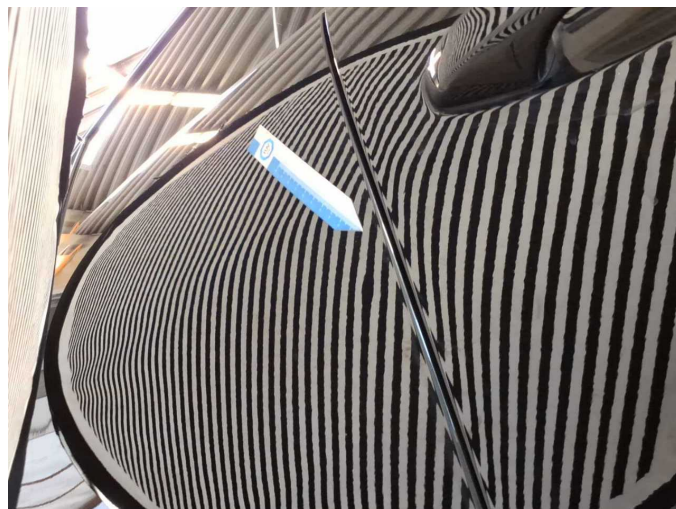

Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair

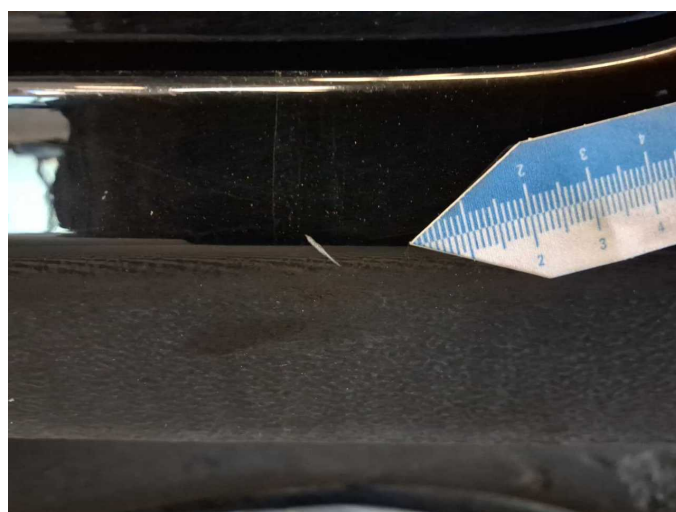

Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door edge - Scratched - Smart repair

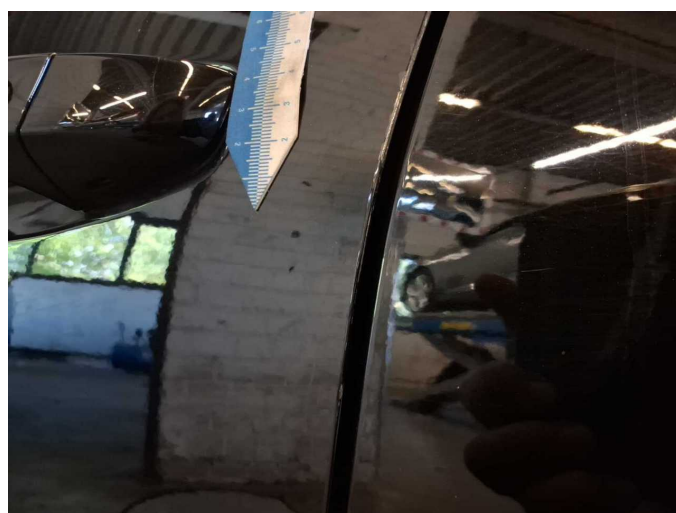

Damage 4: Door - front left side: Door edge - Scratched - Smart repair



Damage 4: Door - front left side: Door edge - Scratched - Smart repair




Damage 5: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace



Damage 5: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value

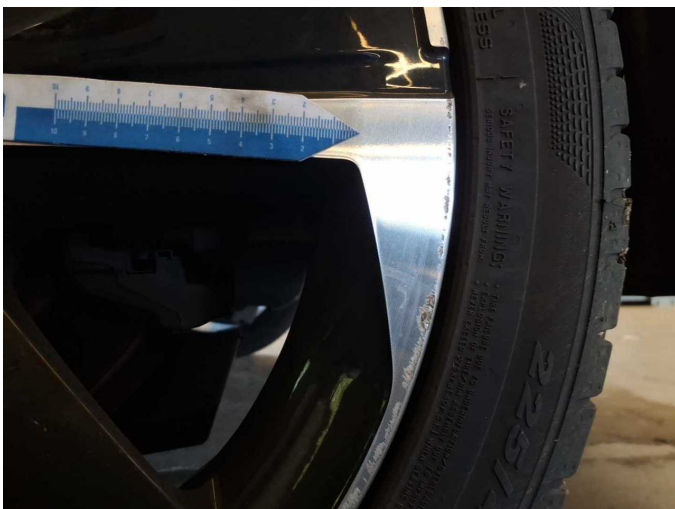

Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

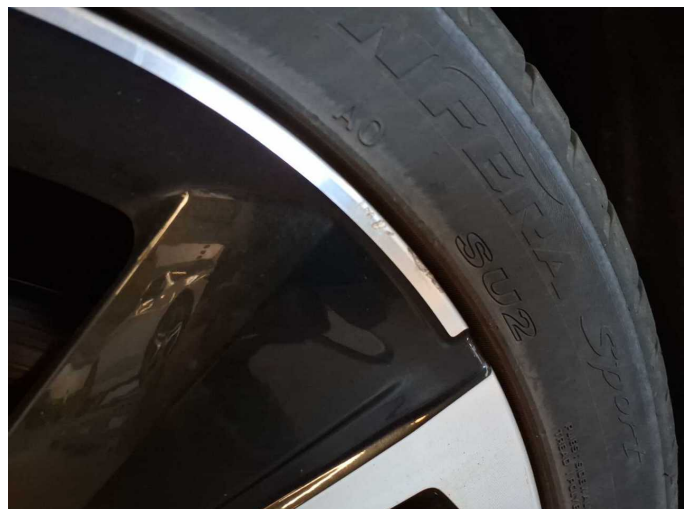

Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 9: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

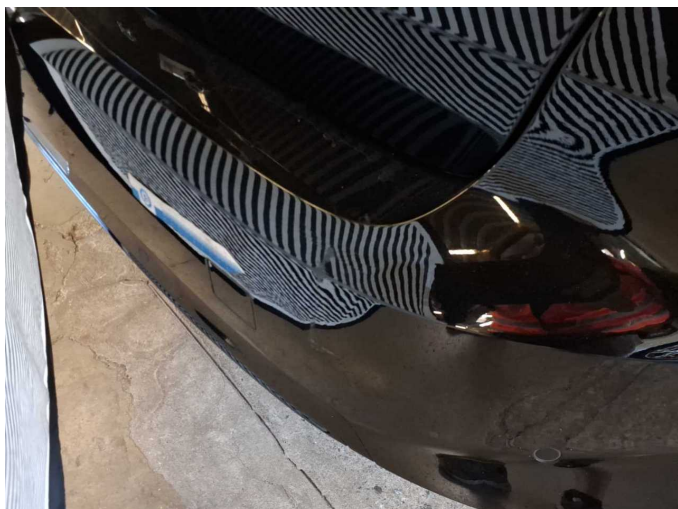

Damage 9: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 9: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

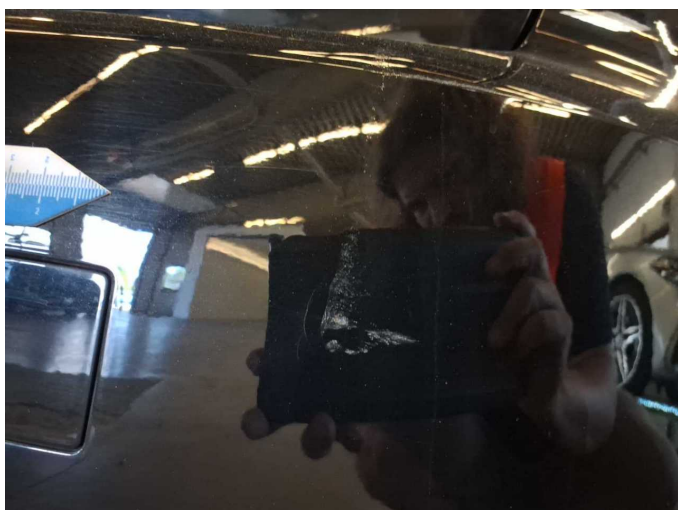

Damage 9: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 9: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

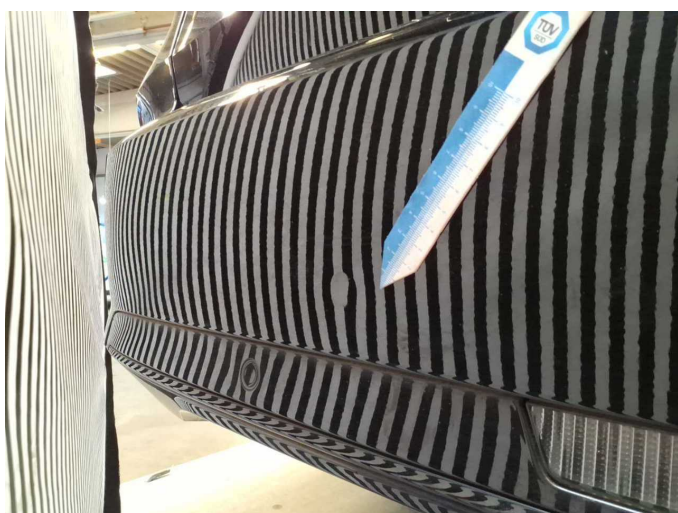

Damage 9: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction




Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Wear and tear 1: Body: Underbody panelling - Scratched - No deduction



Missing part 1: Interior: Rear shelf - Missing - Replace

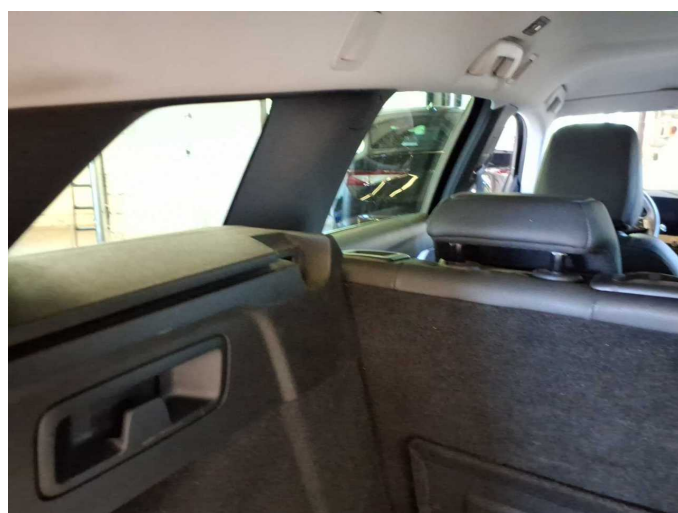

Missing part 1: Interior: Rear shelf - Missing - Replace



Missing part 1: Interior: Rear shelf - Missing - Replace



Repainting 1: Mudguard - left side



Repainting 1: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VXXFCYHZTP1082394

Hersteller / Modell: OPEL OPEL Astra Sports Tourer 1.5 D Automatik Elegance

Datum	KM-Stand	Beschreibung
12.12.2025	61.656	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.10.2025	62.105	Bremsklötze vorne
05.11.2024	28.082	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.04.2024	12.089	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges