



Expertise

Protocol number: 46732163
Order No. / Reference: 26396987-1
Inspection date: 21 Jul 2026

Manufacturer: Ford

Model: Kuga 2.0 EcoBlue Aut. TITANIUM

VIN: WF0FXXWPMFPP43875



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.0 EcoBlue Aut. TITANIUM	
Vehicle Identification number	WF0FXXWPMFPP43875
Mileage (Read)	158,352 km
First registration	9 Apr 2024
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	88 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 %
Last service on / at	03/2026 at 141,472 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GX245089
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BYF 00007		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102H	Winter tyres on Light alloy	Goodyear	3mm / 3mm
2)	225/65 R17 102H	Winter tyres on Light alloy	Goodyear	3mm / 2mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 106V	Summer tyres (Without wheel rim)	Pirelli	4mm / 4mm
2)	225/65 R17 106V	Summer tyres (Without wheel rim)	Pirelli	5 mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	165/70 R17 114M	Summer tyres on Steel	Maxxis	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Ambient lighting at the front
- Electrically adjustable, heated and folding exterior mirrors (painted in body color - with integrated turn signals and ambient lighting)
- Tires: Tire repair kit (maximum speed 80 km/h when used)
- Fabric headliner
- Roof spoiler (painted in car color)
- 12.3-inch digital instrument panel
- Electronic Stability Program (ESP) (with hill start assist, traction control and emergency brake assist)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford Easy Fuel (Ford Easy Fuel comfort refueling system (Eliminates the need for a separate internal fuel cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover, roller blind, removable
- Luggage compartment lighting
- Cruise control
- Transmission: 8-speed automatic
- Illuminated glove compartment
- rear window wiper
- Intelligent Protection System (IPS) (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - warning system for unfastened seat belts in the front and in the 2nd row)
- LED taillights
- Steering column, adjustable in height and reach
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Front and rear parking pilot system
- Upholstery: Cloth
- Post-Collision Assist
- Pre-Collision Assist (including Forward Alert system with pedestrian and bicycle detection)
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlights with delayed shut-off
- Power steering (electro-mechanical, speed-dependent (EPAS - Electric Power Assisted Steering))
- Seats: Driver's seat, 8-way manually adjustable, including adjustable lumbar support
- Seats: Backrest for front passenger, adjustable tilt
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Power outlet: 12-volt connection in the luggage compartment
- Anti-lock braking system
- Passenger airbag deactivation
- Tires: 7 J x 17 alloy wheels (4) in 5x2-spoke design (with 225/65 R 17 tires)
- third brake light
- Roof rails, silver-colored
- Diesel particulate filter
- Tachometer
- Selective driving mode switch (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Roads)
- Electric front and rear windows with all-around closing function
- Ford EcoCoach (shows the efficiency of current driving behavior)
- Ford Power Start function & Ford Key Free system (keyless locking/unlocking)
- FordPass Connect including eCall, Live Traffic information (information about the current status or location of the vehicle, as well as control of selected vehicle functions via a compatible smartphone with the FordPass app - Real-time traffic information)
- Heated rear window
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Front and rear headrests (5) height adjustable
- Paint finish: Solid
- Steering wheel: Steering wheel, 3-spoke design, Sensico in leather look
- Front center console with integrated armrest (2 front cup holders)
- Navigation system: Ford navigation system including Ford SYNC 3 (AppLink, Android Auto, Apple CarPlay - 8" touchscreen (20.3 cm screen diagonal) - DAB/DAB+ radio reception (Digital Audio Broadcasting) - 6 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - USB port - Voice control for audio and telephone - Acoustic and visual route guidance - Dynamic navigation with enhanced traffic information system - Lane guidance - Road map for Europe)
- Rear view camera
- Projection lens headlights with LED daytime running lights
- Headlight assistant with day/night sensor
- Seats: Passenger seat, 8-way manually adjustable (including adjustable lumbar support)
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Driver's backrest, adjustable tilt
- Seats: Front sports seats with integrated headrests
- Start-stop system
- Carpet floor mats front and rear, velour
- Variable radiator air intake



- Immobiliser

- Central locking with remote control and remote luggage compartment release

Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Electric tailgate, sensor-controlled (opens via foot movement)
- Package: Winter I (Heated windscreen - Heated leather steering wheel)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Tires: Spare wheel (T165/70 R17 tire - instead of tire repair kit - permissible at max. 80 km/h when used)
- Package: Technology (Adaptive LED headlights with glare-free high beam assist and dynamic cornering lights, automatic headlight range control and LED fog lights - Head-up display)
- Safety partition net for attachment behind the 2nd row of seats (including attachment points behind the first and second rows of seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (1. und 3. Wartung überzogen)
2	Door - rear left side	Door edge - Scratch(es) - Smart repair
3	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
4	Wing mirror - left side	Mirror glass - Scratch(es) - Replace
5	Door - rear right side	Door - dent(s) - Smooth repair work
6	Side panel - rear right side	Sill - dent(s) - Smart repair
7	Rear bumper	Rear bumper (unpainted) - Scratch(es) - Loss in value
8	Body	Body (Flugrost) - Stone chips - Conditioning
9	Misc.	Inspection / maintenance - Due - Perform
10	Boot lid / rear door	Boot lid - Corrosion - Repair and paint
11	Bonnet	Bonnet - Stone chips - Paint
12	Vehicle glazing	Windscreen - Stone chips - Replace
13	Roof	Roof (+ Kratzer, beginnende Korrosion) - Dent / paintcoat damage - Paint
14	Front bumper	Front bumper (Inklusive anbauteile) - Broken / torn - Replace



Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
2	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
3	Wing mirror - right side	Cap - Scratch(es) - No deduction
4	Wheel / tyres	Tyres - complete set - Worn - No deduction
5	Wheel / tyres	Tyre - front right side (Über 2mm) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - 1 tyre

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Der montierte Reifensatz ist kein Bestandteil des Auslieferungsumfangs.
- Felgen der Winterräder gehören zu den Sommerreifen

Minderwerte höher als HEK



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

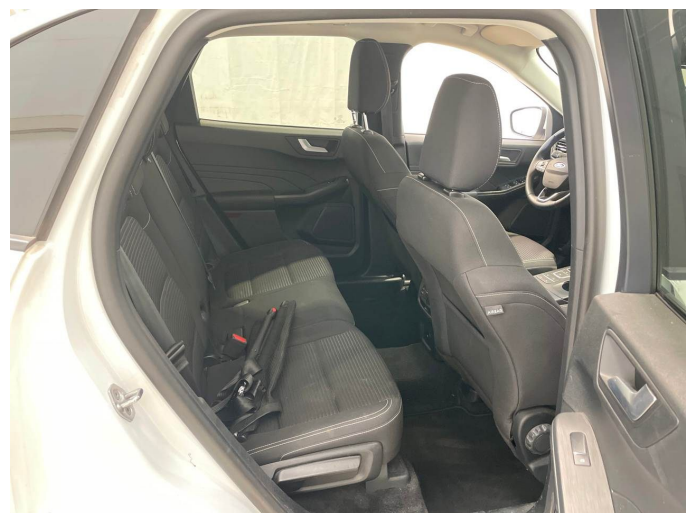


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

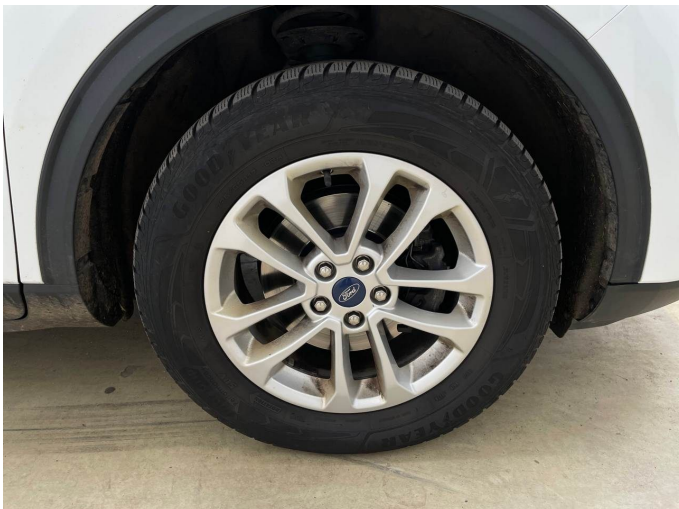


Figure 12: Mounted tyres

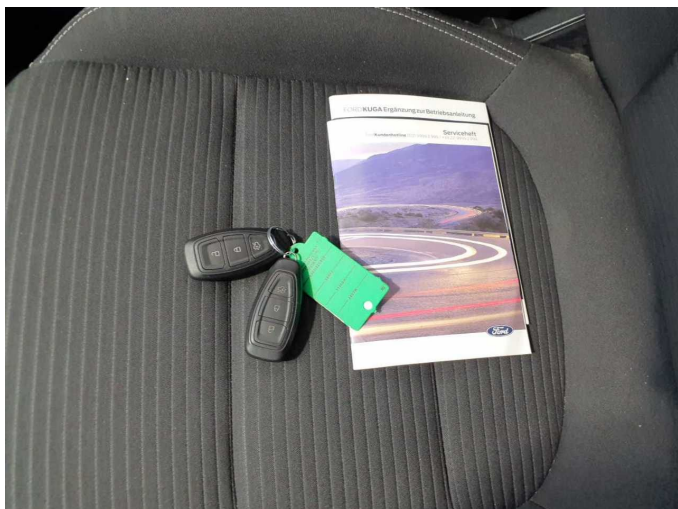


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation

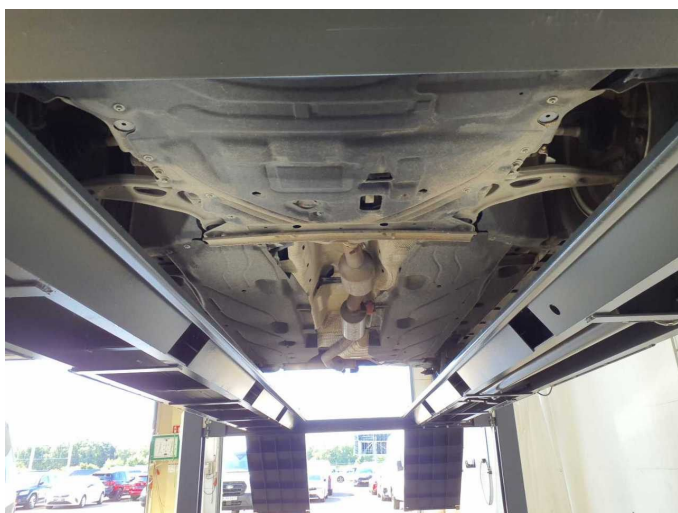


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

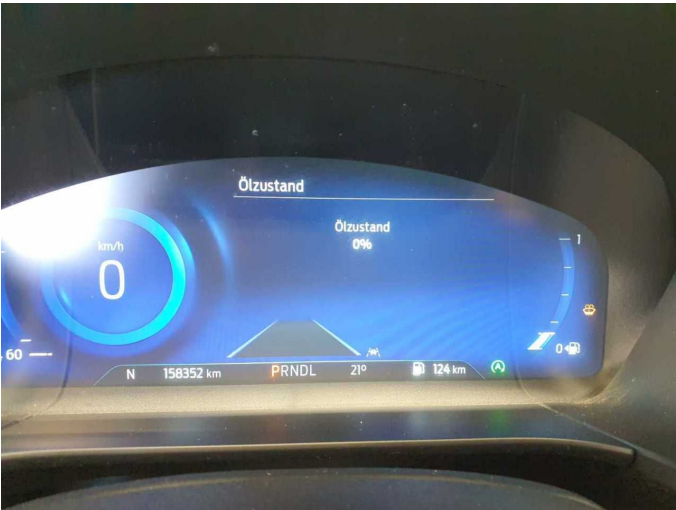


Figure 23: Misc.

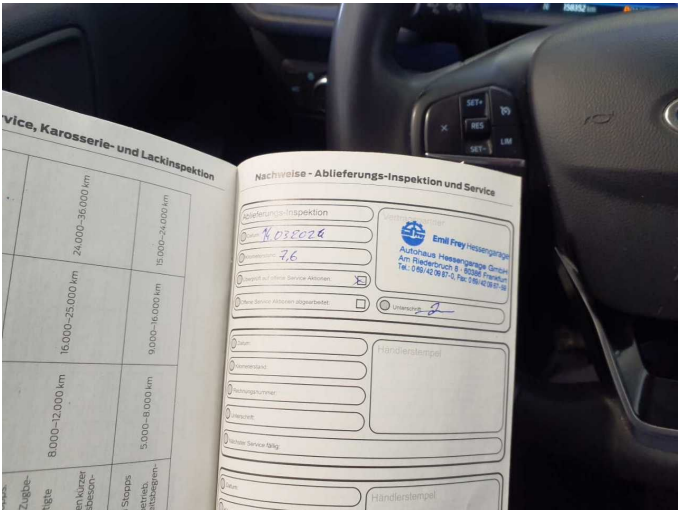


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

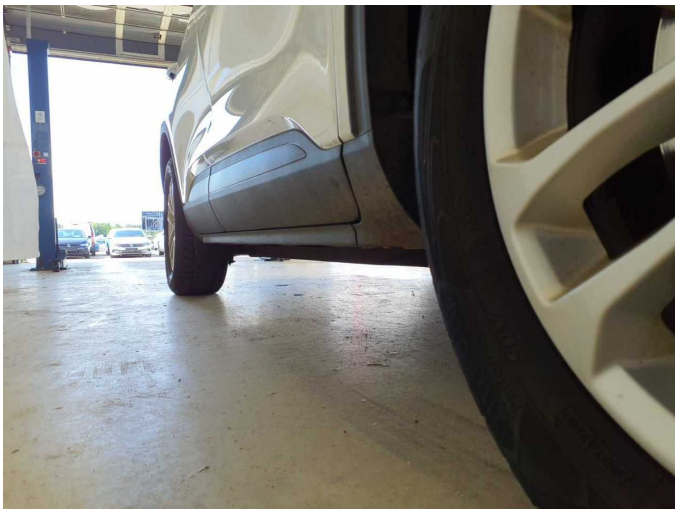


Figure 27: Misc.



Figure 28: Misc.

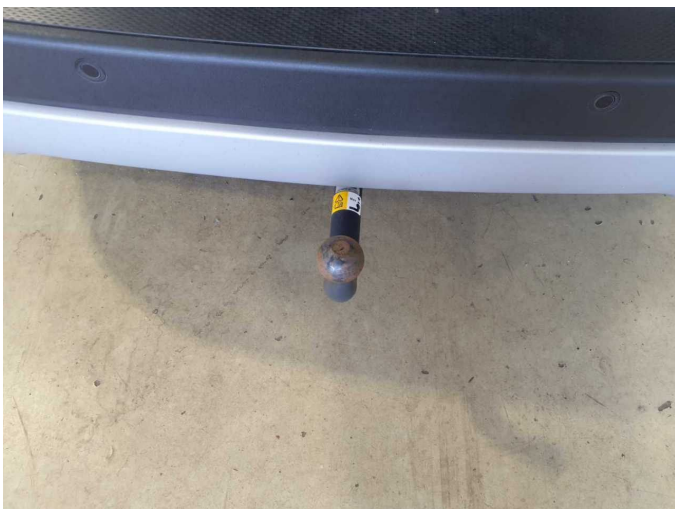



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

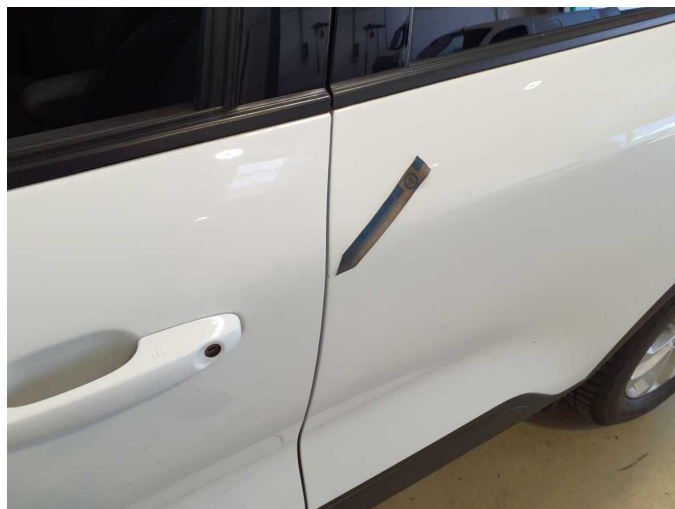

Damage 2: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 3: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 4: Wing mirror - left side: Mirror glass - Scratch(es) - Replace



Damage 4: Wing mirror - left side: Mirror glass - Scratch(es) - Replace



Damage 5: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 5: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 6: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 6: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 7: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value




Damage 7: Rear bumper: Rear bumper (unpainted) - Scratch(es) - Loss in value




Damage 8: Body: Body (Flugrost) - Stone chips - Conditioning




Damage 8: Body: Body (Flugrost) - Stone chips - Conditioning

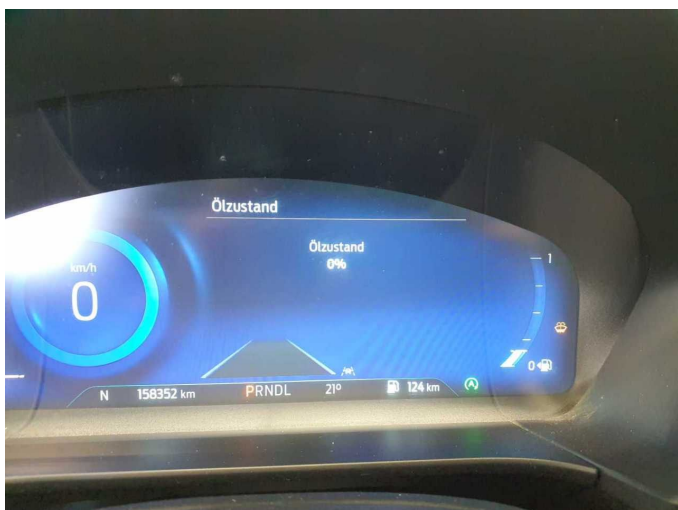

Damage 9: Misc.: Inspection / maintenance - Due - Perform

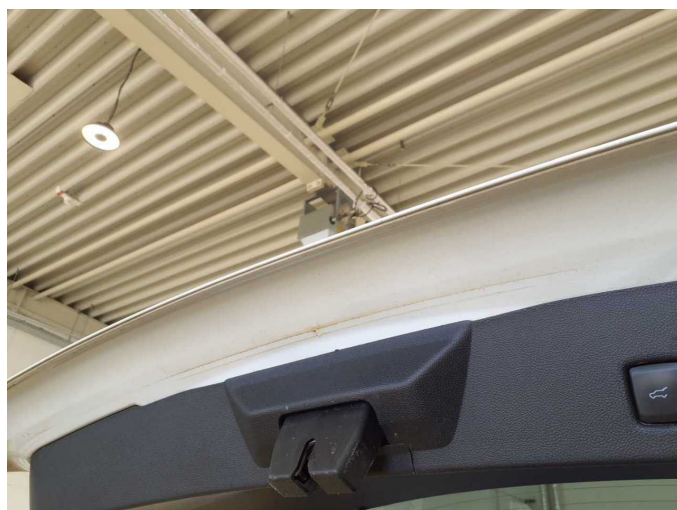

Damage 10: Boot lid / rear door: Boot lid - Corrosion - Repair and paint

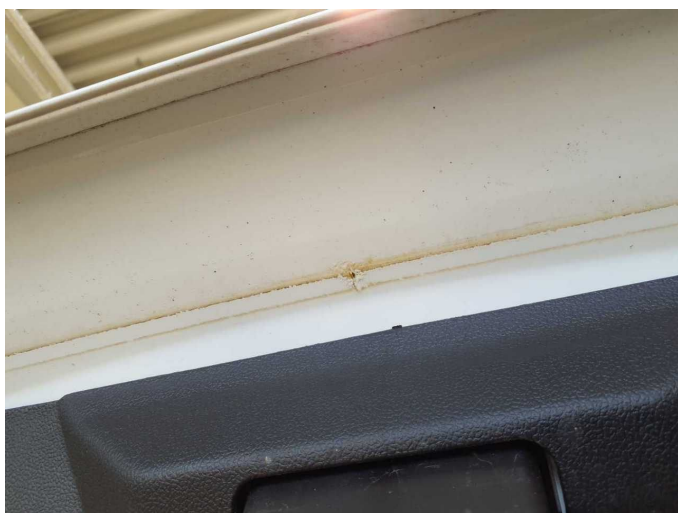

Damage 10: Boot lid / rear door: Boot lid - Corrosion - Repair and paint



Damage 11: Bonnet: Bonnet - Stone chips - Paint



Damage 11: Bonnet: Bonnet - Stone chips - Paint




Damage 11: Bonnet: Bonnet - Stone chips - Paint




Damage 11: Bonnet: Bonnet - Stone chips - Paint



Damage 12: Vehicle glazing: Windscreen - Stone chips - Replace

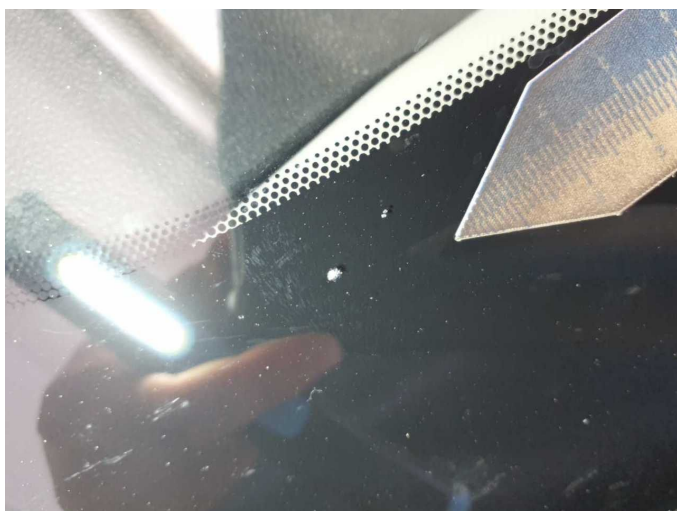

Damage 12: Vehicle glazing: Windscreen - Stone chips - Replace

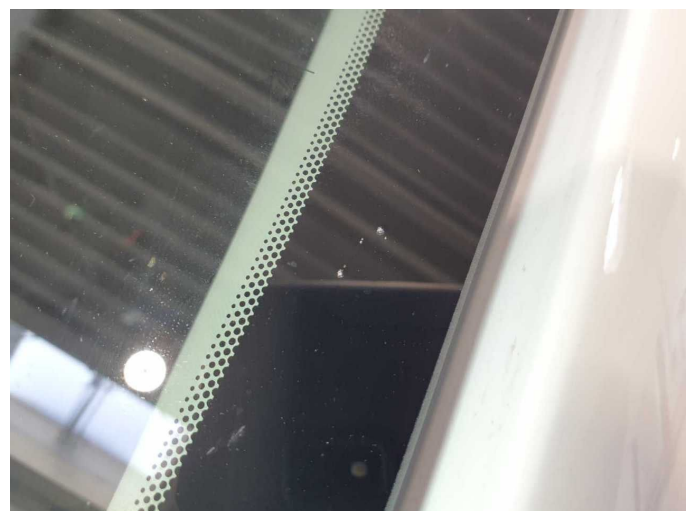

Damage 12: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 12: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 13: Roof: Roof (+ Kratzer, beginnende Korrosion) - Dent / paintcoat damage - Paint



Damage 13: Roof: Roof (+ Kratzer, beginnende Korrosion) - Dent / paintcoat damage - Paint



Damage 13: Roof: Roof (+ Kratzer, beginnende Korrosion) - Dent / paintcoat damage - Paint



Damage 14: Front bumper: Front bumper (Inklusive anbauteile) - Broken / torn - Replace



Damage 14: Front bumper: Front bumper (Inklusive anbauteile) - Broken / torn - Replace



Damage 14: Front bumper: Front bumper (Inklusive anbauteile) - Broken / torn - Replace



Damage 14: Front bumper: Front bumper (Inklusive anbauteile) - Broken / torn - Replace