



Expertise

Protocol number: 46778954
Order No. / Reference: 26747475
Inspection date: 29 Jul 2026

Manufacturer: Seat

Model: Ateca 2.0 TDI FR

VIN: VSSZZZ5FZM6566714



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Ateca 2.0 TDI FR	
Vehicle Identification number	VSSZZZ5FZM6566714
Mileage (Read)	120,191 km
First registration	19 Jul 2021
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Rodium Gray (F7Y)
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	10,600 km
Last service on / at	03/2026 at 106,316 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GW404717
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7593 / AMQ 00122		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,990 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R18 92V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	215/50 R18 92W	Summer tyres on Light alloy	Bridgestone	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	125/70 R18 99M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V socket at the front
- Storage compartment in the middle area of the lower dashboard
- Storage pocket on the back of the front seats
- Electrically adjustable, folding and heated exterior mirrors (turn signals integrated into exterior mirrors)
- Exterior mirror housings in Cosmo Grey
- Outdoor temperature display
- On-board computer
- Roof rails in black
- Electronic differential lock (XDS)
- Three-point automatic seat belts, front and rear, with belt tensioners (with warning buzzer for unfastened seat belts)
- Electronic parking brake including auto-hold function
- Electric windows front and rear (with anti-pinch protection and one-touch function at the front)
- Luggage compartment cover
- Transmission: 6-speed transmission
- LED taillights
- Rear spoiler in car color
- Body covers on the wheel arches
- Climatronic air conditioning system with electronic temperature control (separate temperature control for driver and front passenger)
- Center console with integrated storage compartment, center armrest, cup holders and rear air vents
- Fog lights with cornering light function in LED technology
- Package: LED interior lighting (consisting of LED technology for: - Ambient lighting (multicolor) in the door trim - Ambient lighting front - Footwell lighting - Trunk lighting - Reading lights, 2 front / 2 rear - Make-up mirror lighting)
- Tire Pressure Monitoring System (TPMS)
- Wheels: 4 light alloy wheels "Performance III" (7J x 18 with tires 215/50 R 18)
- Wheels: Tyre fit
- Rear view camera
- Keyless locking and starting system "Kessy"
- SEAT CONNECT (prepared for the use of mobile online services)
- Side windows from the 2nd row of seats and rear window are dark tinted.
- Electromechanical power steering
- Seats: Driver's seat with height adjustment
- Sport pedals in aluminum look
- Start-stop technology
- Front door sill trims in aluminum look, illuminated
- Lashing eyes in the luggage compartment
- Full LED headlights (low beam and high beam in LED technology - dynamic headlight range control)
- Electronic immobilizer
- Thermal insulation glazing
- Central locking, including tailgate, with remote control
- Storage compartment for sunglasses on the driver's side
- Storage compartment in the front doors
- Storage compartment under the driver's seat
- Airbags (driver and front passenger airbag (passenger airbag deactivation) - side airbag for driver and front passenger - head airbag system, front and rear - driver's side knee airbag)
- Hill Start Assist (HHC)
- Chrome applications in the interior
- Diesel particulate filter and SCR catalyst
- Tachometer
- Third brake light, integrated into the tailgate
- Rear parking sensors
- Electronic Stability Control (ESC) (including Anti-lock Braking System (ABS) and Traction Control System (ASR))
- Gear recommendation display
- Cruise control system (CCS)
- Illuminated glove compartment
- Rear window wiper and rear window heater
- ISOFIX child seat restraint system (in the 2nd row, left and right, including top tether anchor points)
- Headrests, 2 front, 3 rear
- Steering wheel: Multifunction steering wheel in leather
- Armrest - centre, rear
- Multifunction display with multi-color screen
- Fatigue detection
- Emergency call service
- Upholstery: Cloth
- Radio: Digital radio reception DAB+
- Radio: Media System Plus Style, Xperience, FR (Audio system with 8.25" color touchscreen - USB and Aux-in interface - 2 USB charging ports for the 2nd row of seats - Bluetooth interface with integrated hands-free system and audio streaming - 8 speakers - Multifunction display with multi-color screen in the instrument panel - Emergency call service)
- Rear seat backrest asymmetrically split and foldable
- "FR" lettering on tailgate
- SEAT Drive Profile with "Driving Experience" button and progressive steering (driving profiles can be individually selected - selected driving profile influences steering assistance, throttle response and shift characteristics (with DSG))
- Seats: Lumbar support for driver and front passenger with height adjustment for front passenger seat
- LED daytime running lights
- Front Assist area monitoring system with City Emergency Braking function (If the distance to the vehicle in front decreases and the driver does not react, the Front Assist area monitoring system automatically brakes the vehicle. The City Emergency Braking function detects pedestrians on the road and automatically activates the brakes.)



Extra equipment

- Deletion of the lettering on the tailgate
- Paint finish: Metallic
- Package: Dinamica (Seat center panel in Dinamica microfiber, black - Comfort seats front)
- Package: Light and Sight (Automatic Coming Home and Leaving Home function - Automatically dimming interior mirror - Light sensor with automatic headlight control - Rain sensor)
- Panoramic glass sliding roof, electric, including sunshade blind.
- Chassis: Adaptive chassis control DCC
- Package: Business Package INFOTAIN (Navigation system - BeatsAudio sound system - Full Link: MirrorLink, Android Auto, Apple CarPlay - Digital radio reception DAB+ - Wireless charger in the storage compartment of the center console - Spare wheel as emergency wheel)
- Package: Winter (multifunction leather steering wheel, heated - heated front seats)
- Park Assist with front and rear parking aid
- Variable luggage compartment floor with storage compartments in the luggage compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Indicator - front	Mirror - right side - Scratch(es) - Replace
4	Door - front left side	Door - Dent / paintcoat damage - Smart repair
5	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
6	Tail light	Tail lamp - right side - Scratch(es) - Replace
7	Boot lid / rear door	Rear spoiler (Anätzung) - Paint defect - Lacquer
8	Front bumper	Front bumper (Inklusive anbauteile) - Scratch(es) - Paint
9	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
12	Bonnet	Bonnet - Corrosion - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Deformed - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Front bumper	Spoiler - Scratch(es) - No deduction
4	Door - rear right side	Door - Scratch(es) - Cover / polish

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

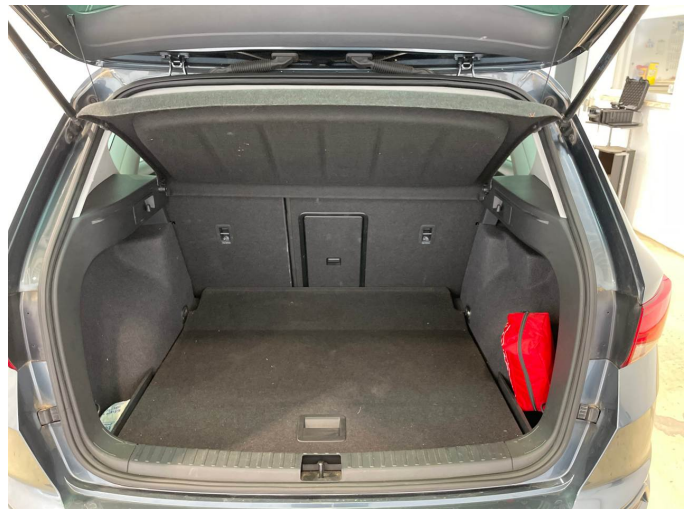


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

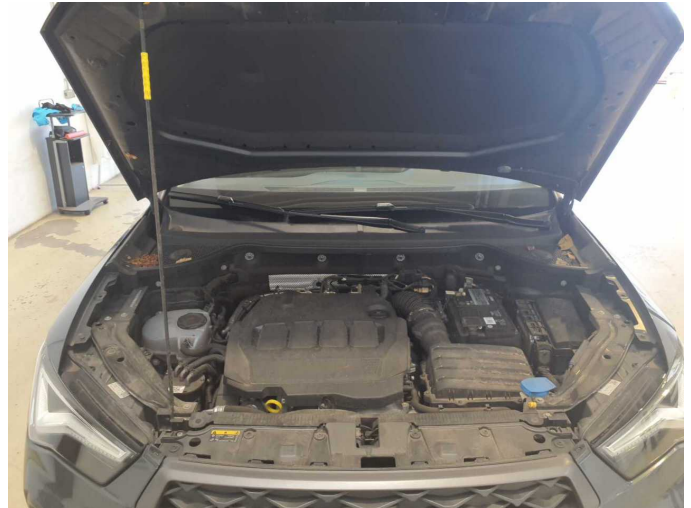


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

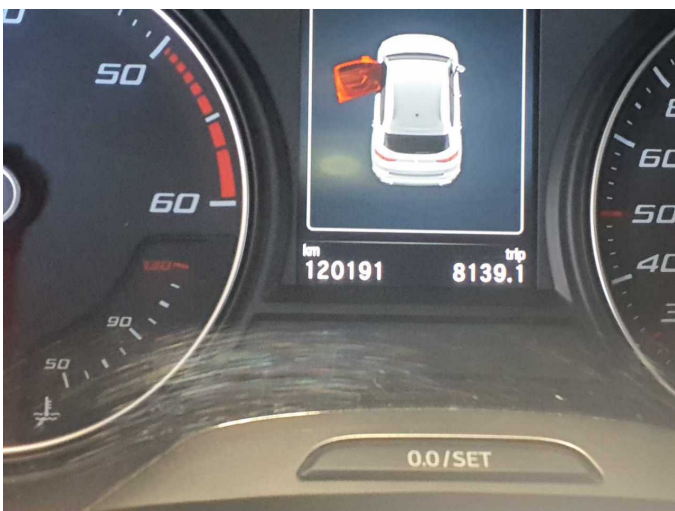


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

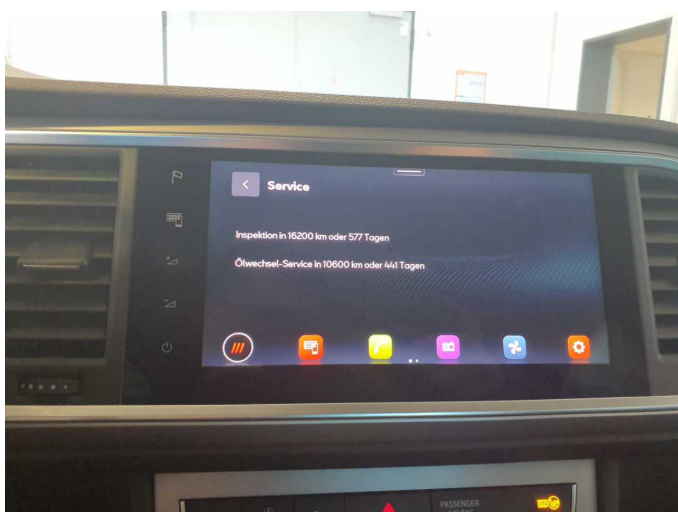


Figure 27: Misc.


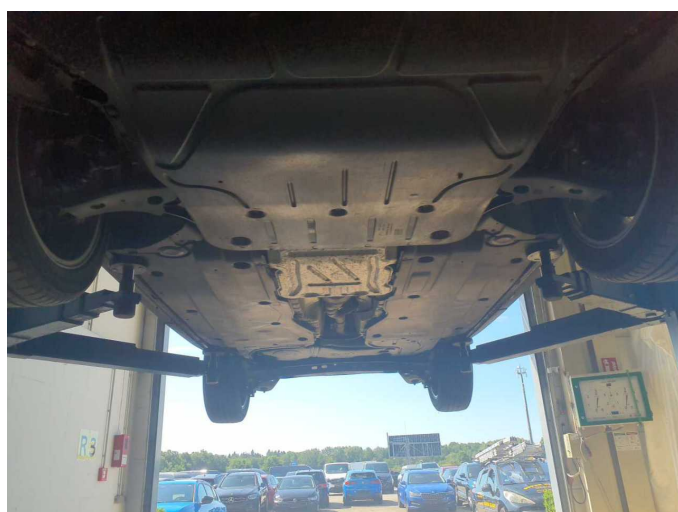


Figure 28: Misc.



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair

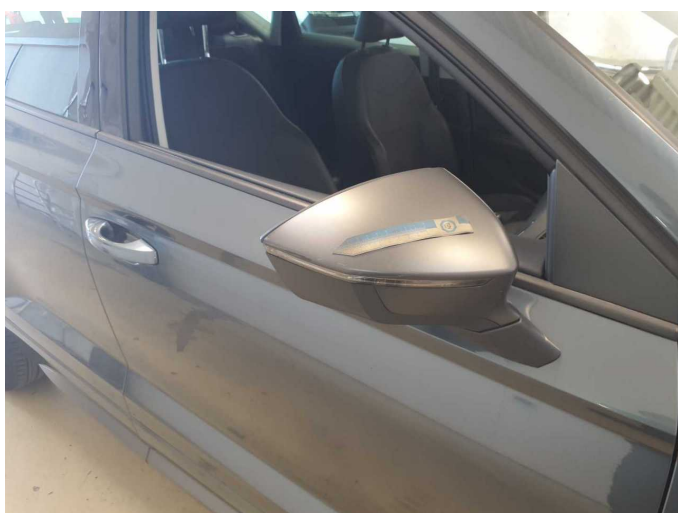

Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 3: Indicator - front: Mirror - right side - Scratch(es) - Replace



Damage 3: Indicator - front: Mirror - right side - Scratch(es) - Replace




Damage 4: Door - front left side: Door - Dent / paintcoat damage - Smart repair

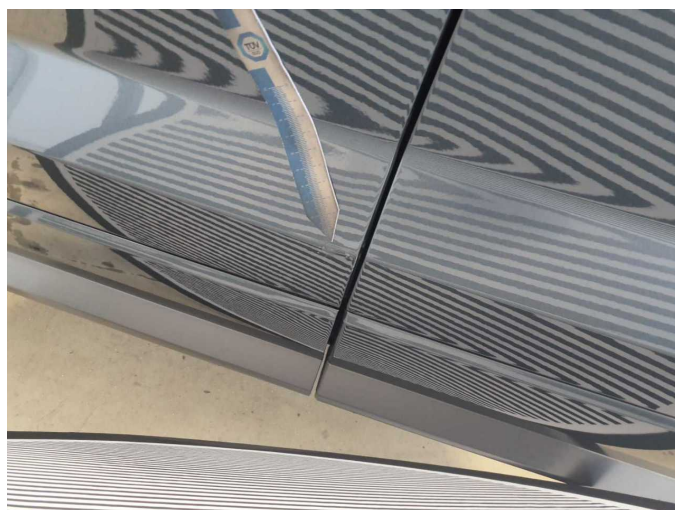

Damage 4: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - front left side: Door - Dent / paintcoat damage - Smart repair

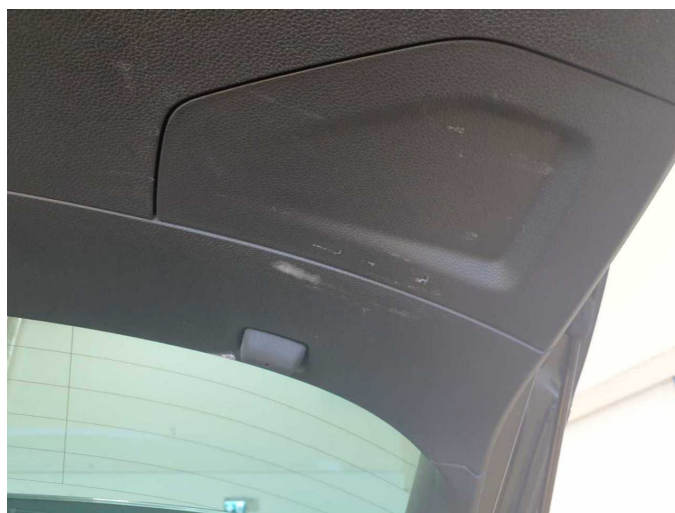


Damage 5: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace




Damage 5: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 6: Tail light: Tail lamp - right side - Scratch(es) - Replace

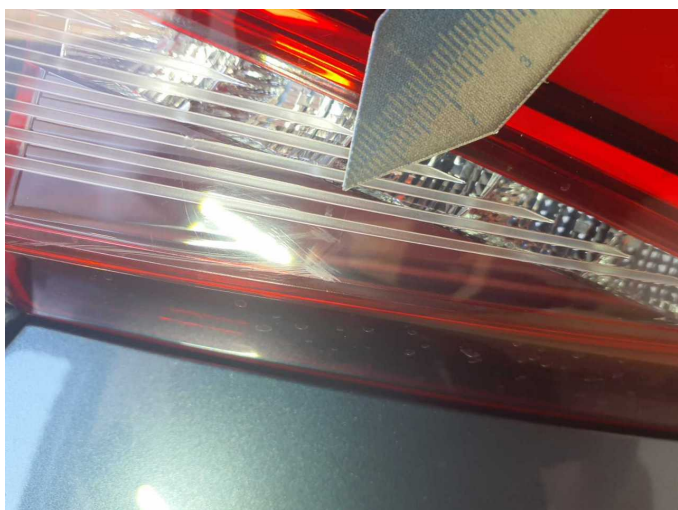

Damage 6: Tail light: Tail lamp - right side - Scratch(es) - Replace

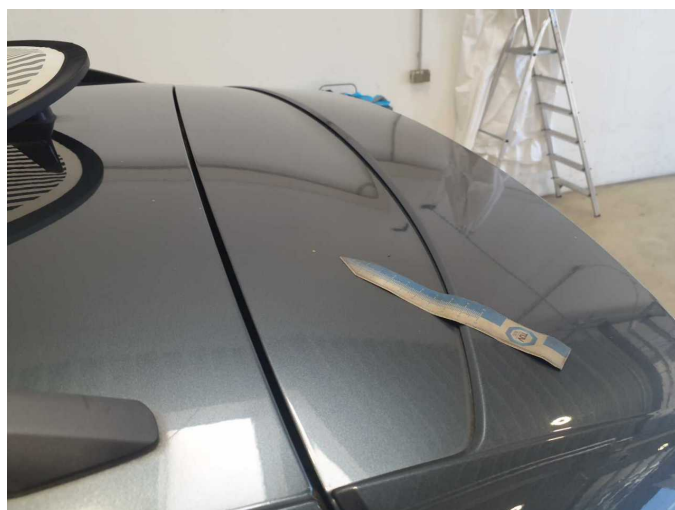

Damage 7: Boot lid / rear door: Rear spoiler (Anätzung) - Paint defect - Lacquer



Damage 7: Boot lid / rear door: Rear spoiler (Anätzung) - Paint defect - Lacquer




Damage 8: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint



Damage 8: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint



Damage 8: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint

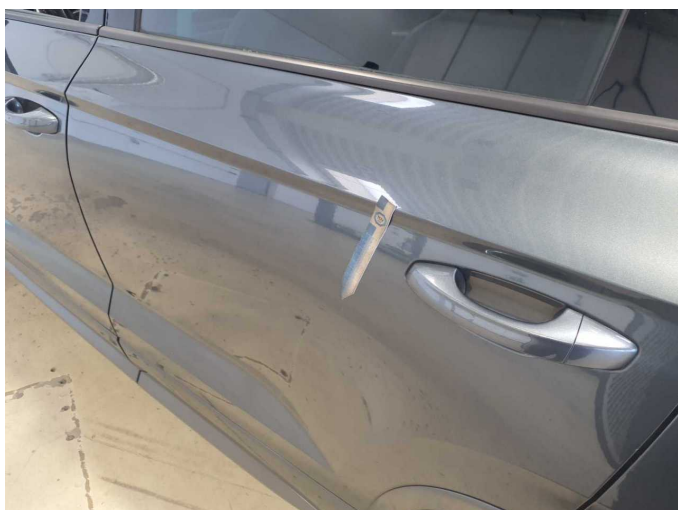

Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 12: Bonnet: Bonnet - Corrosion - Paint



Damage 12: Bonnet: Bonnet - Corrosion - Paint



Wear and tear 1: 2nd wheel set: 1 alloy rim - Deformed - No deduction



Wear and tear 4: Door - rear right side: Door - Scratch(es) - Cover / polish



Wear and tear 4: Door - rear right side: Door - Scratch(es) - Cover / polish



Wear and tear 4: Door - rear right side: Door - Scratch(es) - Cover / polish