



Expertise

Protocol number: 46111658
Order No. / Reference: 26533743
Inspection date: 23 Jun 2026

Manufacturer: Opel

Model: Combo Cargo 1.5 D Edition

VIN: W0VEFYHT2MN554583



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Combo Cargo 1.5 D Edition

Vehicle Identification number W0VEFYHT2MN554583

Mileage (Read) 49,504 km

First registration 24 Jan 2022

Number of holders 1

Next periodical technical inspection 12/2027
(Report not on hand)

Power / Engine displacement 75 kw / 1,499 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Jade Weiß

Doors / Seats 4 / 2

Upholstery type Cloth

Colour of upholstery Black-Anthracite



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	23,900 km
Last service on / at	01/2026 at 43,408 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF956455
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AIQ 00857		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	1,985 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel	Michelin	4mm / 4mm
2)	205/60 R16 96H	Summer tyres on Steel	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Pirelli	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Steel	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Cover strip for sliding door track
- ABS including brake assist and adaptive brake light
- Automatic dipped headlights
- Exterior mirrors, electrically adjustable, heated and manually folding
- Hill Start Assist
- On-board computer
- Tachometer
- Third brake light
- Driver information display - LCD, black surround
- Speed controller
- Air conditioning, front, with particle and odor filter
- Paint finish: Solid color paint
- Steering column, adjustable for reach and height
- Upholstery: Cloth
- Wheels: Tire repair kit
- Side impact protection
- Speed-sensitive power steering
- Seats: Driver's seat adjustable in 6 ways: length, height and backrest angle
- Daytime running light
- Doors: Sheet metal insert, driver's side
- Doors: Sliding door, passenger side, sheet metal
- Immobiliser
- Central locking with remote control
- Storage compartments (edition)
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirror housings in black
- Battery discharge protection
- Floor covering: Cargo area floor, painted
- Diesel particulate filter, maintenance-free
- Three-point seat belts in all seats
- Electronic Stability Program (ESP Plus)
- Speed limiter
- Transmission: 6-speed transmission
- Headrests (2), front, height adjustable
- Steering wheel remote control
- Rear parking pilot
- Radio BT
- Wheels: Steel wheels 6.5 J x 15
- Side protection strips
- Seats: Single passenger seat, fixed
- Start/Stop System
- 12-volt power outlet in the center console
- Traction control with engine and brake intervention (TC Plus)
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- Central locking: Ignition keys (2), one of which is foldable

Extra equipment

- Doors: Sliding door, driver's side with fixed window
- Driver and passenger side airbags
- Electric windows, front, with one-touch function and anti-pinch protection (as well as comfort closing function via remote control of the central locking system - electrically adjustable, heated and folding exterior mirrors)
- Increased payload, L1, XIAB
- Partition wall with window (interior rearview mirror, manually dimmable)
- Radio: Multimedia radio with 8" color touchscreen display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, display of phonebook and call lists, up to 10 mobile phones can be paired, display of pictures/films/videos via USB interface, smartphone integration via Apple CarPlay and Android Auto, USB interface, dual tuner, graphic equalizer, 4 speakers, cruise control, steering wheel remote control)
- Rear wing doors, asymmetrically split, glazed, 180° opening angle (rear window wiper - rear window heater)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Damaged - Replace
2	Wheel / tyres	Wheel rim - front left side - Deformed - Replace
3	Door - front right side	Door - dent(s) - Smooth repair work
4	Roof	Roof - dent(s) - Smooth repair work
5	Door - front left side	Door - Dent / paintcoat damage - Smart repair

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book

Equipment - Tirefit complete

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

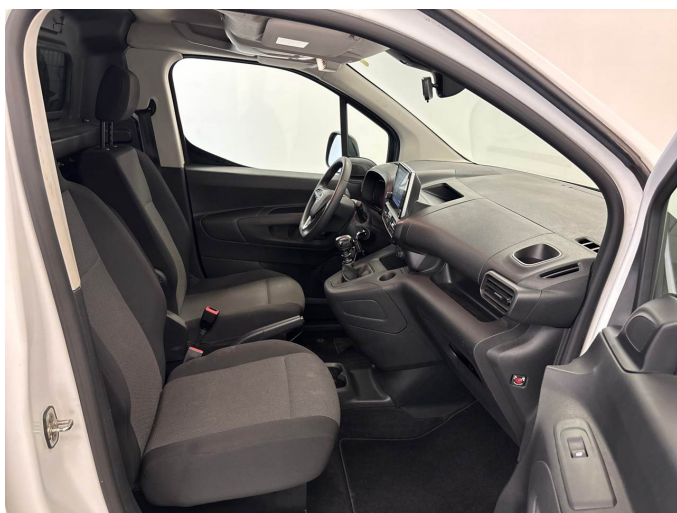


Figure 5: Interior - front

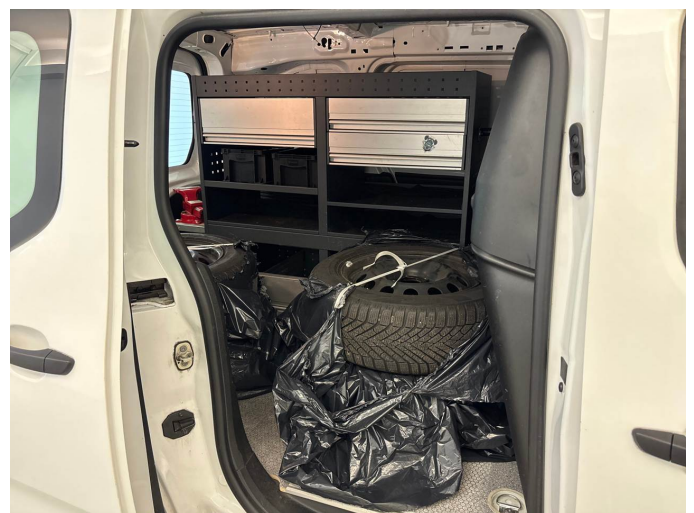


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

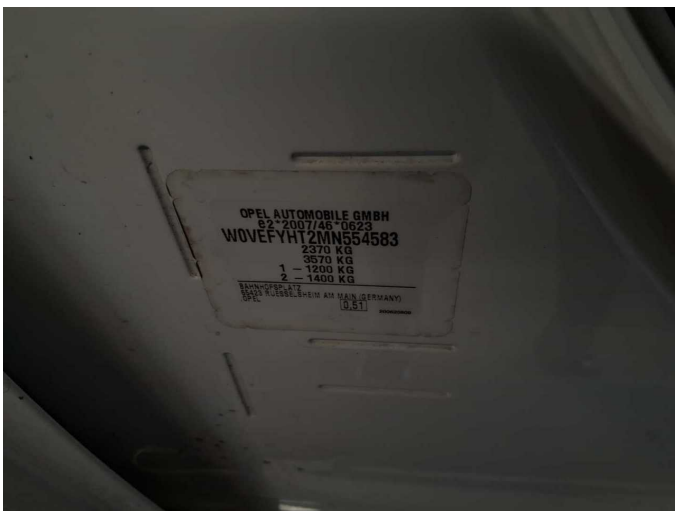


Figure 11: VIN



Figure 12: Mounted tyres

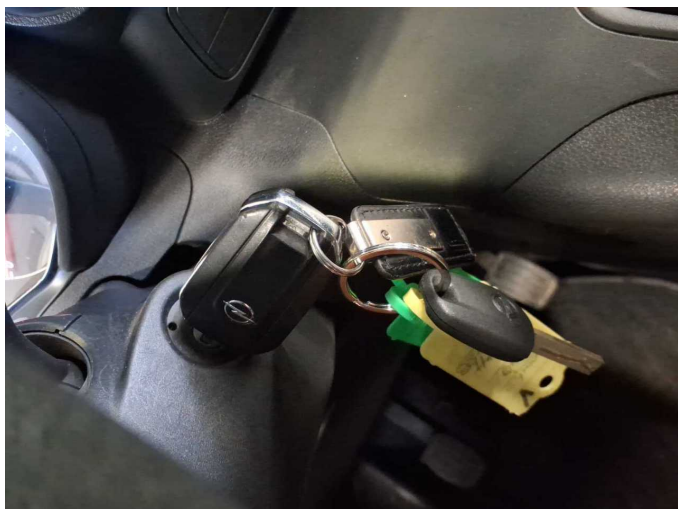


Figure 13: Documents

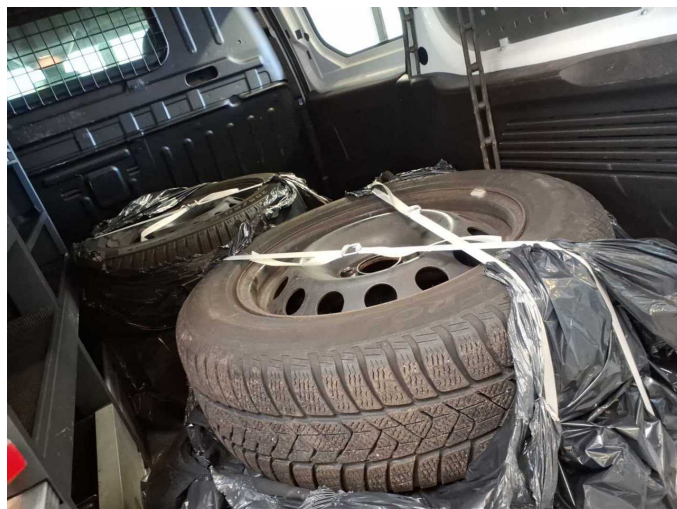


Figure 14: Additional tyres

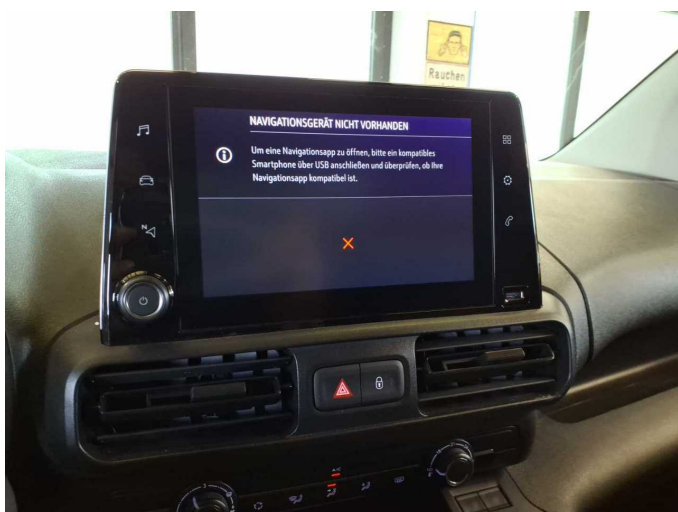


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

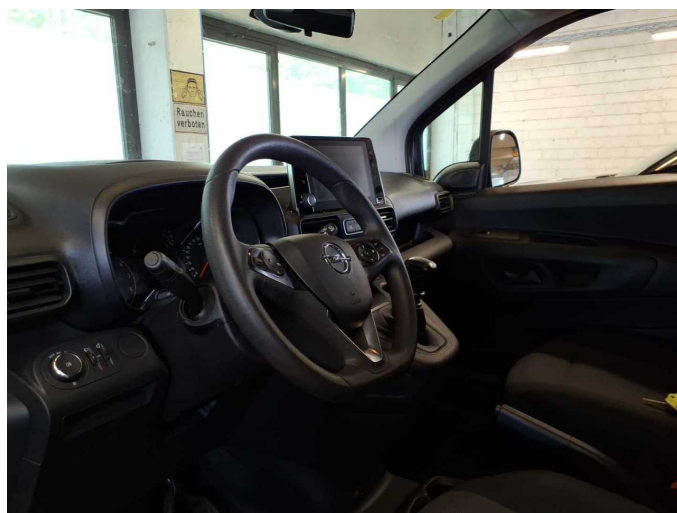


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.




Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.

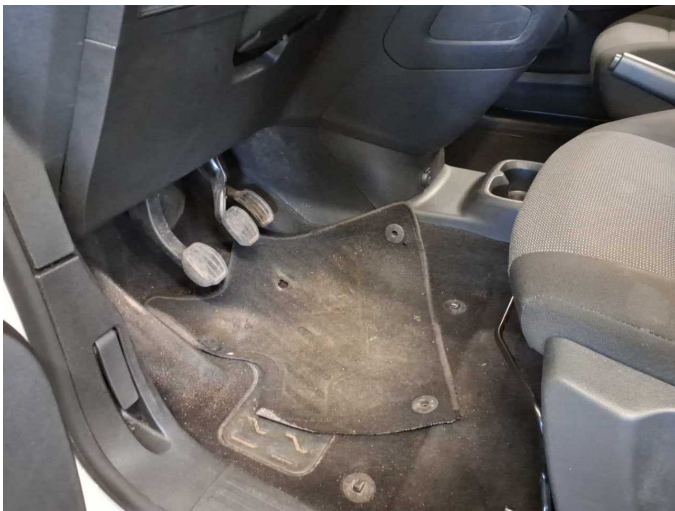

Damage 1: Trim / covers: Floor mats - Damaged - Replace

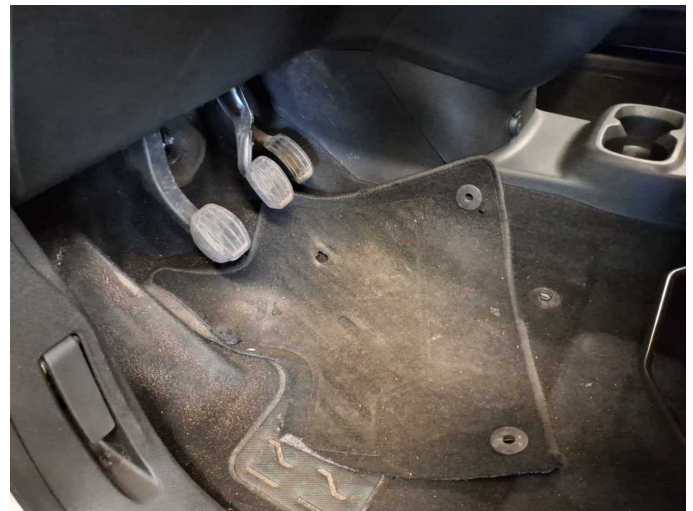

Damage 1: Trim / covers: Floor mats - Damaged - Replace



Damage 2: Wheel / tyres: Wheel rim - front left side - Deformed - Replace



Damage 2: Wheel / tyres: Wheel rim - front left side - Deformed - Replace




Damage 3: Door - front right side: Door - dent(s) - Smooth repair work



Damage 3: Door - front right side: Door - dent(s) - Smooth repair work



Damage 4: Roof: Roof - dent(s) - Smooth repair work

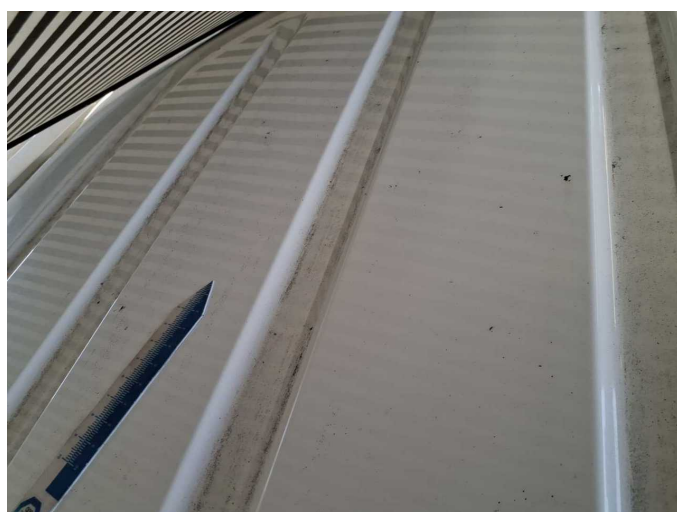


Damage 4: Roof: Roof - dent(s) - Smooth repair work



Damage 4: Roof: Roof - dent(s) - Smooth repair work



Damage 5: Door - front left side: Door - Dent / paintcoat damage - Smart repair

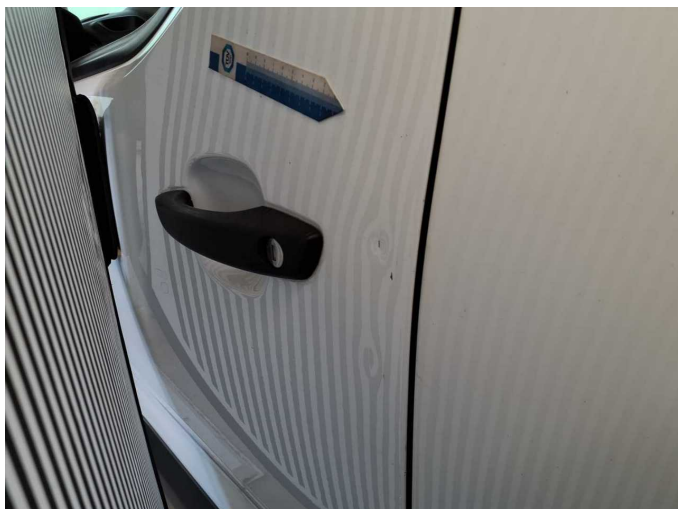

Damage 5: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Wear and tear 1: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Wear and tear 1: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHT2MN554583
Hersteller / Modell: OPEL OPEL Combo Cargo 1.5 D Edition

Datum	KM-Stand	Beschreibung
30.01.2026	43.408	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
04.12.2025	40.547	AU
14.03.2025	28.050	Systemtest/Eigendiagnose
27.01.2025	25.497	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.04.2024	16.344	Systemtest/Eigendiagnose
15.12.2023	13.833	AU
05.01.2023	6.177	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges