



Expertise

Protocol number: 45232666
Order No. / Reference: 26006377
Inspection date: 14 Apr 2026

Manufacturer: Skoda
VIN: TMBJJ8NX0PY076190

Model: Octavia Combi 2.0 TDI DSG Tour



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG Tour	
Vehicle Identification number	TMBJJ8NX0PY076190
Mileage (Read)	172,117 km
First registration	25 Jan 2023
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	600 km
Last service on / at	07/2025 at 151,000 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ538185
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWL 00296		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,990 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Continental	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Hankook	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Trailer hitch preparation including trailer stabilization
- Anti-lock braking system (ABS)
- Automatically dimming exterior mirror (driver's side)
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative trim in anodized cross
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Luggage net partition
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Child safety lock for the rear doors and windows
- Removable boot cover
- LED fog lights
- LED license plate lights
- LED headlights with LED daytime running lights
- Steering wheel: height and reach adjustable
- Steering wheel: Leather steering wheel with multifunction buttons and paddle shifters.
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Tire pressure monitoring
- Wheels: 17" Pulsar AERO alloy wheels, grey, diamond-cut finish
- Seats: Heated rear seats
- Seats: Rear seat backrest split 60:40, foldable
- Speed limiter
- 12V socket in the trunk
- Phone: Wireless SmartLink for Apple CarPlay
- Front door sill trims
- Lashing eyes in the trunk
- Immobiliser
- Storage compartments
- Airbag, driver and passenger
- Airbag, head airbags
- Airbag: Center airbag front
- Extended warranty for 3 years, max. 50,000 km
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Glasses compartment in the headliner
- Roof rails, black
- Diesel particulate filter
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Cruise control system
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (3-zone)
- Headrests (5) front and rear height adjustable
- LED taillights in crystal glass look and animated turn signals
- Steering wheel: Heated steering wheel including heated front seats
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink
- Rain sensor
- Tire mobility kit
- Electromechanical power steering
- Seat belts
- Seats: Height-adjustable driver and passenger seats
- SKODA Care Connect
- Lane keeping assistant (Lane Assist)
- 230V power outlet and USB charging port
- TOUR badge
- Glazing: Acoustic glazing in the front side windows and Sunset
- Central locking including remote control integrated into the key and EASY Start



Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Anti-theft alarm system including safe system with interior monitoring and tilt sensor • Comfort opening with electric tailgate operation (Combi) • Package: Infotainment package Business Columbus (Columbus navigation system - Infotainment Online (3-year subscription) - Digital instrument cluster (Virtual Cockpit) - 3 USB charging ports - Driving profile selection - Adaptive Cruise Control (ACC) - Traveller Assist system) • Wheels: 18" Perseus alloy wheels, anthracite polished (7.5J x 18, ET 48 with 225/45 R18 tires) • Variable loading floor in the trunk including organizer and aluminum crossbars | <ul style="list-style-type: none"> • Chassis: Sport chassis (15 mm reduced ground clearance - modified damper settings) • Paint finish: Pearl effect • Package: Light & Sight (Tour) (Cornering lights in the fog lights - LED ambient lighting - LED main headlights matrix and dynamic high beam assist (AFS) - Driver fatigue detection) • Panoramic sunroof, electric (deletion of the glasses compartment in the headliner) • Auxiliary heater with radio remote control • Heated windscreen |
|--|---|

Retrofitted equipment

- ACCESSORIES Stainless steel footrest 5E10 64209 (WLTP)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Electronic systems	Electronic systems (Start- Stopp) - Functional / admissibility - Perform diagnosis
2	Wheel / tyres	Pressure sensor (Reifendruck) - Functional / admissibility - Perform diagnosis
3	Equipment	Vehicle key (Batterie x2) - Empty - Replace
4	Heating system	Remote control auxiliary heating (Abgenutzt) - Scratched - Loss in value
5	Body	D-pillar - left side (Dichtung) - Loose - Replace
6	Body	D-pillar - left side - Scratched - Smart repair
7	Boot lid / rear door	Boot lid (Innen) - Paint defect - Smart repair
8	Rear bumper	Rear bumper - Scratch(es) - Smart repair
9	Door - front right side	Door - Scratch(es) - Smart repair
10	Interior	Interior (Tier) - Odour - Ozone treatment
11	2nd wheel set	1 tyre (Flanke) - Damaged - Replace
12	Trim / covers	Boot lid - interior trim - Scratched - Replace
13	Trim / covers	Floor covering - front left side - Broken / torn - Smart repair
14	Interior	Interior - Soiled - Clean
15	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
16	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Replace
17	Boot lid / rear door	Gas pressure damper (Motor, links + Halterinkl. inkl. Halter) - Loose - Replace
18	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint



No.	Component group	Description
19	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
20	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
21	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
22	Bonnet	Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Door - rear right side	Door - Scratch(es) - No deduction
4	Front bumper	Air-inlet grille - Scratched - No deduction
5	Trim / covers	Floor mats - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 23 Feb 2023	2.995,92 €
2	Rear, Side right, Provided by user / customer, from 13 Oct 2025	3.122,82 €
3	Front, Side right, Provided by user / customer, from 4 Dec 2023	6.708,67 €

Repainting

No.	Repainting
1	Roof rail - right side, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
4	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - right side	153 µm	Side panel - rear right side	348 µm
Door - rear right side	198 µm	Door - front right side	143 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

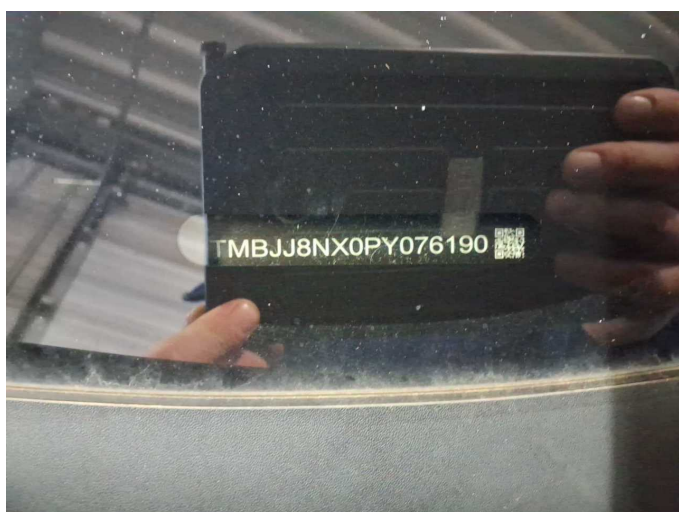


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

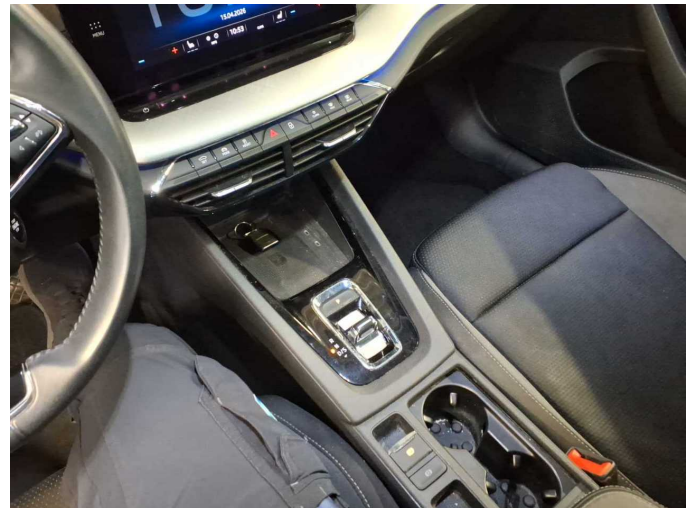


Figure 20: Misc.

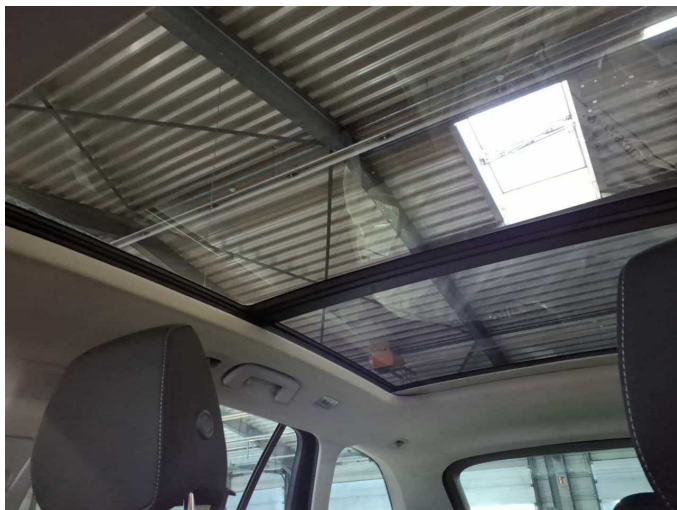


Figure 21: Misc.

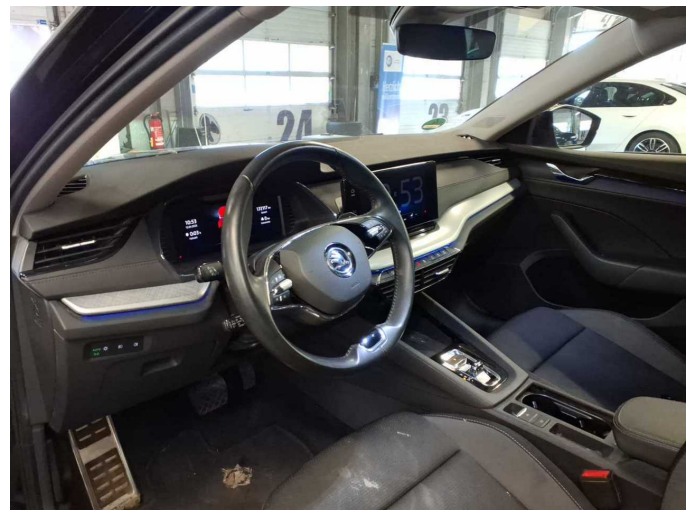


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

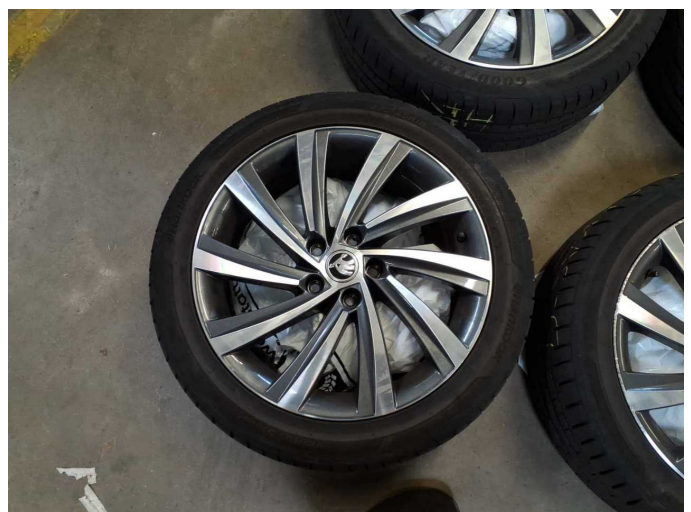


Figure 30: Misc.



Figure 31: Misc.




Damage 1: Electronic systems: Electronic systems (Start- Stopp) - Functional / admissibility - Perform diagnosis




Damage 2: Wheel / tyres: Pressure sensor (Reifendruck) - Functional / admissibility - Perform diagnosis




Damage 4: Heating system: Remote control auxiliary heating (Abgenutzt) - Scratched - Loss in value

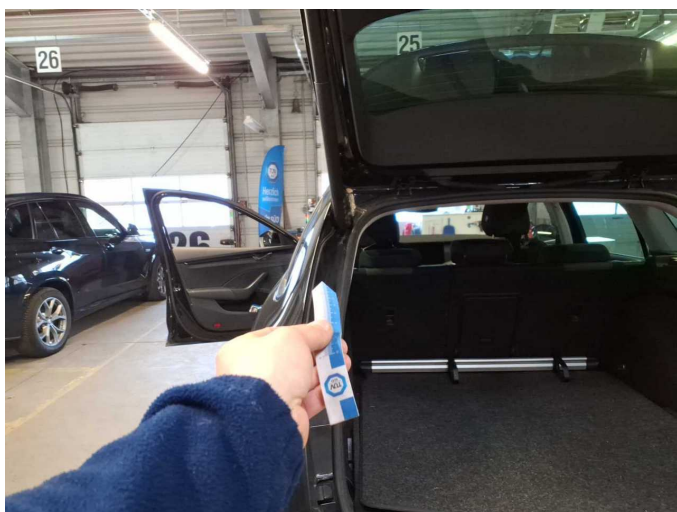

Damage 5: Body: D-pillar - left side (Dichtung) - Loose - Replace

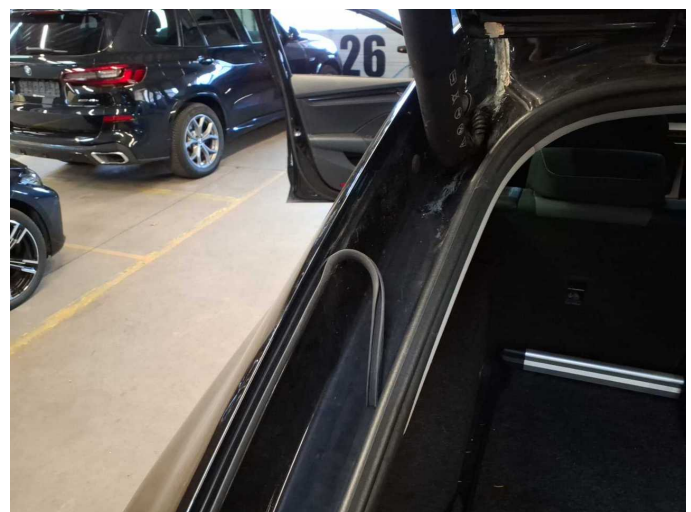


Damage 5: Body: D-pillar - left side (Dichtung) - Loose - Replace

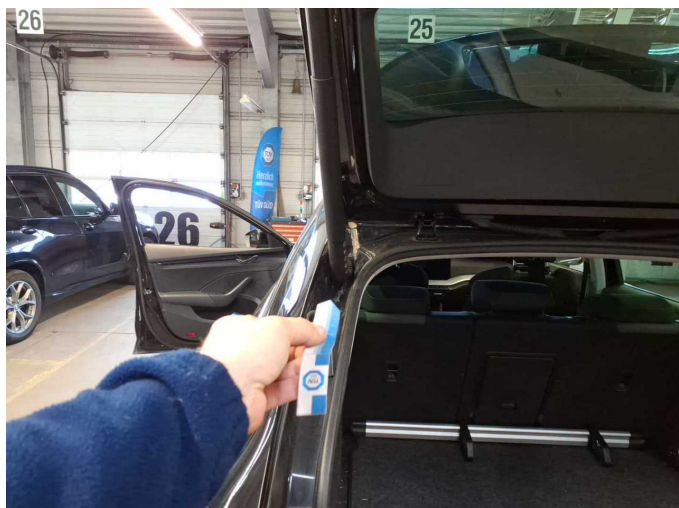


Damage 6: Body: D-pillar - left side - Scratched - Smart repair




Damage 6: Body: D-pillar - left side - Scratched - Smart repair

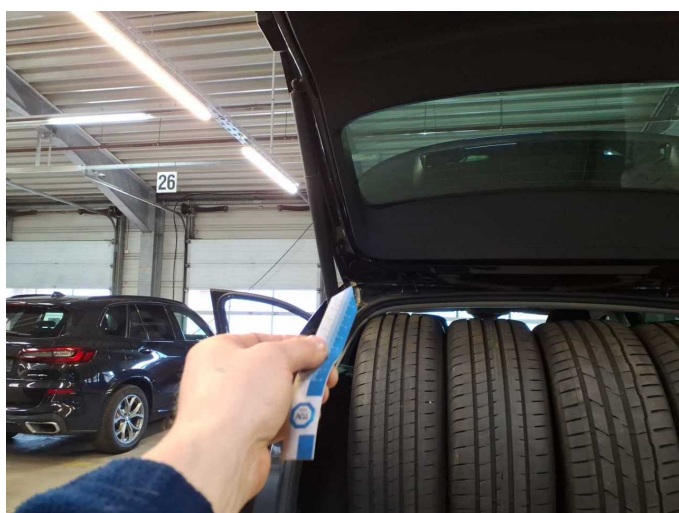

Damage 7: Boot lid / rear door: Boot lid (Innen) - Paint defect - Smart repair

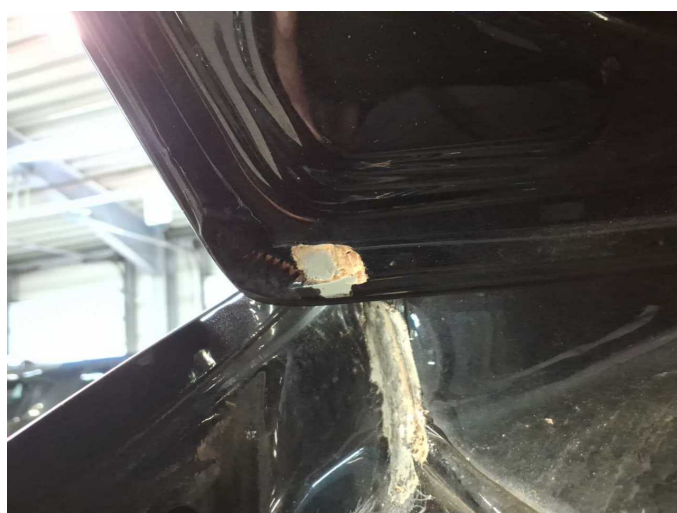

Damage 7: Boot lid / rear door: Boot lid (Innen) - Paint defect - Smart repair

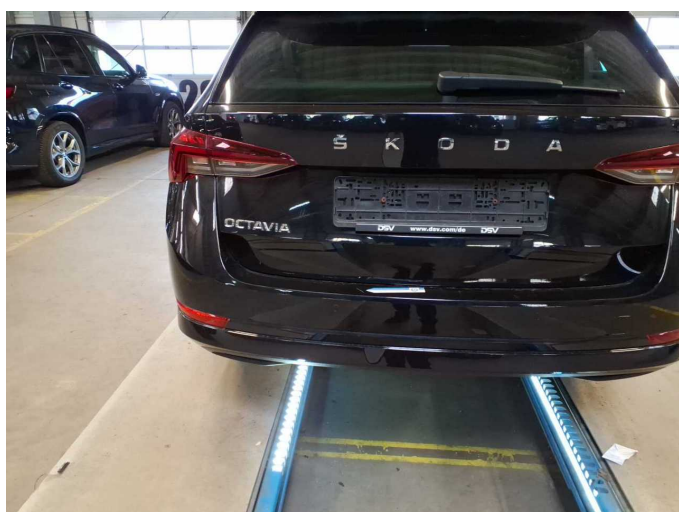


Damage 8: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 9: Door - front right side: Door - Scratch(es) - Smart repair

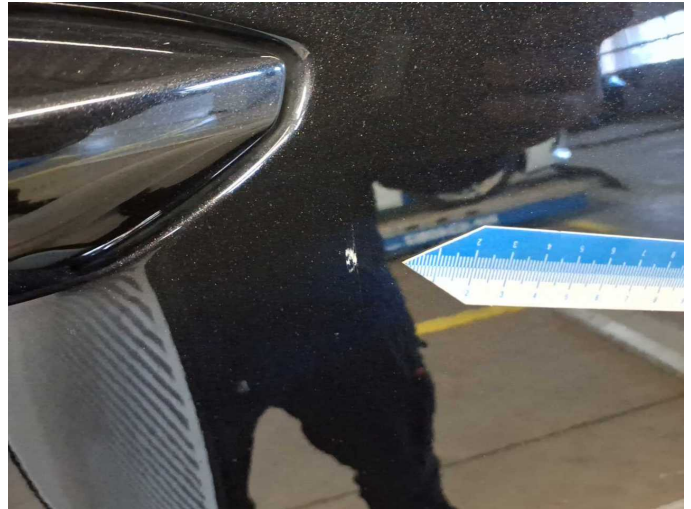

Damage 9: Door - front right side: Door - Scratch(es) - Smart repair




Damage 11: 2nd wheel set: 1 tyre (Flanke) - Damaged - Replace



Damage 11: 2nd wheel set: 1 tyre (Flanke) - Damaged - Replace



Damage 11: 2nd wheel set: 1 tyre (Flanke) - Damaged - Replace

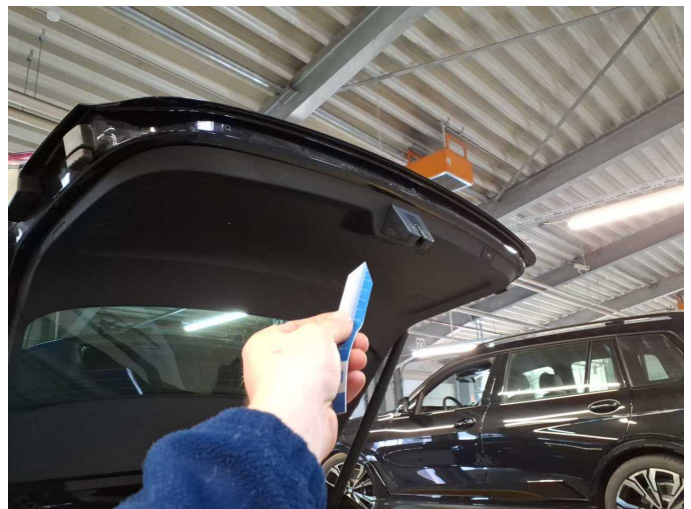

Damage 12: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 12: Trim / covers: Boot lid - interior trim - Scratched - Replace




Damage 12: Trim / covers: Boot lid - interior trim - Scratched - Replace




Damage 12: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 12: Trim / covers: Boot lid - interior trim - Scratched - Replace

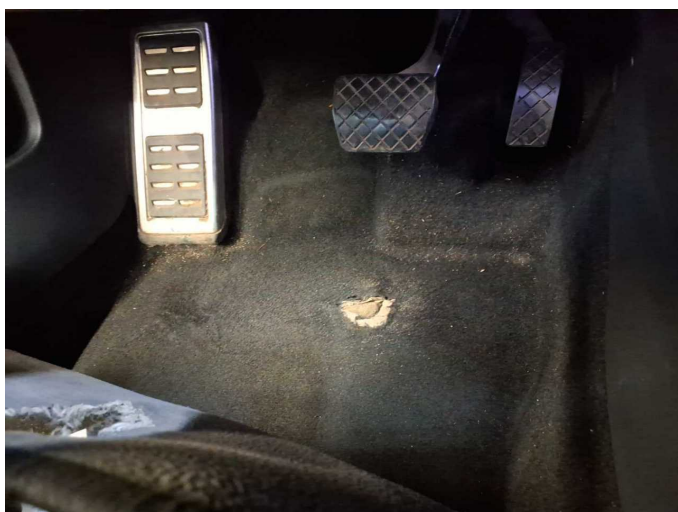

Damage 13: Trim / covers: Floor covering - front left side - Broken / torn - Smart repair

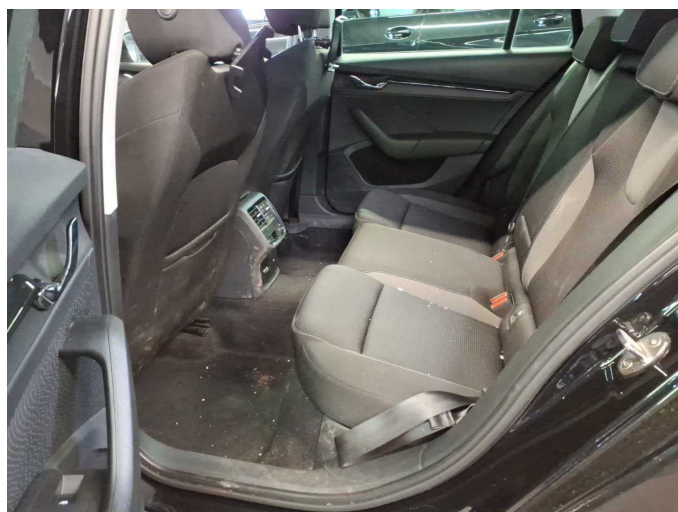


Damage 14: Interior: Interior - Soiled - Clean




Damage 14: Interior: Interior - Soiled - Clean



Damage 14: Interior: Interior - Soiled - Clean

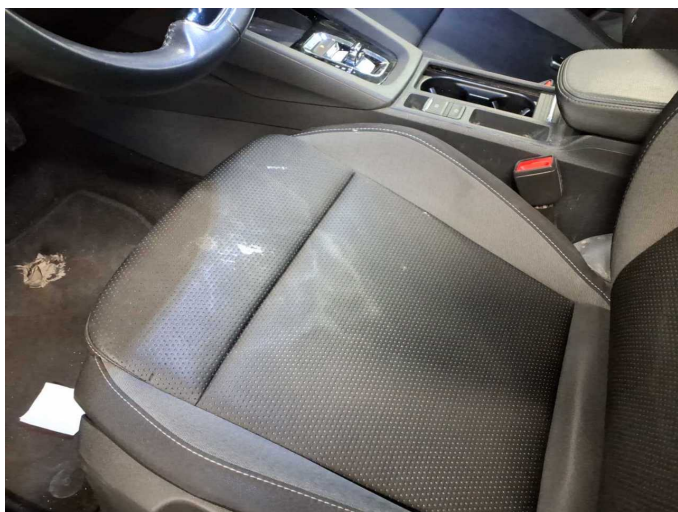


Damage 14: Interior: Interior - Soiled - Clean

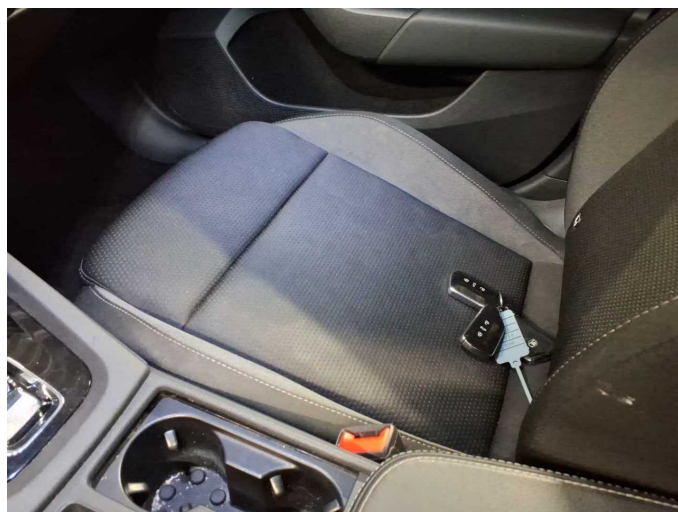

Damage 14: Interior: Interior - Soiled - Clean



Damage 14: Interior: Interior - Soiled - Clean

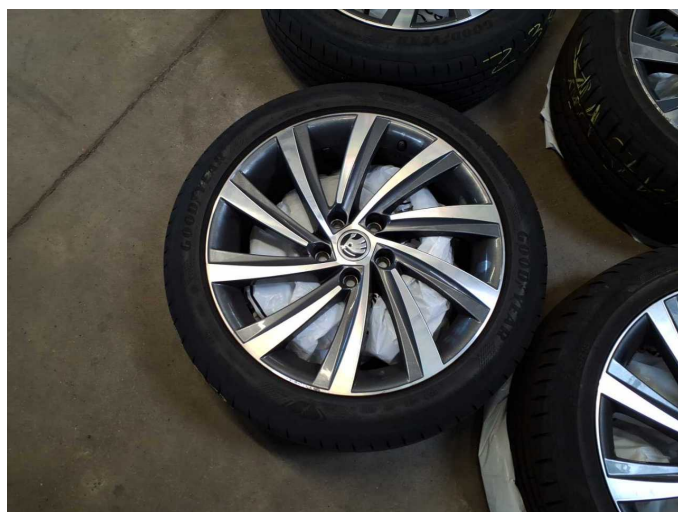

Damage 15: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 15: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 15: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 16: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 16: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 16: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace




Damage 16: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace




Damage 16: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 17: Boot lid / rear door: Gas pressure damper (Motor, links + Halterinkl. inkl. Halter) - Loose - Replace

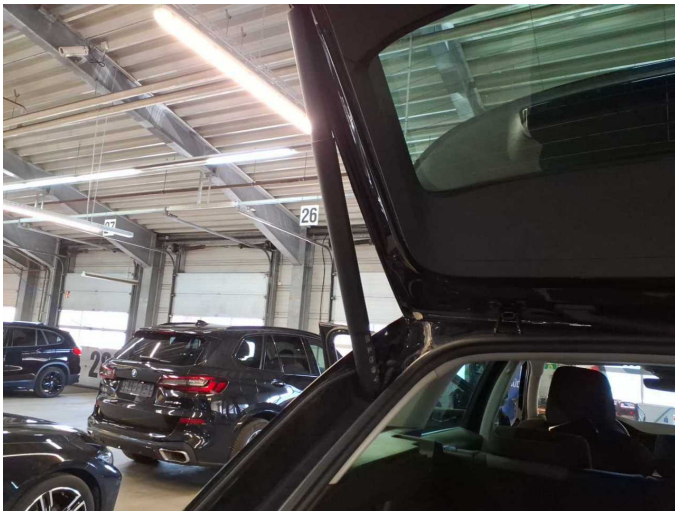

Damage 17: Boot lid / rear door: Gas pressure damper (Motor, links + Halterinkl. inkl. Halter) - Loose - Replace

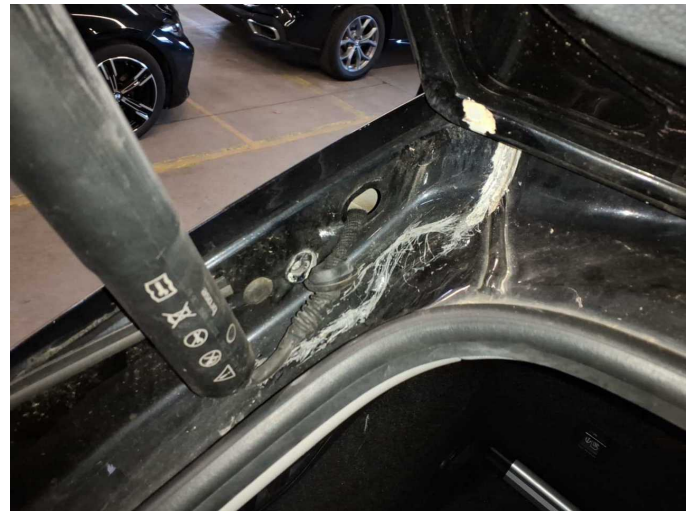

Damage 17: Boot lid / rear door: Gas pressure damper (Motor, links + Halterinkl. inkl. Halter) - Loose - Replace



Damage 17: Boot lid / rear door: Gas pressure damper (Motor, links + Halterinkl. inkl. Halter) - Loose - Replace




Damage 17: Boot lid / rear door: Gas pressure damper (Motor, links + Halterinkl. inkl. Halter) - Loose - Replace



Damage 18: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 18: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

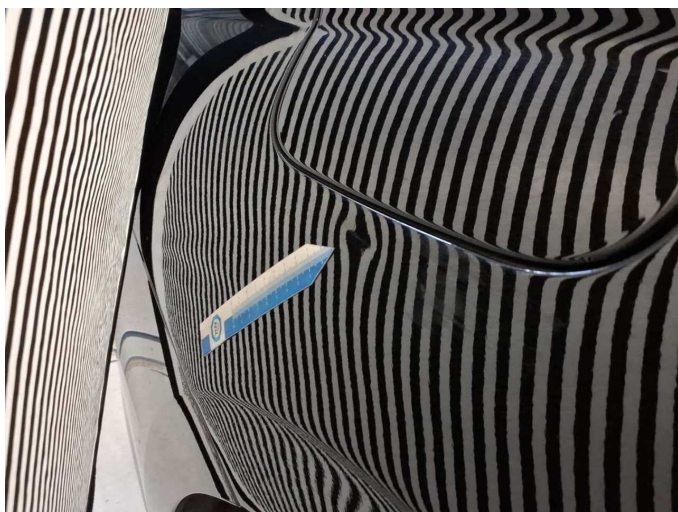


Damage 18: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

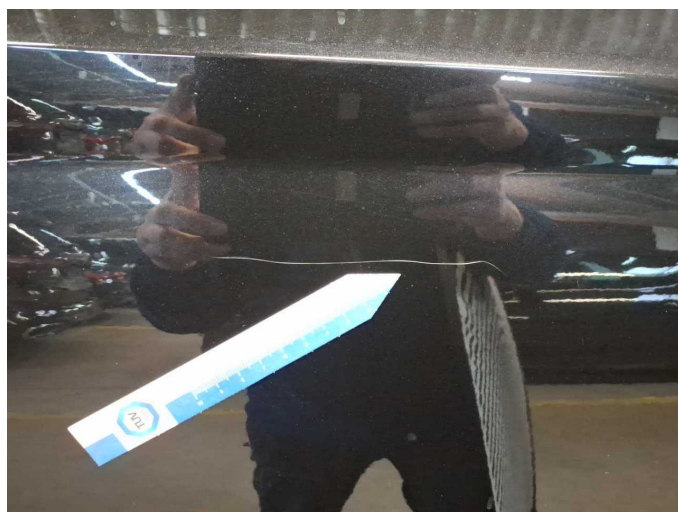

Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

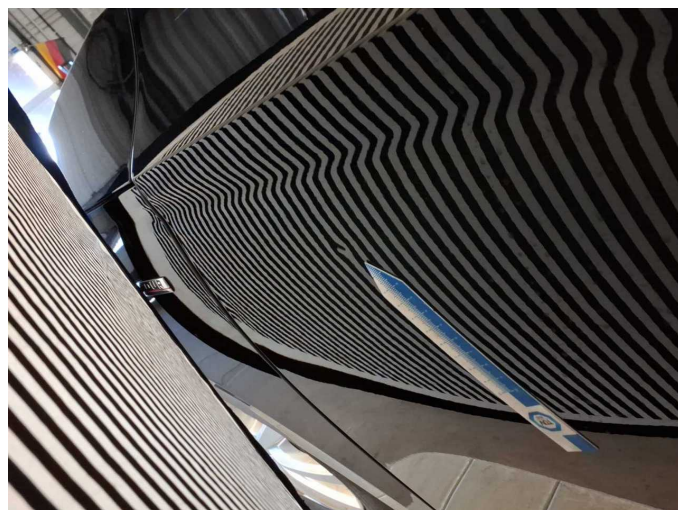

Damage 19: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 20: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

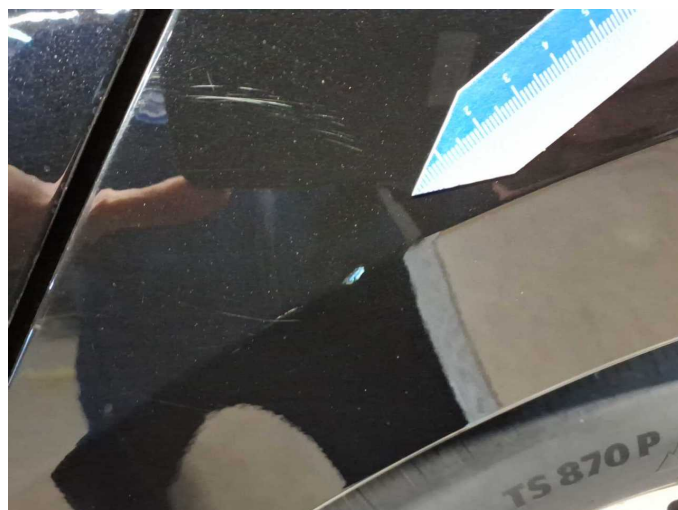

Damage 20: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 20: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 20: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 20: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 21: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 21: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 21: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint




Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint




Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

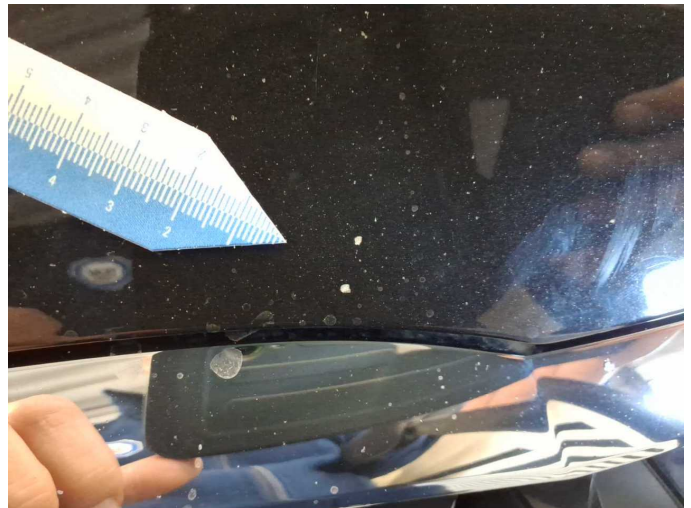

Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

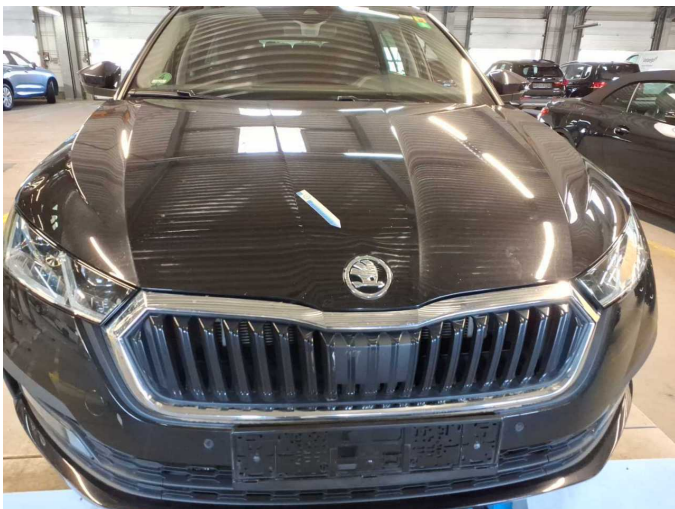

Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

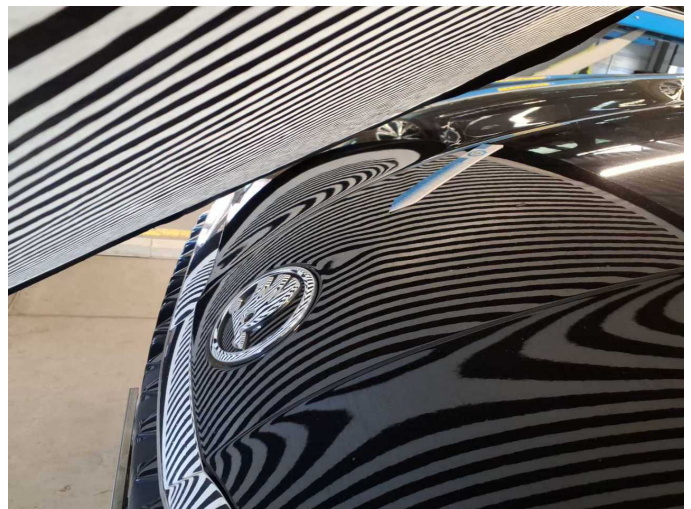


Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint




Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint



Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

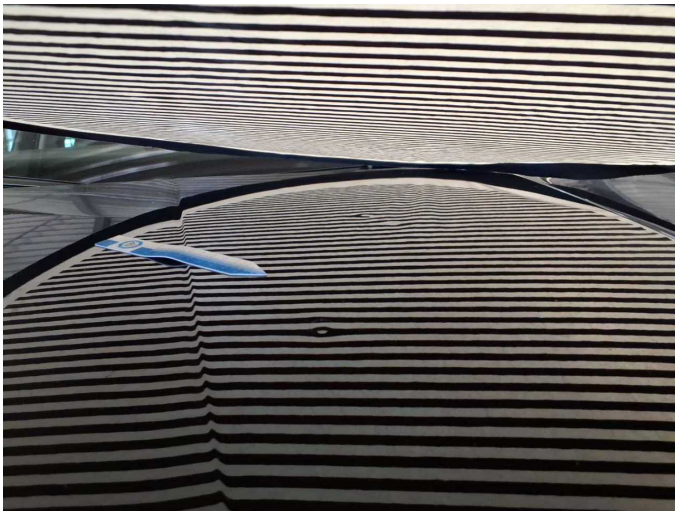


Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

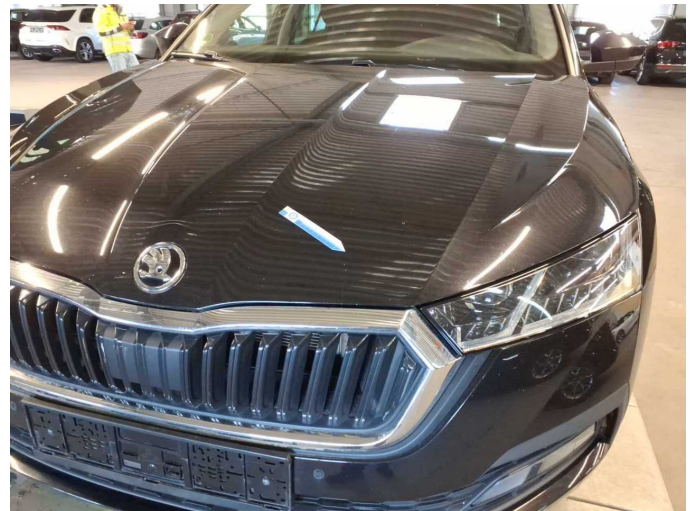

Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint



Damage 22: Bonnet: Bonnet (Verformt) - Dent / paintcoat damage - Repair and paint

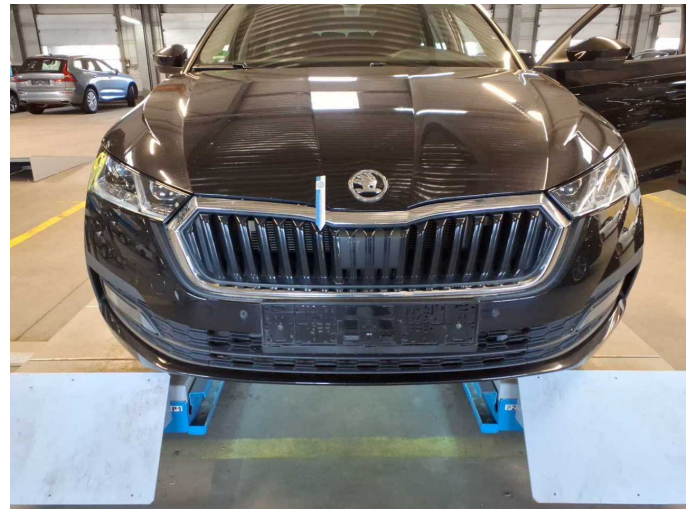


Wear and tear 4: Front bumper: Air-inlet grille - Scratched - No deduction



Wear and tear 4: Front bumper: Air-inlet grille - Scratched - No deduction



Wear and tear 4: Front bumper: Air-inlet grille - Scratched - No deduction

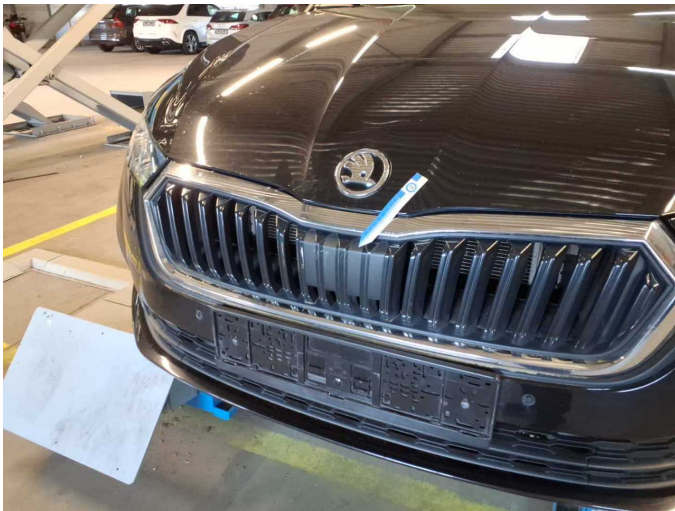

Wear and tear 4: Front bumper: Air-inlet grille - Scratched - No deduction



Wear and tear 4: Front bumper: Air-inlet grille - Scratched - No deduction



Wear and tear 4: Front bumper: Air-inlet grille - Scratched - No deduction



Wear and tear 5: Trim / covers: Floor mats - Broken / torn - No deduction



Repainting 1: Roof rail - right side



Repainting 2: Side panel - rear right side



Repainting 3: Door - rear right side



Repainting 4: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ8NX0PY076190
Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG Tour

Datum	KM-Stand	Beschreibung
30.07.2025	151.000	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.03.2025	131.321	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
09.01.2025	117.650	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges
24.10.2024	103.525	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
16.07.2024	84.885	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
10.06.2024	78.448	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.12.2023	54.612	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.07.2023	26.416	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges