



Expertise

Protocol number: 46242377
Order No. / Reference: 26611675
Inspection date: 29 Jun 2026

Manufacturer: Volkswagen

Model: Caddy Cargo 2.0 TDI BMT

VIN: WV1ZZZSK8PX053892



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Caddy Cargo 2.0 TDI BMT

Vehicle Identification number WV1ZZZSK8PX053892

Mileage (Read) 152,611 km

First registration 24 Feb 2023

Number of holders 1

Power / Engine displacement 75 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Station wagon

Colour / colour code Candyweiß

Doors / Seats 4 / 2

Upholstery type Cloth

Colour of upholstery Anthracite-Black

readiness to drive Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	26,500 km
Last service on / at	06/2026 at 151,807 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP960245
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CMF 00371		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/65 R15 99H	Summer tyres on Steel rim with wheel cover	Hankook	4mm / 4mm
2)	205/65 R15 99H	Summer tyres on Steel rim with wheel cover	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 100T	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	205/60 R16 100T	Winter tyres on Light alloy	Continental	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/65 R15 92H	Summer tyres on Steel	Hankook	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments (Various shelves and storage compartments)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- Cockpit panel, matte
- Three-phase generator 140 A
- Electronic parking brake including auto-hold function
- ESP Electronic Stability Program with Brake Assist (incl. Anti-lock Braking System (ABS), Traction Control (ASR), (EDS and MSR))
- Electric windows, front
- Halogen dual headlights-H7
- Heating and ventilation system in the driver's cab
- Interior lighting in the cargo area (1 light)
- Fuel fill quantity, standard fuel initial fill
- Steering column adjustable in height and tilt
- Center console with 2 universal cup holders
- Multi-collision brake
- Fatigue detection
- Non-smoking version
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Wheels/Tires: 205/65 R 15 99 H XL, optimized for low rolling resistance
- Gearshift lever in plastic
- Sliding door, on the right in the passenger/cargo area
- Standard side panels in the cargo area
- Speed-sensitive power steering (Servotronic)
- Seats: Height adjustment for left seat, manual
- Seats: Left and right seats in the 1st row (including headrests)
- Start-stop system (with brake energy recuperation)
- Partition wall (tall) without window
- Lashing points: 6 lashing points for securing cargo
- Electronic immobilizer
- Central locking with remote control and interior operation
- Storage compartments: Glove compartment open
- Towing eye front and rear, screw-in
- Exterior mirrors: electrically adjustable
- Exterior mirror housings and door handles in black, sliding door track in silver
- Floor coverings: Carpet in the driver's cab
- third brake light
- Roof rail/roof rack preparation
- Three-point automatic seat belts (with front belt height adjustment and electric belt tensioners)
- Automatic headlight control with daytime running lights
- Windows: Laminated glass front pane in heat-insulating glazing
- Transmission: 6-speed transmission
- Rear wing door (asymmetrically divided) without window cutout
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Headlight range control
- Multifunction display: 16.51 cm (6.5 inch) color touchscreen for convenient operation (with USB charging port (Type C), no radio function)
- eCall emergency call system
- Upholstery: Fabric, "Double Grid" design
- Wheels, tires: Wheel covers
- Wheels/Tires: Steel wheels 6J x 15, in black
- taillights
- Windscreen wiper intermittent control with light sensor
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- Seat belt indicator (warning tone and light for unfastened front seat belts)
- Sun visors without mirrors, with ticket pocket on the driver's side, plus airbag label on the sun visor
- Bumper in grey
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Additional dust protection seal on the outside



Extra equipment

- Package: Window package (Caddy Cargo with rear wing doors)
(Rear wing doors with asymmetrically divided window cutouts - Fixed side window in the load/passenger compartment, front left - Fixed side window in the load/passenger compartment, front right - Fixed side window in the load/passenger compartment, rear left - Heated rear window - Fixed side window in the load/passenger compartment, rear right - Rear window wiper/washer system with intermittent function)
- Parking assistance (rear parking distance control)
- Storage compartments: Glove compartment with lockable, illuminated flap
- Air conditioning
- Airbag, side and head airbags for driver and front passenger
- Floor coverings, rubber floor covering in the cargo area
- Floor coverings: Rubber floor covering in the driver's cab
- Radio "Composition Audio" with 16.51 cm (6.5 inch) color touchscreen (2 speakers - mobile phone interface)
- Sliding door, left side in the passenger/cargo area
- Smoker's version
- Wheels/Tires: Spare wheel in driving tire size, steel (spare wheel in driving tire size, steel - on-board tools and jack)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Sill - left side	Sill - Scratch(es) - Smart repair
3	Sill - right side	Sill - Scratch(es) - Smart repair
4	Door - front left side	Door - dent(s) - Smooth repair work
5	Sliding door - left side	Sliding door with glass panel - dent(s) - Smooth repair work
6	Body	Body - Glued / labelled - De-glue / neutralise
7	Sliding door, right	Sliding door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Scratch(es) - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - No deduction
5	2nd wheel set	1 tyre - Damaged - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

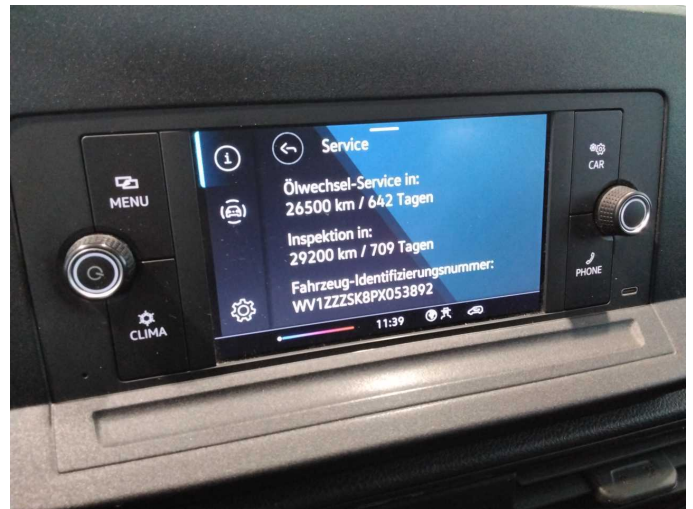


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

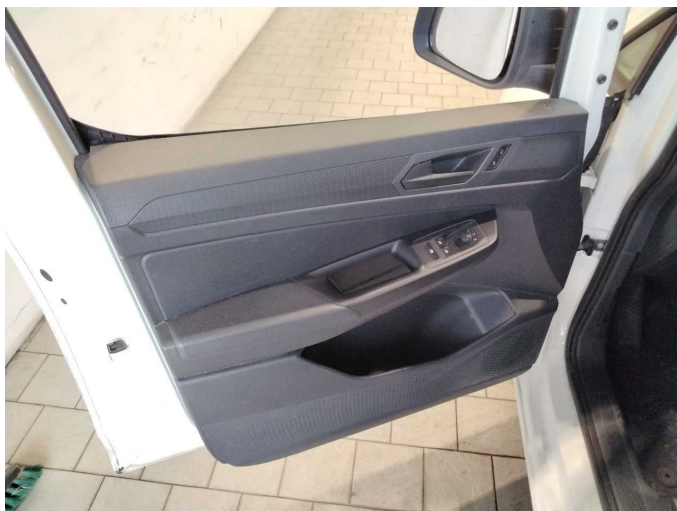


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

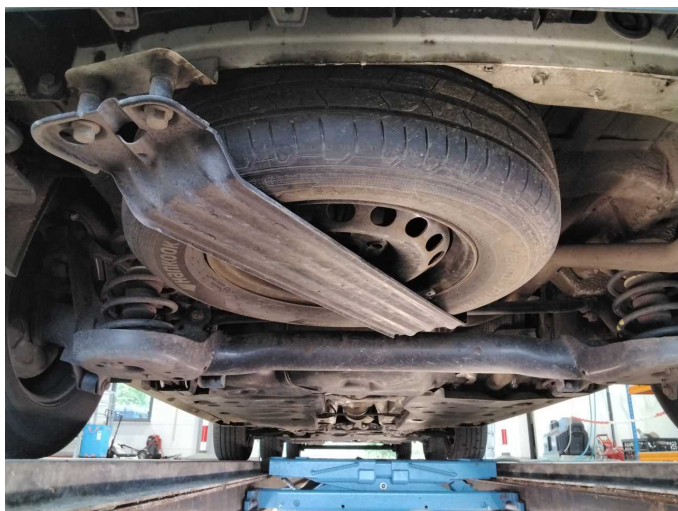


Figure 27: Misc.


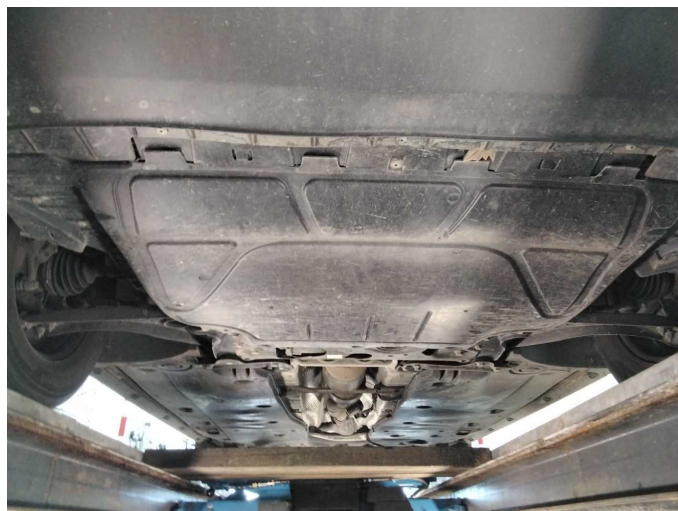


Figure 28: Misc.



Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair

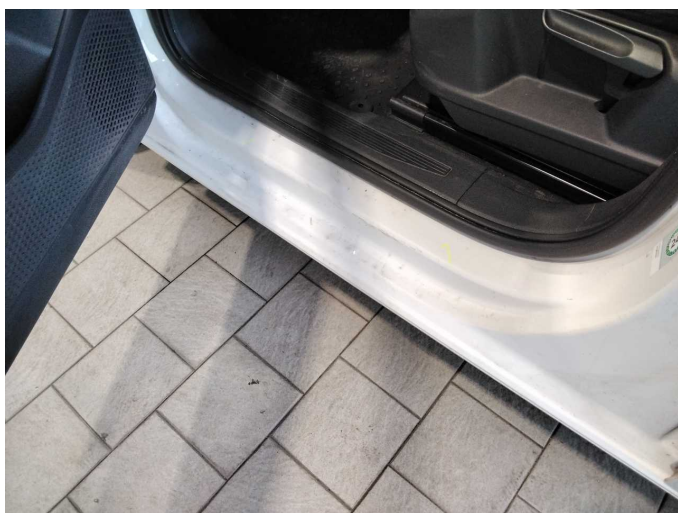

Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 3: Sill - right side: Sill - Scratch(es) - Smart repair




Damage 4: Door - front left side: Door - dent(s) - Smooth repair work



Damage 4: Door - front left side: Door - dent(s) - Smooth repair work



Damage 5: Sliding door - left side: Sliding door with glass panel - dent(s) - Smooth repair work

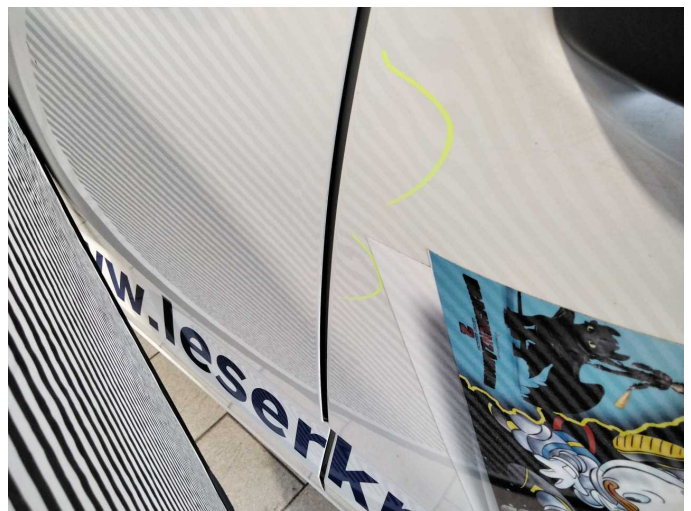

Damage 5: Sliding door - left side: Sliding door with glass panel - dent(s) - Smooth repair work



Damage 5: Sliding door - left side: Sliding door with glass panel - dent(s)
- Smooth repair work



Damage 5: Sliding door - left side: Sliding door with glass panel - dent(s)
- Smooth repair work



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 7: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 7: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 7: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint