



Expertise

Protocol number: 46904713
Order No. / Reference: 26738389
Inspection date: 5 Aug 2026

Manufacturer: Hyundai

Model: TUCSON 1.6 T-GDi Plug-in-Hybrid 4WD Prime

VIN: TMAJE8122SJ389035



Vehicle details	
Manufacturer / Type / Model / Equipment	
Hyundai TUCSON 1.6 T-GDi Plug-in-Hybrid 4WD Prime	
Vehicle Identification number	TMAJE8122SJ389035
Mileage (Read)	20,281 km
First registration	11 Jul 2025
Number of holders	1
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,598 ccm / 4
Power	118 kW
Gearbox / Number of gears	Automatic / 6
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Abyss Black
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	359 Tag(e)
Last service on / at	07/2026 at 20,188 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HM322405
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	1349 / AGQ 00003		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,420 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	235/50 R19 103V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage options (storage pockets on the back of the front seats - compartment in the center console of the dashboard - compartments under the luggage compartment floor - cup holders in the front and rear)
- Airbag: Front side airbags
- Airbag: Curtain airbags extending to the rear seats
- Alarm system
- Ambient lighting (multicoloured)
- Attention Assistant (DAW)
- Highway Assistant 1.5 (HDA 1.5)
- Electrically folding exterior mirrors
- Electrically adjustable and heated exterior mirrors (from inside)
- Exterior mirrors with integrated turn signals
- Hill Start Assist (HAC)
- Roof rails
- Digital Vehicle Key 2.0 (UWB)
- Tachometer
- Rear parking sensors
- Door sill trims in aluminum look
- Electric windows front and rear (with automatic up/down function and anti-pinch protection, front and rear)
- Adaptive cruise control with stop function (ASCC)
- Head-up display
- Heated rear window (with automatic shut-off)
- Interior mirror automatically dimming
- ISOFIX child seat attachment at the rear (on the outer seats including top tether anchor points)
- rear automatic climate control
- Headrests (5) front and rear height adjustable
- Type 2 charging cable
- LED matrix headlights
- Leather steering wheel (three-spoke steering wheel)
- Steering wheel: Paddle shifters on the steering wheel
- light sensor
- Front center armrest with storage compartment
- Multi-collision brake (MCB)
- Emergency call system (eCall)
- Package: Design (Hyundai logo on the front in dark look - radiator grille in dark look - LED daytime running lights in dark look - LED taillights (brake and driving lights))
- Electronic parking brake (EPB) with Auto Hold
- Particle filter
- Upholstery: Leather (combined with high-quality synthetic leather)
- Cross Traffic Collision Mitigation (RCCA)
- Radio (1st row speakers - 2nd row speakers - tweeters)
- Rain sensor
- Tire pressure monitoring system (TPMS)
- Wheels: Tire repair kit
- Crosswind Assist (CWC)
- ABS with EBV
- Adaptive Emergency Stop Signal (ESS)
- Airbag: Center airbag between driver and passenger
- Airbag: Front airbags for driver and front passenger (passenger airbag can be deactivated)
- Active Lane Keeping Assist (LKA)
- All-wheel drive
- Trailer Stability Assist (TSA)
- Exit Warning (SEW)
- Autonomous emergency braking assistant (with pedestrian/cyclist detection (FCA-Ped./FCA-Cyc.) - with turning function (FCA-JT))
- Exterior mirrors painted in car color
- Hill Descent Control (DBC)
- Black headliner
- Roof spoiler with 3rd brake light
- Digital cockpit with 12.3-inch display
- Drive Modes
- Front parking sensors
- Electronic Stability Control (ESC)
- High Beam Assist (HBA)
- luggage compartment cover
- Transmission: 6-speed automatic
- Electrically operated tailgate
- rear window wiper
- Occupant alert, sensor-based (ROA)
- Child safety locks on the rear doors
- 2-zone automatic climate control (automatic interior fogging control)
- Paint finish: Solid
- LED interior lighting front/rear
- Heated steering wheel
- Steering wheel: Multifunction steering wheel (height and reach adjustable)
- Armrest - centre, rear
- Hood insulation
- Navigation system with 12.3-inch touchscreen (Apple CarPlay and Android Auto (wireless) - Hyundai Bluelink - Bluetooth hands-free system - Over-the-air updates (vehicle system))
- Package: Seat package (driver's seat with memory function - driver and front passenger seats electrically adjustable - front passenger seat with adjustment for driver and rear seat row - second row of seats (outer seats) with seat heating - driver and front passenger seats with ventilation - exterior mirrors with memory function)
- Radio: KRELL sound system (radio - with 7 speakers, including subwoofer and amplifier)
- Wheels: Alloy wheels 7.5 J x 19 with tires 235/50 R 19
- Rear view camera
- Power steering



- Shift-by-Wire
- Seats: Passenger seat height adjustable
- Seats: Passenger seat with electrically adjustable lumbar support
- Seats: Driver's seat height adjustable
- Seats: Rear seat backrest split 40:20:40, foldable
- Seats: Heated front seats
- Sun visor with illuminated mirror for driver and passenger
- Lane Following Assist (LFA) (The Lane Following Assist keeps the vehicle in the middle of the lane and, in addition to the lane markings, also uses the vehicle in front as a guide)
- Blind Spot Warning (BCW)
- USB-C charging ports front / rear
- Glazing: Privacy glass (dark tinted from the B-pillar back)
- Traffic sign recognition (Intelligent traffic sign recognition with speed assist (ISLA))
- Central locking with remote control

- Seat belts (three-point belt system on all seats - belt tensioners and belt force limiters front and rear (outer seats) - belt warning for all seats - height-adjustable seat belts in front)
- Seats: Driver's seat with electrically adjustable lumbar support
- Smart key system with start-stop button
- Sunshade (on the windows of the rear doors)
- Start/Stop System
- Static cornering lights
- 12-volt power outlet, front and in the luggage compartment
- Phone: Smartphone holder with wireless charging function
- Door handles painted in car color
- Glazing: Windscreen and front side windows with acoustic laminated glass
- Electronic immobilizer
- Heat-insulating glass (windshield and front side windows)

Extra equipment

- Paint finish: Mineral effect paint
- Package: Assistance (Hybrid) (Rear parking aid with emergency braking function - Side parking aid - Monitor display for the blind spot warning system - 360° camera - Parking assistant with remote control 1.0)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Door - front right side	Door - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
5	Roof	Roof rail - left side (Wellig) - Unprofessionally repaired - Paint
6	Rear bumper	Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
4	Door - rear left side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Repainting

No. Repainting

- 1 Roof rail - left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - left side

204 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

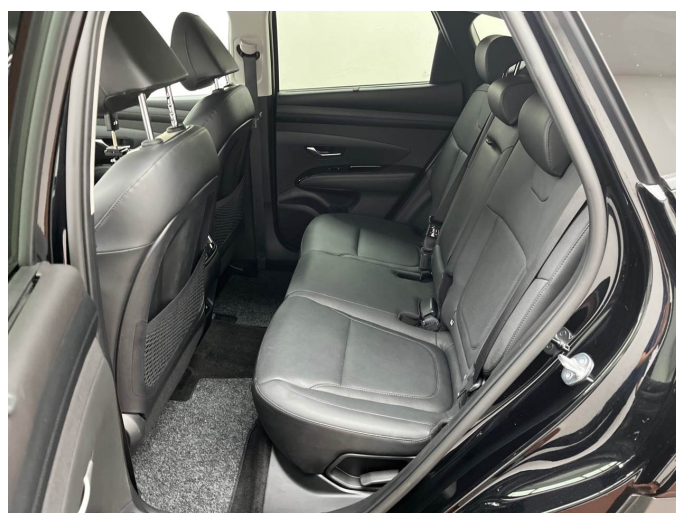


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

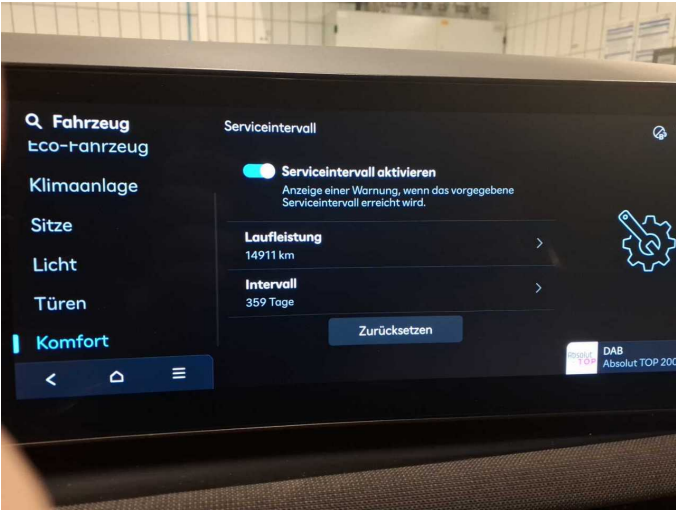


Figure 13: Documents

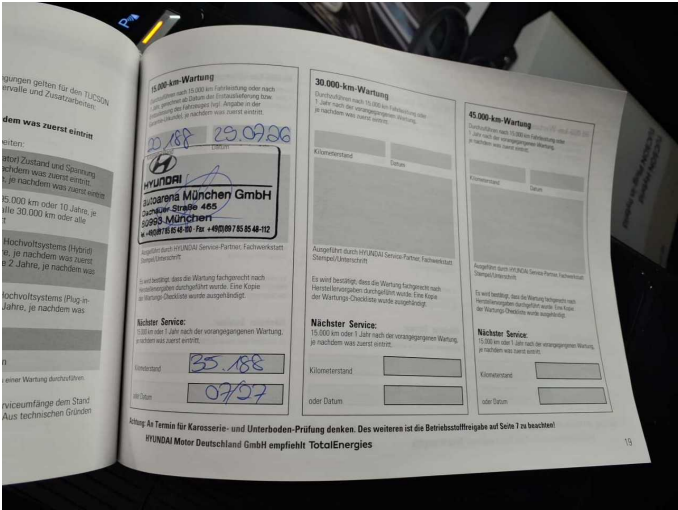


Figure 14: Documents



Figure 15: Documents

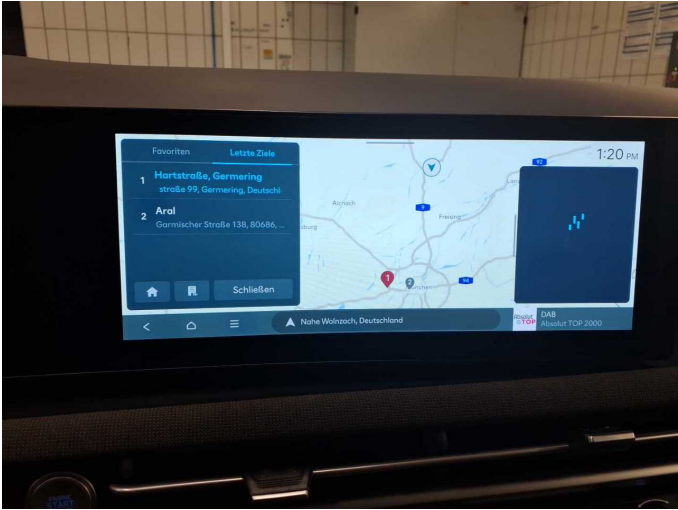


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

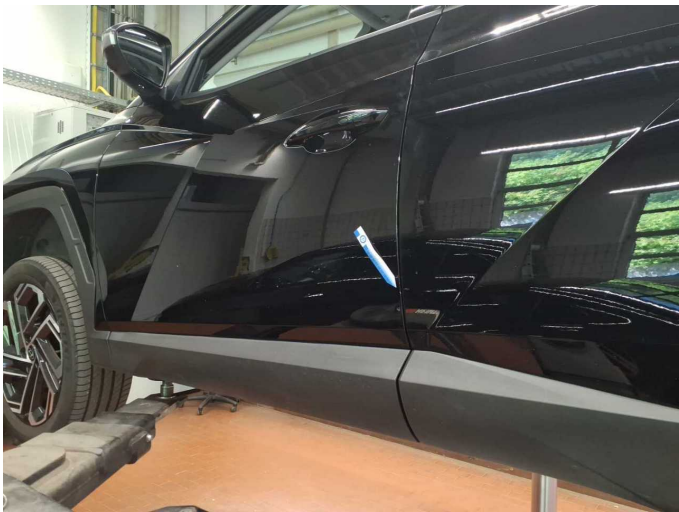

Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair

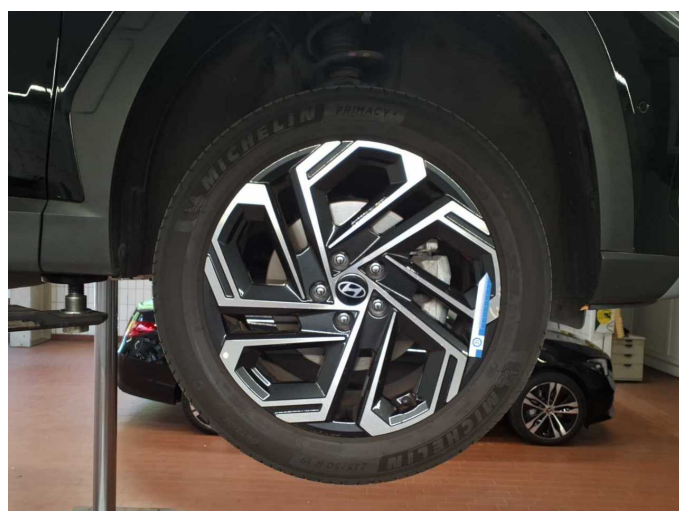


Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

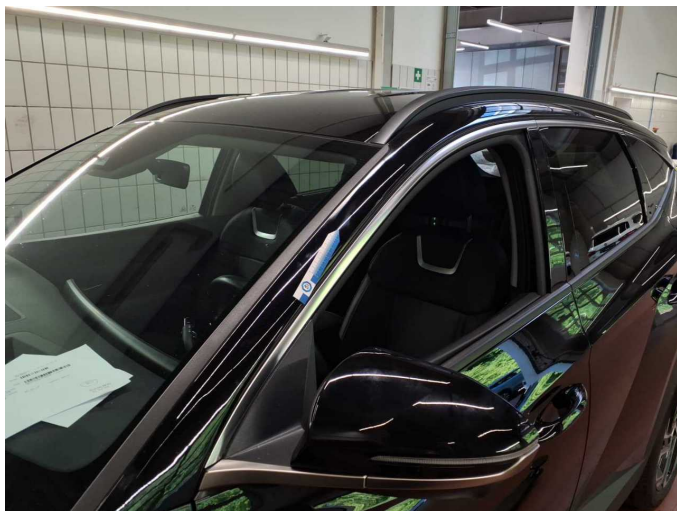

Damage 5: Roof: Roof rail - left side (Wellig) - Unprofessionally repaired - Paint



Damage 5: Roof: Roof rail - left side (Wellig) - Unprofessionally repaired - Paint



Damage 5: Roof: Roof rail - left side (Wellig) - Unprofessionally repaired - Paint



Damage 5: Roof: Roof rail - left side (Wellig) - Unprofessionally repaired - Paint



Damage 5: Roof: Roof rail - left side (Wellig) - Unprofessionally repaired - Paint



Damage 5: Roof: Roof rail - left side (Wellig) - Unprofessionally repaired - Paint



Damage 6: Rear bumper: Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint



Damage 6: Rear bumper: Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint



Damage 6: Rear bumper: Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint



Damage 6: Rear bumper: Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint




Damage 6: Rear bumper: Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint



Damage 6: Rear bumper: Rear bumper (Lackläufer/Einschlüsse; Orangenhaut) - Unprofessionally repaired - Repair and paint




Wear and tear 3: Boot lid / rear door: Boot lid - Scratch(es) - No deduction

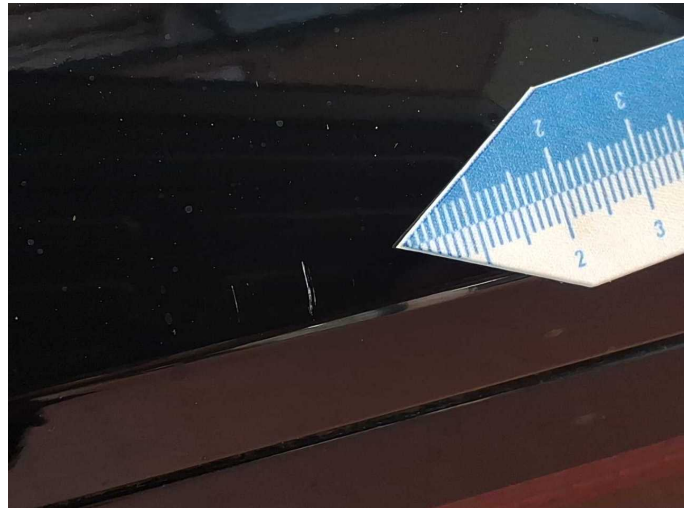

Wear and tear 3: Boot lid / rear door: Boot lid - Scratch(es) - No deduction



Wear and tear 4: Door - rear left side: Door - Scratch(es) - No deduction

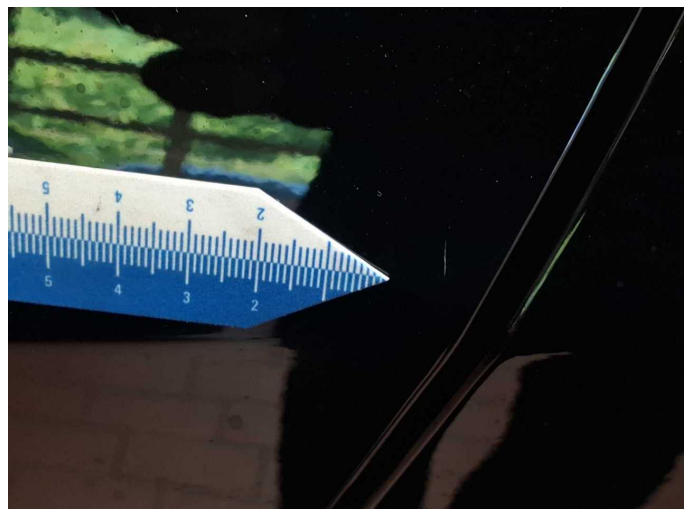

Wear and tear 4: Door - rear left side: Door - Scratch(es) - No deduction



Repainting 1: Roof rail - left side