



Expertise

Protocol number: 46879977
Order No. / Reference: 26765631
Inspection date: 4 Aug 2026

Manufacturer: Toyota

Model: Proace City Verso 1.2 Turbo L2 Aut Team Deutschland

VIN: YARERHNS3GJ018858



Vehicle details	
Manufacturer / Type / Model / Equipment	
Toyota Proace City Verso 1.2 Turbo L2 Aut Team Deutschland	
Vehicle Identification number	YARERHNS3GJ018858
Mileage (Read)	79,808 km
First registration	17 Jan 2023
Number of holders	2
Next periodical technical inspection	01/2028
(Report on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	1,199 ccm / 3
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	metallic grau
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,260 km
Last service on / at	04/2025 at 60,733 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS893366
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	5013 / AOK 00171		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,060 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	205/60 R16 92H	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Automatic low beam - Anti-lock braking system (ABS) - Electrically adjustable and heated exterior mirrors - Hill Start Assist (HAC) - Roof rails - Parking sensors, front and rear - Electric windows front and rear - Textile floor mats - Luggage compartment lighting - Speed limiter - Transmission: 8-speed automatic - Heated rear window - Interior mirror automatically and continuously dimming 2-zone automatic climate control - Headrests: rear (3) height adjustable - LED instrument display with 10" digital cluster - Steering wheel: Leather steering wheel - Fog light - Upholstery: Cloth - Radio: Toyota ProTouch multimedia audio system - Tire Pressure Monitoring System (TPWS) - Tire repair kit - Wheels: 16" alloy wheels - Sliding door on the left, driver's side - Side protection painted in vehicle color - Seat belts - Seats: Passenger seat, flat floor, foldable - Seats: Driver's comfort seat with lumbar support and armrest - Sunshades in the 2nd row of seats 12V socket - Daytime running light - Toyota Safety Sense - Tie-down points 4 in the luggage compartment - Central locking with remote control	- Airbags: 6 airbags - Attention assistant - Electrically folding exterior mirrors - Brake lights with LED technology - Tachometer - Electronic Stability Control (VSC) including Traction Control (ASR) - luggage compartment cover roller blind - luggage compartment partition net - Cruise control - Tailgate with window - rear window wiper - Child safety lock, electric - Front headrests (2), height adjustable - Paint finish: Solid - Steering wheel adjustable for height and reach - center armrests - Package: Visible Package - Privacy glass - Radio accessories: Audio controls integrated into the steering wheel - diesel particulate filter - Rear view camera - Sliding door, right - Power steering - Seats: 2nd row of seats with three removable individual seats - Seats: Driver's seat height adjustable - Seats: ISOFIX child seat attachment - Start-stop system - Bumpers and door handles painted in body color 3.5-inch TFT display - Traffic Sign Recognition Enhanced (ERSA) - Electronic immobilizer
---	--

Extra equipment

- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Roof	Stub aerial - Damage caused by marten / rodent - Replace
2	Trim / covers	Trim / covers (Stossfänger vorn) - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
4	Body	Body (Kostenausweitung möglich) - Glued / labelled - De-glue / neutralise
5	Trim / covers	Trim / covers (Laderaum) - Scratched - Loss in value
6	Roof	Roof - dent(s) - Smooth repair work
7	Trim / covers	Door trim - front right side - Scratched - Replace
8	Trim / covers	Door trim - front left side - Scratched - Replace
9	Boot lid / rear door	Trim - standard - lower - Broken / torn - Replace
10	Rear bumper	Bumper with Parktronic - Scratched - Paint
11	Side panel - rear left side	Side panel (wellig-teilweise) - Unprofessionally repaired - Repair and paint
12	Door - front right side	Door (wellig) - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Sill - left side	Sill - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - No deduction
3	Bonnet	Bonnet (+ Delle) - Stone chips - No deduction
4	Door - front left side	Door edge - Scratch(es) - No deduction
5	Sliding door - left side	Sliding door with glass panel - dent(s) - No deduction
6	2nd wheel set	2 alloy rims - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 31 May 2025	4.026,84 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - front right side, Unprofessionally carried out

Paint coat thickness measurement

Side panel - rear left side	253 µm	Door - front right side	201 µm
-----------------------------	--------	-------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

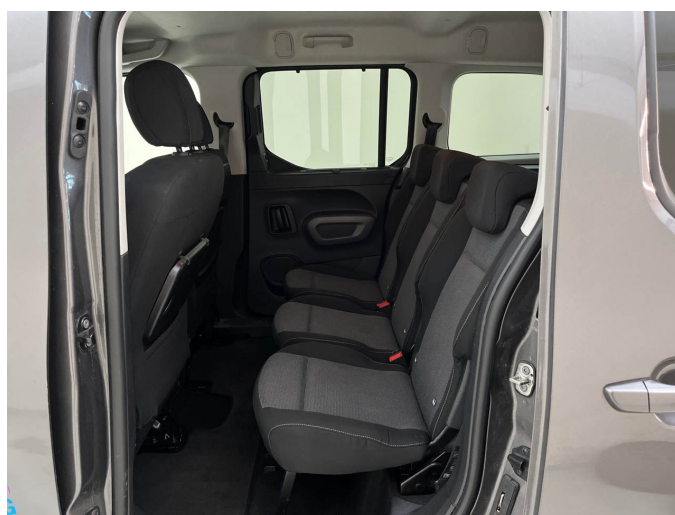


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

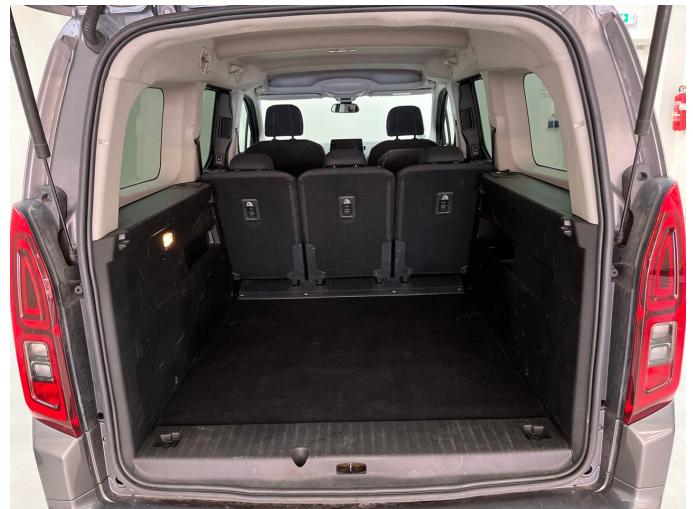


Figure 10: Cargo area

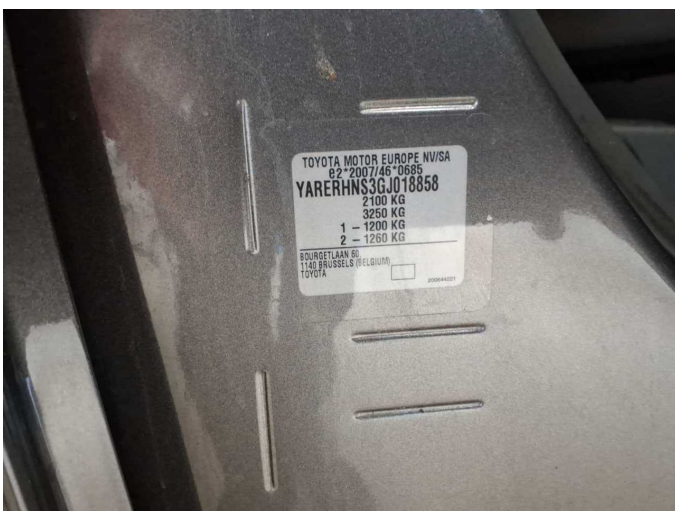


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

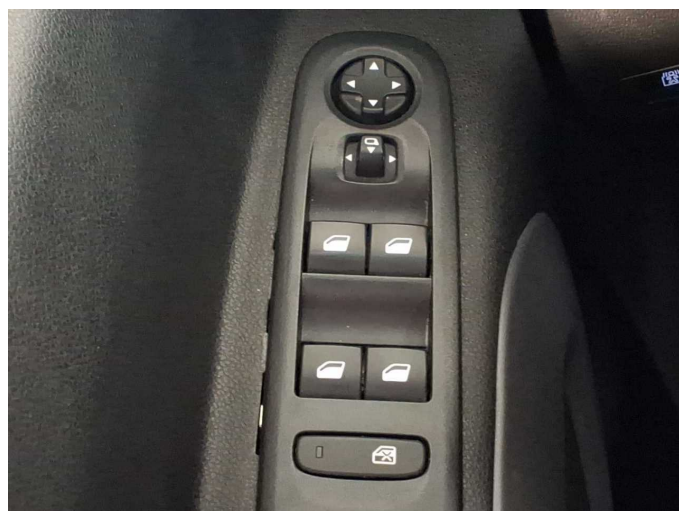


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Roof: Stub aerial - Damage caused by marten / rodent - Replace



Damage 1: Roof: Stub aerial - Damage caused by marten / rodent - Replace



Damage 2: Trim / covers: Trim / covers (Stoßfänger vorn) - Scratch(es) - Smart repair



Damage 2: Trim / covers: Trim / covers (Stoßfänger vorn) - Scratch(es) - Smart repair




Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Body: Body (Kostenausweitung möglich) - Glued / labelled - De-glue / neutralise

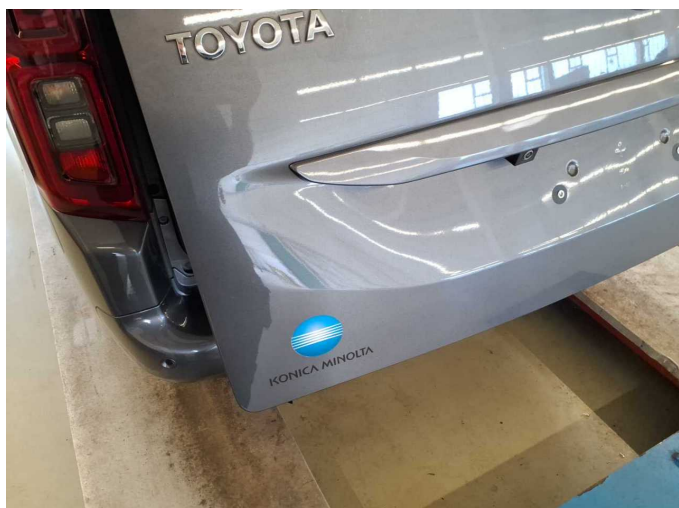

Damage 4: Body: Body (Kostenausweitung möglich) - Glued / labelled - De-glue / neutralise



Damage 5: Trim / covers: Trim / covers (Laderaum) - Scratched - Loss in value



Damage 5: Trim / covers: Trim / covers (Laderaum) - Scratched - Loss in value



Damage 5: Trim / covers: Trim / covers (Laderaum) - Scratched - Loss in value



Damage 5: Trim / covers: Trim / covers (Laderaum) - Scratched - Loss in value



Damage 5: Trim / covers: Trim / covers (Laderaum) - Scratched - Loss in value



Damage 5: Trim / covers: Trim / covers (Laderaum) - Scratched - Loss in value




Damage 6: Roof: Roof - dent(s) - Smooth repair work



Damage 6: Roof: Roof - dent(s) - Smooth repair work



Damage 6: Roof: Roof - dent(s) - Smooth repair work

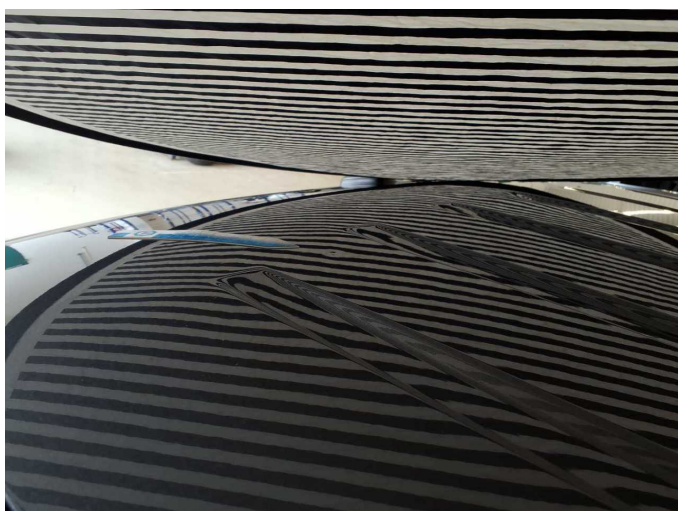

Damage 6: Roof: Roof - dent(s) - Smooth repair work



Damage 7: Trim / covers: Door trim - front right side - Scratched - Replace



Damage 7: Trim / covers: Door trim - front right side - Scratched - Replace



Damage 8: Trim / covers: Door trim - front left side - Scratched - Replace



Damage 8: Trim / covers: Door trim - front left side - Scratched - Replace



Damage 8: Trim / covers: Door trim - front left side - Scratched - Replace



Damage 9: Boot lid / rear door: Trim - standard - lower - Broken / torn - Replace



Damage 9: Boot lid / rear door: Trim - standard - lower - Broken / torn - Replace



Damage 10: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 10: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 10: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 10: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 11: Side panel - rear left side: Side panel (wellig-teilweise) - Unprofessionally repaired - Repair and paint

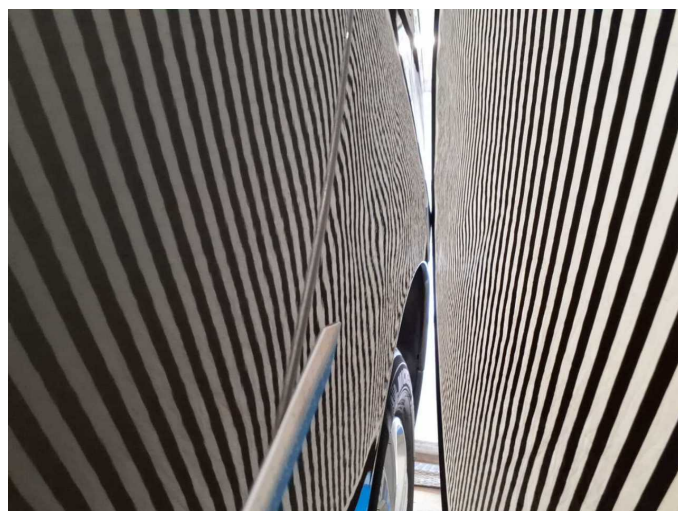


Damage 11: Side panel - rear left side: Side panel (wellig-teilweise) - Unprofessionally repaired - Repair and paint

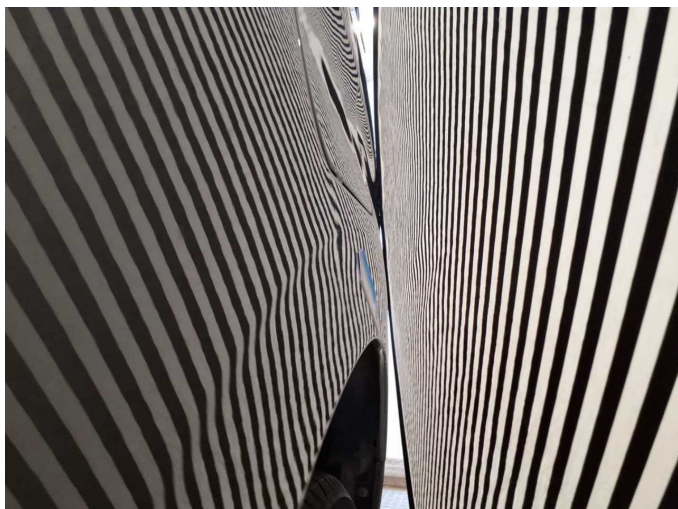


Damage 11: Side panel - rear left side: Side panel (wellig-teilweise) - Unprofessionally repaired - Repair and paint

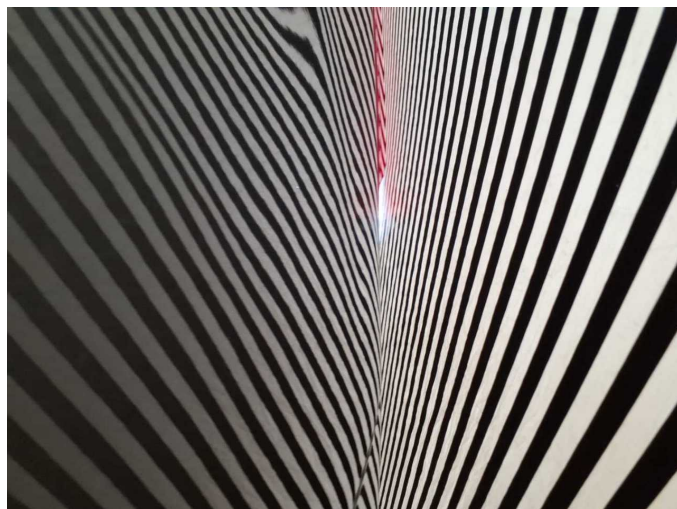


Damage 11: Side panel - rear left side: Side panel (wellig-teilweise) - Unprofessionally repaired - Repair and paint

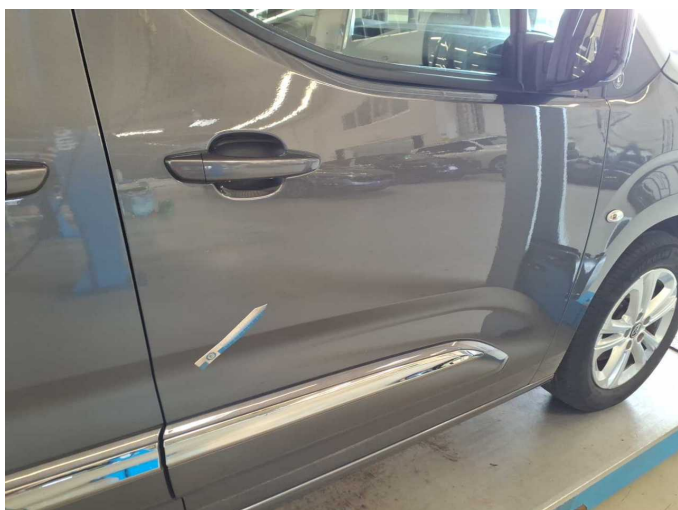

Damage 12: Door - front right side: Door (wellig) - Unprofessionally repaired - Repair and paint

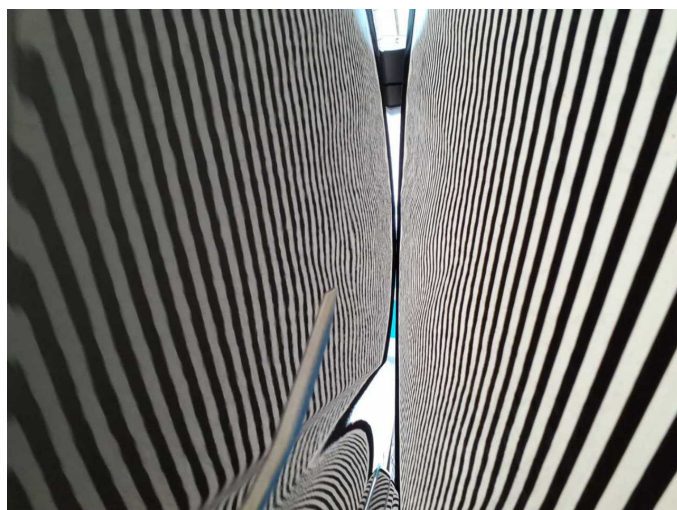

Damage 12: Door - front right side: Door (wellig) - Unprofessionally repaired - Repair and paint

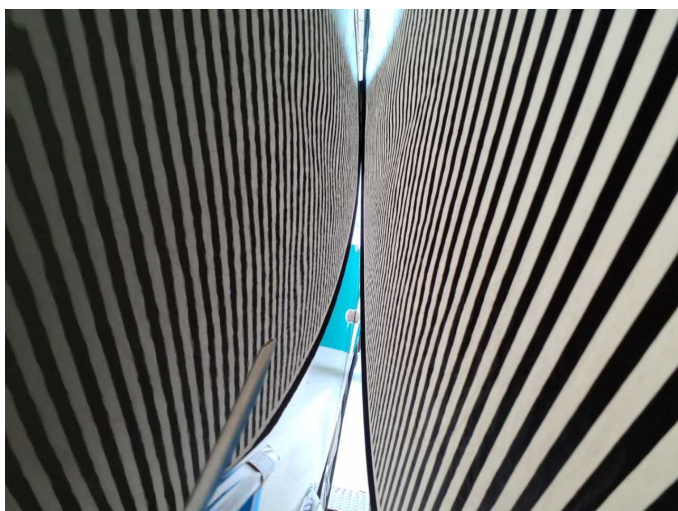

Damage 12: Door - front right side: Door (wellig) - Unprofessionally repaired - Repair and paint



Wear and tear 6: 2nd wheel set: 2 alloy rims - Scratch(es) - No deduction




Wear and tear 6: 2nd wheel set: 2 alloy rims - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 2 alloy rims - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 2 alloy rims - Scratch(es) - No deduction

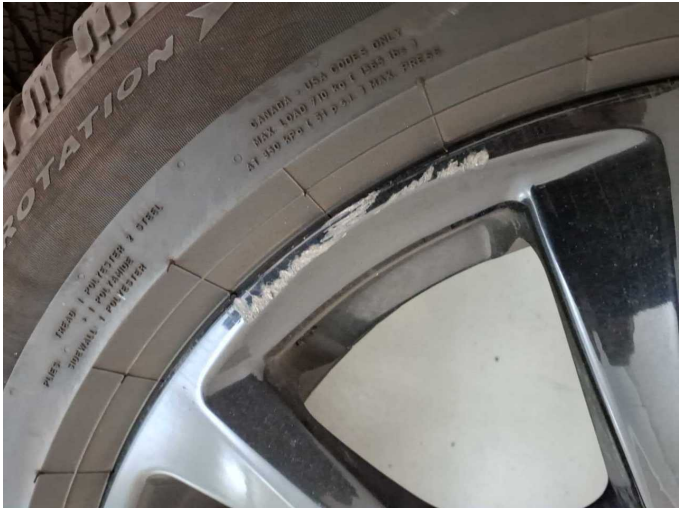

Wear and tear 6: 2nd wheel set: 2 alloy rims - Scratch(es) - No deduction



Side panel - rear left side: 253 µm



Door - front right side: 201 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YARERHNS3GJ018858

Hersteller / Modell: TOYOTA TOYOTA Proace City Verso 1.2 Turbo L2 Aut Team
Deutschland

Datum	KM-Stand	Beschreibung
23.01.2026	73.838	HU + AU
29.04.2025	60.733	Motoröl b. Wartung; Regelwartungsdienst
24.09.2024	39.593	Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst; Zündkerzen ern
31.01.2024	16.439	HU + AU
22.01.2024	16.438	Motoröl b. Wartung; Regelwartungsdienst