



Expertise

Protocol number: 46711579
Order No. / Reference: 26795010
Inspection date: 24 Jul 2026

Manufacturer: Opel

Model: Astra Sports Tourer 1.5 D Business Edition

VIN: VXXKFCYHZLP1042289



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra Sports Tourer 1.5 D Business Edition	
Vehicle Identification number	VXXKFCYHZLP1042289
Mileage (Read)	165,241 km
First registration	28 Jul 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,498 ccm / 4
Power	96 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	White University
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	11/2025 at 143,893 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS851837
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / AEY 00007		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,960 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 94V	All-season tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/55 R16 94V	All-season tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/85 R16 99M	Summer tyres on Steel	Uniroyal	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Storage compartments • Airbag: Front airbags, driver and front passenger • Airbag: Front and rear outer head airbags • Automatic activation of the hazard warning lights • Exterior mirror housings in black • Hill Start Assist • third brake light • Tachometer • Electronic brake force distribution (EBD) • Electronic Stability Program (ESP) and Traction Control with engine and brake intervention (TCPlus) • Back window, heater • Cable set for trailer hitch • Front headrests and 3 rear headrests, height adjustable • LED interior lighting • Steering wheel: Leather steering wheel, flat-bottomed, with steering wheel remote control • Center armrest, front and rear • Fog light • Tire repair kit • 180-degree reversing camera • Keyless Start system • Seats: Ergonomic active driver's seat, Modene fabric • Solar Protect thermal insulation glazing • 12V power outlet in the center console • Electronic immobilizer • Central locking with remote control | <ul style="list-style-type: none"> • Airbag: Chest-pelvis-side airbags, driver and front passenger • Anti-lock braking system (ABS) • Exterior mirrors, electrically adjustable, heated and manually foldable • On-board computer • Diesel particulate filter (DPF) maintenance-free • Eco Coaching: Upshift recommendation via display in the driver information display • Electric windows front and rear • Transmission: 6-speed manual transmission • rear window wiper • automatic climate control • Paintwork: Roof in car color • LED headlights • Steering wheel heating • Illuminated makeup mirrors in both sun visors • Multimedia infotainment system • Electric parking brake • Tire pressure monitoring system • Rear seat backrest folds forward in a 40:20:40 split • Seat belts: Three-point seat belts in all seats • Heated seats, driver and passenger • Start/Stop System • Pre-wiring for ISOFIX child seat mounting system • Wireless Charging |
|---|--|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Detachable trailer hitch • Paint finish: Solid • Retrofitting emergency wheel • Wheels: Alloy wheels 7 J x 16 (5 double spokes) in silver with all-weather tires | <ul style="list-style-type: none"> • Rubber mats • cargo area liner • Navigation system • Wheels: Pre-installation for emergency wheels • safety net |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap (Lack nebel) - Paint defect - Smart repair
2	Door - rear left side	Door - dent(s) - Smooth repair work
3	Front bumper	Front bumper - Scratch(es) - Smart repair
4	Door - front right side	Door edge - Dent / paintcoat damage - Smart repair
5	Bonnet	Insulation lining - Broken / torn - Replace
6	Front bumper	Parking sensors - left side (Und rechts) - Stone chips - Paint
7	Trim / covers	Trim / covers (Scheinwerfer zierleiste) - Scratch(es) - Replace
8	Body	A-pillar - right side (Lack nebel) - Paint defect - Paint
9	Mudguard - right side	Mudguard - right side (Wellig und lack löst sich) - Unprofessionally repaired - Paint
10	Side panel - rear left side	Side panel (Wellig) - Unprofessionally repaired - Paint
11	Bonnet	Bonnet - Scratch(es) - Paint
12	Rear bumper	Rear bumper - dent(s) - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Body	A-pillar - left side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 22 May 2025	1.131,71 €
2	Side - left, Professionally repaired, Invoice of repair done Non-existent, from 12 Jun 2025	1.134,00 €

Repainting

No.	Repainting
1	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
2	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - right side, Unprofessionally carried out, Invoice of repair done Non-existent
4	Side panel - rear left side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	214 µm	Side panel - rear left side	229 µm
Door - rear left side	198 µm	Door - front left side	420 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

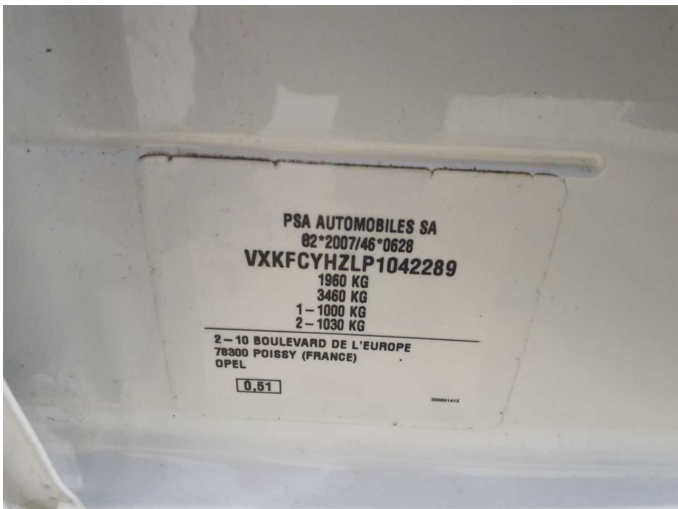


Figure 11: VIN

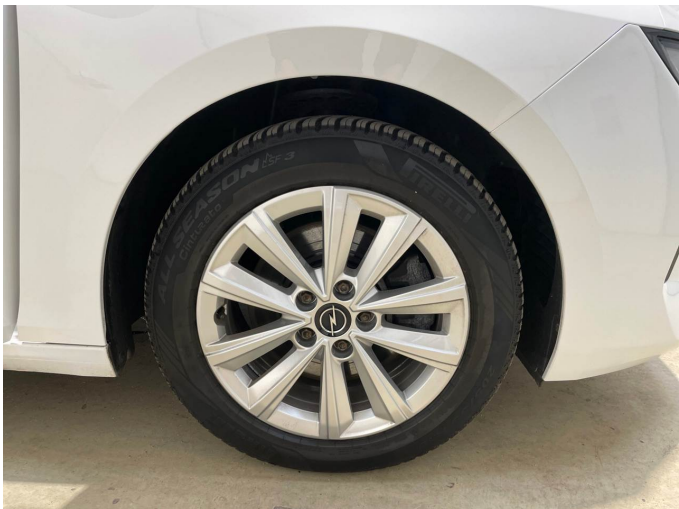


Figure 12: Mounted tyres



Figure 13: Documents

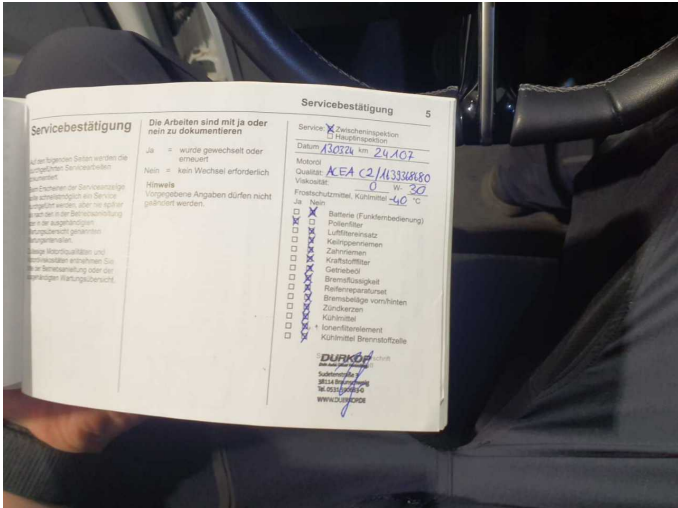


Figure 14: Documents



Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

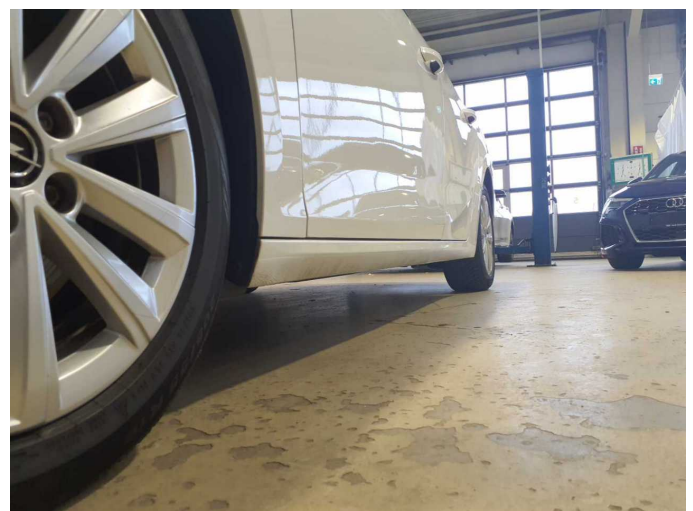


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

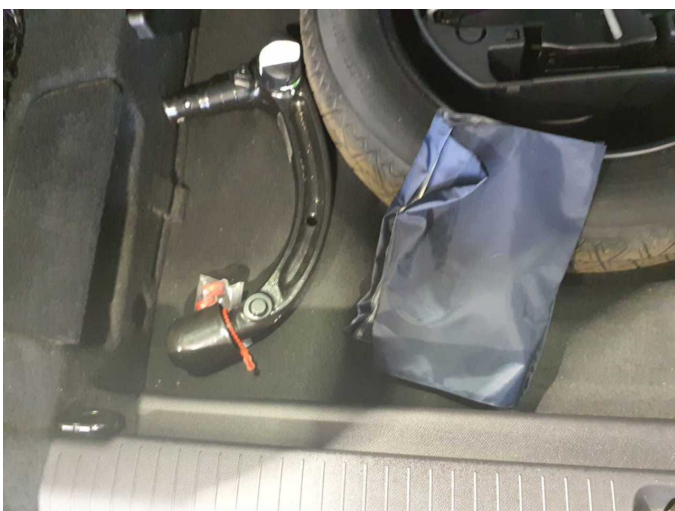



Figure 29: Misc.




Damage 1: Wing mirror - right side: Cap (Lack nebel) - Paint defect - Smart repair




Damage 1: Wing mirror - right side: Cap (Lack nebel) - Paint defect - Smart repair

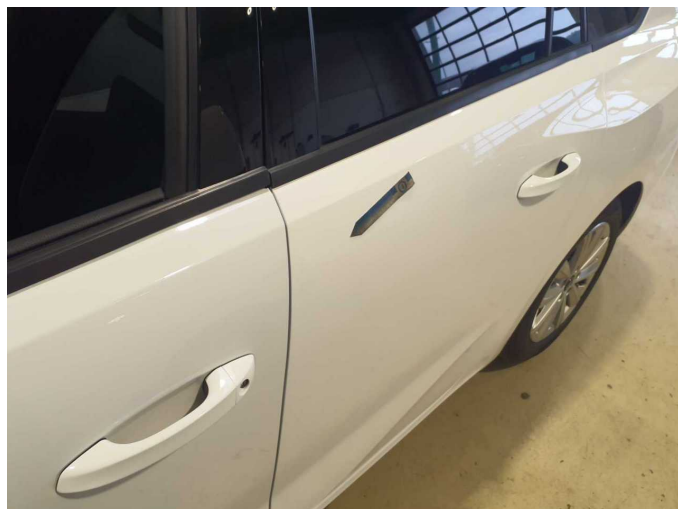

Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work

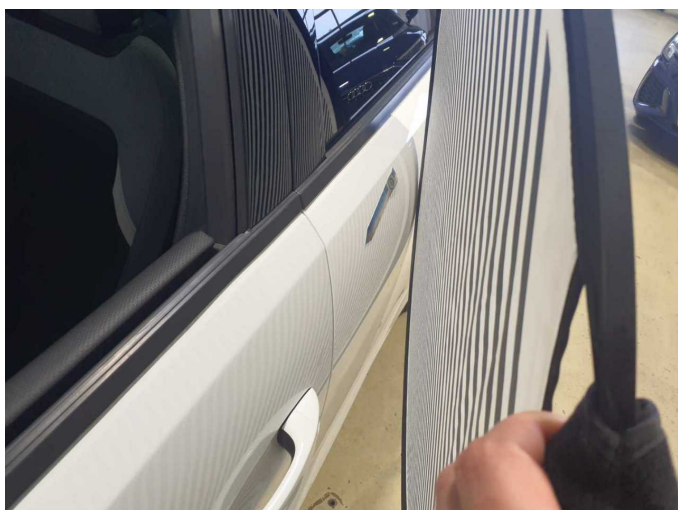


Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work

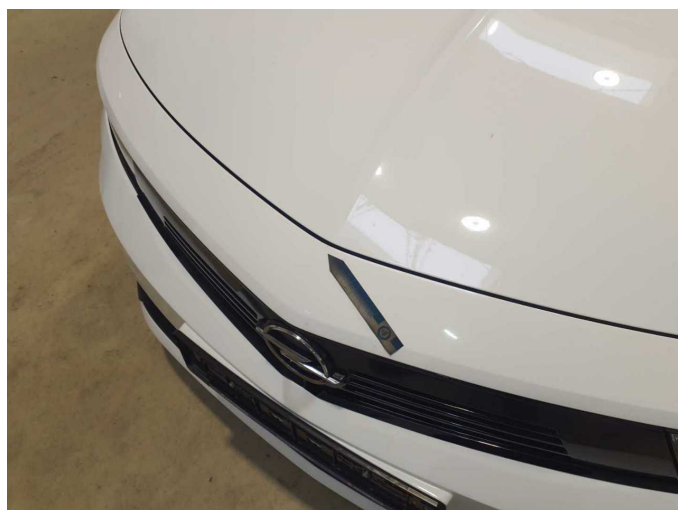

Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair

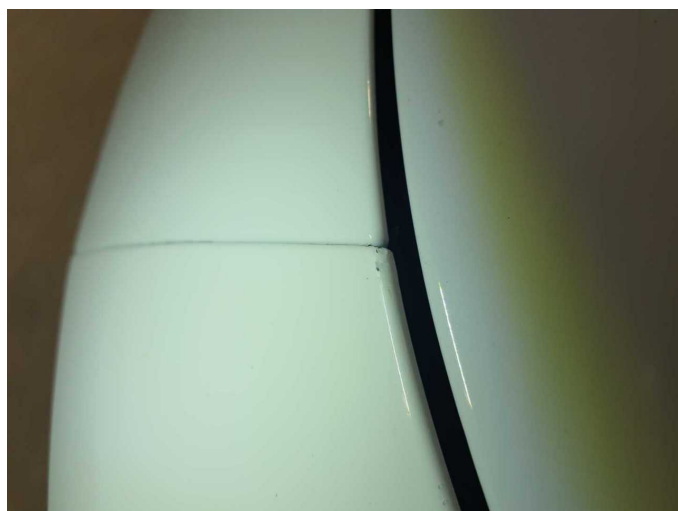

Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 4: Door - front right side: Door edge - Dent / paintcoat damage - Smart repair



Damage 4: Door - front right side: Door edge - Dent / paintcoat damage - Smart repair




Damage 4: Door - front right side: Door edge - Dent / paintcoat damage - Smart repair

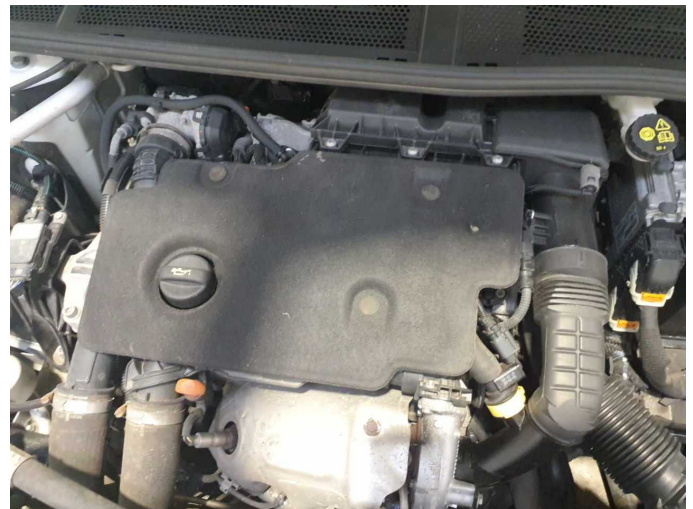

Damage 5: Bonnet: Insulation lining - Broken / torn - Replace




Damage 5: Bonnet: Insulation lining - Broken / torn - Replace

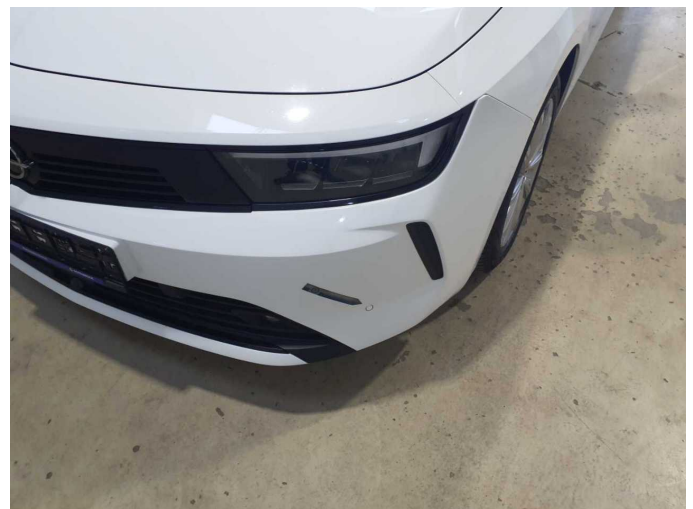

Damage 6: Front bumper: Parking sensors - left side (Und rechts) - Stone chips - Paint



Damage 6: Front bumper: Parking sensors - left side (Und rechts) - Stone chips - Paint

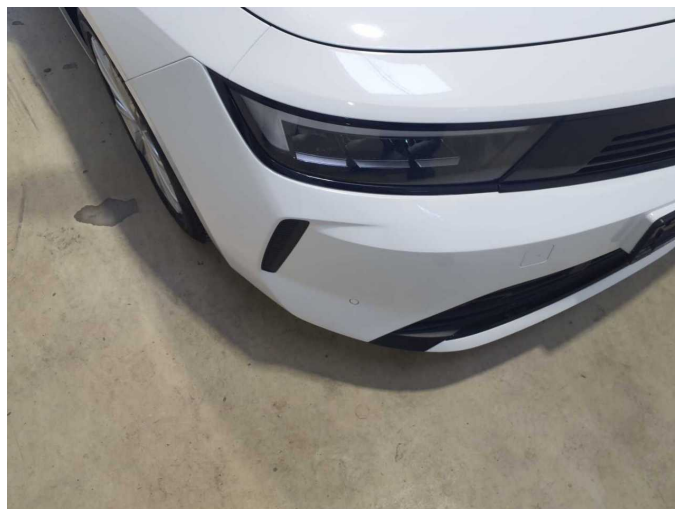

Damage 6: Front bumper: Parking sensors - left side (Und rechts) - Stone chips - Paint




Damage 6: Front bumper: Parking sensors - left side (Und rechts) - Stone chips - Paint



Damage 7: Trim / covers: Trim / covers (Scheinwerfer zierleiste) - Scratch(es) - Replace



Damage 7: Trim / covers: Trim / covers (Scheinwerfer zierleiste) - Scratch(es) - Replace

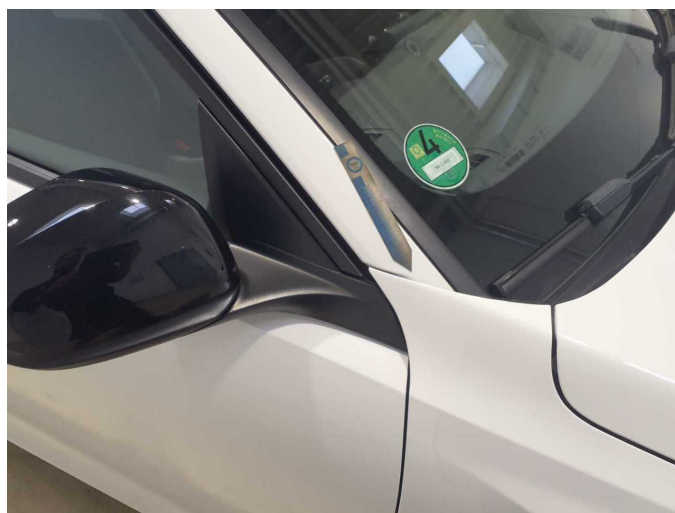

Damage 8: Body: A-pillar - right side (Lack nebel) - Paint defect - Paint




Damage 8: Body: A-pillar - right side (Lack nebel) - Paint defect - Paint



Damage 8: Body: A-pillar - right side (Lack nebel) - Paint defect - Paint



Damage 9: Mudguard - right side: Mudguard - right side (Wellig und lack löst sich) - Unprofessionally repaired - Paint

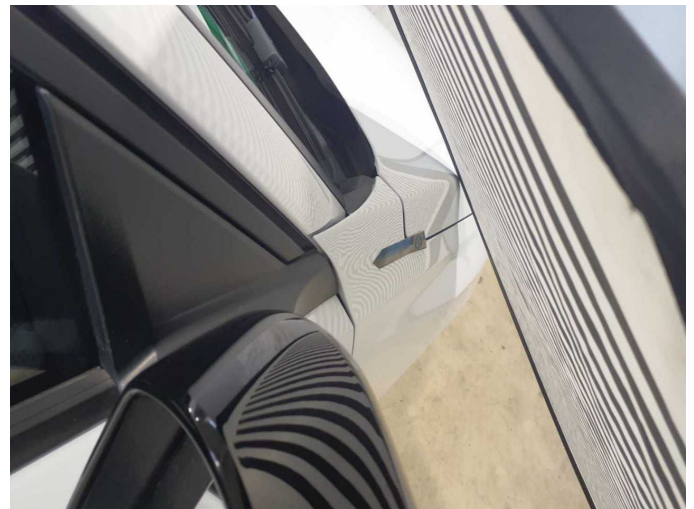

Damage 9: Mudguard - right side: Mudguard - right side (Wellig und lack löst sich) - Unprofessionally repaired - Paint




Damage 9: Mudguard - right side: Mudguard - right side (Wellig und lack löst sich) - Unprofessionally repaired - Paint




Damage 10: Side panel - rear left side: Side panel (Wellig) - Unprofessionally repaired - Paint



Damage 10: Side panel - rear left side: Side panel (Wellig) - Unprofessionally repaired - Paint

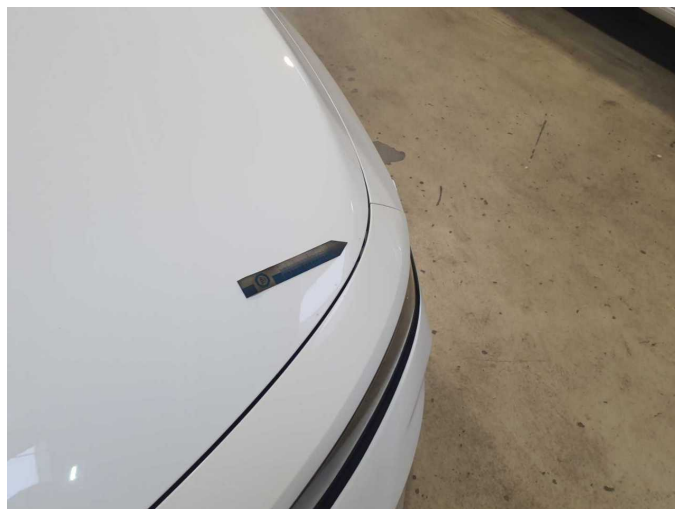

Damage 11: Bonnet: Bonnet - Scratch(es) - Paint

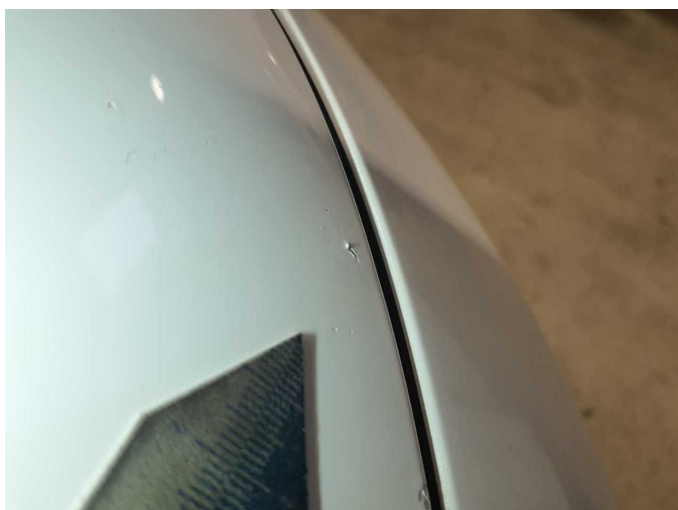

Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - dent(s) - Paint



Damage 12: Rear bumper: Rear bumper - dent(s) - Paint



Repainting 1: Door - rear left side



Repainting 1: Door - rear left side



Repainting 2: Door - front left side



Repainting 2: Door - front left side



Repainting 3: Mudguard - right side



Repainting 3: Mudguard - right side



Repainting 4: Side panel - rear left side



Repainting 4: Side panel - rear left side