



Expertise

Protocol number: 46600112
Order No. / Reference: 26774292
Inspection date: 20 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR DSG Life

VIN: WVGZZZ5NZNW527413



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZ5NZNW527413
Mileage (Read)	163,672 km
First registration	4 Jul 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,100 km
Last service on / at	04/2026 at 152,876 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ276360
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZG 22640		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Steel	Continental	7mm / 7mm
2)	215/65 R17 99H	Winter tyres on Steel	Continental	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	145/85 R18 103M	Summer tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side
- Adaptive Cruise Control (ACC) (DSG)
- third brake light
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program with counter-steering support
- Electric windows front and rear
- High beam control Light Assist
- Pedestrian detection
- Transmission: 7-speed DSG
- rear window wiper
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Rear headrests (3)
- Front headrests
- LED reading lights, 2 in the front and 2 in the rear
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Emergency call service
- Radio "Composition"
- Rain sensor
- Wheels: Light alloy (4) "Tulsa" 7 J x 17
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- First aid kit, warning triangle and high-visibility vest
- Green thermal insulation glazing, sides and rear
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Electrically adjustable and heated exterior mirrors
- black roof rails
- Tachometer
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- Windscreen made of laminated safety glass, heat and sound insulating
- Rear window heated
- Interior mirror automatically dimming
- LED license plate lighting
- Combination instrument cluster with electronic speedometer
- Paint finish: Solid
- LED headlights with LED daytime running lights
- Light in the front footwell
- Manual headlight range adjustment
- Multifunction display "Premium"
- Non-smoking version
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire pressure monitoring system
- Wheels: Tires 215/65 R 17, rolling resistance class A
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Rear bench seat asymmetrically split
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys

Extra equipment

- Foldable towbar (electric release)
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
- Wheels: Winter wheels (4) (additional), steel, 6.5 J x 17 (AirStop winter tires 215/65 R 17 H - on-board tools and jack)
- Paint finish: Pearl effect
- Package: Ambient lighting package (ambient lighting version 2 - chrome applications on mirror adjustment and window regulator switches, door pull handles; interior door controls in matt chrome - decorative inserts for instrument panel and front door trim - illuminated aluminum door sill trims at the front)
- Wheels: Spare wheel in a weight- and space-saving design (on-board tools and jack - luggage compartment floor height-adjustable in 2 stages - spare wheel in a weight- and space-saving design)
- Rear View reversing camera



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	Firewall trim (Dämmmaterial) - Damage caused by marten / rodent - Replace
2	Side panel - rear left side	Sill - Scratched - Smart repair
3	Sill - right side	Sill - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - dent(s) - No deduction
2	Rear bumper	Spoiler - dent(s) - No deduction
3	Boot lid / rear door	Emblem - Paint defect - No deduction
4	Tail light	Tail lamp - right side - Scratched - No deduction
5	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
6	Bonnet	Bonnet (Delle) - Stone chips - No deduction
7	Rear bumper	Rear bumper - Scratch(es) - No deduction
8	Body	Partition wall - Differs from the original configuration - No deduction
9	Body	Body (Polierspuren) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
4	Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	191 µm	Side panel - rear left side	180 µm
Door - rear left side	473 µm	Door - front left side	201 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

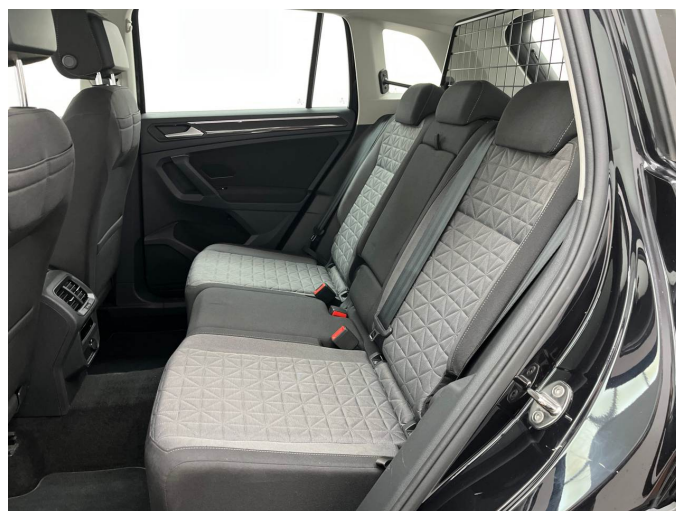


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

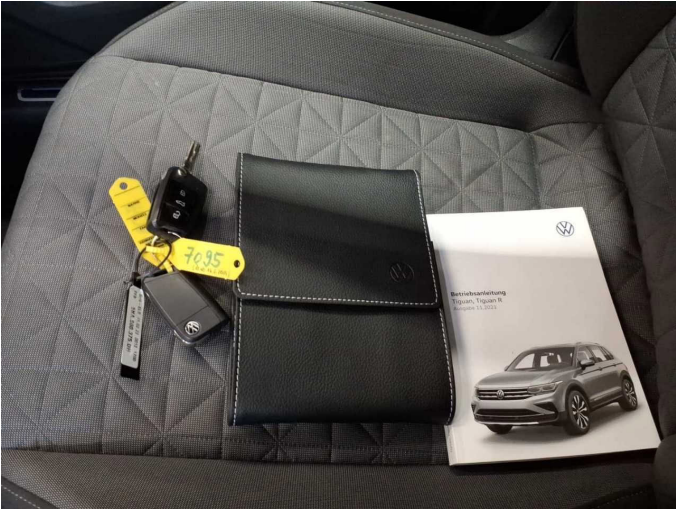


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

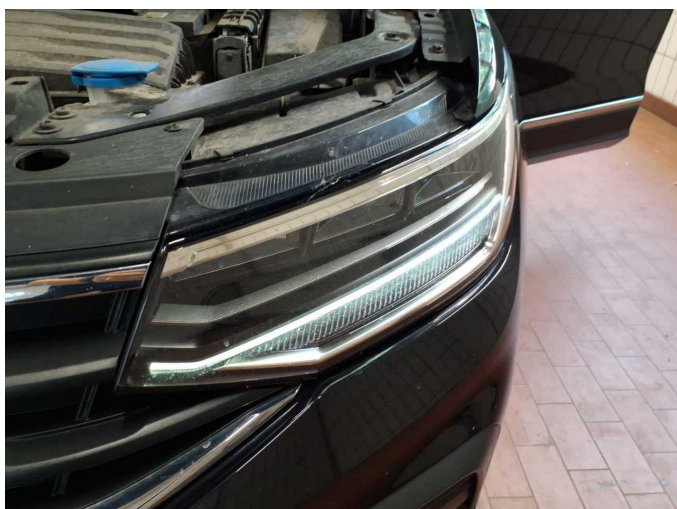


Figure 23: Misc.

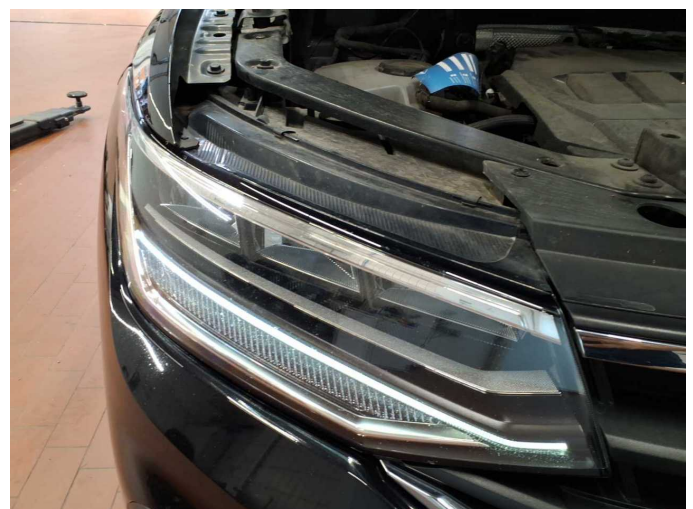


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.




Figure 32: Misc.




Damage 1: Body: Firewall trim (Dämmmaterial) - Damage caused by marten / rodent - Replace

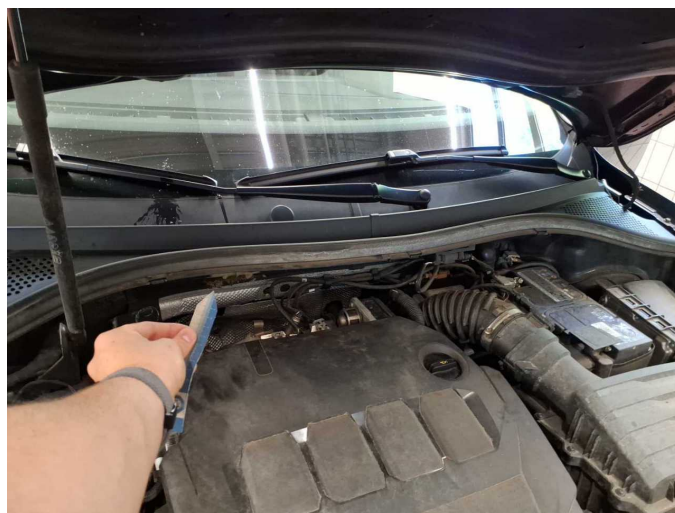

Damage 1: Body: Firewall trim (Dämmmaterial) - Damage caused by marten / rodent - Replace

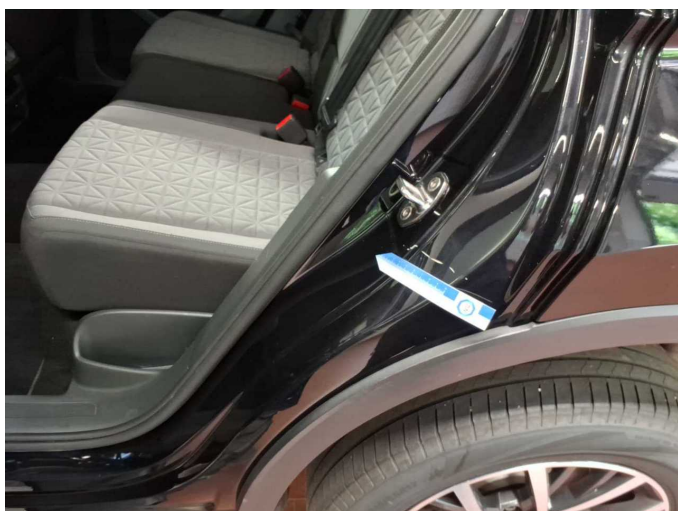

Damage 2: Side panel - rear left side: Sill - Scratched - Smart repair

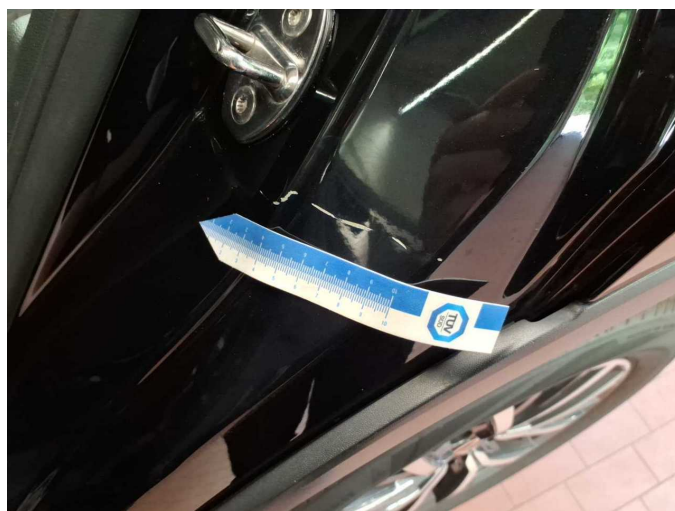


Damage 2: Side panel - rear left side: Sill - Scratched - Smart repair



Damage 3: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 3: Sill - right side: Sill - Scratch(es) - Smart repair

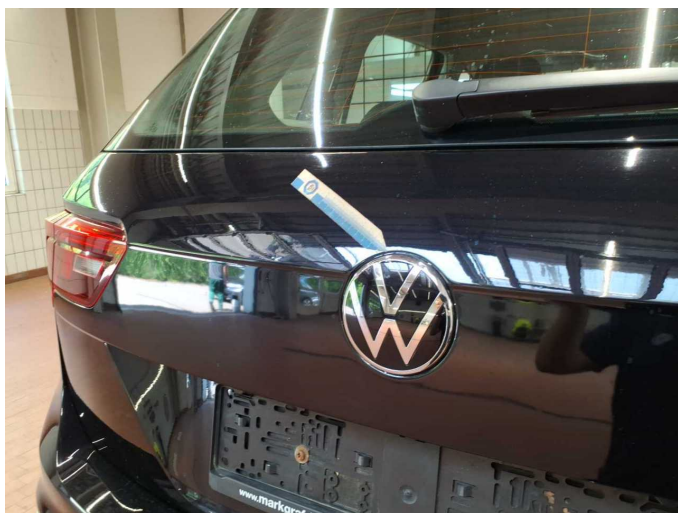


Wear and tear 3: Boot lid / rear door: Emblem - Paint defect - No deduction



Wear and tear 3: Boot lid / rear door: Emblem - Paint defect - No deduction



Wear and tear 4: Tail light: Tail lamp - right side - Scratched - No deduction

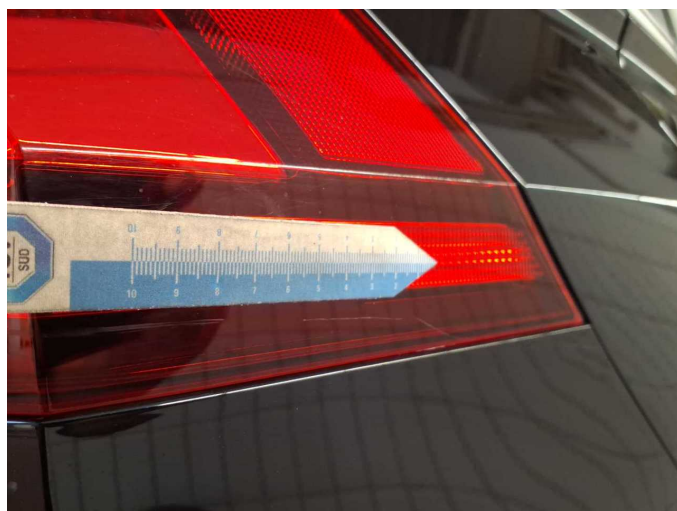


Wear and tear 4: Tail light: Tail lamp - right side - Scratched - No deduction




Wear and tear 5: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction




Wear and tear 5: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction

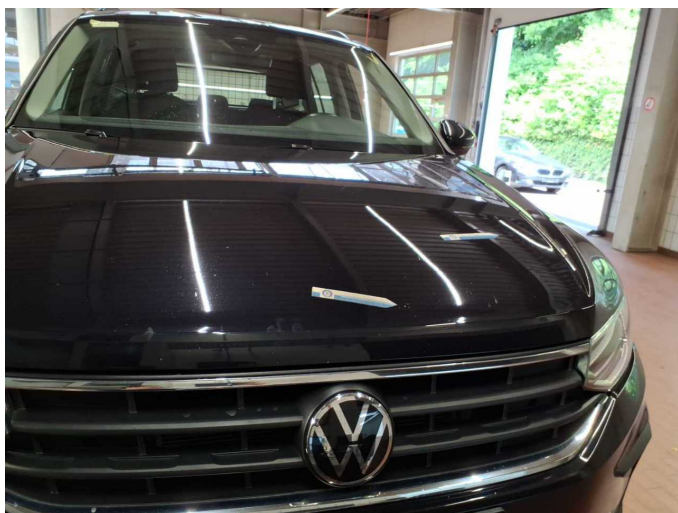

Wear and tear 6: Bonnet: Bonnet (Delle) - Stone chips - No deduction

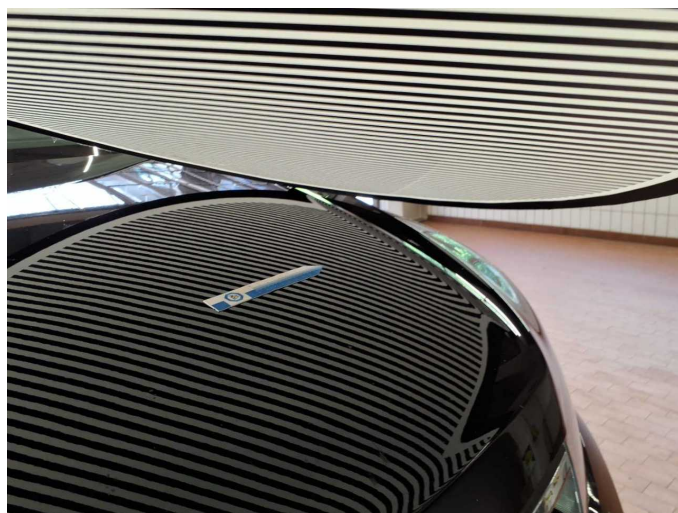

Wear and tear 6: Bonnet: Bonnet (Delle) - Stone chips - No deduction

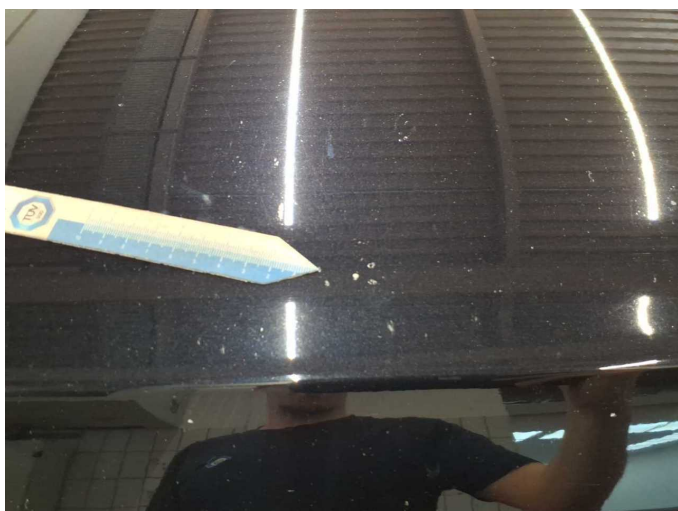

Wear and tear 6: Bonnet: Bonnet (Delle) - Stone chips - No deduction



Wear and tear 7: Rear bumper: Rear bumper - Scratch(es) - No deduction




Wear and tear 7: Rear bumper: Rear bumper - Scratch(es) - No deduction




Wear and tear 8: Body: Partition wall - Differs from the original configuration - No deduction



Wear and tear 8: Body: Partition wall - Differs from the original configuration - No deduction

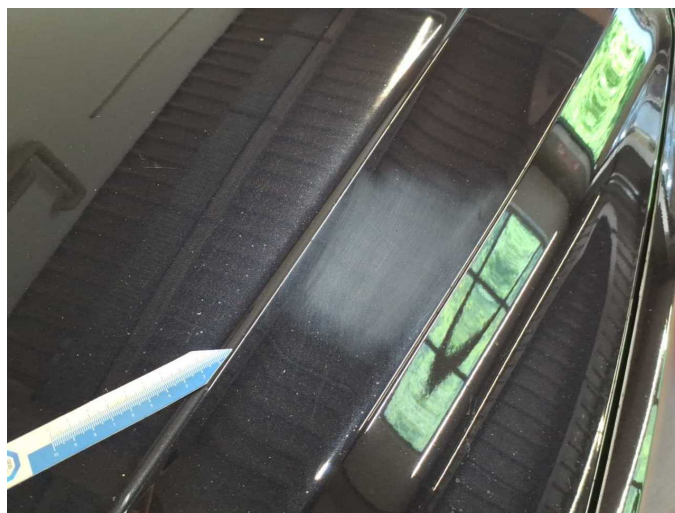

Wear and tear 9: Body: Body (Polierspuren) - Scratch(es) - No deduction

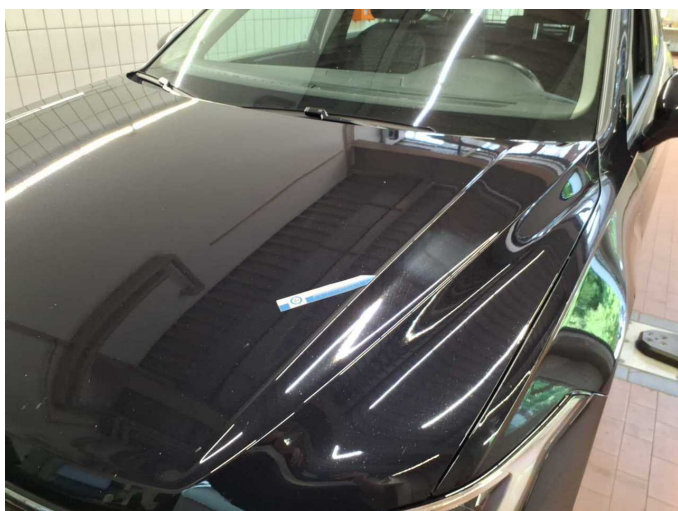


Wear and tear 9: Body: Body (Polierspuren) - Scratch(es) - No deduction




Wear and tear 9: Body: Body (Polierspuren) - Scratch(es) - No deduction



Wear and tear 9: Body: Body (Polierspuren) - Scratch(es) - No deduction

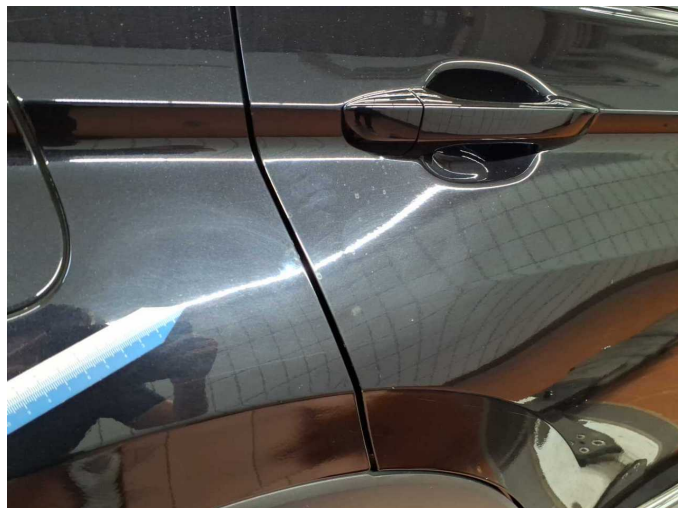

Wear and tear 9: Body: Body (Polierspuren) - Scratch(es) - No deduction

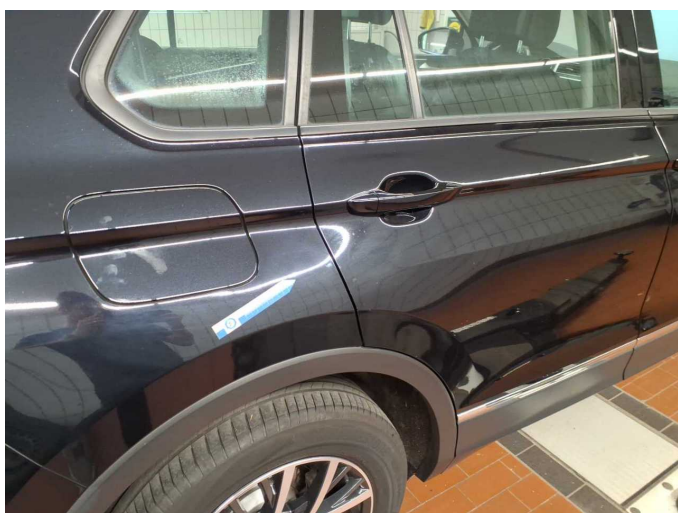

Wear and tear 9: Body: Body (Polierspuren) - Scratch(es) - No deduction




Repainting 1: Boot lid / rear door



Repainting 2: Side panel - rear left side



Repainting 3: Door - rear left side

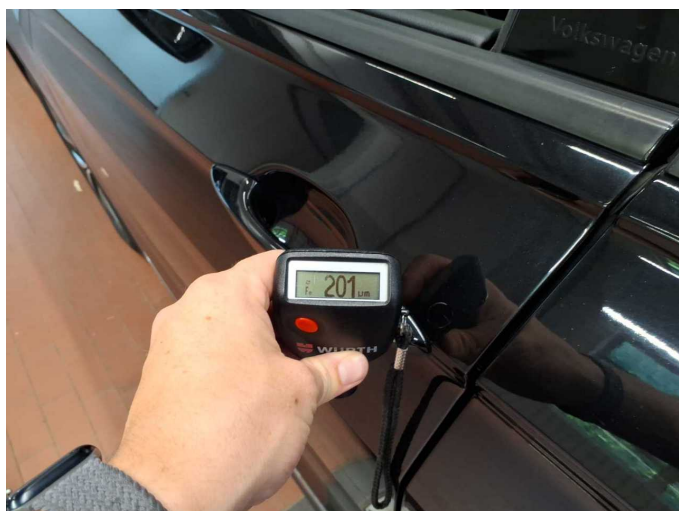

Repainting 4: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZNW527413

Hersteller / Modell: VOLKSWAGEN VW Tiguan 2.0 TDI SCR DSG Life

Datum	KM-Stand	Beschreibung
02.04.2026	152.876	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.07.2025	121.669	AU; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges
26.11.2024	90.928	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
08.12.2023	60.371	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.04.2023	30.408	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges