



Expertise

Protocol number: 46631222
Order No. / Reference: 26579887
Inspection date: 17 Jul 2026

Manufacturer: Ford

Model: Kuga 1.5 EcoBlue Aut. COOL&CONNECT

VIN: WF0FXXWPMFNL56189



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Kuga 1.5 EcoBlue Aut. COOL&CONNECT

Vehicle Identification number	WF0FXXWPMFNL56189
Mileage (Read)	110,945 km
First registration	10 Jun 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	88 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV

Colour / colour code	Agate Black Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black

readiness to drive	Not roadworthy / moveable
--------------------	------------------------------



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19 %
Last service on / at	07/2025 at 86,634 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH421127
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	With complaint
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BTJ 00257		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,110 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102H	Winter tyres on Steel rim with wheel cover	Hankook	6mm / 6mm
2)	225/65 R17 102H	Winter tyres on Steel rim with wheel cover	Hankook	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102V	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
2)	225/65 R17 102V	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Anti-lock braking system
- Tires: 7 J x 17 steel wheels
- third brake light
- Fabric headliner
- Diesel particulate filter
- Tachometer
- Driver information system with on-board computer - color
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford EcoCoach
- FordPass Connect
- Luggage compartment lighting
- Transmission: 8-speed automatic
- Heated rear window
- Intelligent Protection System (IPS)
- Front and rear headrests (5) height adjustable
- LED taillights
- Steering column, adjustable in height and reach
- Front center console with integrated armrest
- Navigation system: Ford navigation system including Ford SYNC 3
- Front and rear parking pilot system
- Upholstery: Cloth
- Pre-Collision Assist
- Projection lens headlights with LED daytime running lights
- Headlight assistant with day/night sensor
- Seats: Passenger seat, 4-way manually adjustable
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front sports seats with integrated headrests
- Start-stop system
- Carpet floor mats in the front
- Immobiliser

Extra equipment

- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- WKR on LMF 225/65 R17

- Passenger airbag deactivation
- Tires: Tire repair kit
- Chrome decorative trim around the side windows
- Roof spoiler
- Dual exhaust system
- Electronic Stability Program (ESP)
- Driving mode switch selective
- Electric windows front and rear
- Ford Easy Fuel
- FordPower starting function
- Luggage compartment cover, roller blind, removable
- Cruise control
- Illuminated glove compartment
- rear window wiper
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Steering wheel: Steering wheel, 3-spoke design, in Sensico synthetic leather
- MyKey key system
- Fog light
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Post-Collision Assist
- Tire Pressure Monitoring System (TPMS)
- Headlights with delayed shut-off
- Power steering
- Seats: Driver's seat, 8-way manually adjustable, including adjustable lumbar support
- Seats: Front seats, individually and variably heated
- Power outlet: 12-volt connection in the luggage compartment
- Central locking with remote control and remote luggage compartment release

- Paint finish: Agate Black Metallic
- Safety partition net (including attachment points behind the first and second rows of seats)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Motorkontrolleuchte aktiv, Fehlerursache ohne Diagnose nicht genau identifizierbar
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Instrument panel	Indicator light (Motor) - on - Perform diagnosis
3	Door - rear left side	Door - Scratch(es) - Paint
4	Side panel - rear right side	Side panel - Deformed - Repair and paint
5	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Interior	Interior - Soiled - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Underbody, Provided by user / customer, from 16 May 2023	7.487,09 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

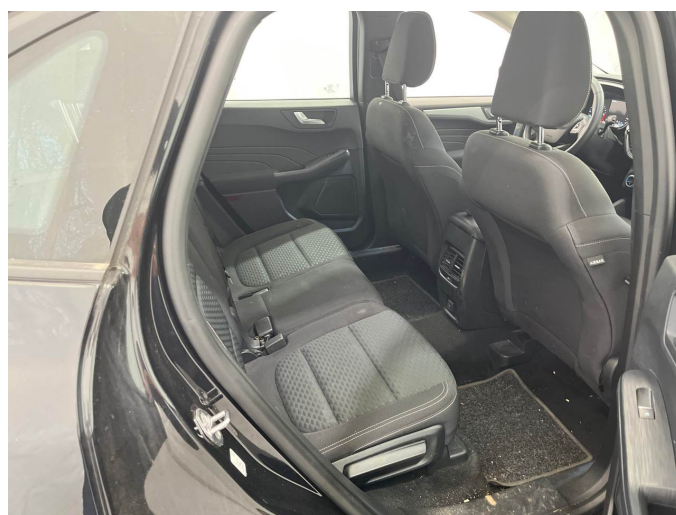


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

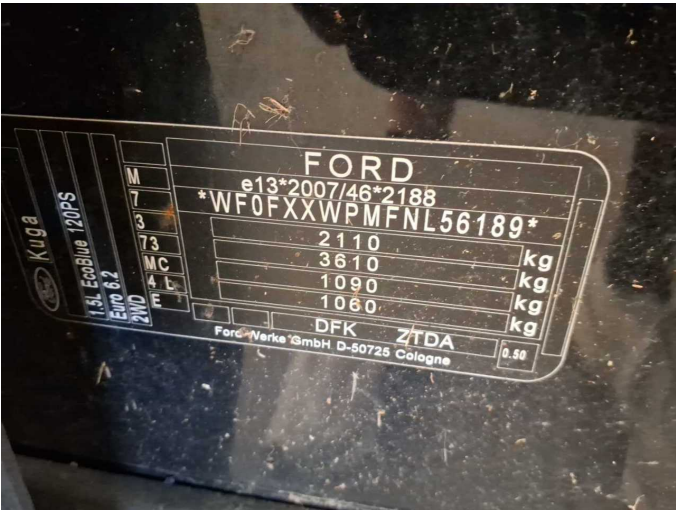


Figure 11: VIN



Figure 12: Mounted tyres

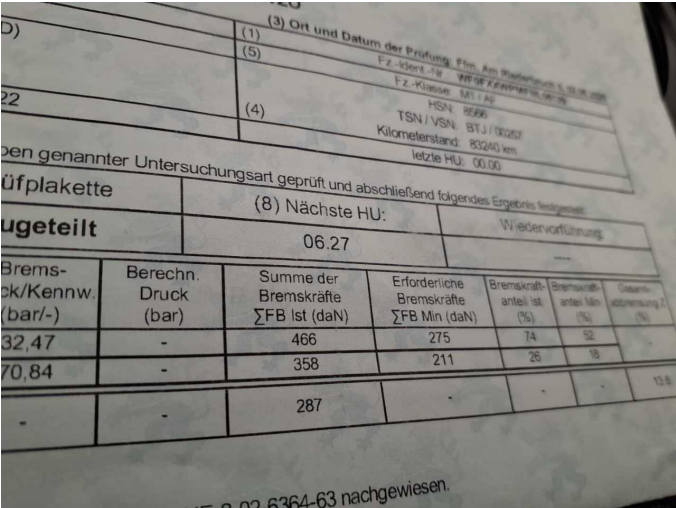


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

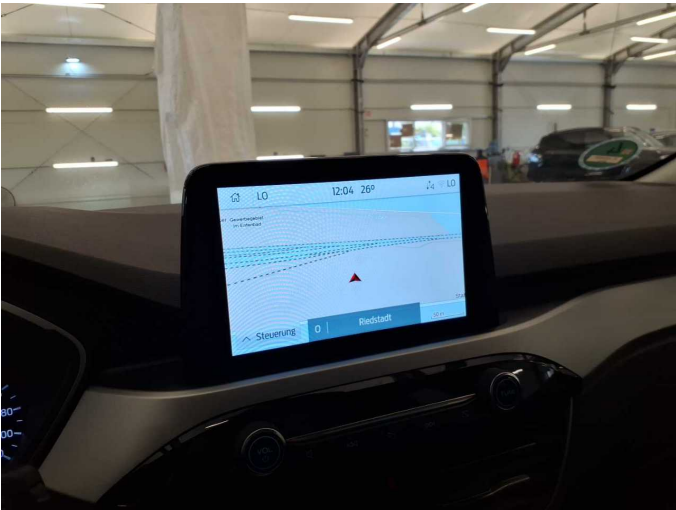


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

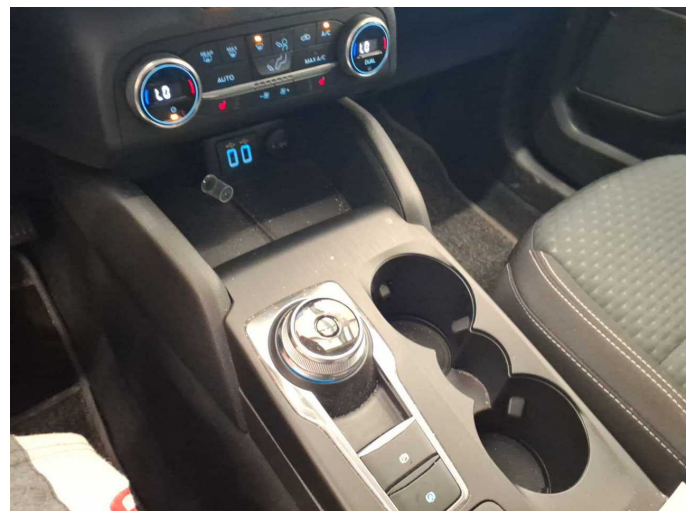


Figure 22: Misc.

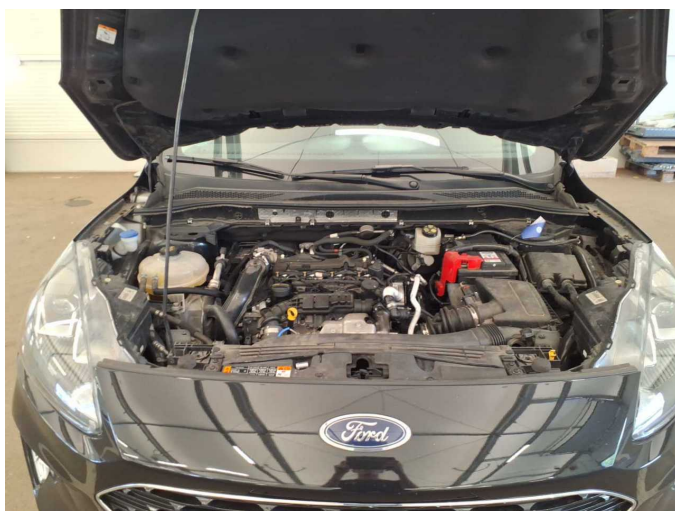


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

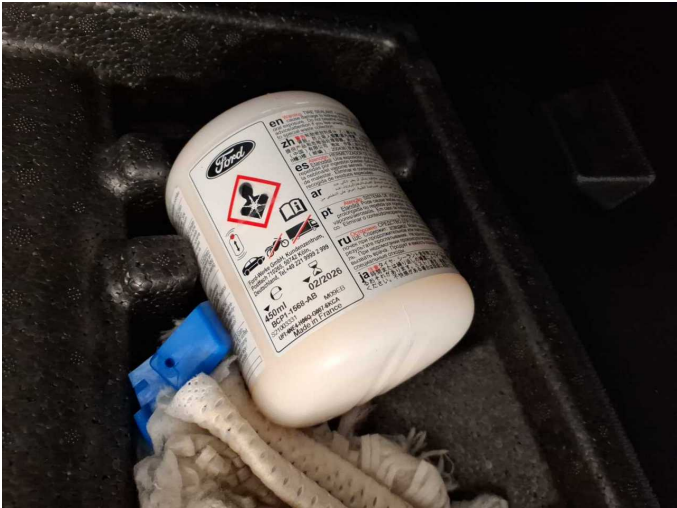


Figure 28: Misc.



Figure 29: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Instrument panel: Indicator light (Motor) - on - Perform diagnosis



Damage 3: Door - rear left side: Door - Scratch(es) - Paint



Damage 3: Door - rear left side: Door - Scratch(es) - Paint




Damage 3: Door - rear left side: Door - Scratch(es) - Paint




Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint




Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint

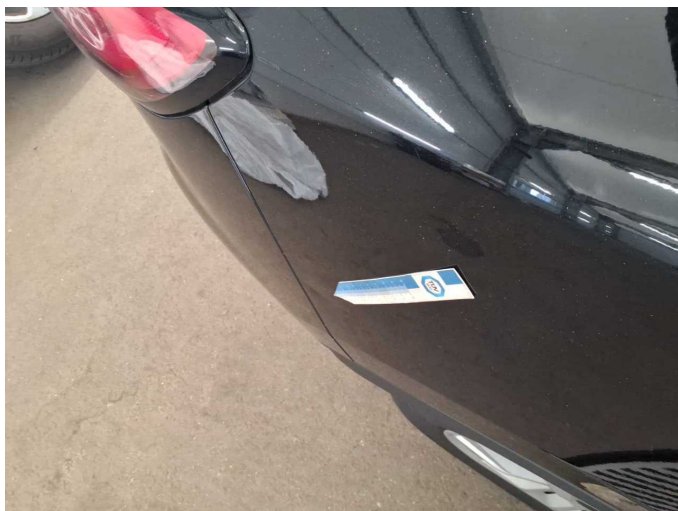


Damage 4: Side panel - rear right side: Side panel - Deformed - Repair and paint

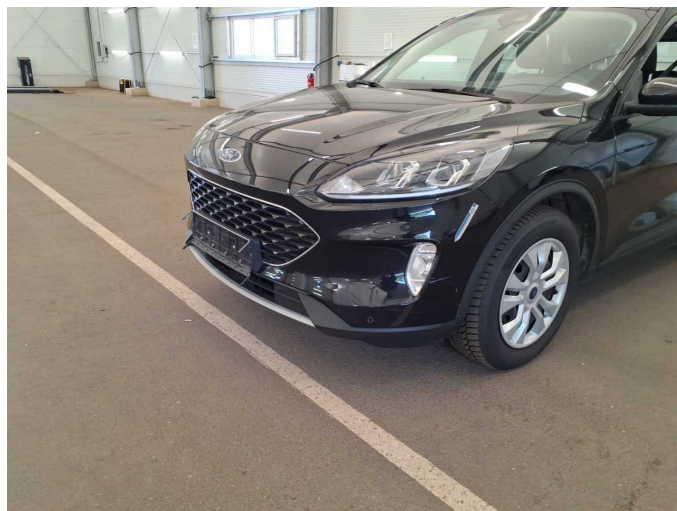


Damage 5: Front bumper: Front bumper - Scratched - Paint

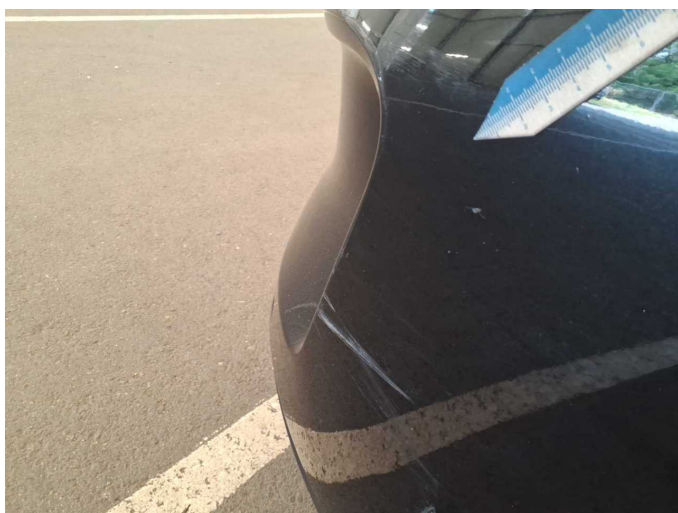

Damage 5: Front bumper: Front bumper - Scratched - Paint

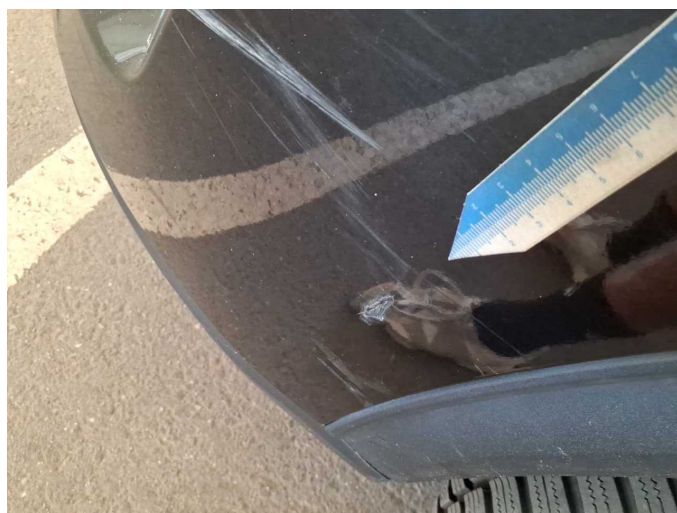

Damage 5: Front bumper: Front bumper - Scratched - Paint

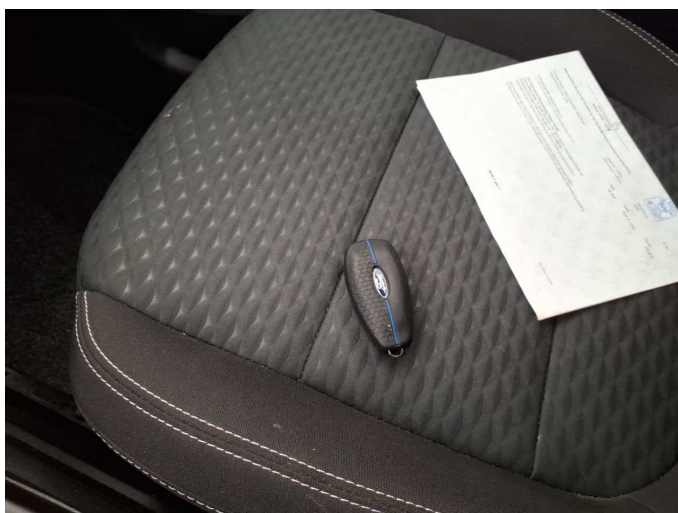

Missing part 1: Equipment: Vehicle key - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0FXXWPMFNL56189

Hersteller / Modell: FORD FORD Kuga 1.5 EcoBlue Aut. COOL&CONNECT

Datum	KM-Stand	Beschreibung
14.07.2025	86.634	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.06.2025	83.239	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
05.07.2024	57.459	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.07.2023	29.503	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst