



Expertise

Protocol number: 46583987
Order No. / Reference: 26701496
Inspection date: 16 Jul 2026

Manufacturer: Skoda
VIN: TMBJH7NP0M7072616

Model: Superb Combi 2.0 TDI Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI Style	
Vehicle Identification number	TMBJH7NP0M7072616
Mileage (Read)	208,325 km
First registration	8 Jun 2021
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Quar-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	-15,200 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD047886
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / APL 01101		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,176 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	215/60 R16 95H	Winter tyres on Light alloy	Dunlop	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors and door handles in body color
- Electrically folding exterior mirrors (with boarding lights - interior and exterior mirrors with automatic dimming)
- Hydraulic brake assist (HBA)
- Roof rails, anodized
- Diesel particulate filter and SCR catalyst
- Third brake light
- Easy Start (start-stop button instead of ignition lock)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (tunnel light, coming and leaving home function)
- Front radar assist including city emergency braking function (The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to the vehicle ahead using a radar sensor integrated into the radiator grille.)
- Rear window wiper including windshield washer system
- Air Care Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter and air-conditioned glove compartment)
- Metal loading sill protector
- Steering wheel: 2-spoke leather steering wheel with multifunction buttons (including gearshift and handbrake levers in leather)
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Radio: Bolero infotainment system (8.0" capacitive multi-touch display (800x480) - 8 speakers - Wireless Smartlink for Apple CarPlay)
- Radio accessories: SmartLink+ (Apple CarPlay - Android Auto - MirrorLink - SmartGate)
- Tire mobility kit (tire repair spray incl. compressor)
- Heated windshield washer nozzles
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, holder for the warning vests in the front doors, glasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5l bottle holders, cup holder in the front center console with easy-open bottle opening, storage pockets on the front seat backrests, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk)
- Illuminated glove compartment
- Hill start assist
- Grey headliner
- Decorative inlay Dark Brushed
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electric tailgate opening (including boot cover and multifunction storage compartment)
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front footwell lighting
- Cruise control system (cruise control) including speed limiter
- Transmission: 6-speed manual transmission
- Tinted windows
- Heated rear window
- ISOFIX preparation on the outer rear seats, including top tether
- Boot cover, roll-up and removable, semi-automatic
- Front and rear headrests are height-adjustable.
- Paint finish: Solid
- Remote release of the rear seat backrests in the trunk
- Steering wheel: height and reach adjustable
- Reading lights at the front and rear of the headliner
- Matrix LED headlights (AFS - dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - incl. dynamic turn signals)
- Color multifunction display in the instrument cluster
- LED fog lights with integrated cornering lights
- Upholstery: Cloth
- Radio accessories: 2 USB-A ports in the center console
- Radio accessories: Digital radio reception DAB+
- Radio accessories: In-car communication
- Radio accessories: Wireless SmartLink for Apple CarPlay
- Tire pressure monitoring
- Wheels: 17" Drakon alloy wheels (6.5J x 17" ET 41 with 215/55 R17 tires - anthracite polished)
- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)
- Seats: electrically adjustable driver's seat with memory function (driver's seat and exterior mirrors with memory function)



- Seats: Electrically adjustable front seats, driver's seat with memory function
- Seats: Electric operation of the front passenger seat from the rear
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Telephone: Convenient hands-free phone system with Bluetooth (without connection to an external antenna)
- Chrome-plated elements (on air vents, light switches, music or navigation systems, air conditioning)
- Immobiliser

- Seats: Height-adjustable front seats
- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Lashing eyes in the trunk
- Central locking with remote control

Extra equipment

- Package: Business Amundsen (Combi) (Amundsen dynamic radio navigation system - 8" capacitive touchscreen in glass design - color Maxi-Dot display - Wi-Fi hotspot (uses the data connection of the paired mobile phone) - voice control - phone box with inductive charging function (connection via external antenna) - driver fatigue detection - 230 V socket and USB ports, tablet holder in the rear - Sunset (dark tinted rear window and rear side windows) - Infotainment Online subscription (3 years) - luggage net partition)

- Front and rear parking sensors
- Heated windshield
- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Documents	Service book (Digitaler Nachweis) - No evidence - No deduction
2	Misc.	Inspection / maintenance - No evidence - No deduction
3	Misc.	Main inspection - No evidence - No deduction
4	Equipment	Tirefit filler - Expired - Replace
5	Door - front left side	Door handle - outside - Scratch(es) - Smart repair
6	Door - front left side	Strip - outer - Scratch(es) - Replace
7	Door - front right side	Strip - outer - Scratch(es) - Replace
8	Steering system	Steering column (Taster Startknopf) - Broken / torn - Loss in value
9	Door - rear left side	Door - dent(s) - Smart repair
10	Vehicle glazing	Door glass - rear right side - Scratch(es) - Loss in value
11	Body	A-pillar - left side - Scratch(es) - Smart repair
12	Side panel - rear left side	Sill - Scratch(es) - Smart repair
13	Equipment	Vehicle key with remote control - Non-operational - Perform diagnosis
14	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace
15	Misc.	Inspection / maintenance (seit 15200 km) - Due - Perform
16	Rear bumper	Rear bumper - Scratched - Paint
17	Side panel - rear right side	Side panel - Scratch(es) - Paint
18	Door - front left side	Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint
19	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
20	Bonnet	Bonnet (+ Steinschläge) - Paint defect - Paint
21	Front bumper	Front bumper (+ Fehlstellung) - Scratched - Repair and paint
22	Door - rear right side	Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint
23	Vehicle glazing	Windscreen (Im Sichtbereich) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction
3	Door - front right side	Door - Soiled - No deduction
4	Tail light	Tail lamp - right side - Scratch(es) - No deduction
5	Trim / covers	Floor mats - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Side - left



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

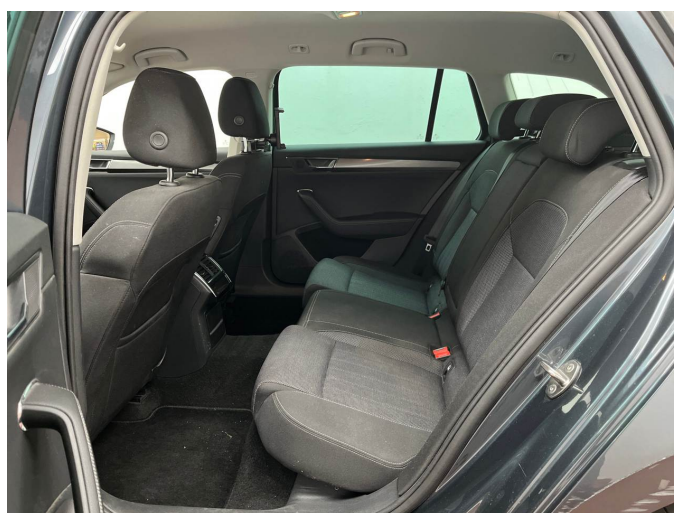


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

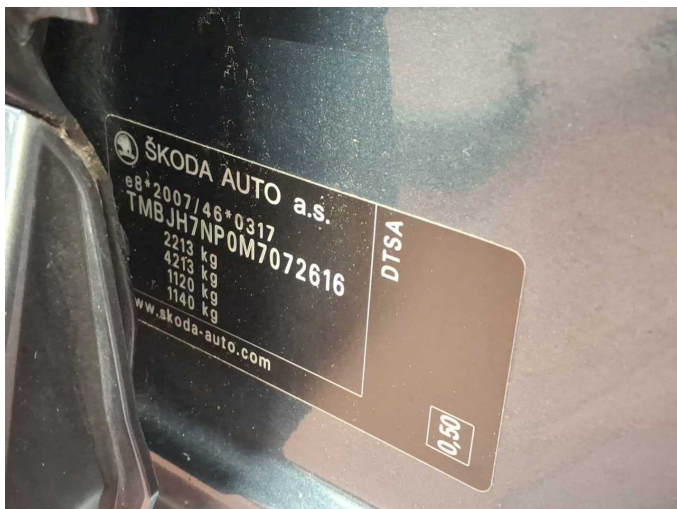


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

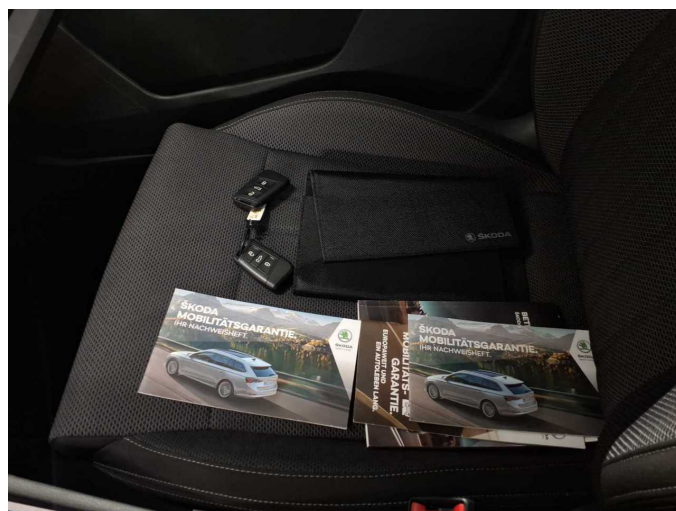


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

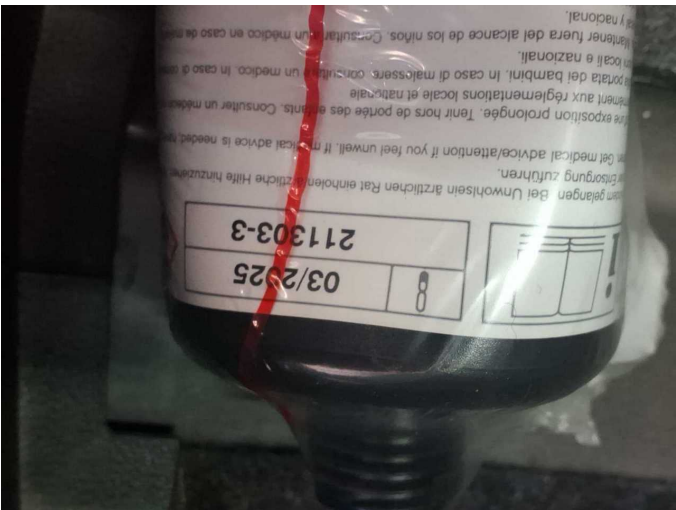


Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

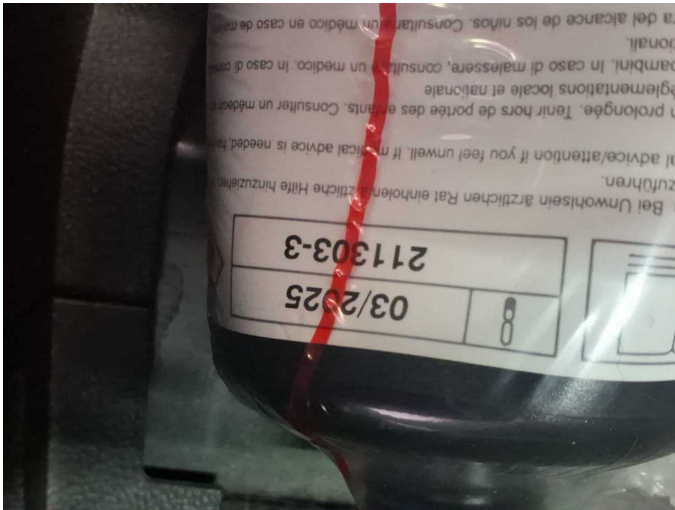

Damage 4: Equipment: Tirefit filler - Expired - Replace



Damage 5: Door - front left side: Door handle - outside - Scratch(es) - Smart repair



Damage 5: Door - front left side: Door handle - outside - Scratch(es) - Smart repair




Damage 6: Door - front left side: Strip - outer - Scratch(es) - Replace




Damage 6: Door - front left side: Strip - outer - Scratch(es) - Replace



Damage 6: Door - front left side: Strip - outer - Scratch(es) - Replace

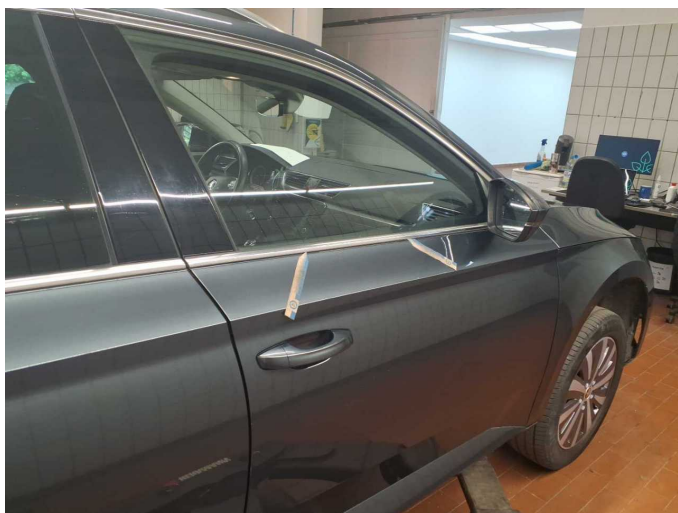

Damage 7: Door - front right side: Strip - outer - Scratch(es) - Replace

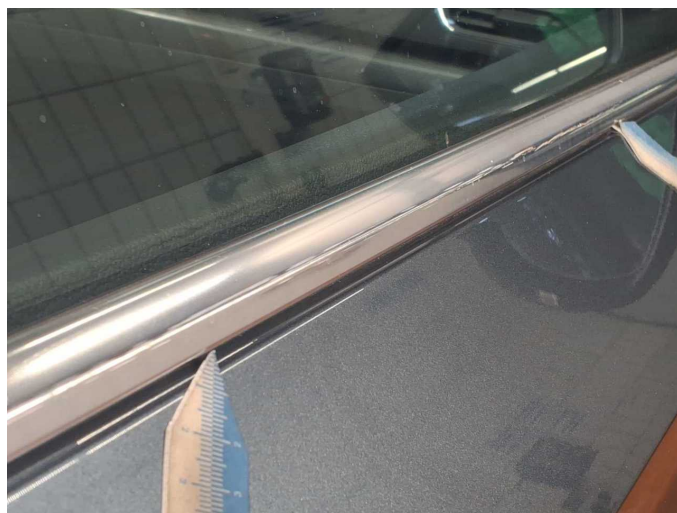


Damage 7: Door - front right side: Strip - outer - Scratch(es) - Replace



Damage 7: Door - front right side: Strip - outer - Scratch(es) - Replace



Damage 7: Door - front right side: Strip - outer - Scratch(es) - Replace

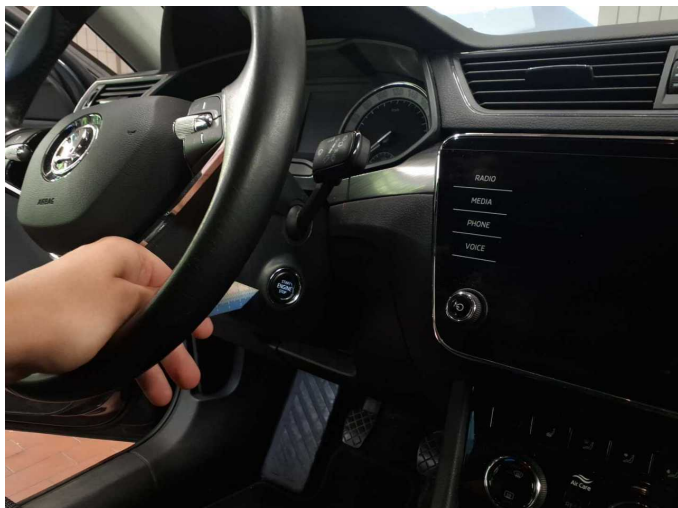


Damage 8: Steering system: Steering column (Taster Startknopf) - Broken / torn - Loss in value



Damage 8: Steering system: Steering column (Taster Startknopf) - Broken / torn - Loss in value



Damage 9: Door - rear left side: Door - dent(s) - Smart repair

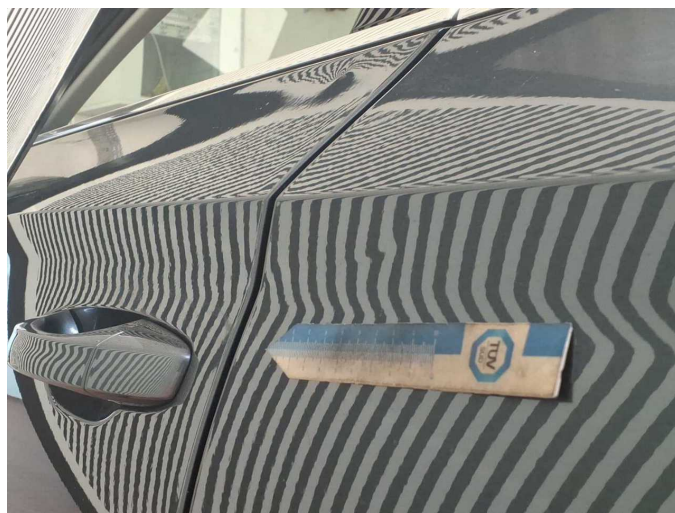

Damage 9: Door - rear left side: Door - dent(s) - Smart repair



Damage 9: Door - rear left side: Door - dent(s) - Smart repair



Damage 10: Vehicle glazing: Door glass - rear right side - Scratch(es) - Loss in value



Damage 10: Vehicle glazing: Door glass - rear right side - Scratch(es) - Loss in value




Damage 10: Vehicle glazing: Door glass - rear right side - Scratch(es) - Loss in value



Damage 11: Body: A-pillar - left side - Scratch(es) - Smart repair



Damage 11: Body: A-pillar - left side - Scratch(es) - Smart repair

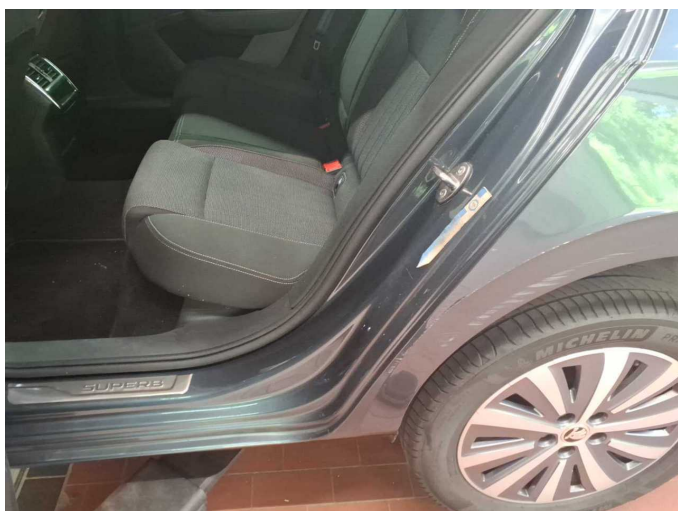

Damage 12: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 12: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 14: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace



Damage 14: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace




Damage 15: Misc.: Inspection / maintenance (seit 15200 km) - Due - Perform




Damage 16: Rear bumper: Rear bumper - Scratched - Paint



Damage 16: Rear bumper: Rear bumper - Scratched - Paint

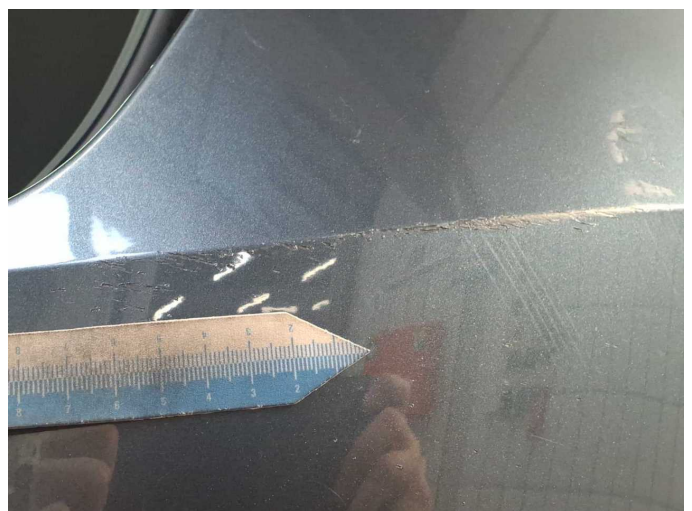


Damage 16: Rear bumper: Rear bumper - Scratched - Paint

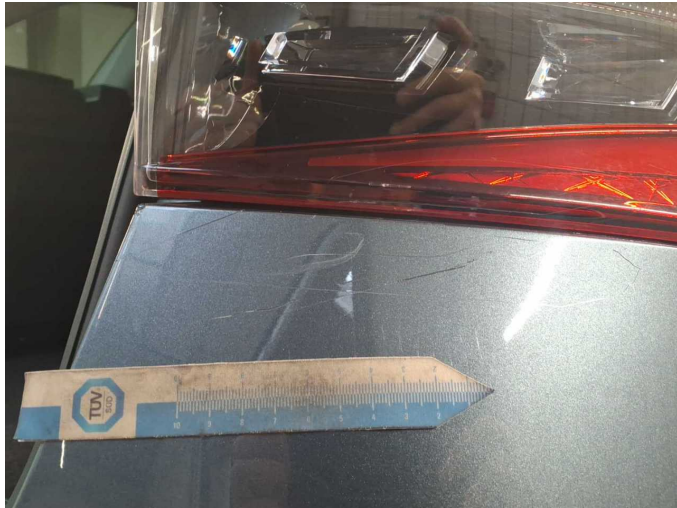

Damage 16: Rear bumper: Rear bumper - Scratched - Paint



Damage 16: Rear bumper: Rear bumper - Scratched - Paint

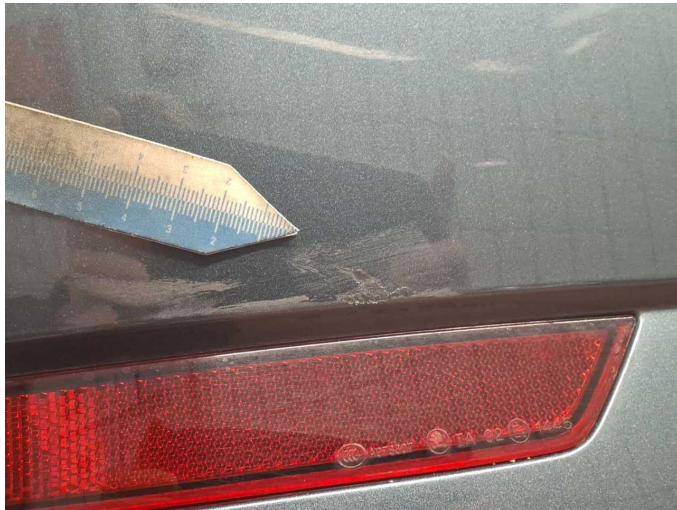

Damage 16: Rear bumper: Rear bumper - Scratched - Paint



Damage 16: Rear bumper: Rear bumper - Scratched - Paint



Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint

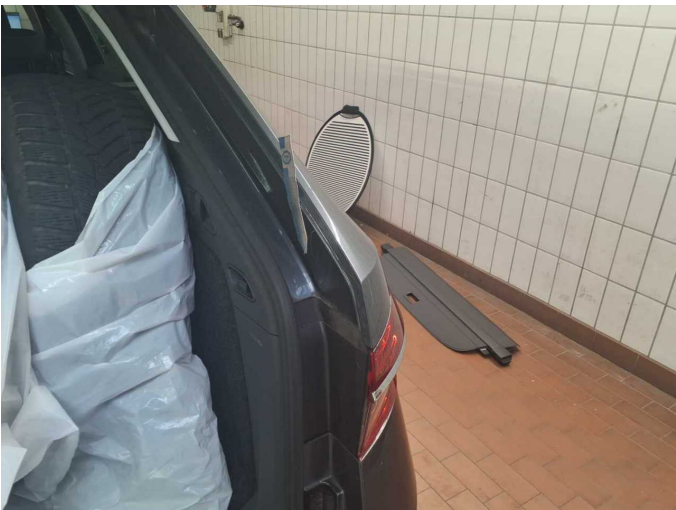


Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 17: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint

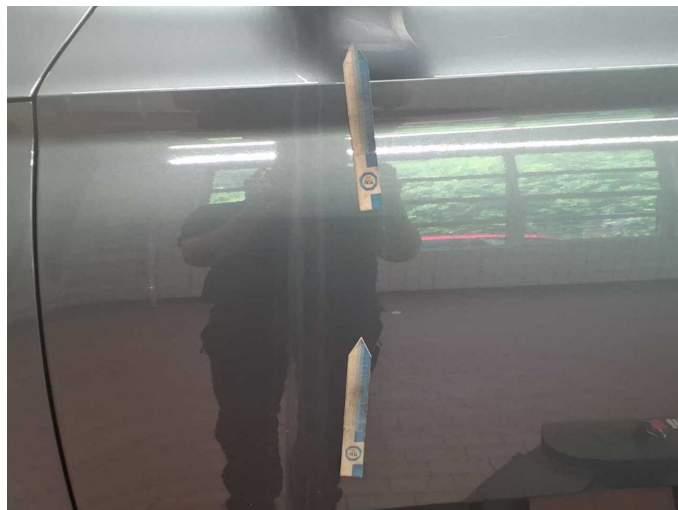

Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint



Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint



Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint



Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint



Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint



Damage 18: Door - front left side: Door (+ verschmutzt) - Dent / paintcoat damage - Repair and paint



Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

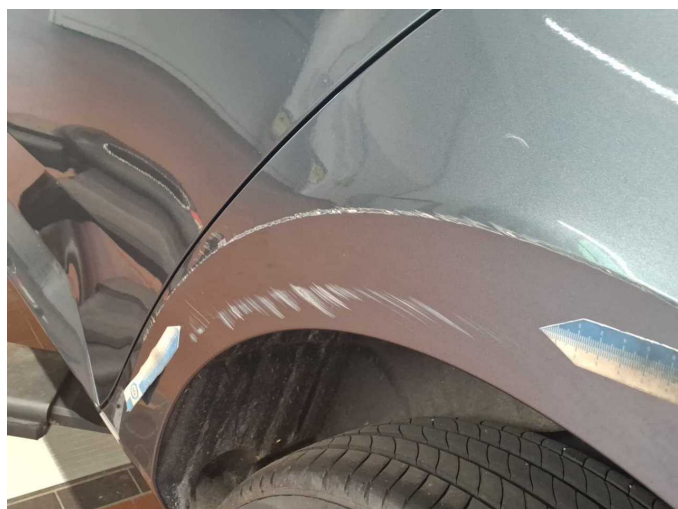

Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 19: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint



Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint




Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint



Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint




Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint

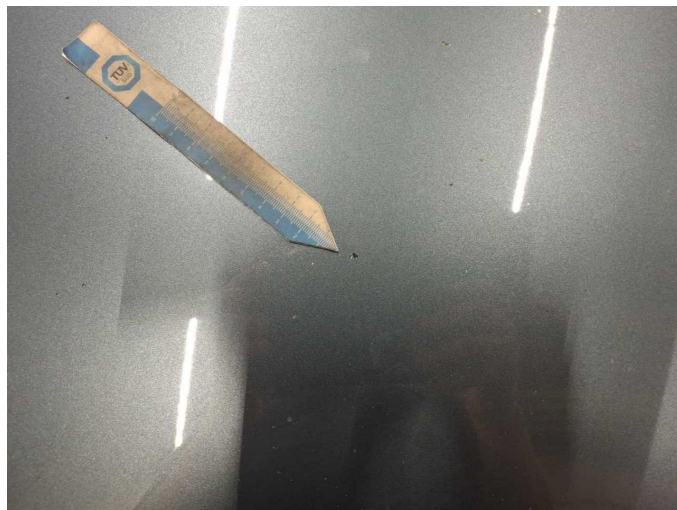

Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint



Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint

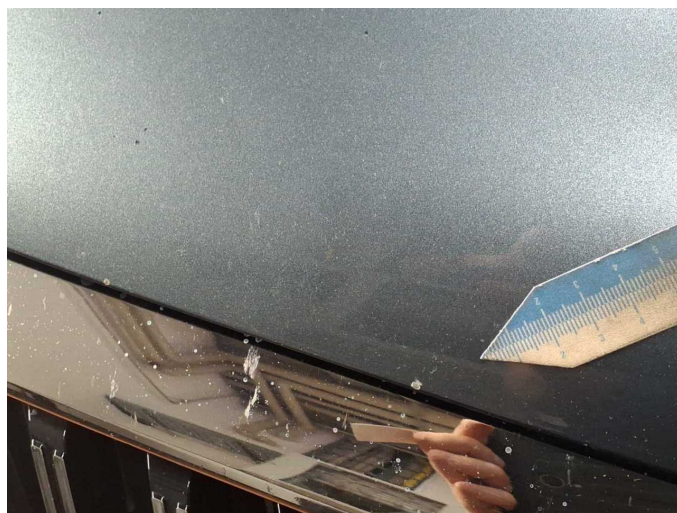

Damage 20: Bonnet: Bonnet (+ Steinschläge) - Paint defect - Paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 21: Front bumper: Front bumper (+ Fehlstellung) - Scratched - Repair and paint



Damage 22: Door - rear right side: Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint



Damage 22: Door - rear right side: Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint



Damage 22: Door - rear right side: Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint



Damage 22: Door - rear right side: Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint




Damage 22: Door - rear right side: Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint



Damage 22: Door - rear right side: Door (+ Zierleiste verschürft - lackieren) - Dent / paintcoat damage - Repair and paint



Damage 23: Vehicle glazing: Windscreen (Im Sichtbereich) - Stone chips - Replace

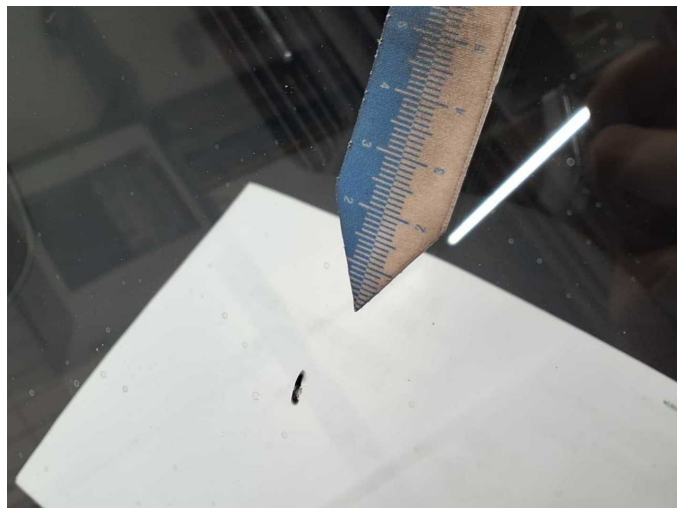


Damage 23: Vehicle glazing: Windscreen (Im Sichtbereich) - Stone chips - Replace



Wear and tear 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wear and tear 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction

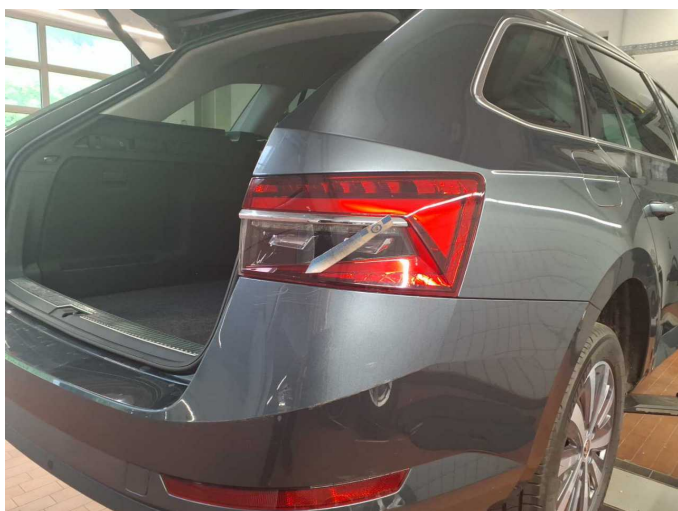


Wear and tear 4: Tail light: Tail lamp - right side - Scratch(es) - No deduction



Wear and tear 4: Tail light: Tail lamp - right side - Scratch(es) - No deduction



Wear and tear 5: Trim / covers: Floor mats - Broken / torn - No deduction

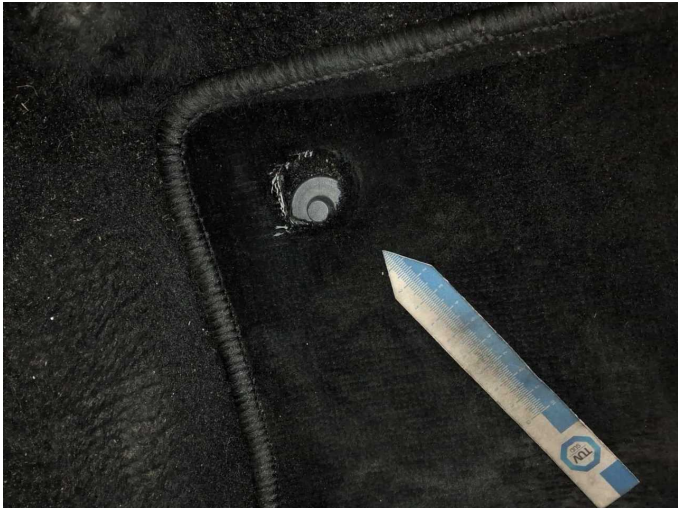


Wear and tear 5: Trim / covers: Floor mats - Broken / torn - No deduction



Accident 1: Side - left



Accident 1: Side - left

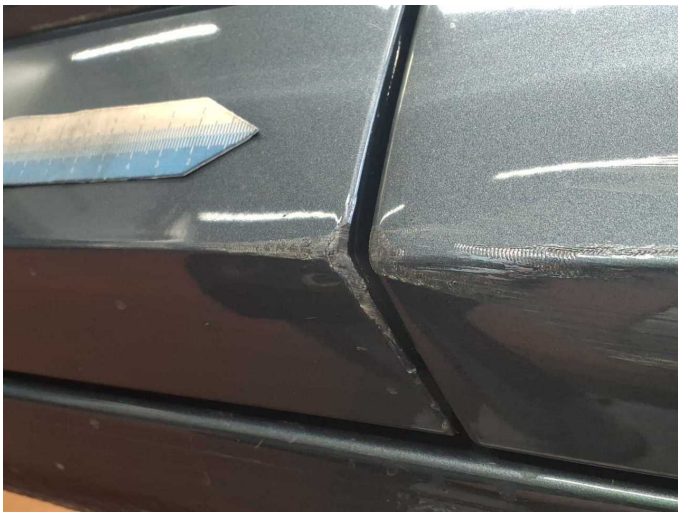

Accident 1: Side - left



Accident 1: Side - left