



Expertise

Protocol number: 46680249
Order No. / Reference: 26585299
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Crafter 35 TDI 4MOTION Trendline

VIN: WV1ZZZSYZN9013225



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Crafter 35 TDI 4MOTION Trendline	
Vehicle Identification number	WV1ZZZSYZN9013225
Mileage (Read)	141,985 km
First registration	9 Feb 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	103 kW
Gearbox / Number of gears	Manual / 6
Type of drive	All-wheel drive
Type of vehicle	Van
Colour / colour code	Reflexsilber Metallic
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,700 km
Last service on / at	03/2026 at 140,222 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF455282
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	Conditional: Light/moisture/dirt	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CCA 09994		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,500 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R16 121R	Winter tyres on Steel	Continental	5mm / 5mm
2)	235/65 R16 121R	Winter tyres on Steel	Continental	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R16 115R	Summer tyres on Steel	Continental	6mm / 6mm
2)	235/65 R16 115R	Summer tyres on Steel	Continental	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	235/65 R16 115R C	Summer tyres on Light alloy	Continental	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments: Glove compartment with lockable, illuminated flap
- Airbag: Driver's side
- Convex exterior mirrors (left and right), with integrated LED turn signal and wide-angle range
- third brake light
- Three-point automatic seat belts
- Chassis: Suspension and damping, standard
- Total weight: Vehicle registration with a permissible total weight of 3.5 t
- Rear doors/tailgate: Hinges for rear doors
- Interior lighting: Front step lighting
- Headrests (2)
- Headlight range control
- Fog lights including cornering lights
- Upholstery: Seat covers in fabric, "Memphis" design
- "Composition Audio" radio with TFT display and mobile phone interface
- Wheels: Steel wheels 6.5 J x 16, in silver
- Keys for locking system: 2 remote control flip keys
- electromechanical power steering
- Seats 1st row: Comfort seat on the left, in the 1st row
- Power outlet: 12V socket and 4 cup holders in the dashboard
- Daytime running light
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control and interior operation
- Registration as a truck
- Storage package 2: Roof gallery with two 1-DIN slots and reading light
- 4MOTION all-wheel drive (permanent)
- Hill Start Assist
- Floor coverings: Rubber floor covering in the driver's cab
- Chrome applications in the driver's cab
- Electronic Stability Program and ABS
- Electric windows, front
- Transmission: 6-speed transmission
- Rear wing door without window cutout
- High roof, painted exterior in car color
- Instrument usage (km/h)
- Steering wheel adjustable in height and reach
- Multifunction display "Plus"
- Particulate filter: Soot particle filter for diesel engines
- Center wheel cover with chrome emblem
- Wheels/Tires: 235/65 R 16 C 115/113 R, optimized for low rolling resistance
- Sliding door, on the right in the passenger/cargo area
- Crosswind assist
- Seatbelt check
- Start-stop system
- Power outlets in the driver's cab
- Front bumper in grey with painted trim in body color
- Partition walls: Partition wall
- Lashing eyes for securing cargo
- thermal insulation glazing
- Accessories: On-board tools

Extra equipment

- Towing eye front and rear
- Electrically adjustable and heated exterior mirrors
- Batteries: 2nd battery with isolating relay
- Cruise control system including speed limiter
- Paint finish: Metallic
- Package: Light and Sight (High beam control "Light Assist" - Daytime running lights with automatic headlight control, "Leaving home" function and manual "Coming home" function - Windscreen wiper interval control with light and rain sensor)
- Seats 1st row: Comfort seat "Plus" on the left, in the 1st row
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Windows: Laminated glass front pane in heat-insulating glass, heated
- Steering wheel: Multifunction steering wheel (3 spokes)
- ParkPilot in the front and rear areas
- Wheels, tires: spare wheel (steel rim) with driving tires, as well as on-board tools and jack
- Seats 1st row: Double passenger seat on the right, with storage compartment, in the 1st row (and folding backrest with storage table including headrest, height adjustable)
- Power outlet: 230V socket in the left seat frame



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed. This is due to the following reason.: Motorschaden

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Trim / covers	Roof lining (Beleuchtung mitte, Abdeckung ggf, erneuern) - Loose - Perform diagnosis
3	Boot lid / rear door	Rear door - left side - dent(s) - Smooth repair work
4	Sliding door, right	Sliding door - dent(s) - Smooth repair work
5	Door - front right side	Door - dent(s) - Smooth repair work
6	Side panel - rear left side	Side panel (Mitte) - dent(s) - Smooth repair work
7	Interior	Interior - Soiled - Clean
8	Tail light	Tail lamp - left side - Broken / torn - Replace
9	Fog lamp	Fog lamp - front left side - Broken / torn - Replace
10	Body	Body - Glued / labelled - De-glue / neutralise
11	Seat - front	Seat cover - left side (+ Polster) - Broken / torn - Replace
12	Sill - right side	Sill - Deformed - Repair and paint
13	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
14	Boot lid / rear door	Rear door - right side - Deformed - Repair and paint
15	Side panel - rear left side	Side panel (Hinten) - Deformed - Repair and paint
16	Vehicle glazing	Windscreen - Broken / torn - repair according to calculation
17	Engine	Engine - Non-operational - repair according to calculation

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key with remote control

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Underbody, Provided by user / customer, from 2 Sept 2025	1.541,12 €



Accident damages

No. Accident

1 Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

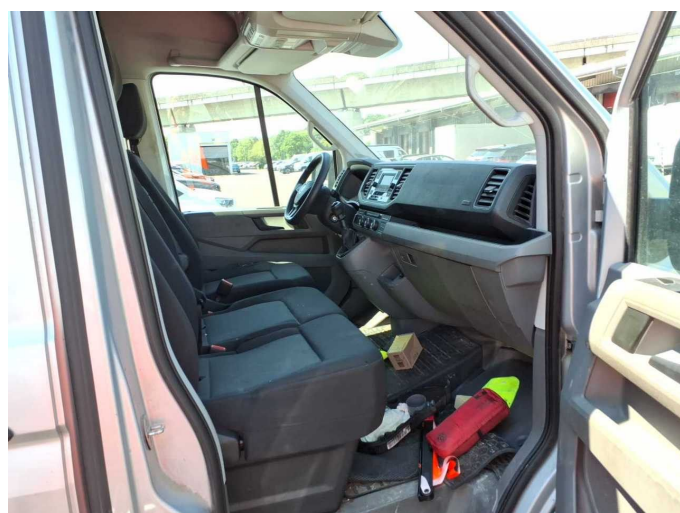


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

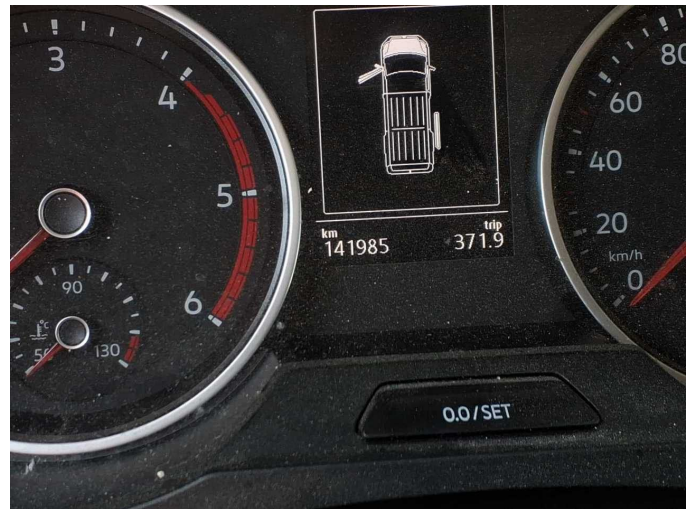


Figure 16: Misc.

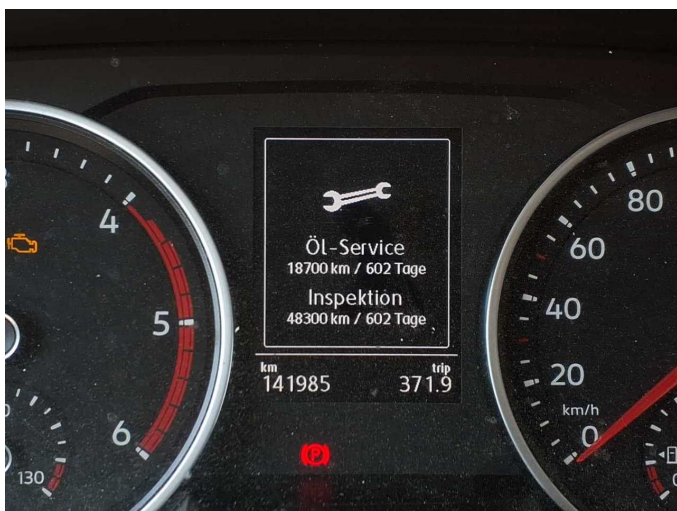


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

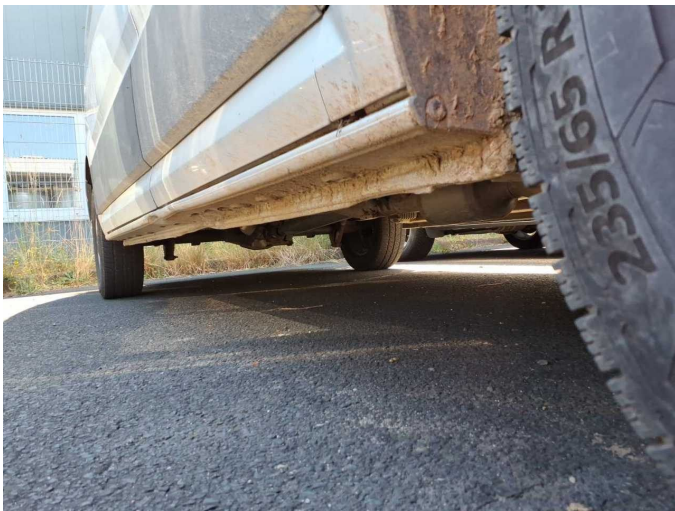


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

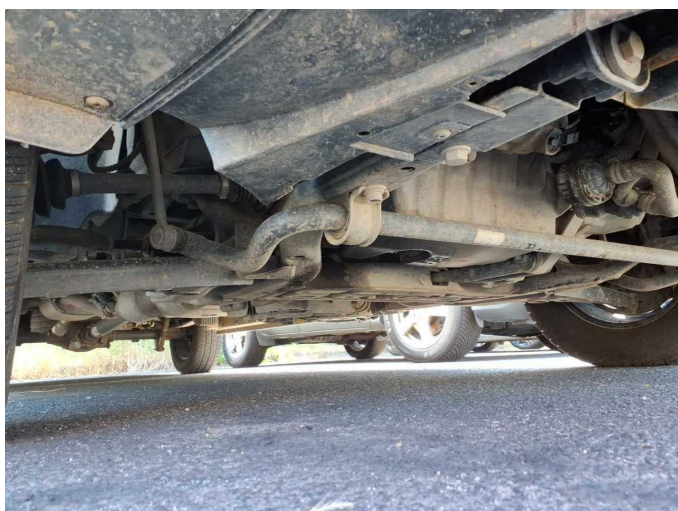


Figure 29: Misc.

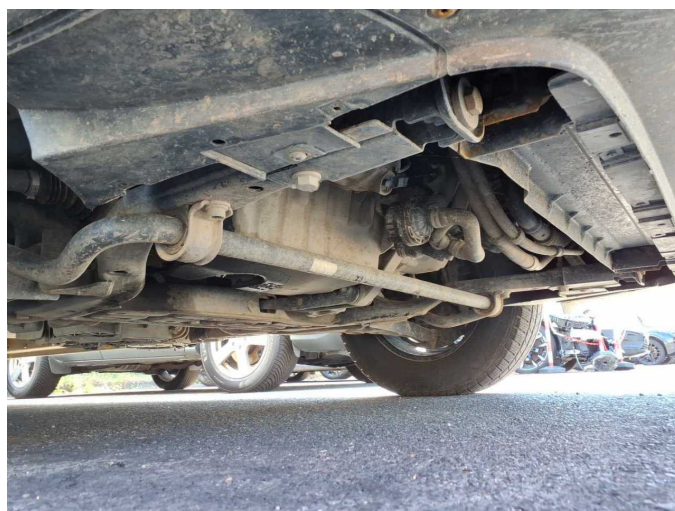


Figure 30: Misc.



Figure 31: Misc.




Damage 2: Trim / covers: Roof lining (Beleuchtung mitte, Abdeckung ggf, erneuern) - Loose - Perform diagnosis



Damage 2: Trim / covers: Roof lining (Beleuchtung mitte, Abdeckung ggf, erneuern) - Loose - Perform diagnosis




Damage 2: Trim / covers: Roof lining (Beleuchtung mitte, Abdeckung ggf, erneuern) - Loose - Perform diagnosis

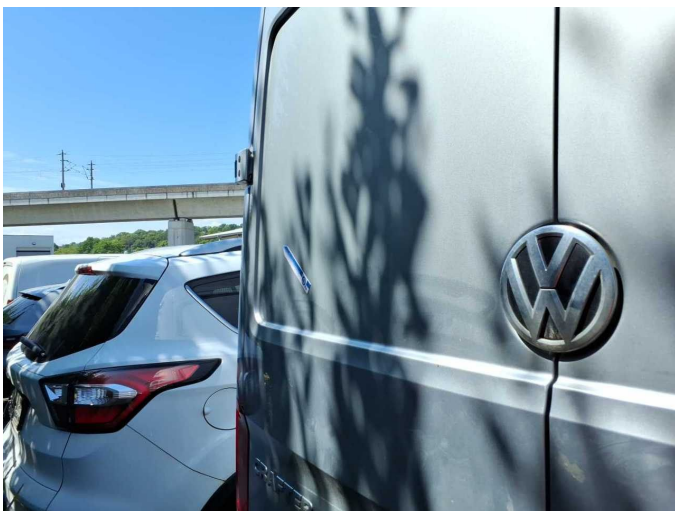

Damage 3: Boot lid / rear door: Rear door - left side - dent(s) - Smooth repair work



Damage 3: Boot lid / rear door: Rear door - left side - dent(s) - Smooth repair work

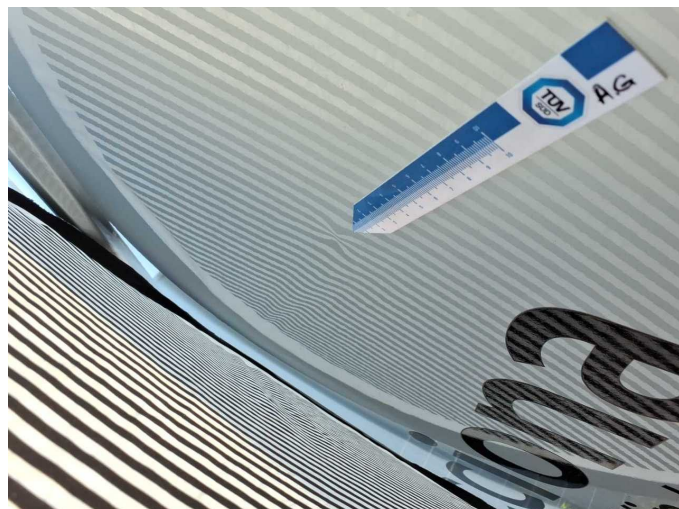


Damage 4: Sliding door, right: Sliding door - dent(s) - Smooth repair work

Damage 4: Sliding door, right: Sliding door - dent(s) - Smooth repair work




Damage 5: Door - front right side: Door - dent(s) - Smooth repair work

Damage 5: Door - front right side: Door - dent(s) - Smooth repair work

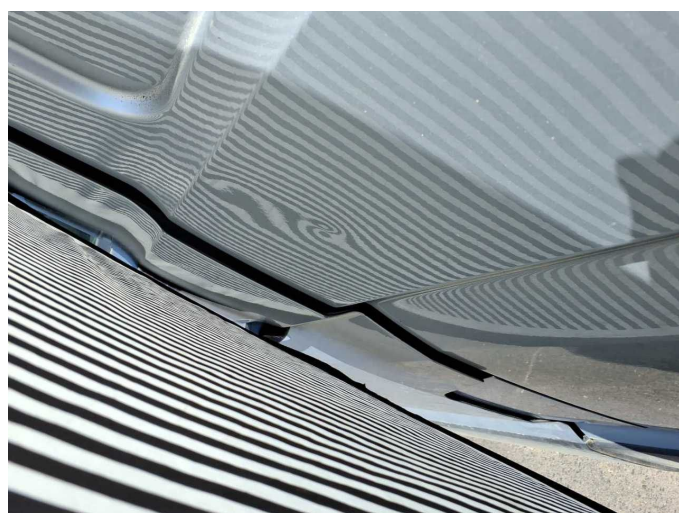


Damage 6: Side panel - rear left side: Side panel (Mitte) - dent(s) - Smooth repair work


Damage 6: Side panel - rear left side: Side panel (Mitte) - dent(s) - Smooth repair work

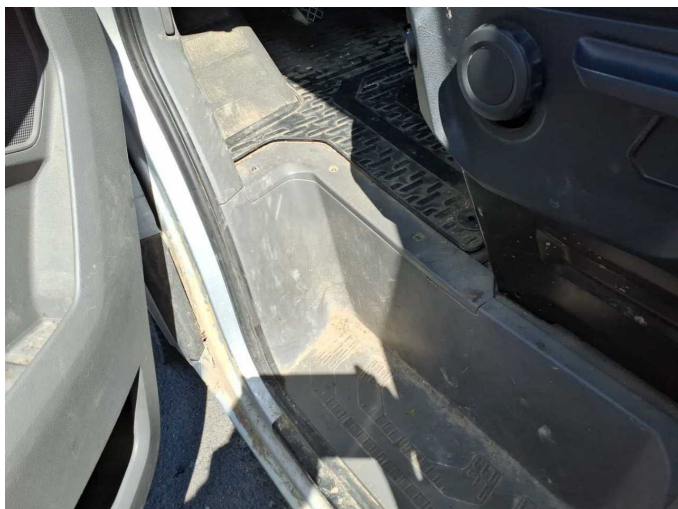

Damage 7: Interior: Interior - Soiled - Clean

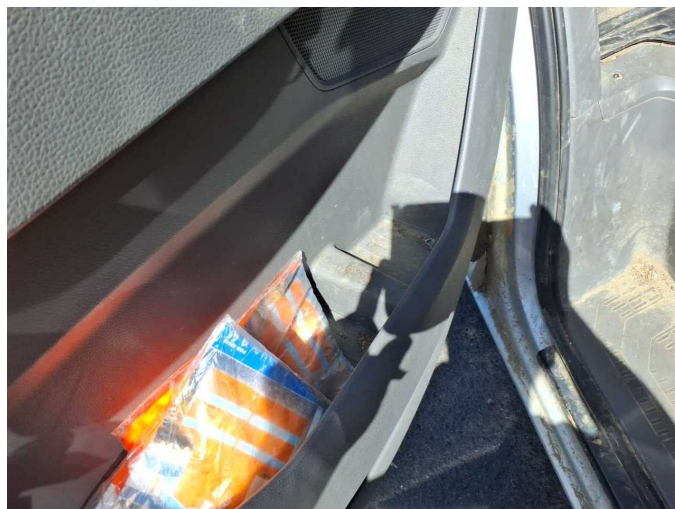


Damage 7: Interior: Interior - Soiled - Clean

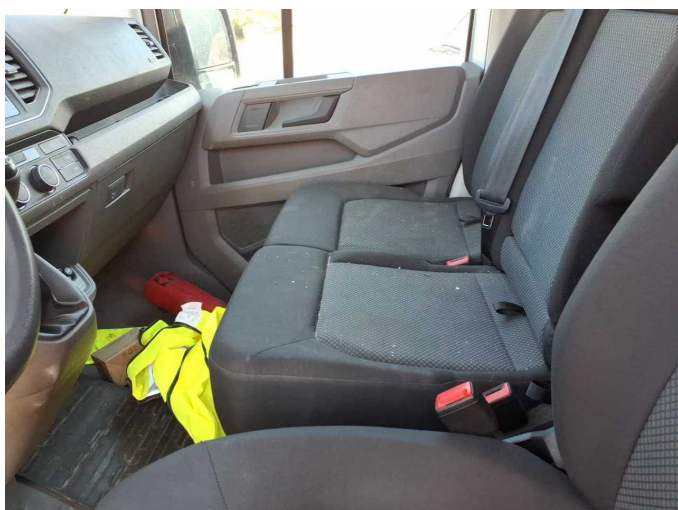


Damage 7: Interior: Interior - Soiled - Clean



Damage 8: Tail light: Tail lamp - left side - Broken / torn - Replace

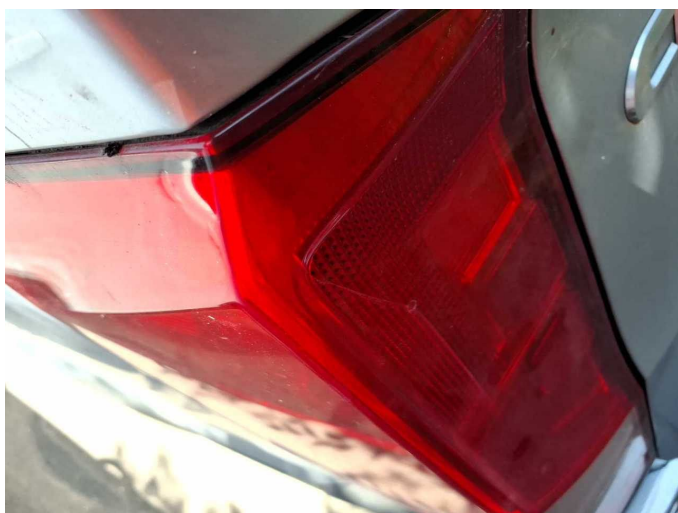

Damage 8: Tail light: Tail lamp - left side - Broken / torn - Replace

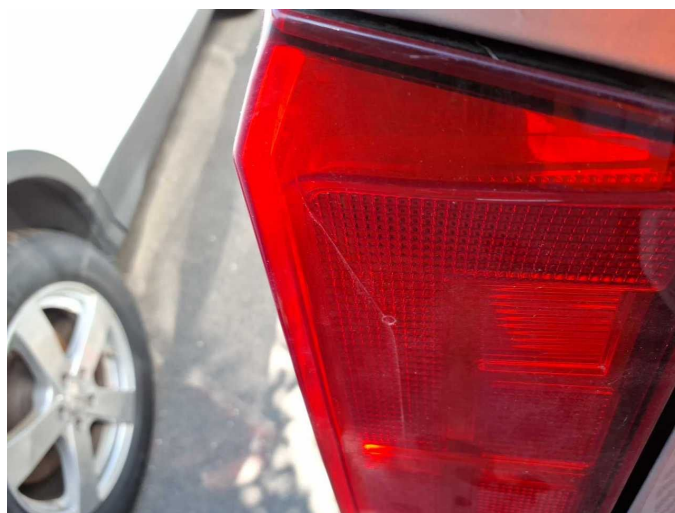

Damage 8: Tail light: Tail lamp - left side - Broken / torn - Replace



Damage 9: Fog lamp: Fog lamp - front left side - Broken / torn - Replace



Damage 9: Fog lamp: Fog lamp - front left side - Broken / torn - Replace



Damage 9: Fog lamp: Fog lamp - front left side - Broken / torn - Replace



Damage 10: Body: Body - Glued / labelled - De-glue / neutralise



Damage 10: Body: Body - Glued / labelled - De-glue / neutralise



Damage 10: Body: Body - Glued / labelled - De-glue / neutralise




Damage 11: Seat - front: Seat cover - left side (+ Polster) - Broken / torn - Replace




Damage 11: Seat - front: Seat cover - left side (+ Polster) - Broken / torn - Replace



Damage 12: Sill - right side: Sill - Deformed - Repair and paint

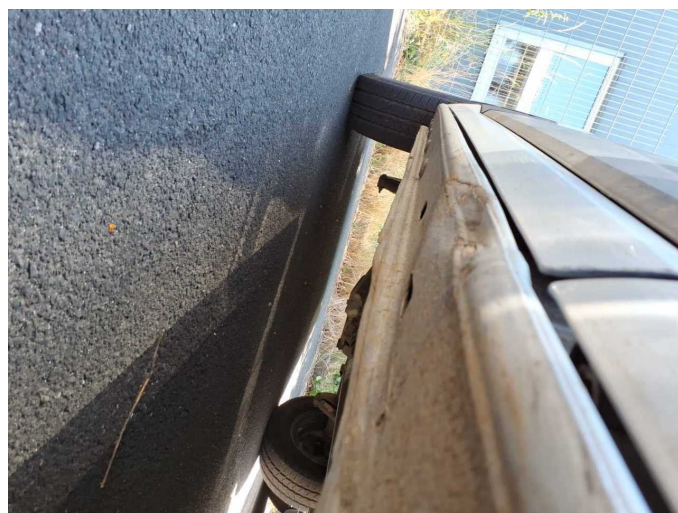


Damage 12: Sill - right side: Sill - Deformed - Repair and paint

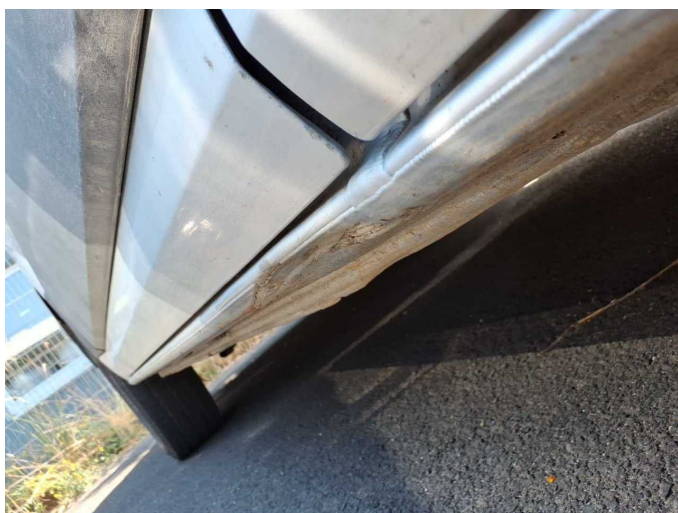


Damage 12: Sill - right side: Sill - Deformed - Repair and paint



Damage 12: Sill - right side: Sill - Deformed - Repair and paint

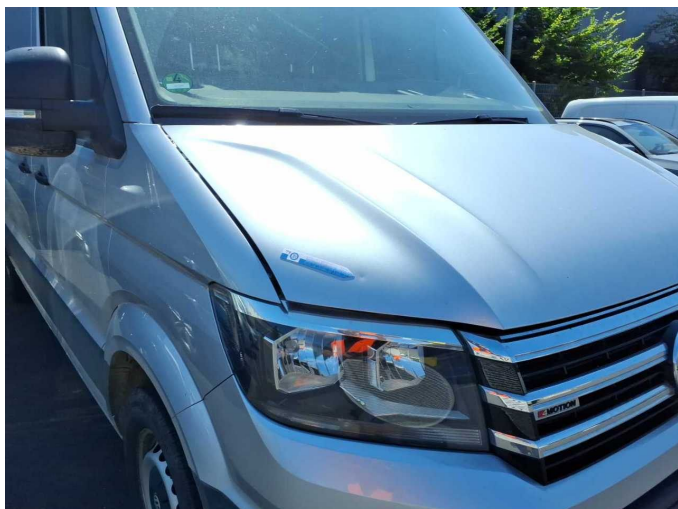


Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

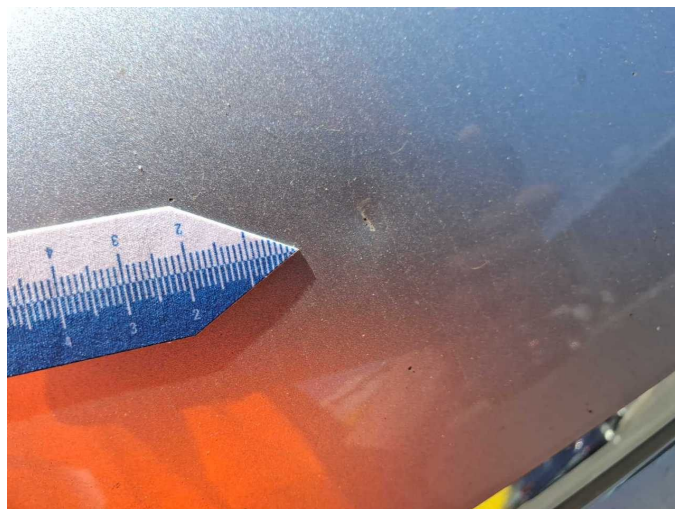


Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 13: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

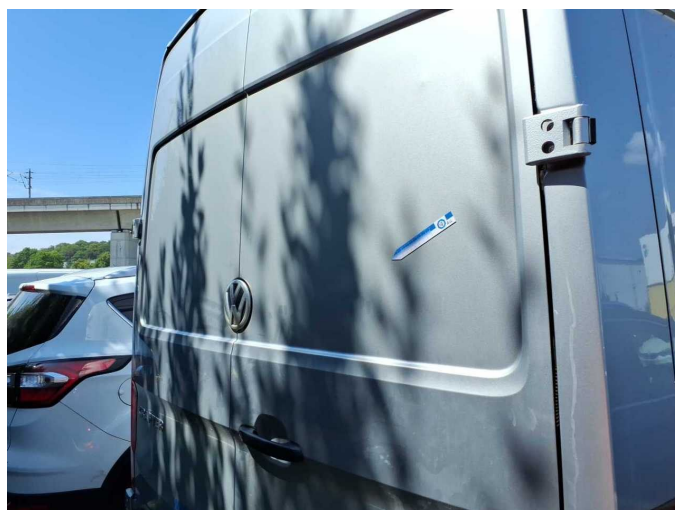

Damage 14: Boot lid / rear door: Rear door - right side - Deformed - Repair and paint

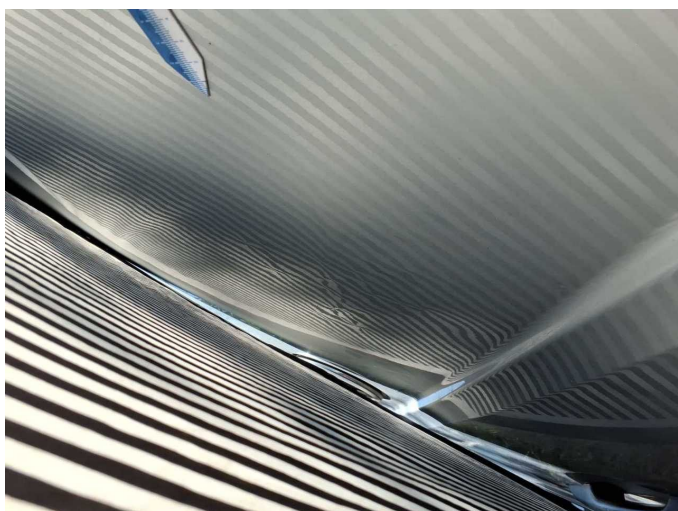

Damage 14: Boot lid / rear door: Rear door - right side - Deformed - Repair and paint

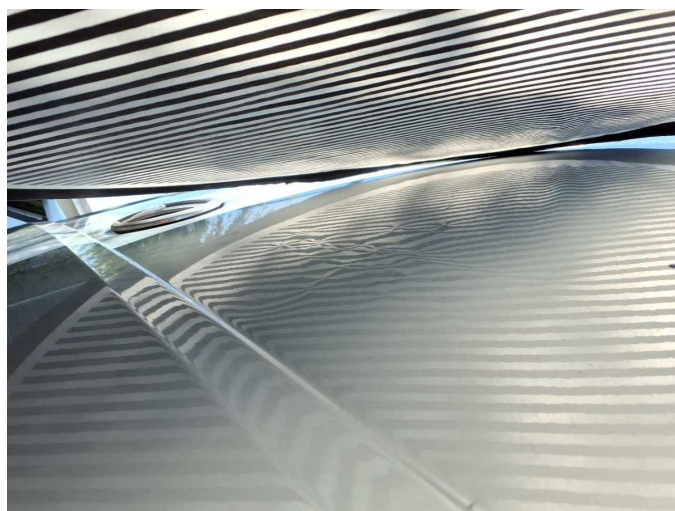


Damage 14: Boot lid / rear door: Rear door - right side - Deformed - Repair and paint



Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint




Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint

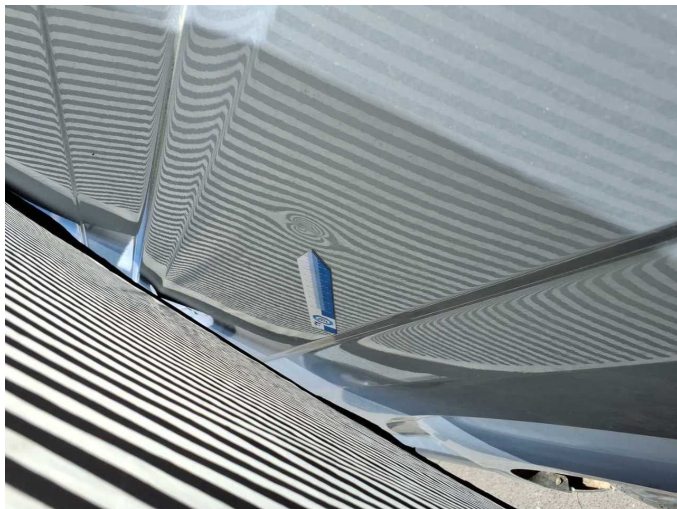


Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint




Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint

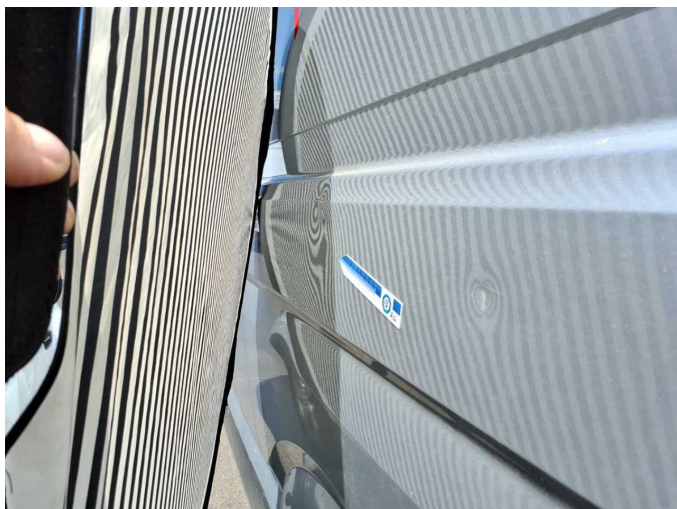


Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint

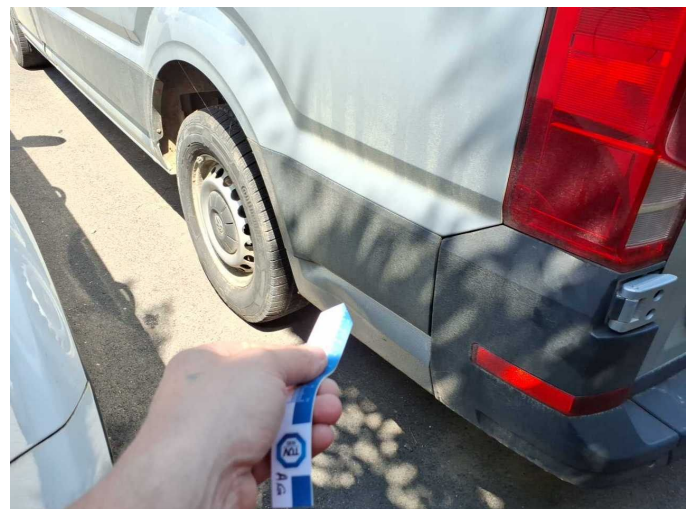


Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint

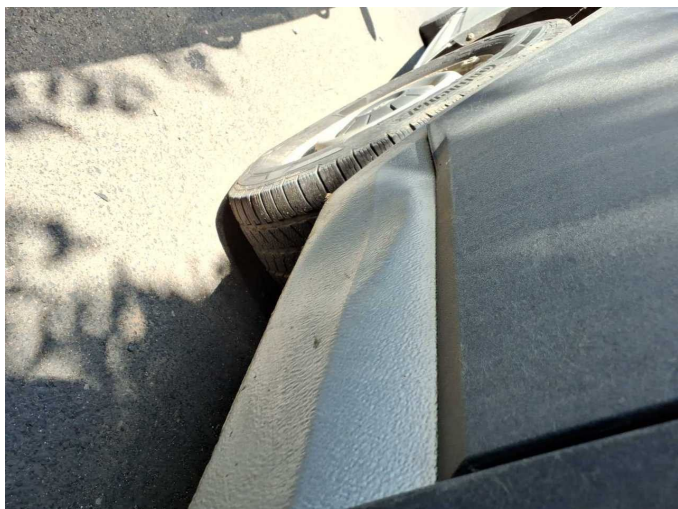

Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint

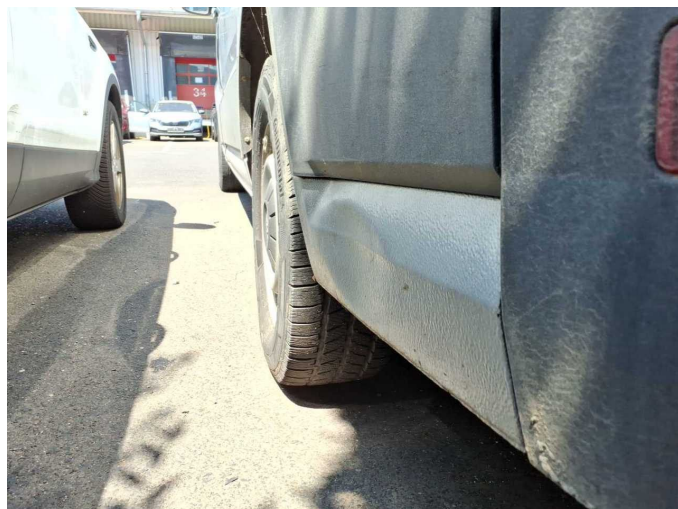

Damage 15: Side panel - rear left side: Side panel (Hinten) - Deformed - Repair and paint

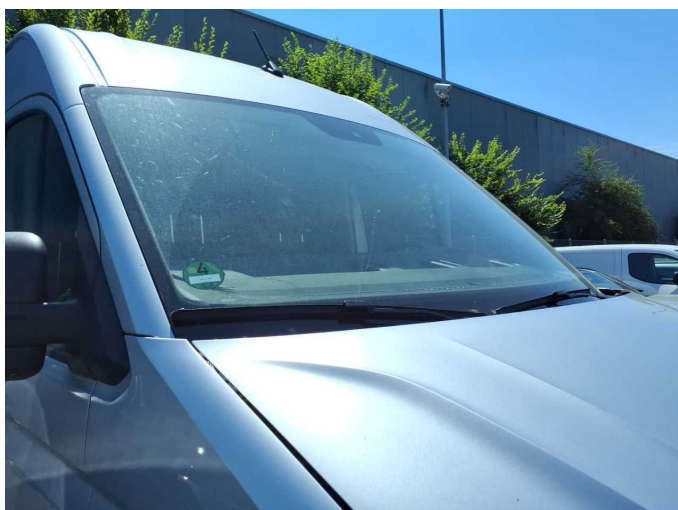

Damage 16: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation




Damage 16: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation




Damage 16: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Damage 17: Engine: Engine - Non-operational - repair according to calculation

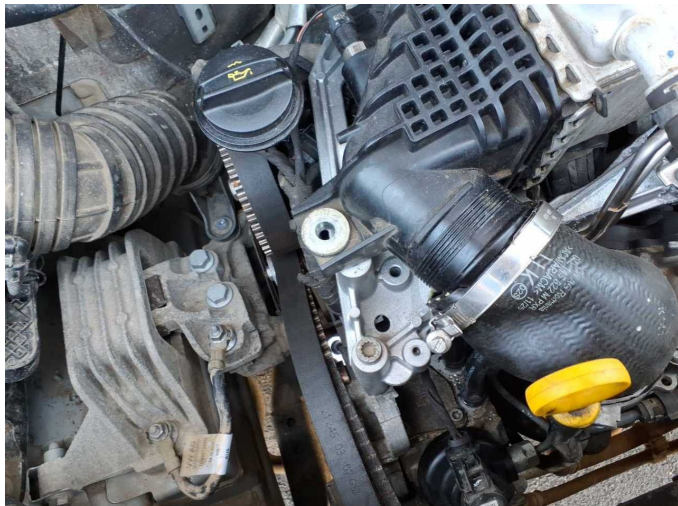


Damage 17: Engine: Engine - Non-operational - repair according to calculation

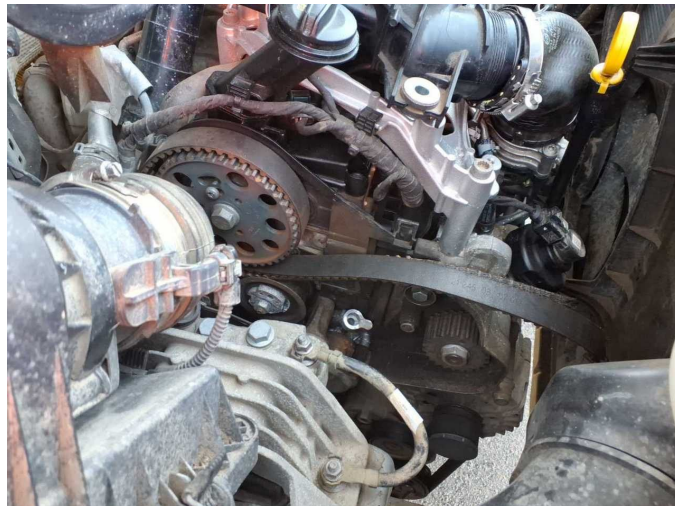

Damage 17: Engine: Engine - Non-operational - repair according to calculation



Damage 17: Engine: Engine - Non-operational - repair according to calculation

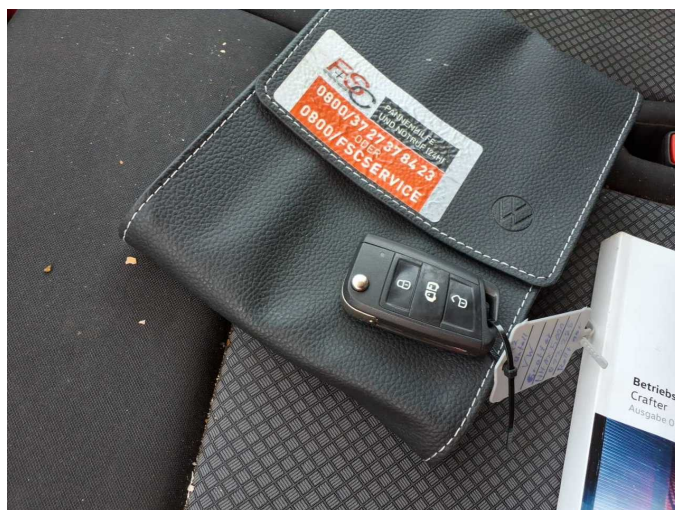

Missing part 1: Equipment: Vehicle key with remote control - Missing - Replace



Accident 1: Side right




Accident 1: Side right



Accident 1: Side right




Accident 1: Side right

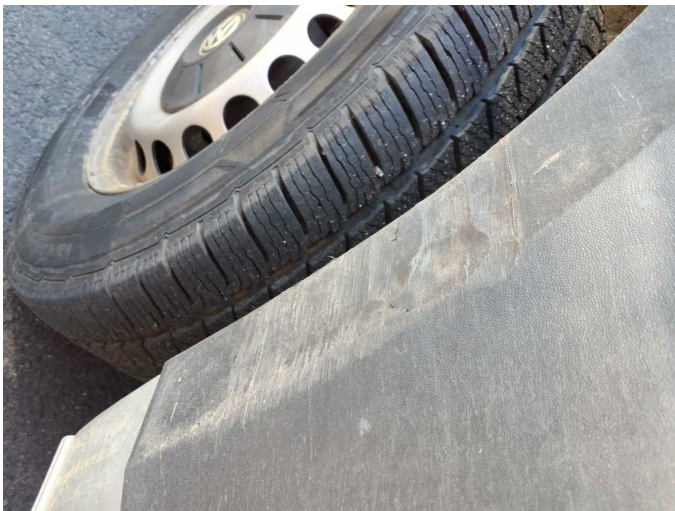

Accident 1: Side right



Accident 1: Side right

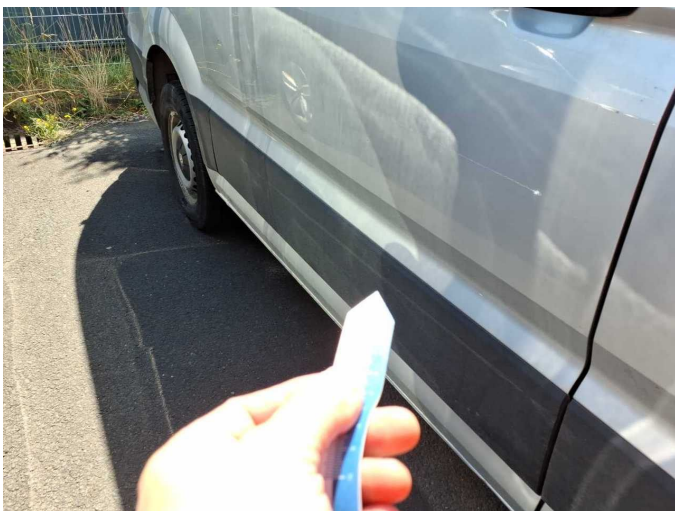

Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZSYZN9013225
Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Crafter 35 TDI 4MOTION
Trendline

Datum	KM-Stand	Beschreibung
31.03.2026	141.800	Kraftstoffpumpe ern; Reparatur Sonstiges; Systemtest/Eigendiagnose
09.03.2026	140.222	Keilrippenriemen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.02.2026	138.734	Ladeluftschlauch ern; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wasserpumpe ern
16.02.2026	137.802	Ölwechsel - Hinterachse; Reparatur Sonstiges; Systemtest/Eigendiagnose
09.12.2025	133.464	Systemtest/Eigendiagnose
10.10.2025	125.714	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
28.07.2025	116.951	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
10.06.2025	109.769	Systemtest/Eigendiagnose
21.01.2025	95.671	Ladeluftschlauch ern; Systemtest/Eigendiagnose
13.12.2024	91.594	Bremsbelagfühler ern; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges; Zahnriemen/Steuerkett ern
03.12.2024	90.786	Reparatur Sonstiges; Systemtest/Eigendiagnose
16.08.2024	80.577	AU
30.11.2023	59.581	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.09.2023	51.881	Regelwartungsdienst; Wartung Sonstiges; Zahnriemen/Steuerkett ern
12.01.2023	32.358	Systemtest/Eigendiagnose
10.01.2023	32.358	Motoröl b. Wartung; Ölwechsel
26.07.2022	17.568	Motoröl b. Wartung; Regelwartungsdienst