



Expertise

Protocol number: 46182191  
Order No. / Reference: 26531697  
Inspection date: 24 Jun 2026

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue Aut. ST-LINE

VIN: WF0JXXWPCJNY75856



| Vehicle details                         |                    |
|-----------------------------------------|--------------------|
| Manufacturer / Type / Model / Equipment |                    |
| Ford S-Max 2.0 EcoBlue Aut. ST-LINE     |                    |
| Vehicle Identification number           | WF0JXXWPCJNY75856  |
| Mileage (Read)                          | 179,381 km         |
| First registration                      | 4 Apr 2022         |
| Number of holders                       | 1                  |
| Power / Engine displacement             | 110 kw / 1,995 ccm |
| Fuel type / Cylinder                    | Diesel / 4         |
| Gearbox / Number of gears               | Automatic / 8      |
| Type of drive                           | Front drive        |
| Type of vehicle                         | Saloon car         |
| Colour / colour code                    | Frost-Weiß         |
| Doors / Seats                           | 5 / 5              |
| Upholstery type                         | Leather            |
| Colour of upholstery                    | Anthracite-Black   |



## Vehicle details

|                                                  |                              |                                |                                                            |
|--------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | Available / complete         | <b>Next maintenance in</b>     |                                                            |
| <b>Last service on / at</b>                      | 08/2025 at 149,604 km        |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                              | <b>Letter No.</b>              | GK789979                                                   |
| <b>Previous damage / Accident</b>                | Detectable                   | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                     | sufficient                   | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 8566 / BKM 01185             |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,555 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/55 R15 103V | Winter tyres on Light alloy | Firestone    | 3mm / 3mm   |
| 2) | 235/55 R15 103V | Winter tyres on Light alloy | Continental  | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/50 R18 101Y | Summer tyres on Light alloy | Michelin     | 4mm / 4mm   |
| 2) | 235/50 R18 101Y | Summer tyres on Light alloy | Michelin     | 4mm / 4mm   |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Storage compartments
- Anti-lock braking system (ABS)
- Attachment points for safety partition grilles
- Tires: 7.5 J x 18 alloy wheels (4) with 235/50 R 18 tires
- Body styling kit
- Brake calipers, painted red
- roof console
- Diesel particulate filter (DPF)
- Front door sill trims with ST-Line design
- Driver information system display 25.4 cm color
- Chassis: Sport chassis
- Electric windows front and rear
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- luggage compartment cover
- Cruise control system with intelligent speed limiter
- Back window, heater
- Rear spoiler
- Interior mirror, automatically dimming
- Isofix bracket
- Air conditioning with automatic temperature control
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: Paddle shifters on the steering wheel
- Front center console with padded armrest
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect
- Package: Winter
- Pedal assembly with aluminum pads
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Front sports seats
- Start-stop system
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Traffic sign recognition system
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Cigarette lighter
- Ambient lighting at the front
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Hill start assist
- third brake light
- Black woven fabric headliner
- Roof rails, black
- Tachometer
- Electronic Shifter
- Lane keeping assist including lane keeping assist and driver fatigue warning
- High Beam Assist
- Ford Easy Fuel
- Ford Power Start function
- Ford Power start function with Ford Key Free system
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission
- rear window wiper
- Interior lighting with delay circuit
- Intelligent security system
- Electric child safety lock
- Steering wheel: Steering column, adjustable in height and reach
- Reading lights front and rear
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light
- Front and rear parking pilot system
- Tire repair kit
- LED taillights
- Headlight dipped beam with switch-off delay including "greeting function"
- Electromechanical power steering
- Seats: Flexible seating system "FoldFlatSystem (FFS)"
- Seats: Front seats can be heated individually and variably.
- 230 volt socket
- Bumpers painted in body color
- Trays on the front seatbacks
- Premium carpet floor mats, front and rear
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control



## Extra equipment

- Paint finish: Frost White
- Panoramic roof (non-opening) (sun protection blinds integrated into the rear side doors - windshield and panoramic roof with "Solar-Reflect" heat protection)
- Upholstery: Premium leather (seat center panels and door inserts in leather - exterior mirror, driver's side, automatically dimming - driver's seat, 10-way electrically adjustable with memory function - passenger seat, 10-way electrically adjustable)
- Safety partition net behind the 2nd row of seats
- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group | Description                                                      |
|-----|-----------------|------------------------------------------------------------------|
| 1   | Engine          | Engine - Leaking - Diagnosed and repair if necessary             |
| 2   | 2nd wheel set   | 1 alloy rim - Scratched - Loss in value                          |
| 3   | Seat - rear     | Back seat - Damaged - Replace                                    |
| 4   | Front bumper    | Front bumper (+ mit Steinschlägen übersät) - Scratch(es) - Paint |
| 5   | Bonnet          | Bonnet - Corrosion - Repair and paint                            |

## Wear and tear

| No. | Component group       | Description                                             |
|-----|-----------------------|---------------------------------------------------------|
| 1   | Vehicle glazing       | Windscreen - Stone chips - No deduction                 |
| 2   | Wheel / tyres         | Alloy rim - rear left side - Scratched - No deduction   |
| 3   | Wheel / tyres         | Alloy rim - front right side - Scratched - No deduction |
| 4   | Interior              | Interior - Scratch(es) - No deduction                   |
| 5   | Mudguard - right side | Mudguard - right side - Stone chips - No deduction      |
| 6   | Seat - front          | Seat cover - left side - Broken / torn - No deduction   |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Missing parts

### Description

Equipment - Tirefit filler



## Previous damages

| No. | Previous damage                                           | Extent of damage (Net) |
|-----|-----------------------------------------------------------|------------------------|
| 1   | Side - left, Provided by user / customer, from 9 Dec 2025 | 7.299,53 €             |

## Repainting

### No. Repainting

|   |                                                                                                                    |
|---|--------------------------------------------------------------------------------------------------------------------|
| 1 | Mudguard - left side, Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent |
|---|--------------------------------------------------------------------------------------------------------------------|

## Paint coat thickness measurement

|                      |        |                             |        |
|----------------------|--------|-----------------------------|--------|
| Mudguard - left side | 174 µm | Side panel - rear left side | 205 µm |
|----------------------|--------|-----------------------------|--------|

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

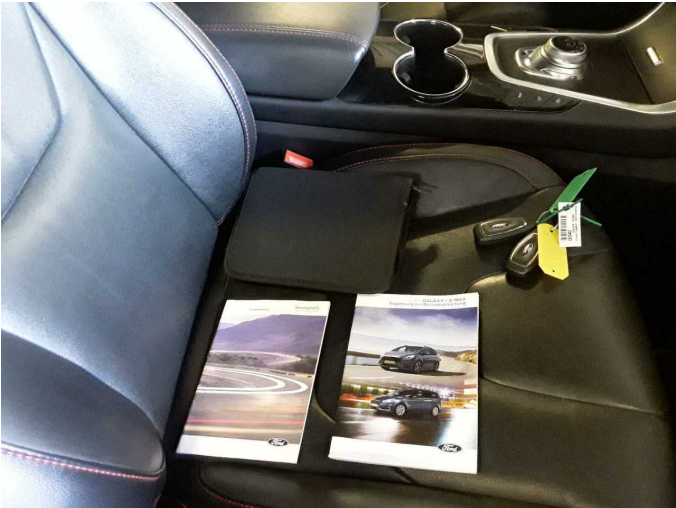


Figure 13: Documents

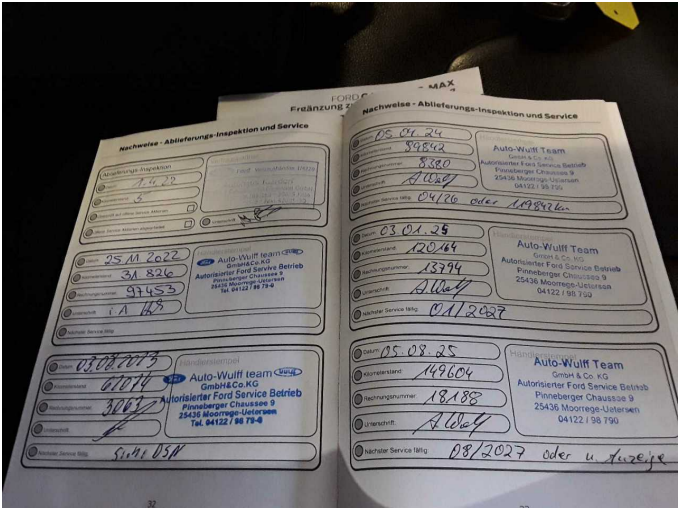


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

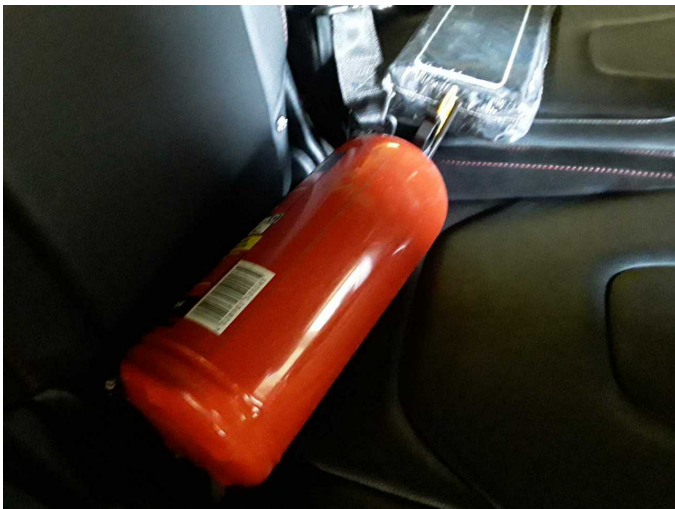


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



**Figure 31:** Misc.




**Damage 1:** Engine: Engine - Leaking - Diagnosed and repair if necessary




**Damage 1:** Engine: Engine - Leaking - Diagnosed and repair if necessary




**Damage 2:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value

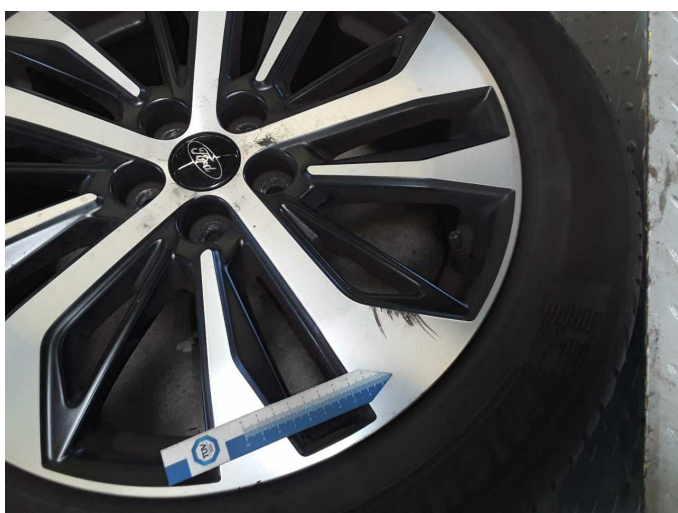


**Damage 2:** 2nd wheel set: 1 alloy rim - Scratched - Loss in value

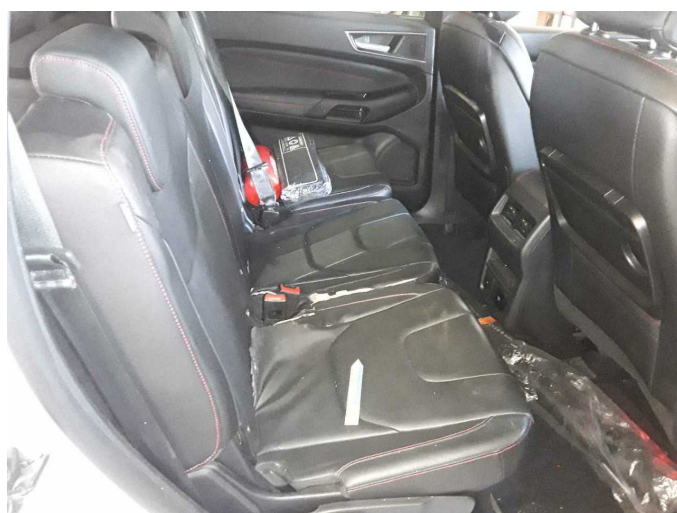


**Damage 3:** Seat - rear: Back seat - Damaged - Replace

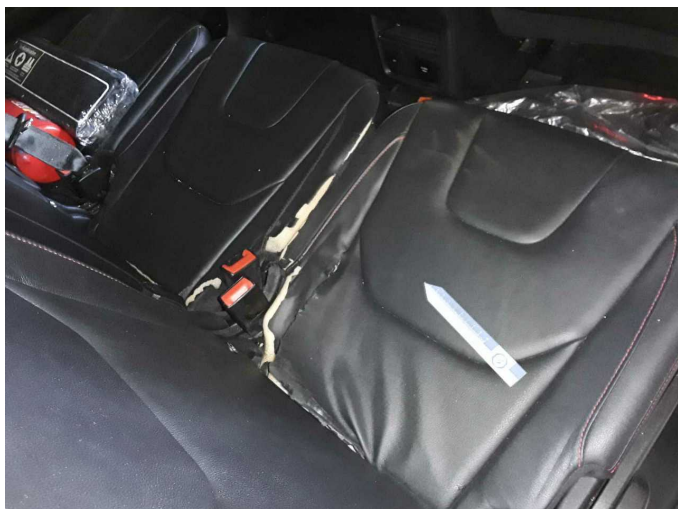

**Damage 3:** Seat - rear: Back seat - Damaged - Replace

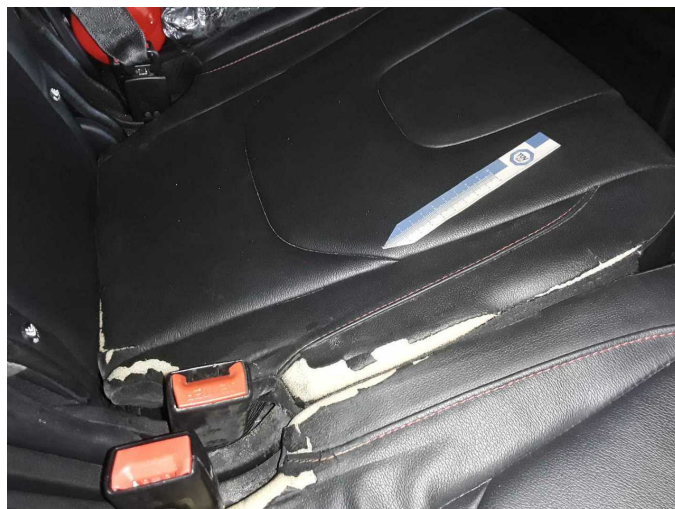

**Damage 3:** Seat - rear: Back seat - Damaged - Replace

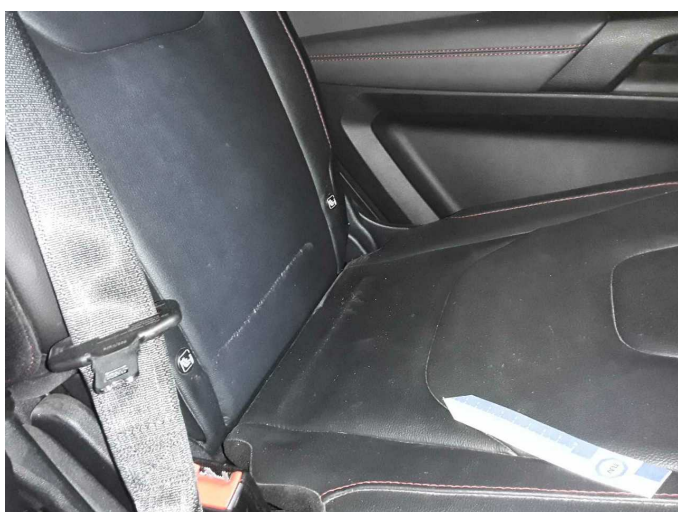

**Damage 3:** Seat - rear: Back seat - Damaged - Replace



**Damage 4:** Front bumper: Front bumper (+ mit Steinschlägen übersät) - Scratch(es) - Paint



**Damage 4:** Front bumper: Front bumper (+ mit Steinschlägen übersät) - Scratch(es) - Paint



**Damage 5:** Bonnet: Bonnet - Corrosion - Repair and paint




**Damage 5:** Bonnet: Bonnet - Corrosion - Repair and paint




**Damage 5:** Bonnet: Bonnet - Corrosion - Repair and paint



**Wear and tear 1:** Vehicle glazing: Windscreen - Stone chips - No deduction

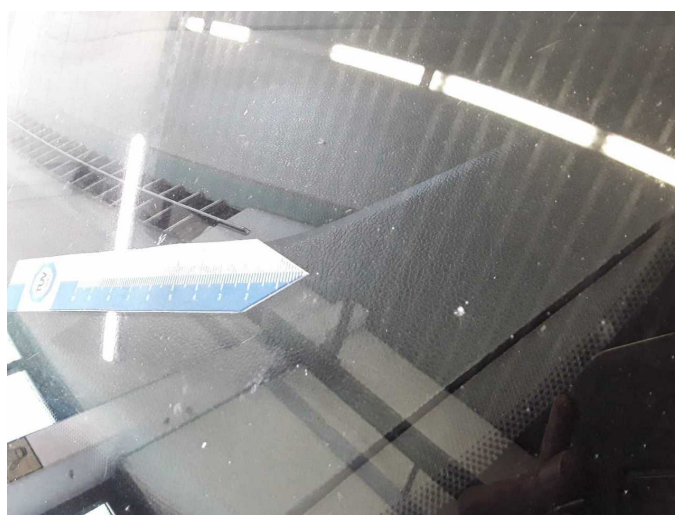

**Wear and tear 1:** Vehicle glazing: Windscreen - Stone chips - No deduction

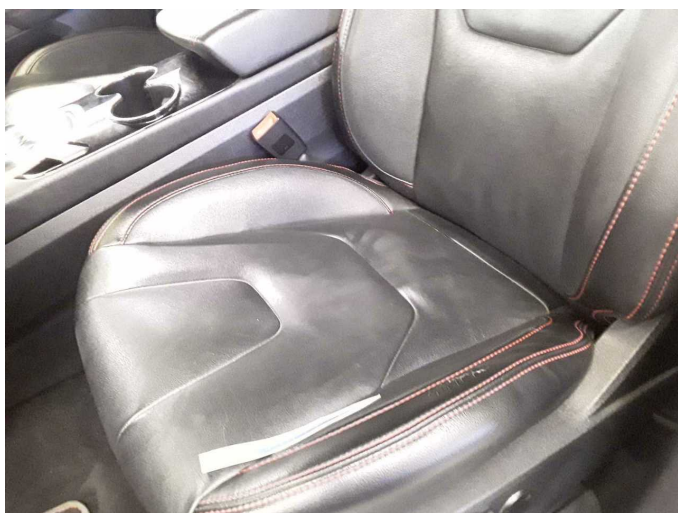

**Wear and tear 6:** Seat - front: Seat cover - left side - Broken / torn - No deduction




**Wear and tear 6:** Seat - front: Seat cover - left side - Broken / torn - No deduction



**Repainting 1:** Mudguard - left side, Side panel - rear left side



**Repainting 1:** Mudguard - left side, Side panel - rear left side

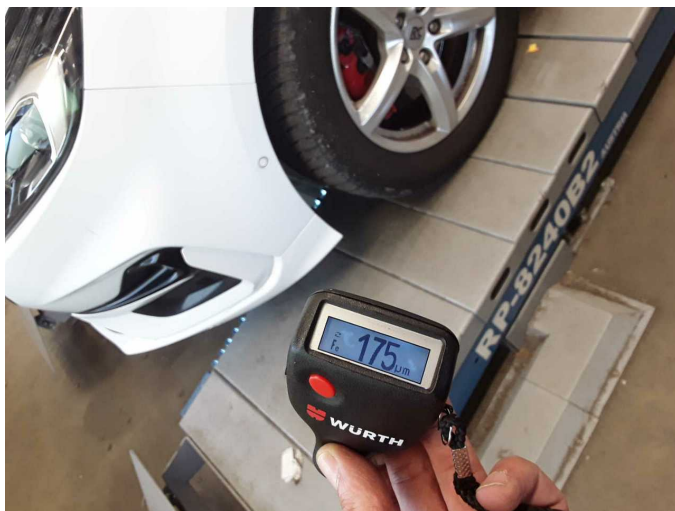

**Repainting 1:** Mudguard - left side, Side panel - rear left side



**Repainting 1:** Mudguard - left side, Side panel - rear left side