



Expertise

Protocol number: 46356040
Order No. / Reference: 26550159
Inspection date: 30 Jun 2026

Manufacturer: Volvo

Model: XC90 T8 AWD Recharge Geartronic Inscription Expression

VIN: YV1LFBMUDM1741600



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 T8 AWD Recharge Geartronic Inscription Expression	
Vehicle Identification number	YV1LFBMUDM1741600
Mileage (Read)	112,641 km
First registration	4 May 2021
Number of holders	1
Power / Engine displacement	223 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Savile Grau-Metallic
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	0 km
Last service on / at	06/2025 at 91,063 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA551355
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BMH 00052		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,980 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/45 R20 110V	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	275/45 R20 110V	Winter tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/40 R21 107V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	275/40 R21 107V	Summer tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System
- Airbags
- All-wheel drive (AWD)
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Brake energy recuperation
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Connected Safety
- Roof spoiler
- Tachometer
- Driver Alert - Attention Warning
- Rear parking assist
- Electronic differential lock
- Electronic stability control
- Chrome window surround
- Bottle holder in the luggage compartment
- Luggage compartment partition net
- Transmission: 8-speed Geartronic automatic transmission
- Automatic tailgate
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- IntelliSafe Surround
- Keyless Drive
- Child lock
- Air conditioning for the 3rd row of seats
- Headrests of the 2nd row of seats can be folded down (electrically)
- LED headlights "Thor's Hammer"
- Steering wheel: Steering wheel heating
- Illuminated makeup mirror for driver and front passenger
- Sensus navigation system
- Oncoming Lane Mitigation
- Pollen filter
- Radio: Sensus Connect infotainment system with high-performance sound
- Radio accessories: Two USB-C ports on the back of the center console
- Road Edge Detection
- Run-off Road Protection
- Rear seat backrests can be folded down in a 60/40 split or completely.
- Sensus Connect infotainment system
- Safety braking system with disc brakes all around (internally ventilated)
- Passenger side airbag can be deactivated
- Active safety belts with belt tensioners
- Aluminum loading sill protector in the luggage compartment
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Attachment system for carrier bags in the luggage compartment
- Fog sensor for automatic activation of the defroster function
- On-board computer
- third brake light
- Chrome applications in the front bumper
- City Safety
- CleanZone air quality system with activated carbon filter
- Aluminum roof rails (integrated)
- Digital Instrumentation
- Drive Mode
- Aluminum inlay Iron Ore
- Aluminum door sill plates with Recharge lettering, front (illuminated) and rear
- Electric windows front and rear
- Automatic emergency braking
- Front grille in waterfall design in chrome
- Cruise control system with variable speed limiter
- Seat belt height adjustment front and rear (2nd row of seats)
- rear window wiper
- Interior lighting
- IntelliSafe Assistant
- ISOFIX mounting for the outer rear seats
- Keyless Start
- Automatic climate control with 4-zone temperature control
- Headrests (7)
- Charging cable Schuko / Type 2 (Mode 2), 4.5 m length
- Cargo area roller blind (semi-automatic)
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Front center armrest including cup holder
- Emergency brake lights
- Electric parking brake
- Upholstery: Leather comfort seats
- Radio accessories: Smartphone integration Apple CarPlay and Android Auto
- Rain sensor with automatic light function
- Tire pressure monitoring system
- Road Sign Information (RSI) - Traffic Sign Recognition
- Wheels: Tire sealant
- Heated windshield washer nozzles
- Whiplash Protection System (WHIPS)
- Speed-sensitive power steering
- Seats: Third row of seats (7-seater)
- Seats: Driver and front passenger seats are height-adjustable (electrically)



- Seats: Lumbar support (2-way adjustable) for driver and front passenger seats
- Start/Stop technology
- Power socket
- Textile floor mat for the 3rd row of seats
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

- Seats: Heated front seats
- Storage compartment under the cargo floor
- subwoofer
- Textile floor mats
- Glazing: Colored glazing
- Volvo On Call with Wi-Fi hotspot
- Warning tone/indicator when seat belts are not fastened (for all seats)

Extra equipment

- Parking assistance, front and rear
- Paint finish: Metallic paint
- Package: Parking Assistance Package (front and rear parking aid - reversing camera)
- Parking camera with 360° surround view
- LM with winter tires

- Child safety lock for the rear doors (electric)
- Charging cable Type 2 / Type 2 (Mode 3) (7 m length, single-phase, 16A (for connection to a charging station with Type 2 connector))
- Wheels: 21" 10-spoke turbine design alloy wheels (tires 275/40 R21; rims 9 x 21")

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door - Scratch(es) - Smart repair
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
5	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
6	2nd wheel set	1 alloy rim - Scratched - Loss in value
7	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
8	Misc.	Inspection / maintenance - Due - Perform
9	Door - rear left side	Door - Scratch(es) - Paint
10	Door - front right side	Door - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 13 Jul 2021	1.263,83 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

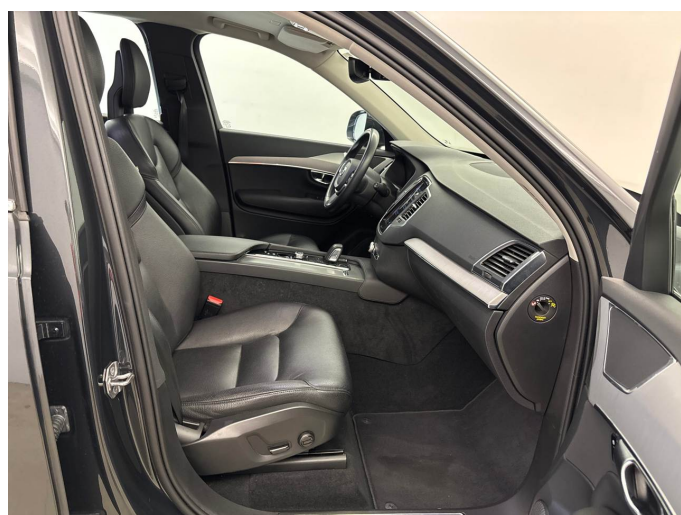


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

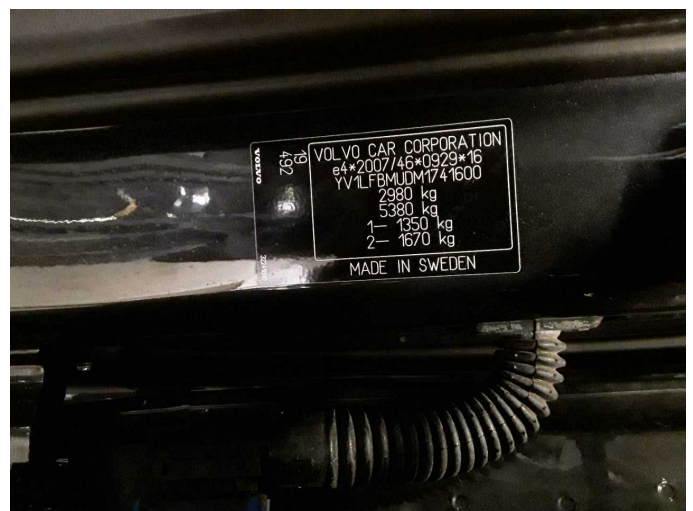


Figure 12: VIN



Figure 13: Mounted tyres

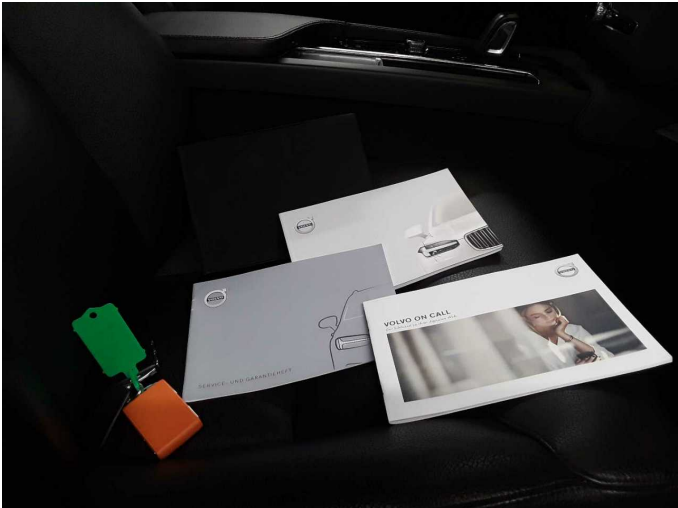


Figure 14: Documents

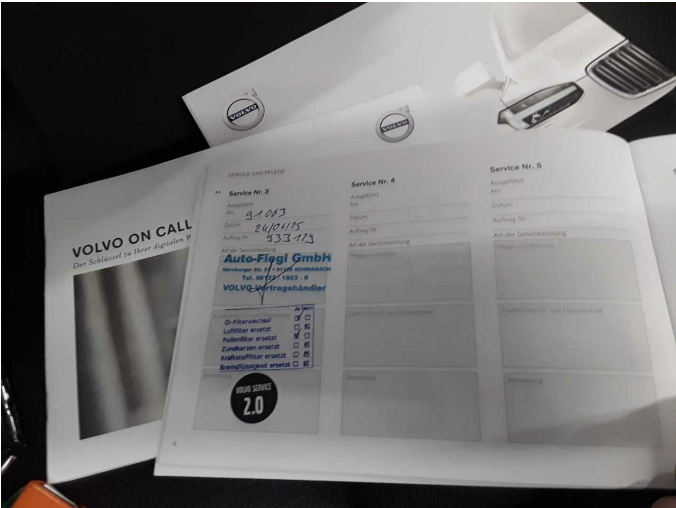


Figure 15: Documents

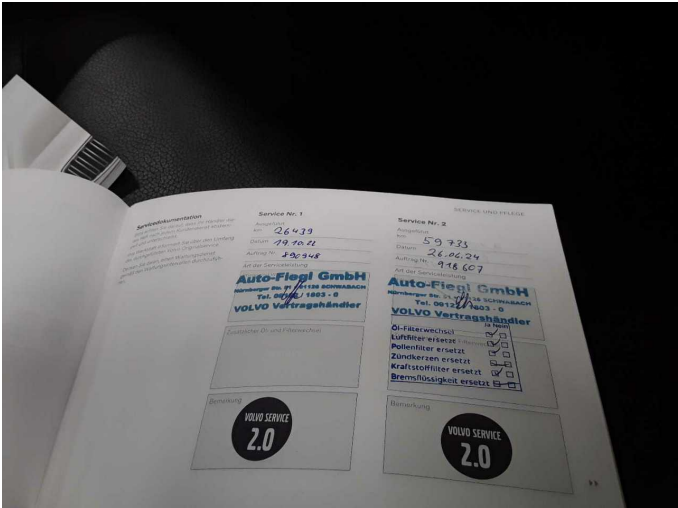


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.

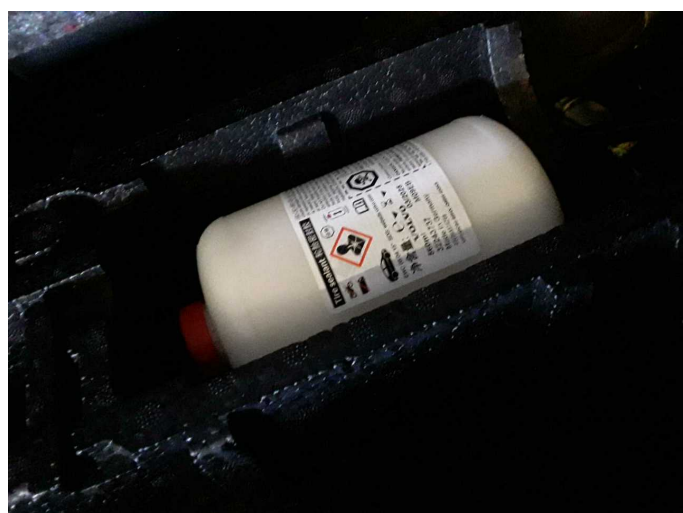

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair

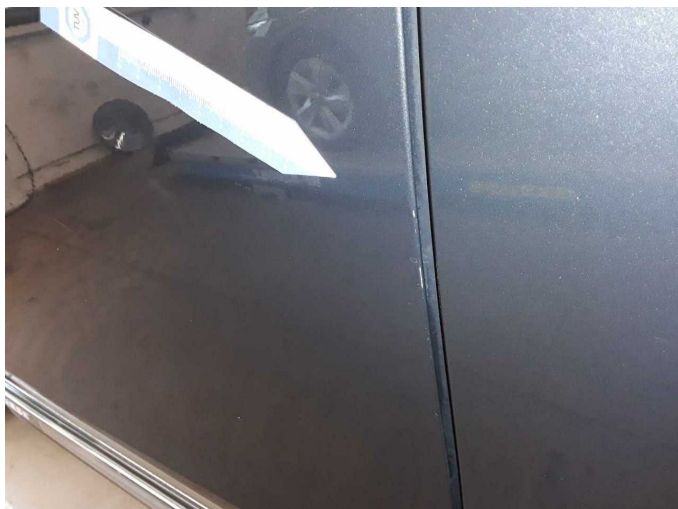

Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value




Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value

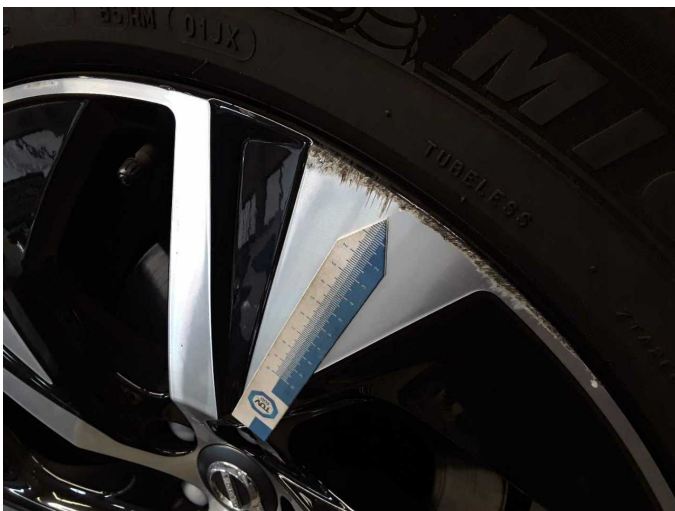


Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 8: Misc.: Inspection / maintenance - Due - Perform




Damage 9: Door - rear left side: Door - Scratch(es) - Paint

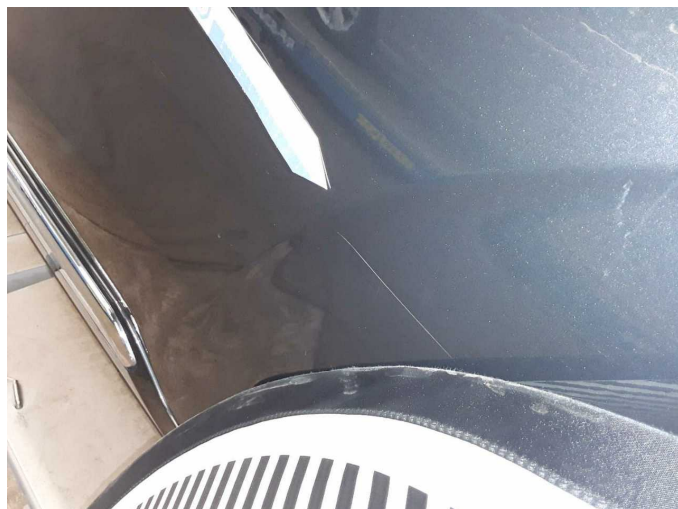


Damage 9: Door - rear left side: Door - Scratch(es) - Paint

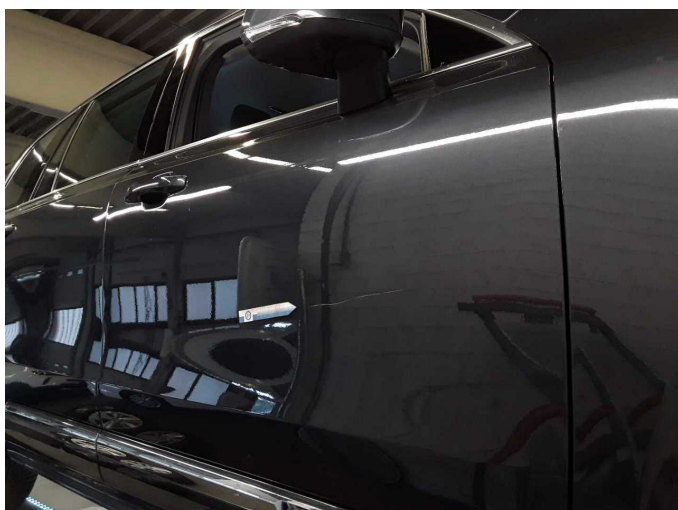


Damage 10: Door - front right side: Door - Scratch(es) - Paint

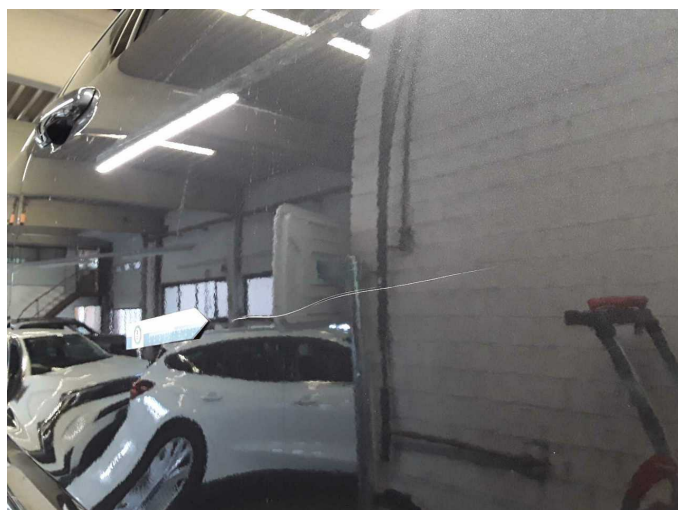


Damage 10: Door - front right side: Door - Scratch(es) - Paint

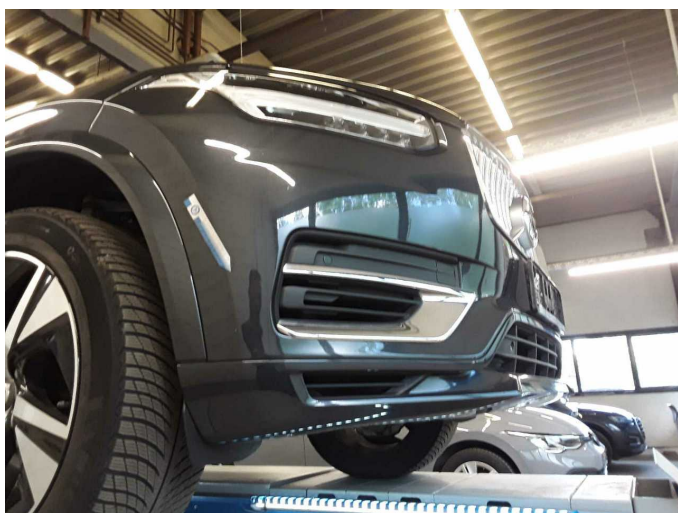

Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction

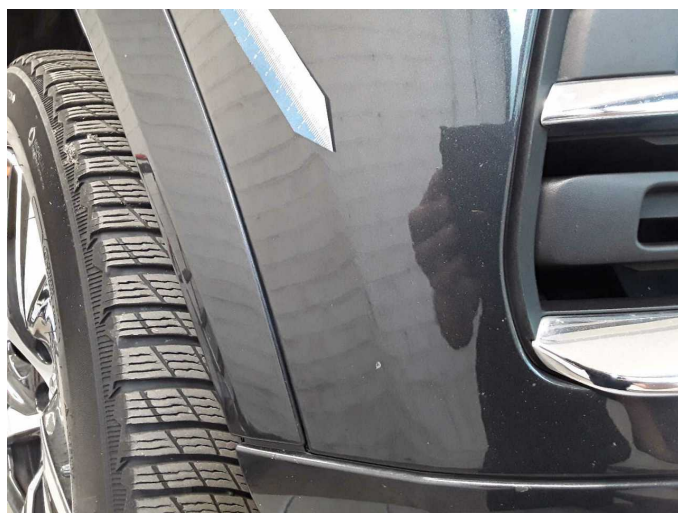

Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction

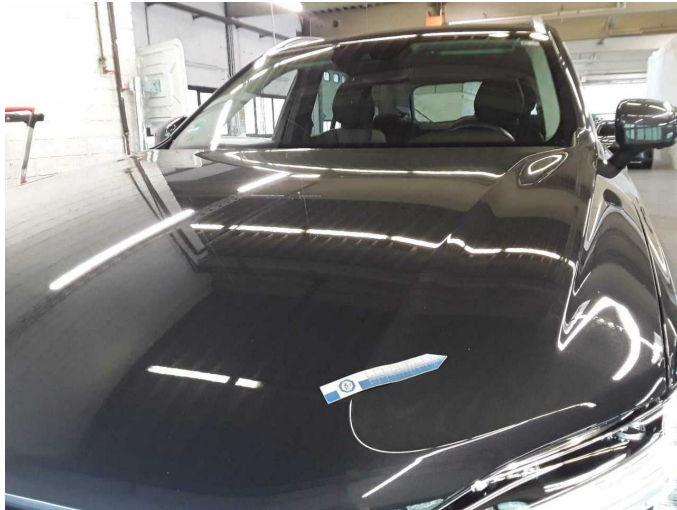

Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction