



Expertise

Protocol number: 46750649
Order No. / Reference: 26628879
Inspection date: 28 Jul 2026

Manufacturer: Opel

Model: Zafira Life 2.0 D L Aut. Elegance

VIN: VXEEH7NZ068300



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Zafira Life 2.0 D L Aut. Elegance	
Vehicle Identification number	VXEEH7NZ068300
Mileage (Read)	104,312 km
First registration	30 Mar 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,997 ccm / 4
Power	130 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Mondstein Grau Metallic
Doors / Seats	5 / 8
Upholstery type	Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,180 km
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ357360
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	3003 / BBA 00346		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,830 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	225/55 R17 101H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Low beam automatically
- Airbag for driver and passenger side
- Airbag: Curtain airbags, in the 2nd and 3rd rows of seats
- Automatic activation of the hazard warning lights
- Exterior mirror housings in black
- On-board computer
- Headliner with 3 reading lights and ambient lighting
- Tachometer
- Window: Window, driver's side in the 2nd row of seats, fixed
- Luggage compartment cover
- Electric handbrake
- Glazed tailgate, with rear window wiper and heater
- Interior mirror, automatically dimming
- Child safety lock, electric
- Automatic climate control: Dual-zone automatic climate control
- Headlight range adjustment, manual
- Fog light
- Rear fog lights with reversing lights
- Package: Driver Assistance Package 1
- Panoramic glass roof with 2 separate windows, manually retractable
- Quickheat rapid heating system
- Radio accessories: Sound system
- Tire repair kit
- Wheels: Alloy wheels in bicolor, 7J x 17
- Keyless locking and starting system Keyless Open & Start
- Side protection strips in vehicle color
- Seat belts: Three-point seat belts in all seats
- Seats: 8 leather seats, Claudia Schwarz
- Solar Protect thermal insulation glazing
- Sunshades in the 2nd row of seats
- 12V socket
- Traction Control (TC) Plus
- Door: Electric sliding door, driver and passenger side
- Illuminated door sill trim
- Xenon headlights with LED daytime running lights
- Ignition keys (2), both foldable
- Storage compartments
- Airbag: Head airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors, electrically adjustable, heated and folding
- Hill Start Assist
- Third brake light
- Diesel particulate filter
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Floor mats in all rows of seats
- Transmission: 8-speed automatic transmission
- Head-Up Display
- Interior lighting
- Interior mirror, additional, for interior monitoring
- Air conditioning: Auxiliary air conditioning, rear
- Steering wheel: Multifunction leather steering wheel, flattened at the bottom
- Navigation system: Multimedia Navi Pro with 7" color touchscreen display, voice control for audio, telephone, navigation
- Package: Driver Assistance Package 2
- 180° panoramic reversing camera
- Parkpilot, front and rear
- Radio: Digital radio reception DAB+
- Rain sensor
- Tire pressure warning
- Sliding door trim with cover, in vehicle color
- Side impact protection
- Power steering
- Safety steering column, height and length adjustable
- Heated seats for driver and front passenger
- Sun visors driver and passenger side
- 12-volt power outlet in the second row of seats
- Power outlet: 220/230V, in the second row of seats under the passenger seat
- Exterior door handles, in chrome
- Immobiliser
- Central locking with remote control

Extra equipment

- Detachable trailer hitch
- IntelliGrip (Adaptive traction system with 5 selectable modes: - ESP off - ESP standard - Snow mode - Mud mode - Sand mode)
- Luggage compartment partition net (vertical behind the last row of seats)
- Paint finish: Metallic
- Webasto auxiliary heater (programmable with remote control)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Roof	Roof rail - right side - dent(s) - Smooth repair work
2	Front bumper	Front bumper - Scratched - Smart repair
3	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace
4	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
5	Bonnet	Bonnet - Scratched - Paint
6	Door - front left side	Door - Scratched - Paint
7	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
8	Sliding door - left side	Sliding door with glass panel - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Headlight	Headlight - right side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Provided by user / customer, from 17 Sept 2024	2.129,09 €
2	Side right, Provided by user / customer, from 28 Nov 2025	10.971,88 €

Repainting

No. Repainting

1	Roof, Door - rear right side, Door - front right side
---	---

Paint coat thickness measurement

Roof	155 µm	Door - rear right side	176 µm
Door - front right side	188 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

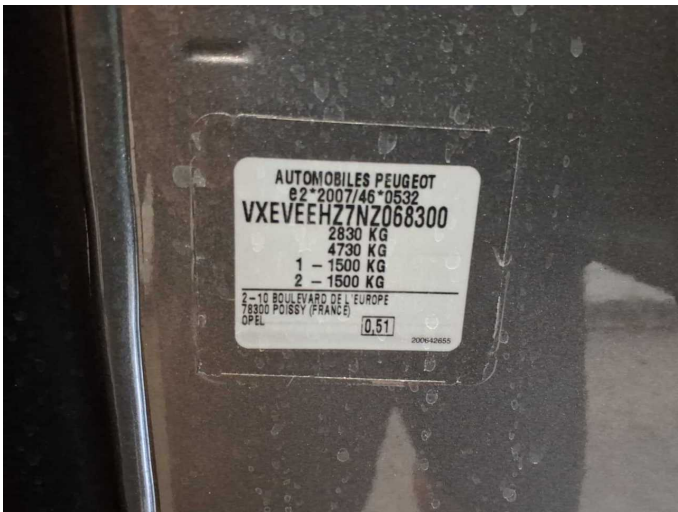


Figure 11: VIN



Figure 12: Mounted tyres

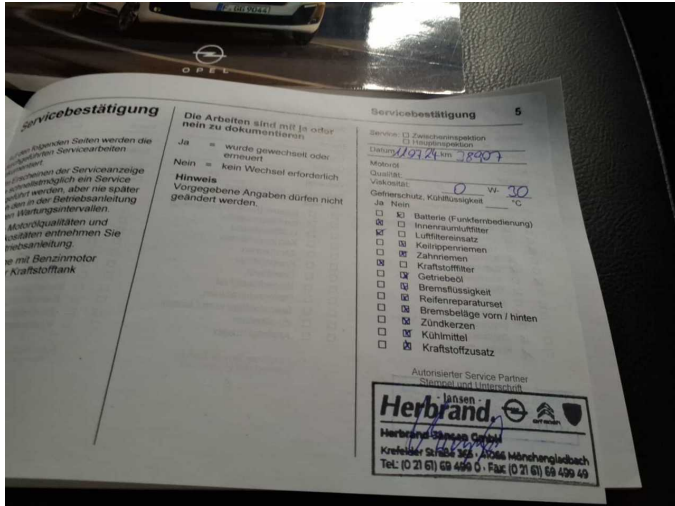


Figure 13: Documents

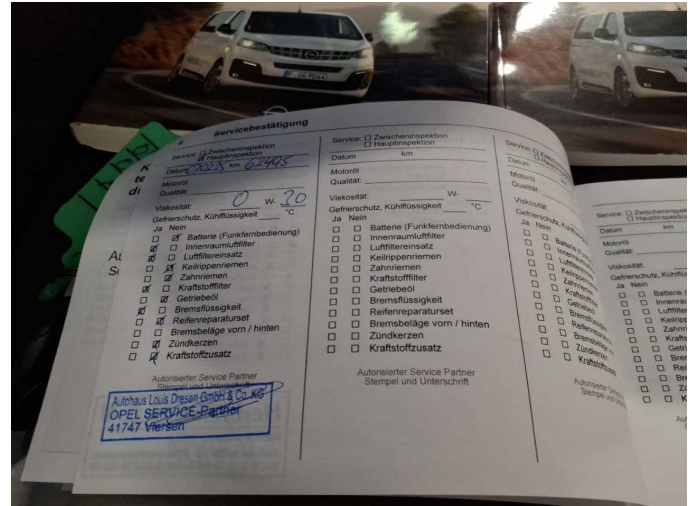


Figure 14: Documents

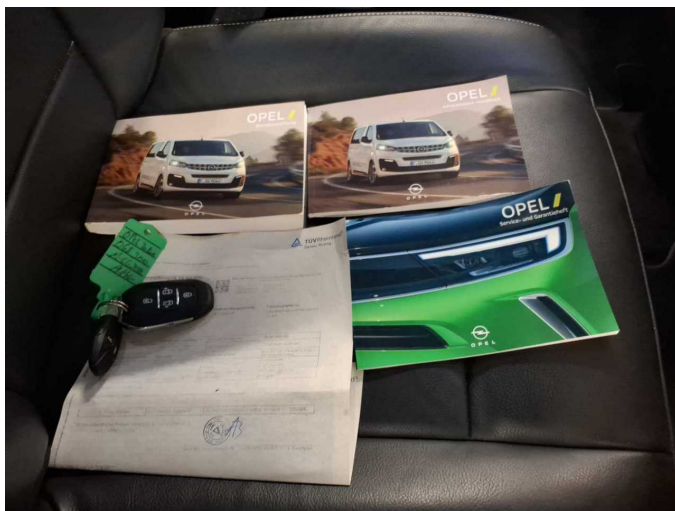


Figure 15: Documents



Figure 16: Documents



Figure 17: Documents

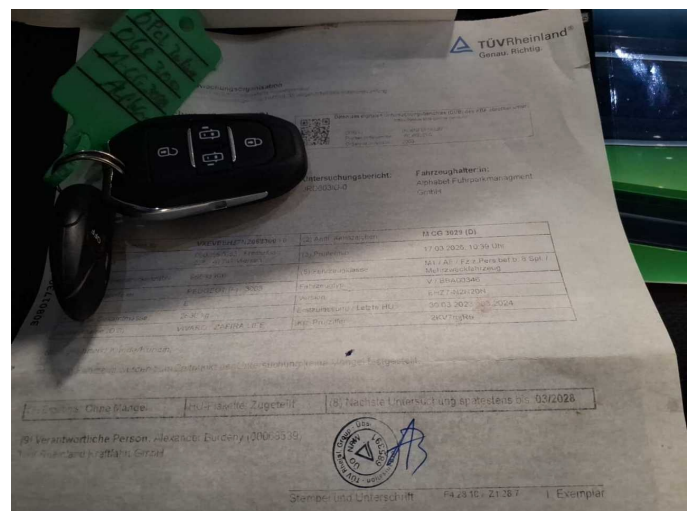


Figure 18: Documents



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

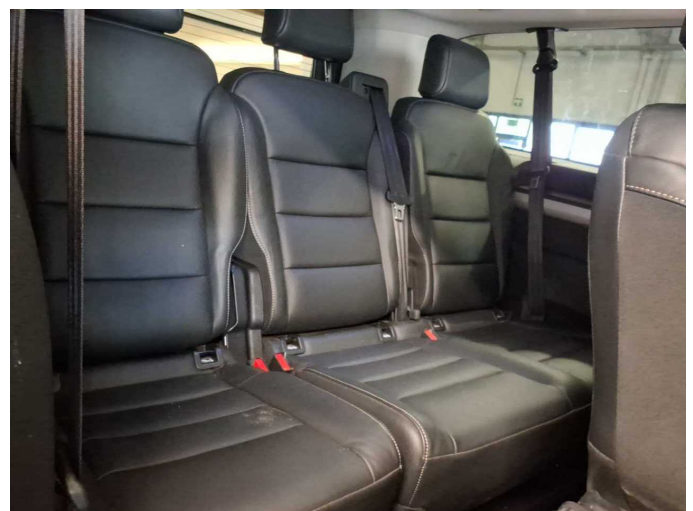


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

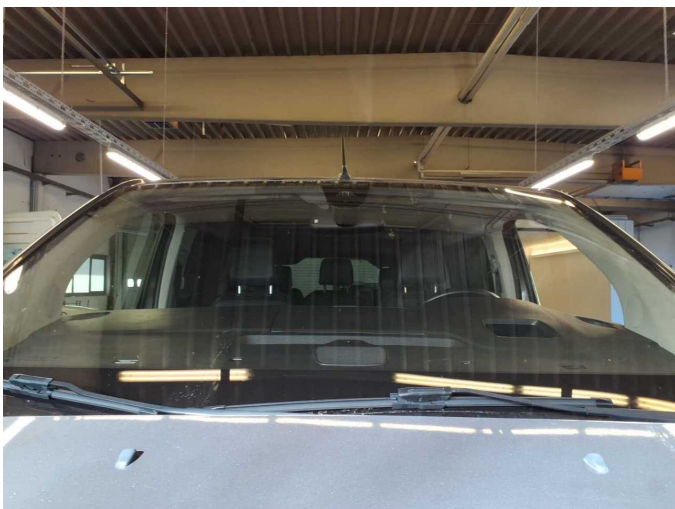


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

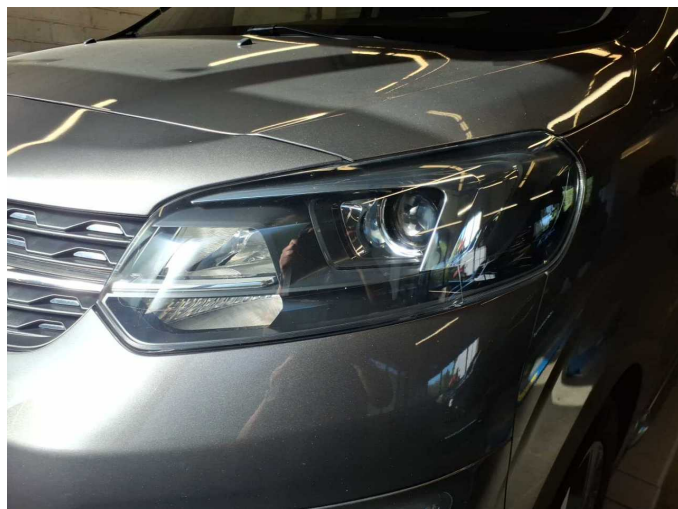


Figure 32: Misc.

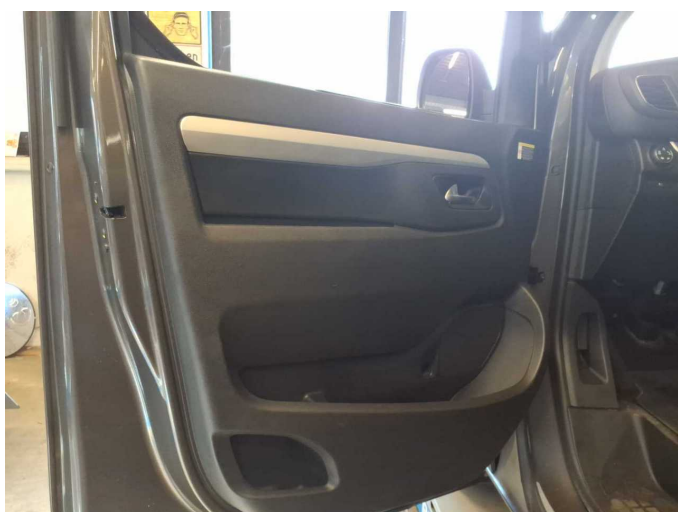


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

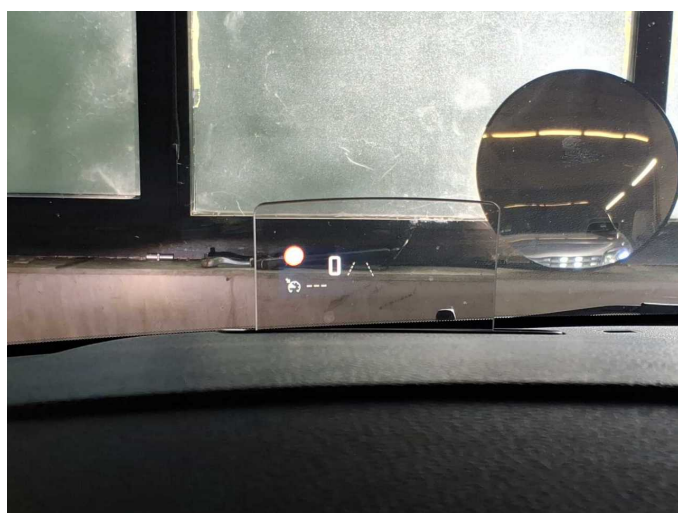


Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.



Figure 39: Misc.



Damage 1: Roof: Roof rail - right side - dent(s) - Smooth repair work

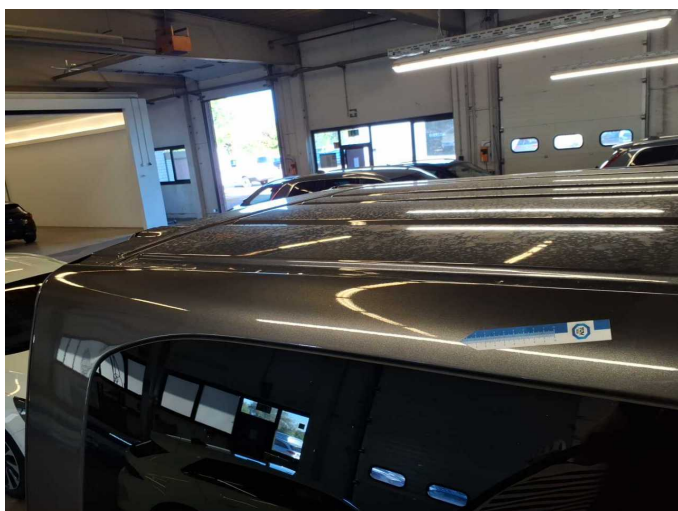

Damage 1: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 2: Front bumper: Front bumper - Scratched - Smart repair



Damage 2: Front bumper: Front bumper - Scratched - Smart repair




Damage 3: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 3: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace




Damage 4: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint

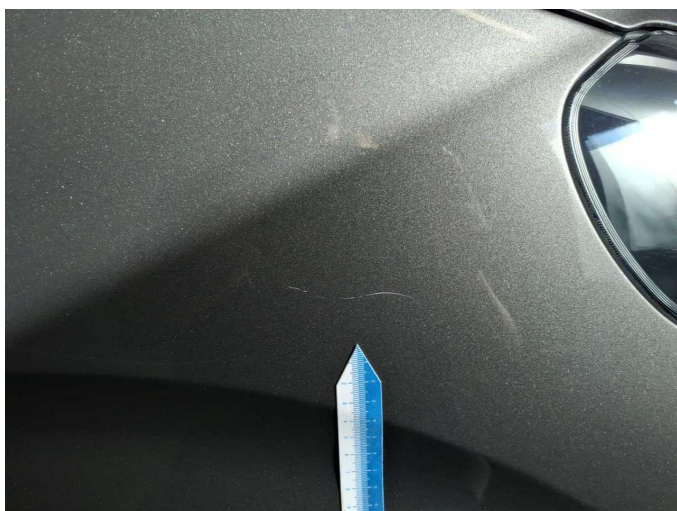

Damage 4: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint

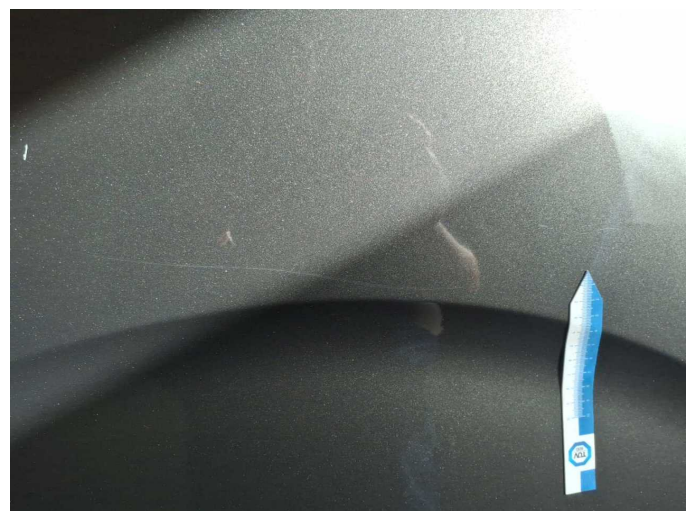

Damage 4: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint

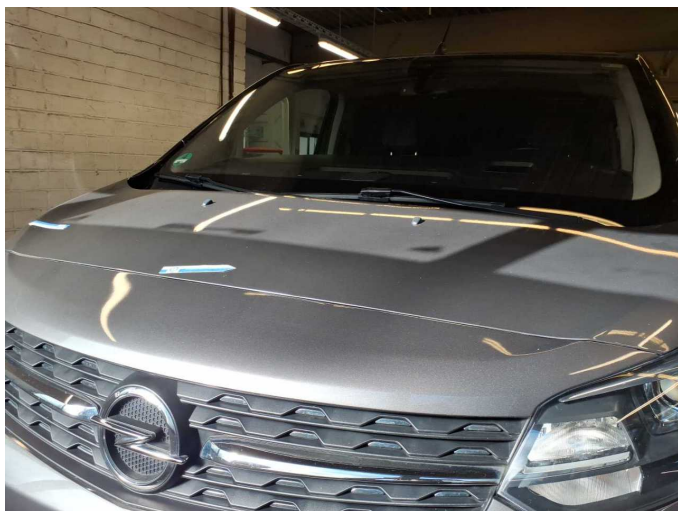

Damage 5: Bonnet: Bonnet - Scratched - Paint




Damage 5: Bonnet: Bonnet - Scratched - Paint




Damage 5: Bonnet: Bonnet - Scratched - Paint



Damage 5: Bonnet: Bonnet - Scratched - Paint

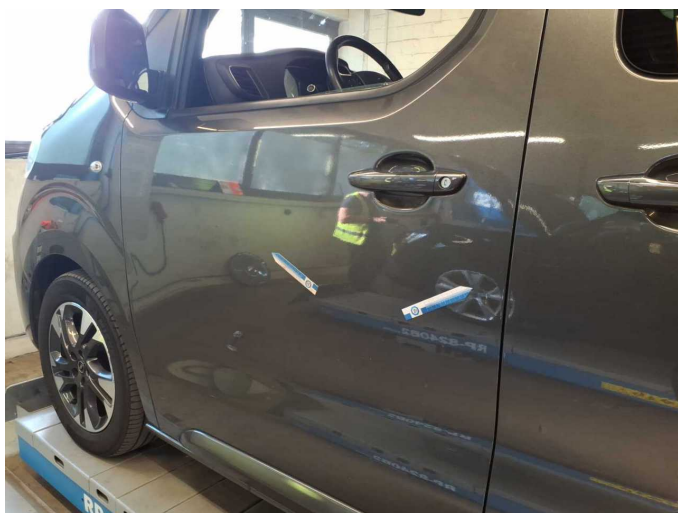

Damage 6: Door - front left side: Door - Scratched - Paint

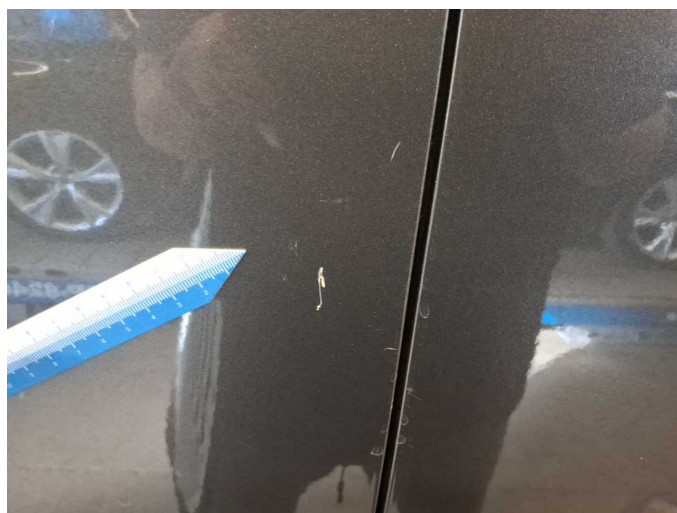

Damage 6: Door - front left side: Door - Scratched - Paint



Damage 6: Door - front left side: Door - Scratched - Paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 8: Sliding door - left side: Sliding door with glass panel - Scratched - Paint




Damage 8: Sliding door - left side: Sliding door with glass panel - Scratched - Paint



Damage 8: Sliding door - left side: Sliding door with glass panel - Scratched - Paint

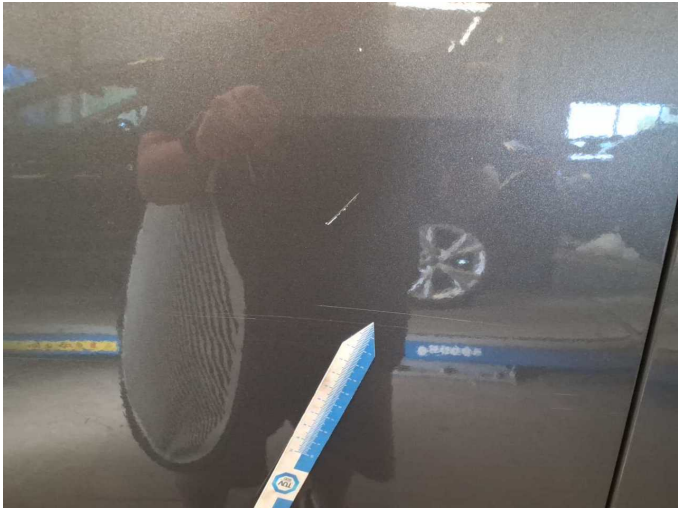


Damage 8: Sliding door - left side: Sliding door with glass panel - Scratched - Paint

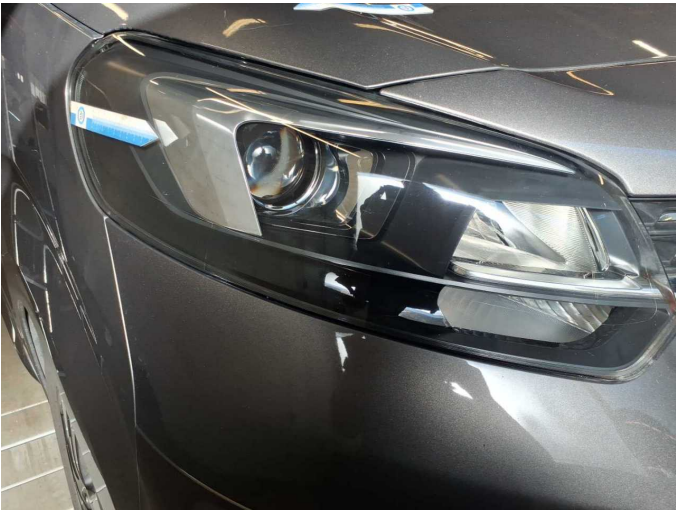

Wear and tear 1: Headlight: Headlight - right side - Scratch(es) - No deduction




Missing part 1: Equipment: Vehicle key - Missing - Replace

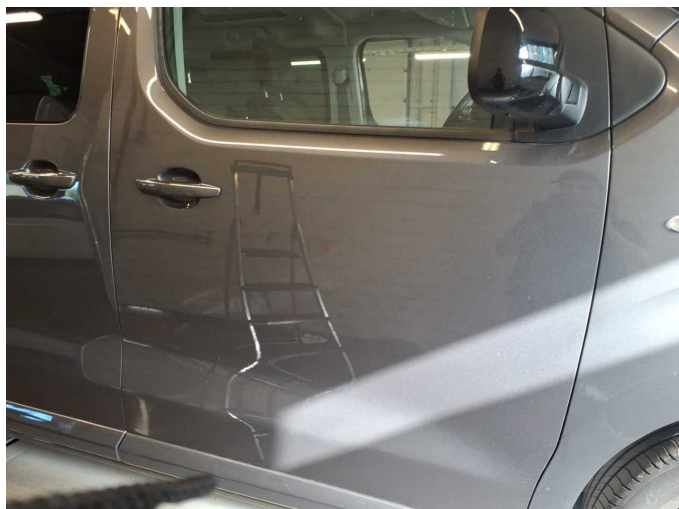

Repainting 1: Roof, Door - rear right side, Door - front right side



Repainting 1: Roof, Door - rear right side, Door - front right side

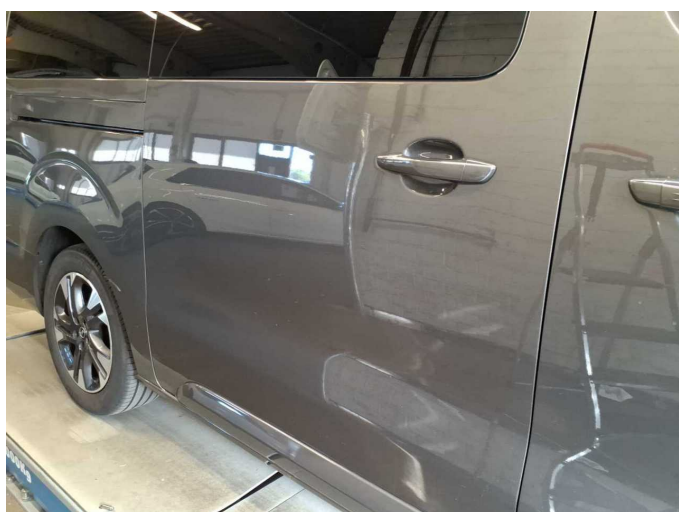

Repainting 1: Roof, Door - rear right side, Door - front right side



Repainting 1: Roof, Door - rear right side, Door - front right side



Repainting 1: Roof, Door - rear right side, Door - front right side



Repainting 1: Roof, Door - rear right side, Door - front right side