



Expertise

Protocol number: 46840805  
Order No. / Reference: 26780144  
Inspection date: 3 Aug 2026

Manufacturer: Hyundai

Model: KONA EV Prime

VIN: TMAK381GFPJ096178



| Vehicle details                         |                   |
|-----------------------------------------|-------------------|
| Manufacturer / Type / Model / Equipment |                   |
| Hyundai KONA EV Prime                   |                   |
| Vehicle Identification number           | TMAK381GFPJ096178 |
| Mileage (Read)                          | 47,376 km         |
| First registration                      | 7 Jul 2023        |
| Number of holders                       | 1                 |
| Next periodical technical inspection    | 06/2028           |
| (Report on hand)                        |                   |
| Fuel type                               | Electric          |
| Power                                   | 28 kW             |
| Gearbox / Number of gears               | Direct drive / 1  |
| Type of drive                           | Front drive       |
| Type of vehicle                         | SUV               |
| Colour / colour code                    | Atlas White       |
| Doors / Seats                           | 5 / 5             |
| Upholstery type                         | Leather           |
| Colour of upholstery                    | Black             |
| Vehicle with smoke odor                 | no                |



## Vehicle details

|                                                      |                                     |                                |                                                            |
|------------------------------------------------------|-------------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital proof / complete            | <b>Next maintenance in</b>     | 283 Tag(e)                                                 |
| <b>Last service on / at</b>                          | 02/2026 at 39,708 km                |                                |                                                            |
| <b>Key is / should be</b>                            | 2 / 2                               | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                                     | <b>Letter No.</b>              | GY587656                                                   |
| <b>Previous damage / Accident</b>                    | None detectable                     | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                         | sufficient                          | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                    | short drive on the company premises | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/<br/>type code number</b> | 1349 / AFH 00010                    |                                |                                                            |
| <b>Emission standard</b>                             | 2017/1151                           | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,170 kg                            | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 215/55 R17 94V | Summer tyres on Light alloy | Michelin     | 5mm / 5mm   |
| 2) | 215/55 R17 94V | Summer tyres on Light alloy | Michelin     | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 215/55 R17 94H | Winter tyres on Light alloy | Continental  | 5mm / 5mm   |
| 2) | 215/55 R17 94H | Winter tyres on Light alloy | Continental  | 7mm / 7mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 07/2028 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

## Standard equipment

- 3-phase charging (11kW)
- Adaptive Emergency Stop Signal (ESS)
- Airbag: Front airbags for driver and front passenger (passenger airbag can be deactivated)
- Airbag: Side airbags for driver and front passenger
- Active Lane Keeping Assist (LKA)
- Lead Vehicle Approach Warning (LVDA)
- Attention Assistant (DAW)
- Highway Assist (HDA) (this is a combination of lane keeping assist and intelligent speed control - the system maintains a safety distance to the front and monitors the distances to the lane markings to the left and right of the vehicle)
- AVAS - Artificial Engine Sound
- Hill Start Assist (HAC)
- Roof rails
- Digital cockpit with 10.25-inch color display
- eCall emergency call system
- Front parking sensors
- Vehicle Stability Management (VSM)
- High beam assist
- Footwell lighting (front)
- Luggage compartment cover
- Cruise control with limiter
- Transmission: 1-stage reduction gear
- Heated rear window (with automatic shut-off)
- Interior mirror automatically dimming
- Child safety locks on the rear doors
- Automatic climate control (automatic interior fogging control)
- ICCB charging cable
- LED daytime running lights
- Steering wheel: Multifunctional leather steering wheel (with paddle shifters for regenerative braking)
- Light sensor
- Package: Assistance Package (Head-Up Display - Active Blind Spot Assist (BCA) - Active Rear Cross Traffic Alert with Emergency Braking Function (RCCA) - Exit Warning (SEW))
- Electric parking brake
- Upholstery: Cloth
- Radio accessories: Apple CarPlay, Android Auto (wired)
- Radio accessories: DAB+ radio
- Rain sensor
- Tire pressure monitoring system (TPMS)
- Wheels: Tire repair kit
- Power steering
- Seat belts (three-point belt system on all seats - belt tensioners and belt force limiters in the front - belt warning for all seats - height-adjustable seat belts in the front)
- Seats: Driver's seat height adjustable
- Seats: Rear seat backrest asymmetrically split, foldable
- Storage compartments: (Storage pockets on the back of the front seats - compartment in the center console of the dashboard - compartments in the doors - front cup holders - cup holders in the front center armrest)
- Airbag: Curtain airbags extending to the rear seats
- Alarm system (occupant alarm)
- Anti-lock braking system (ABS), with electronic brake-force distribution (EBD)
- Automatic interior hardware control
- Autonomous Emergency Braking (FCA) (including forward collision warning with pedestrian and cyclist detection)
- Electrically folding exterior mirrors
- Electrically adjustable and heated exterior mirrors (integrated LED turn signals - painted in car color)
- Brake Assist (BAS)
- Roof spoiler with 3rd brake light
- Drive Modes
- Rear parking sensors
- Electronic Stability Control (ESC)
- Electric windows front and rear (driver's window with automatic up/down function and anti-pinch protection)
- Luggage net
- Luggage compartment lighting
- Adaptive Cruise Control (ASCC) (with distance control and stop function)
- Rear window wiper/washer system
- ISOFIX child seat attachment at the rear (on the outer seats including top tether anchor points)
- Headrests (5) front and rear height adjustable
- Paint finish: Solid
- LED taillights (brake and driving lights)
- Heated steering wheel
- Reading lights front and rear
- Headlight range adjustment, manual
- Front center armrest with storage compartment
- Package: Efficiency (Heat pump - Type 2 charging cable (20 A, 11 kW 3-phase, 5 m usable length))
- Package: Navigation package (10.25-inch color touchscreen - Bluelink telematics services - Lifetime MapCare - LIVE Services - Radio navigation system - Traffic sign recognition (ISLW) - KRELL sound system - 8 speakers including subwoofer and amplifier)
- Radio accessories: Prime (RDS radio - Bluetooth with hands-free function - USB port)
- Wheels: Alloy wheels 7 J x 17 with tires 215/55 R 17
- Rear view camera
- Shift-by-Wire
- Safety steering column, tilt and length adjustable
- Front seats electrically adjustable
- Seats: Passenger seat height adjustable



- Seats: Heated front seats
- Smartphone holder with wireless charging function
- Lane Following Assist (LFA) (The Lane Following Assist keeps the vehicle in the center of the lane, taking into account not only the lane markings but also the vehicle ahead. - Lane Departure Warning System (LDW))
- Dark tinted glazing from the B-pillar back
- Glazing: Windscreen with sunshade wedge
- Full LED projection spotlight
- thermal insulation glazing

- Seats: Driver's seat with electrically adjustable lumbar support
- Smart key system with start-stop button
- Sun visor with illuminated mirror for driver and passenger
- Lane Departure Warning System
- 12-volt socket
- Door handles painted in car color
- Interior door handles, in silver-grey
- All-around tinted glazing
- Glazing: Heat-insulating windshield
- Electronic immobilizer
- Central locking with key-integrated remote control

### Extra equipment

- Paint finish: Solid special color
- Package: Seat package (leather seat upholstery combined with high-quality synthetic leather - ventilated front seats - heated rear seats)

### Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | A short maneuvering and shunting exercise was carried out on the company premises.                                                                                           |
| Engine function test | An engine test run was performed.                                                                                                                                            |

### Value reducing factors

| No. | Component group          | Description                                                  |
|-----|--------------------------|--------------------------------------------------------------|
| 1   | Door - front left side   | Brightware - lower - Scratch(es) - Smart repair              |
| 2   | Wing mirror - right side | Cap - Scratch(es) - Smart repair                             |
| 3   | Door - rear left side    | Brightware - lower - Scratch(es) - Smart repair              |
| 4   | Wing mirror - left side  | Cap - Scratch(es) - Smart repair                             |
| 5   | Wheel / tyres            | Alloy rim - front right side - Scratched - Loss in value     |
| 6   | Bonnet                   | Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint |

### Wear and tear

| No. | Component group         | Description                                      |
|-----|-------------------------|--------------------------------------------------|
| 1   | Door - front left side  | Door - dent(s) - No deduction                    |
| 2   | Door - front right side | Door - dent(s) - No deduction                    |
| 3   | Indicator - front       | Mirror - right side - Scratch(es) - No deduction |
| 4   | Wing mirror - left side | Mirror housing - Scratch(es) - No deduction      |
| 5   | Vehicle glazing         | Windscreen - Stone chips - No deduction          |
| 6   | Indicator - front       | Mirror - left side - Scratch(es) - No deduction  |
| 7   | 2nd wheel set           | 1 alloy rim - Scratched - No deduction           |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Repainting

### No. Repainting

- 1 Roof, Professionally carried out, Invoice of repair done Non-existent
- 2 Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
- 3 Bonnet, Unprofessionally carried out, Invoice of repair done Non-existent

## Paint coat thickness measurement

|        |        |                      |        |
|--------|--------|----------------------|--------|
| Roof   | 386 µm | Boot lid / rear door | 246 µm |
| Bonnet | 200 µm |                      |        |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

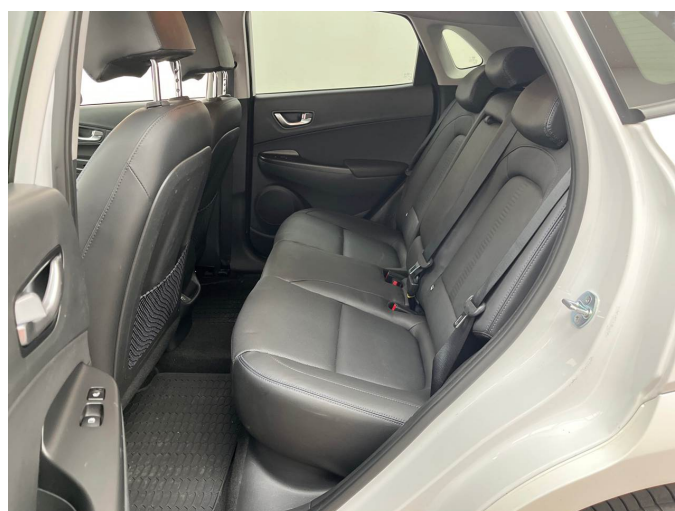


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

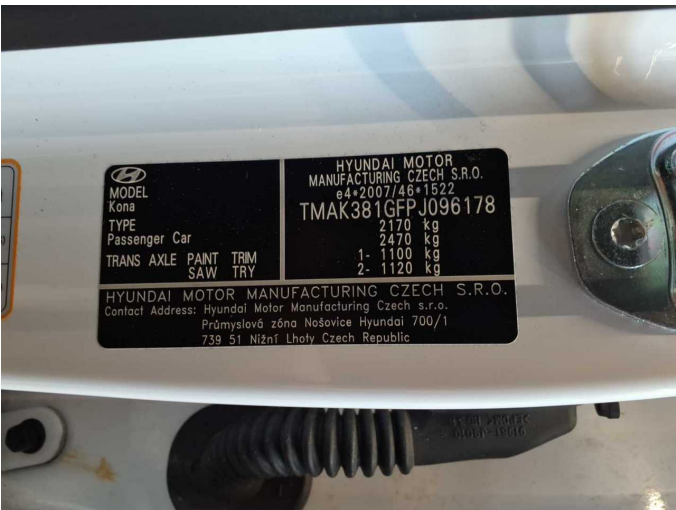


Figure 11: VIN



Figure 12: Mounted tyres

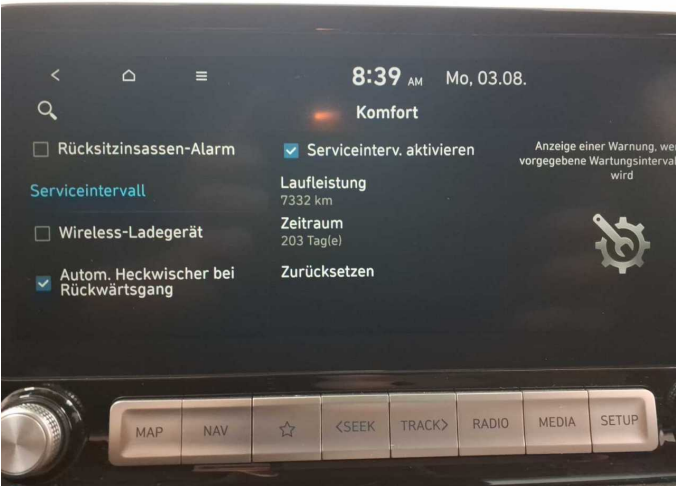


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

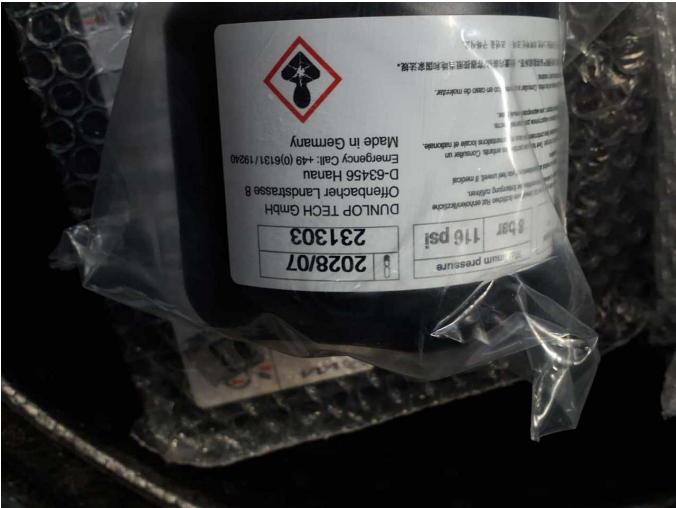


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.




**Damage 1:** Door - front left side: Brightware - lower - Scratch(es) - Smart repair

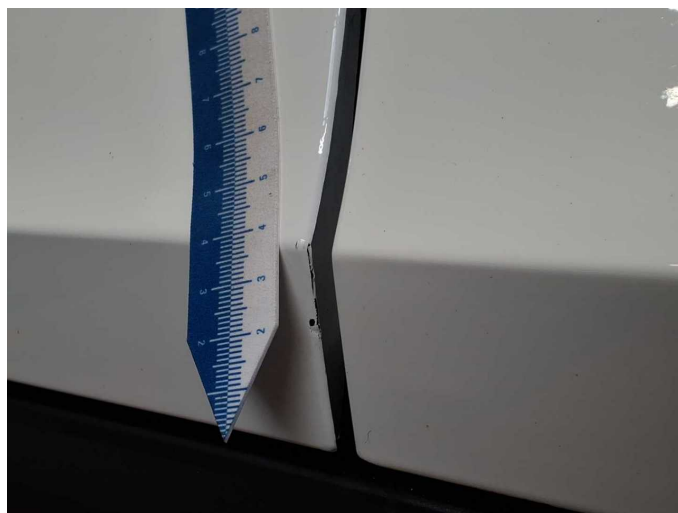

**Damage 1:** Door - front left side: Brightware - lower - Scratch(es) - Smart repair



**Damage 2:** Wing mirror - right side: Cap - Scratch(es) - Smart repair

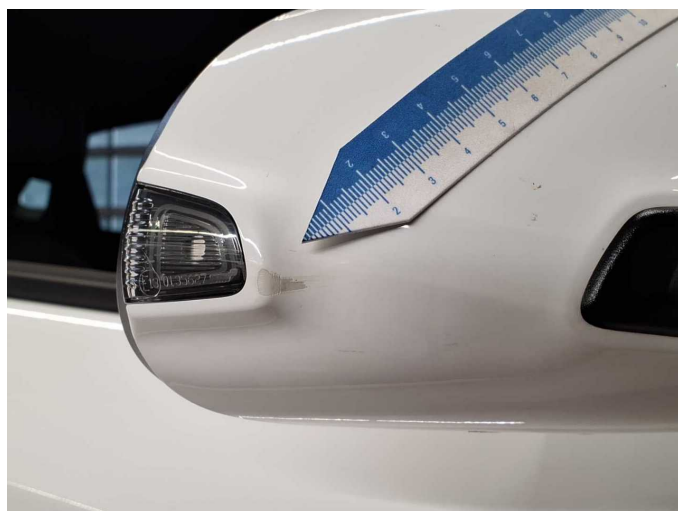

**Damage 2:** Wing mirror - right side: Cap - Scratch(es) - Smart repair



**Damage 3:** Door - rear left side: Brightware - lower - Scratch(es) - Smart repair



**Damage 3:** Door - rear left side: Brightware - lower - Scratch(es) - Smart repair



**Damage 4:** Wing mirror - left side: Cap - Scratch(es) - Smart repair



**Damage 4:** Wing mirror - left side: Cap - Scratch(es) - Smart repair



**Damage 5:** Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint




**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint

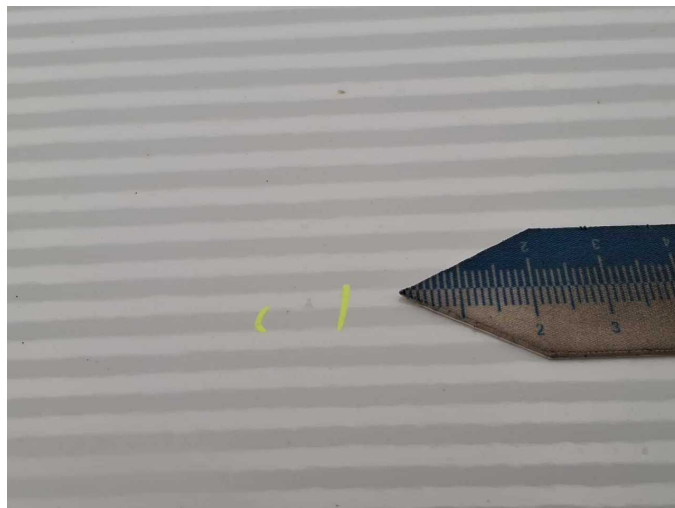

**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint




**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Damage 6:** Bonnet: Bonnet (Lackeinschlüsse) - Unprofessionally repaired - Paint



**Wear and tear 2:** Door - front right side: Door - dent(s) - No deduction

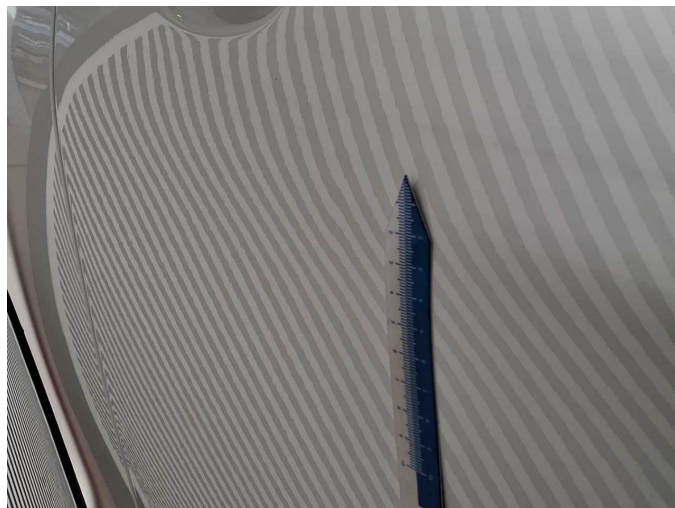

**Wear and tear 2:** Door - front right side: Door - dent(s) - No deduction



**Wear and tear 4:** Wing mirror - left side: Mirror housing - Scratch(es) - No deduction



**Wear and tear 4:** Wing mirror - left side: Mirror housing - Scratch(es) - No deduction



**Repainting 1:** Roof



**Repainting 2:** Boot lid / rear door



**Repainting 3: Bonnet**



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMAK381GFPJ096178  
Hersteller / Modell: HYUNDAI HYUNDAI KONA EV Prime

| Datum      | KM-Stand | Beschreibung                                                |
|------------|----------|-------------------------------------------------------------|
| 24.02.2026 | 39.708   | Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst |
| 26.08.2024 | 19.819   | Regelwartungsdienst                                         |