



Expertise

Protocol number: 45514439
Order No. / Reference: 26106128-1
Inspection date: 10 Mar 2026

Manufacturer: Ford

Model: Transit Custom 340 L1H1 LKW VA Trend

VIN: WF0YXXTTGYKM28936



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Custom 340 L1H1 LKW VA Trend	
Vehicle Identification number	WF0YXXTTGYKM28936
Mileage (Read)	109,470 km
First registration	26 Feb 2020
Number of holders	1
Next periodical technical inspection	07/2026
(Report not on hand)	
Power / Engine displacement	125 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Polar-Silber Metallic
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,000 km
Last service on / at	07/2024 at 89,280 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FS955086
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BMV 03871		
Emission standard	EURO6;WLTP;CI;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,400 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Winter tyres on Steel rim with wheel cover	Hankook	5mm / 5mm
2)	215/65 R16 109T	Winter tyres on Steel rim with wheel cover	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel	Goodyear	6mm / 6mm
2)	215/65 R16 109T	Summer tyres on Steel	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	Summer tyres on Steel	Goodyear	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- roof, flat
- Double-leaf rear door with 180° opening angle (without window)
- Front electric windows
- Ford Easy Fuel
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 6-speed transmission
- Interior lighting with delay circuit
- Paint finish: Solid color paint
- Cargo area floor: Vinyl floor covering, sealed, "Easy Clean"
- Emergency brake assist including emergency brake light
- Front and rear parking pilot system including fog lights
- Radio: Audio system 13 additionally with DAB/DAB+
- Wheels/Tires: Spare wheel, steel wheel
- Headlights: Halogen projector headlights
- Sliding door: Sliding door, right
- Mud flaps front and rear
- Low side paneling
- Seat belts
- Start-stop system
- Power outlet: 12-volt connection
- Lashing eyes 8
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric
- Driver's side airbag
- Exterior mirrors, electrically adjustable and heated
- On-board computer
- Headliner in driver's cab
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- FordPass Connect
- Generator, 240 A
- Cruise control including leather steering wheel
- Lockable glove compartment with lid
- Front air conditioning
- Cargo area lighting with activatable switch-off delay
- Steering column, adjustable in height and reach
- Package: Style-Color Package
- Particulate filter: diesel particulate filter
- Wheel trims
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 R tires
- Sliding door entry light automatically illuminates when the door is opened
- Side protection strips
- Power steering
- Seats: Seat package 13 - partition (load-through flap), without window (Custom Truck Trend)
- Front bumper in body color
- Immobiliser
- Central locking with remote control
- Second key with remote control

Extra equipment

- Package: Service Line (shelving systems (left and right) - vise - ventilation for transporting gas cylinders - HDF wall cladding - screen-printed wooden floor in the cargo area (the standard lashing eyes are omitted))
- Seats: Seat Package 2 - Partition (load-through flap), without window (Custom Truck Trend) (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Interior armrest for driver - Faux leather (vinyl) - Partition without window)
- Package: Rough road package 2 (underride protection for engine and transmission, sheet steel (thickness: 2.5 mm; weight: 14 kg))
- Package: Visibility Package II (Trend) (Heated windscreen - Electrically folding exterior mirrors - Adjustable instrument lighting - Windscreen wipers with rain sensor - Headlight assistant with day/night sensor)
- Paint finish: Metallic
- Power outlet: 12-volt connection in the cargo area (D-pillar)
- Towing device (fixed, 13-pin socket - incl. trailer stability control (TSC))



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection (laut Wartungshis. 07.2024 durchgeführt) - No evidence - No deduction
2	Interior	Cargo space partition (Regaleinbauten Sortimo) - Differs from the original configuration - No deduction
3	Boot lid / rear door	Trim rear door - plywood - lower - Broken / torn - Replace
4	Interior	Cargo area floor - Scratched - Loss in value
5	Vehicle glazing	Windscreen - Stone chips - Smart repair
6	Body	Partition wall - Dent / paintcoat damage - Loss in value
7	Seat - front	Seat cover - left side - Broken / torn - Replace
8	Seat - front	armrests - Broken / torn - Replace
9	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - Repair and paint
10	Boot lid / rear door	Rear door - left side - Dent / paintcoat damage - Repair and paint
11	Door - front left side	Door - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Fuel system	Tank cap - Scratch(es) - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - No deduction
3	Sill - right side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
3	Bonnet, Professionally carried out, Invoice of repair done Non-existent
4	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
5	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
6	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	320 µm	Mudguard - right side	223 µm
Bonnet	227 µm	Side panel - rear left side	219 µm
Door - rear right side	235 µm	Door - front right side	191 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Für den montierten Radsatz wurde kein Nachweiß erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

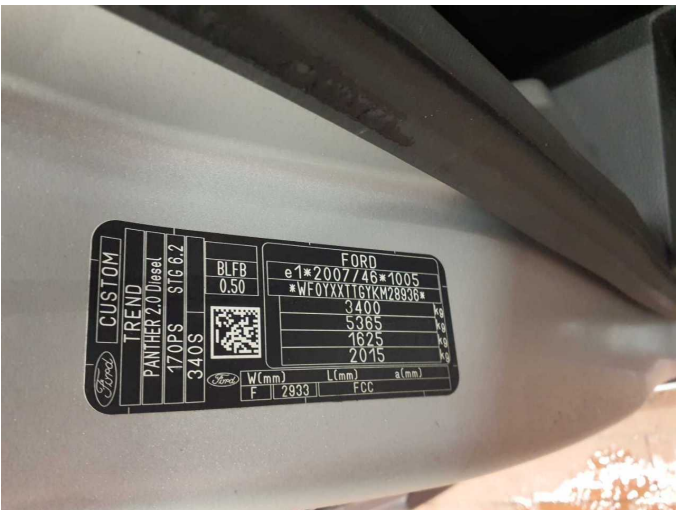


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

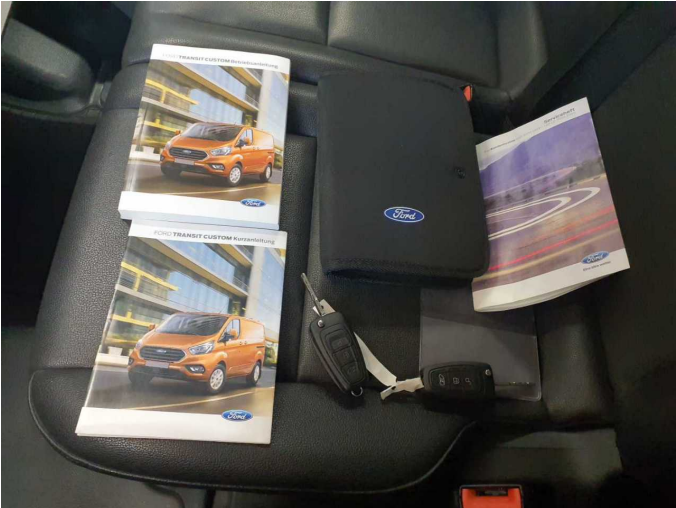


Figure 15: Documents

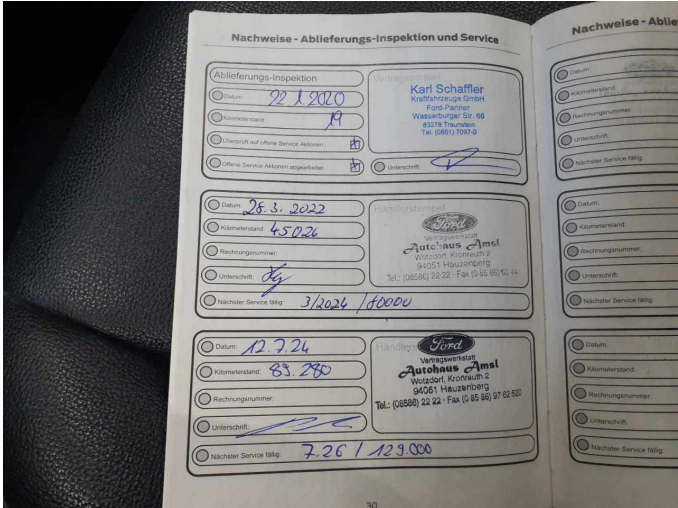


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Misc.: Main inspection (laut Wartungshis. 07.2024 durchgeführt) - No evidence - No deduction




Damage 3: Boot lid / rear door: Trim rear door - plywood - lower - Broken / torn - Replace



Damage 3: Boot lid / rear door: Trim rear door - plywood - lower - Broken / torn - Replace




Damage 4: Interior: Cargo area floor - Scratched - Loss in value

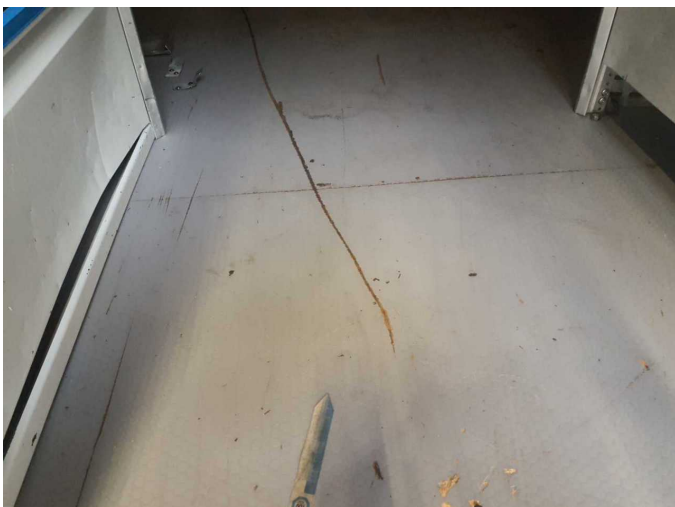

Damage 4: Interior: Cargo area floor - Scratched - Loss in value



Damage 4: Interior: Cargo area floor - Scratched - Loss in value

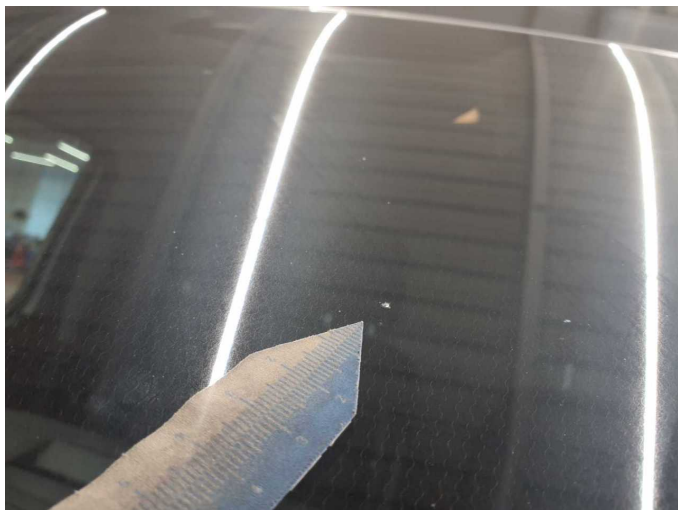

Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 6: Body: Partition wall - Dent / paintcoat damage - Loss in value



Damage 6: Body: Partition wall - Dent / paintcoat damage - Loss in value

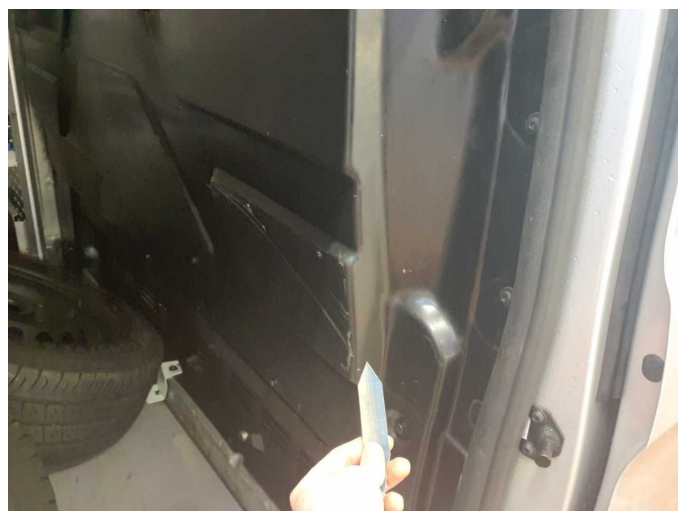

Damage 6: Body: Partition wall - Dent / paintcoat damage - Loss in value




Damage 7: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 7: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 8: Seat - front: armrests - Broken / torn - Replace

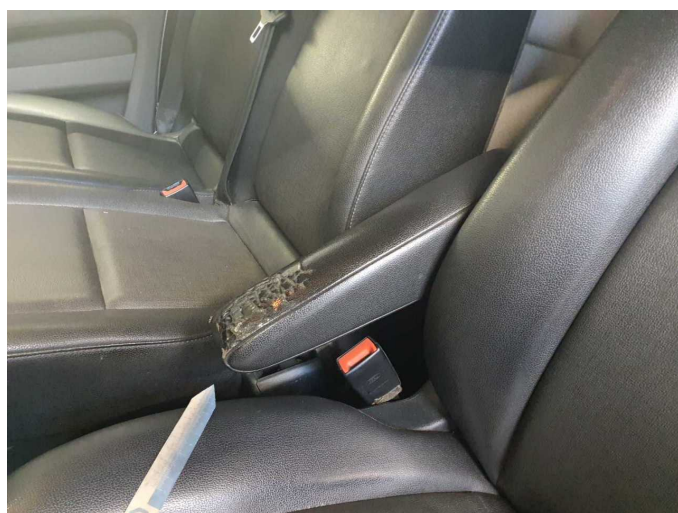


Damage 8: Seat - front: armrests - Broken / torn - Replace




Damage 9: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 9: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint

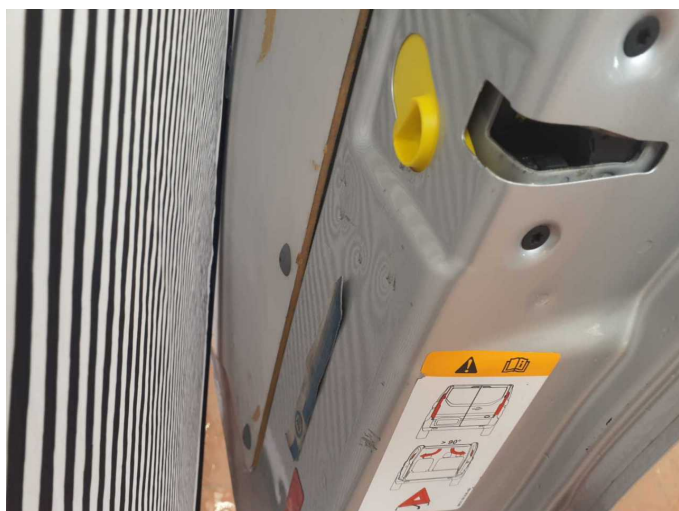

Damage 9: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint

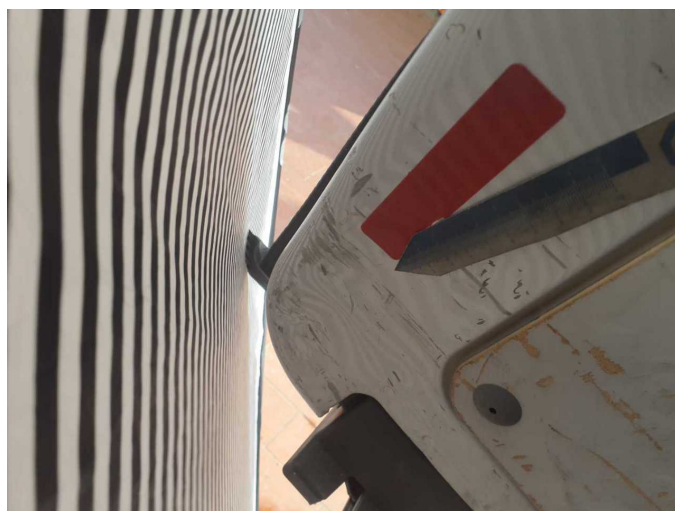

Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 10: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 11: Door - front left side: Door - Scratched - Paint



Damage 11: Door - front left side: Door - Scratched - Paint



Damage 11: Door - front left side: Door - Scratched - Paint



Wear and tear 1: Fuel system: Tank cap - Scratch(es) - No deduction



Wear and tear 2: Wing mirror - right side: Cap - Scratch(es) - No deduction



Wear and tear 3: Sill - right side: Sill - Scratch(es) - No deduction



Repainting 1: Boot lid / rear door



Repainting 2: Mudguard - right side



Repainting 3: Bonnet



Repainting 4: Side panel - rear left side



Repainting 5: Door - rear right side



Repainting 6: Door - front right side