



Expertise

Protocol number: 46811409
Order No. / Reference: 26746485
Inspection date: 30 Jul 2026

Manufacturer: Skoda
VIN: TMBJH7NP4N7041483

Model: Superb Combi 2.0 TDI DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG Ambition	
Vehicle Identification number	TMBJH7NP4N7041483
Mileage (Read)	130,772 km
First registration	16 May 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Moon-Weiß Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,300 km
Last service on / at	03/2026 at 121,032 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ912077
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / APL 01655		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,236 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	235/45 R18 94W	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Traction control (ASR)
- Exterior mirrors and door handles in body color
- Illuminated glove compartment
- Hydraulic brake assist (HBA)
- Decorative inlay silver brushed
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system (cruise control) including speed limiter
- Heated rear window
- ISOFIX preparation on the outer rear seats, including top tether
- Boot cover, roll-up and removable, semi-automatic
- LED low beam
- Steering wheel: height and reach adjustable
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Radio accessories: Wireless SmartLink for Apple CarPlay
- Tire pressure monitoring
- Heated windshield washer nozzles
- Superb seat belts
- Seats: Height-adjustable front seats
- SKODA Care Connect
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- Telephone: Convenient Bluetooth hands-free phone system
- Immobiliser
- Storage compartments
- Airbag, driver and switchable passenger airbag
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Hill start assist
- Grey headliner
- Diesel particulate filter and SCR catalyst
- Tachometer
- Easy Start (start-stop button instead of ignition lock)
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- Rear window wiper including windshield washer system
- Child safety lock for rear doors & windows, electric
- Air Care Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED taillights
- Reading lights at the front and rear of the headliner
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- LED fog lights with integrated cornering lights
- Radio: Bolero infotainment system
- Radio accessories: In-car communication
- Radio accessories: USB ports at the front (Type-C) and USB charging port (Type-A) in the center armrest
- Tire mobility kit
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- 12V socket in the center console, front and rear
- Chrome-plated elements
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Roof rails, anodized
- Luggage net partition
- Paint finish: Pearl effect
- Package: Business Amundsen (DSG) (Amundsen navigation system - voice control - Wi-Fi hotspot - Wireless Smartlink for Apple CarPlay - 8" capacitive touchscreen in glass design - Phonebox - Traveller assistance system (traffic sign recognition, predictive lane keeping assist pACC, adaptive lane keeping assist, emergency and traffic jam assist, capacitive steering wheel with hands-off detection) - 230 V socket and 3 USB ports, tablet holder - Sunset - Infotainment Online (3-year subscription))
- Electric tailgate opening (including boot cover and multifunction storage compartment)
- Steering wheel: Heated steering wheel (2 spokes) (with paddle shifters)
- Front and rear parking sensors
- Wheels: 18" Antares alloy wheels (8J x 18" ET 44 with 235/45 R18 tires)
- Keyless entry/start-stop system
- Seats: Heated front seats
- Auxiliary heater with radio remote control
- Divider grille Skoda Superb Combi

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Mudguard - left side	Mudguard - left side (Schleifspuren) - Unprofessionally repaired - Paint
3	Door - front left side	Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint
4	Front bumper	Front bumper (Lackabplatzer) - Paint defect - Paint
5	Vehicle glazing	Windscreen - Broken / torn - repair according to calculation

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Side panel - rear left side	Side panel - Soiled - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 1 Dec 2023	2.662,77 €
2	Front, Side - left, Provided by user / customer, from 5 Oct 2022	3.459,34 €

Accident damages

No.	Accident
1	Rear



Repainting

No. Repainting

1 Mudguard - left side, Door - front left side, Unprofessionally carried out

Paint coat thickness measurement

Mudguard - left side	146 µm	Door - front left side	153 µm
----------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand.
Schadenausweitung möglich, Zusatzkosten können entstehen.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

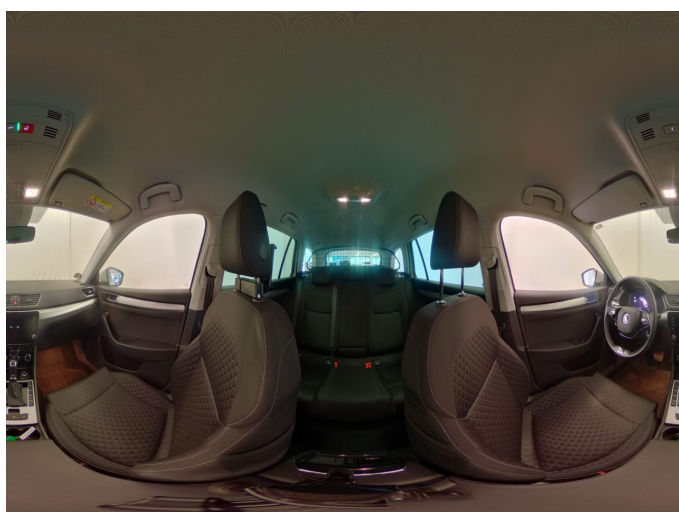


Figure 9: Interior 360° view



Figure 10: Cargo area

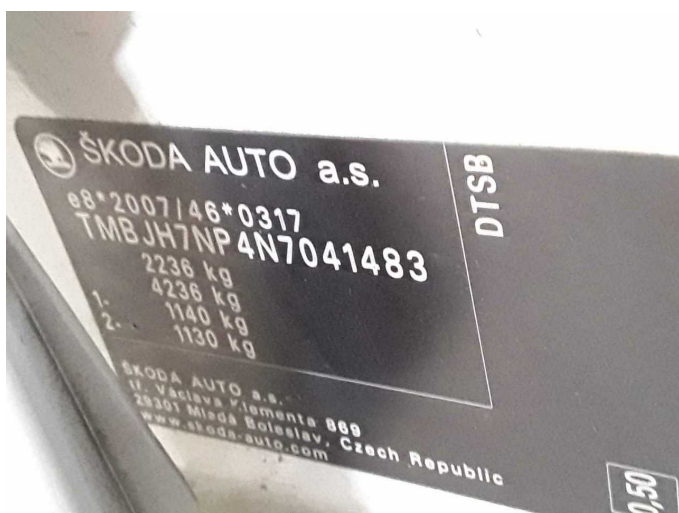


Figure 11: VIN



Figure 12: Mounted tyres

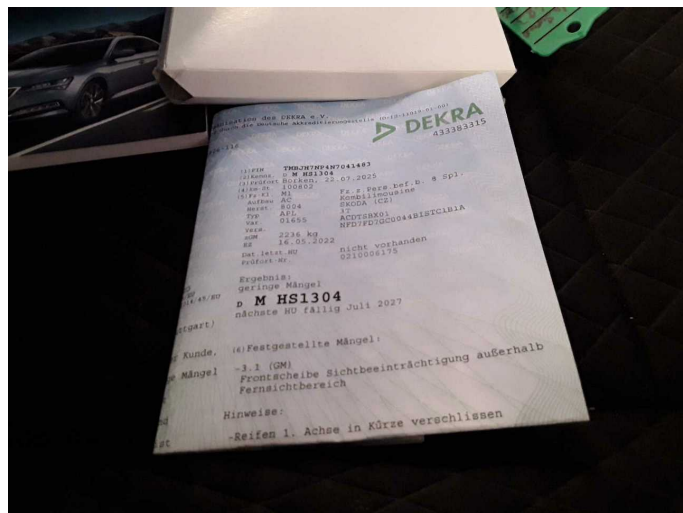


Figure 13: Documents

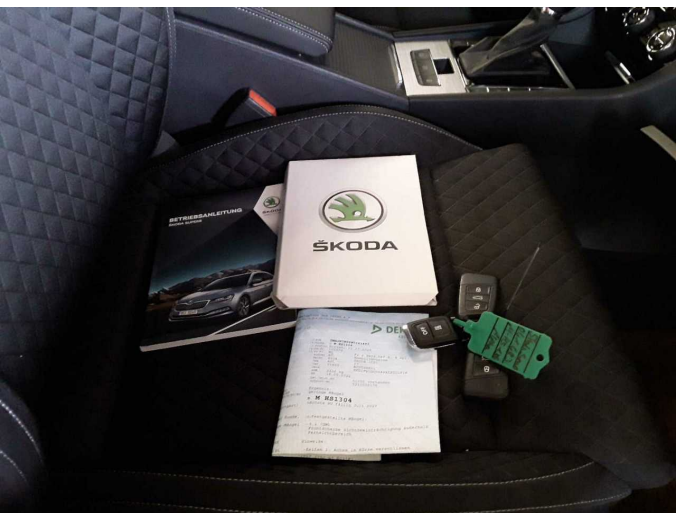


Figure 14: Documents

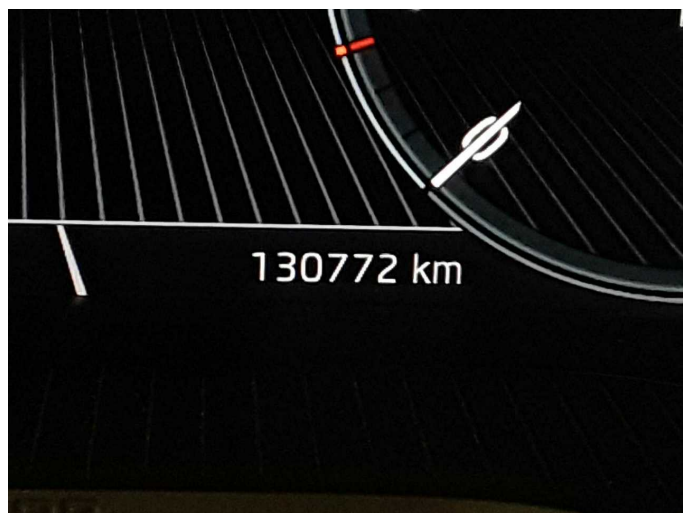


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

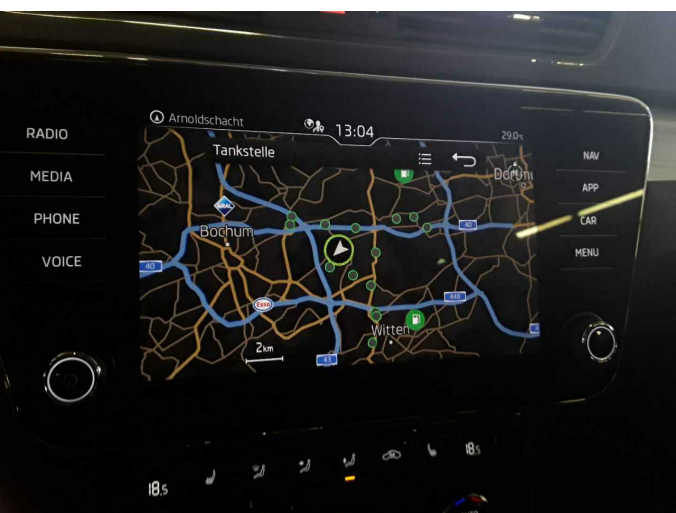


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

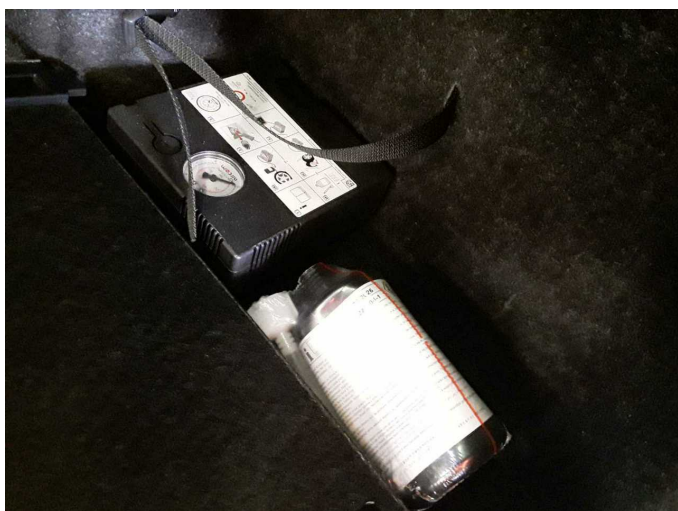


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

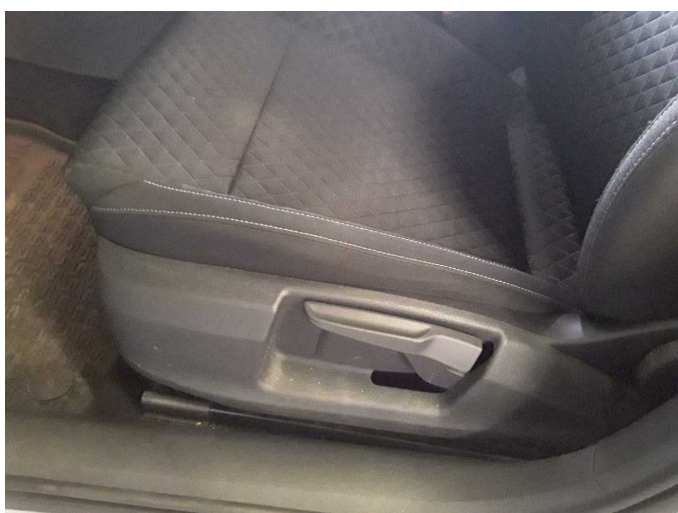


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Mudguard - left side: Mudguard - left side (Schleifspuren) - Unprofessionally repaired - Paint



Damage 2: Mudguard - left side: Mudguard - left side (Schleifspuren) - Unprofessionally repaired - Paint



Damage 2: Mudguard - left side: Mudguard - left side (Schleifspuren) - Unprofessionally repaired - Paint



Damage 2: Mudguard - left side: Mudguard - left side (Schleifspuren) - Unprofessionally repaired - Paint



Damage 2: Mudguard - left side: Mudguard - left side (Schleifspuren) - Unprofessionally repaired - Paint



Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint



Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint



Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint



Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint




Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint



Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint



Damage 3: Door - front left side: Door (Orangenhaut + Silikon Einschlüsse) - Unprofessionally repaired - Paint

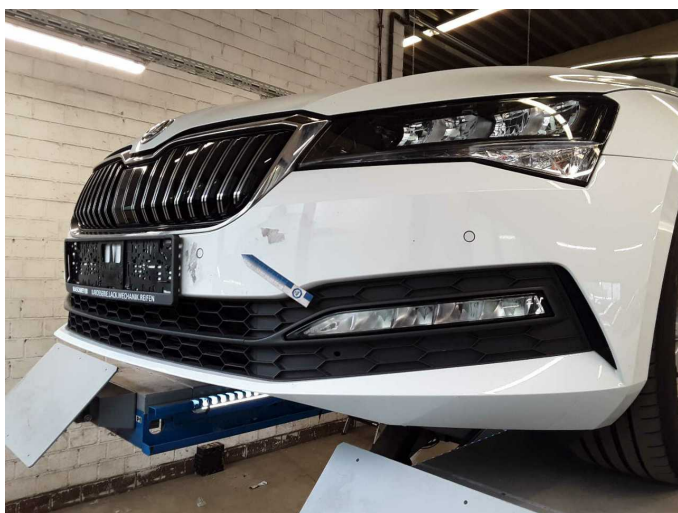

Damage 4: Front bumper: Front bumper (Lackabplatzer) - Paint defect - Paint



Damage 4: Front bumper: Front bumper (Lackabplatzer) - Paint defect - Paint



Damage 4: Front bumper: Front bumper (Lackabplatzer) - Paint defect - Paint



Damage 5: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Damage 5: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Side panel - rear left side: Side panel - Soiled - No deduction



Wear and tear 2: Side panel - rear left side: Side panel - Soiled - No deduction



Accident 1: Rear



Accident 1: Rear



Accident 1: Rear




Accident 1: Rear



Accident 1: Rear



Accident 1: Rear

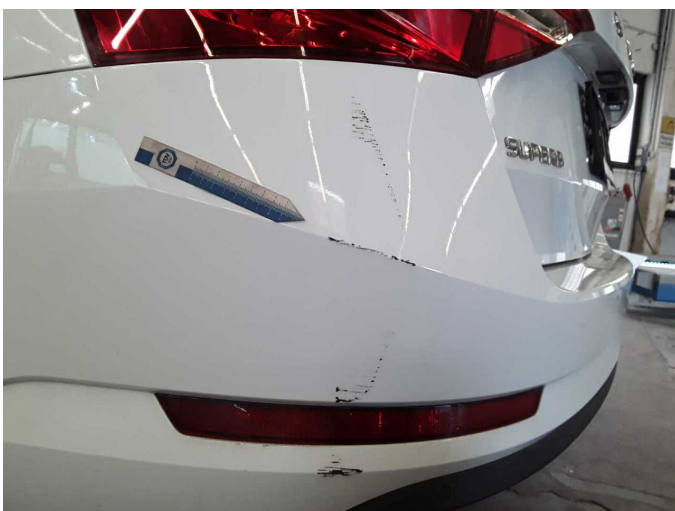

Accident 1: Rear



Repainting 1: Mudguard - left side, Door - front left side



Repainting 1: Mudguard - left side, Door - front left side



Repainting 1: Mudguard - left side, Door - front left side



Repainting 1: Mudguard - left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJH7NP4N7041483
Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG Ambition

Datum	KM-Stand	Beschreibung
03.03.2026	121.032	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/ prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.07.2025	100.809	AU
13.03.2025	92.256	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Systemtest/Eigendiagnose; Wartung Sonstiges
03.04.2024	62.238	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.03.2023	30.943	Bremse Sonstiges; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges