



Expertise

Protocol number: 46886975
Order No. / Reference: 26782825
Inspection date: 4 Aug 2026

Manufacturer: Opel

Model: Astra 1.5 D Start/Stop Sports Tourer Elegance

VIN: W0VBE8EV8N8040466



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra 1.5 D Start/Stop Sports Tourer Elegance	
Vehicle Identification number	W0VBE8EV8N8040466
Mileage (Read)	74,852 km
First registration	5 Apr 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,496 ccm / 3
Power	90 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Argonsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	63 %
Last service on / at	03/2026 at 72,606 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ649398
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / ALM 00227		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,945 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Dunlop	6mm / 6mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	115/70 R16 92M	Summer tyres on Light alloy	Continental	5 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

Standard equipment

- 2 ignition keys
- Airbag for driver and passenger side
- Airbag: Head airbags, 1st and 2nd row (outer seats)
- Ambient lighting, front doors
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Roof rails, silver
- Diesel particulate filter (DPF)
- Electronic Stability Program Plus (ESP Plus)
- Front camera
- Transmission: 6-speed manual transmission
- rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- Rear headrests (3)
- Cargo area cover
- LED daytime running lights
- Steering column, height and reach adjustable
- Sliding center armrest, front
- Pedals: Disengaging safety pedals
- Quickheat rapid heating system
- Radio: Multimedia radio with 7" touchscreen color display
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- 12V power outlet in the center console
- Pre-installation for child seat mounting system "ISOFIX"
- Heat-insulating glazing, green tinted, and windshield
- Storage compartments
- Airbag: Chest-pelvis side airbag for driver and front passenger side
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- third brake light
- Decorative trim strips in piano black
- Tachometer
- Electric windows front and rear
- Speed controller with limiter
- Back window, heater
- Interior lighting, front and rear
- Automatic climate control, two zones
- trunk light
- Front headrests
- LED headlights
- Light alloy wheels 7 J x 16 in a "10-spoke" design
- Lighting equipment
- Electric parking brake
- Upholstery: Fabric/Premium leather look
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire pressure monitoring system
- Power steering
- Luggage compartment safety net
- Start/Stop System
- Traction Control (TC) Plus
- Immobiliser
- Central locking with remote control and interior switches



Extra equipment

- Interior equipment Sports Tourer (rear seat backrest foldable in 40:20:40 ratio - rear center armrest with pass-through from the luggage compartment - FlexFold rear seat backrest)
- Package: Elegance Package (IntelliLux LED Matrix headlights - LED taillights - Multimedia Navi Pro voice control touchscreen color display multimedia radio Apple CarPlay/Android Auto Bluetooth - Solar Protect heat-insulating glazing, heavily tinted, in the rear)
- Phone: Wireless charging including 2 USB ports, rear
- Traffic sign assistant with pedestrian detection, front (detection of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the detected sign in the driver information display (depending on traffic sign quality, visibility and weather conditions), automatic activation between 14 km/h and 200 km/h (during the day) or 150 km/h (at night))
- Connectivity services (emergency call)
- Heated windscreen, ThermoTec
- Ignition keys, two, both foldable
- Paint finish: Metallic
- Park & Go Digital (Automatic parking assistant including parking pilot, front and rear parking aid - blind spot warning in both exterior mirrors - electrically folding exterior mirrors - digital reversing camera with steering guidelines)
- Seats: Ergonomic active seat, driver and front passenger (certified by the Campaign for Healthy Backs (AGR) Driver and front passenger seat: - Length, height and tilt adjustable - Electropneumatic lumbar support adjustable in height and length - Extendable thigh support - Pocket on the back of the front seats, driver and front passenger)
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including rear footwell heating)
- Wheels: Emergency spare wheel, steel 4Jx16

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - Smart repair
2	Boot lid / rear door	Boot lid (Delle auf der Kante) - dent(s) - Smart repair
3	Rear bumper	Rear bumper - Scratch(es) - Paint
4	Front bumper	Front bumper - Stone chips - Paint
5	Door - rear left side	Door - Scratch(es) - Paint
6	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
7	Roof	Roof - Stone chips - Paint

Repainting

No.	Repainting
1	Side panel - rear right side, Door - front right side, Professionally carried out

Paint coat thickness measurement

Side panel - rear right side	1,487 µm	Door - front right side	201 µm
------------------------------	-------------	-------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument cluster



Figure 9: Instrument panel



Figure 10: Interior 360° view



Figure 11: Cargo area

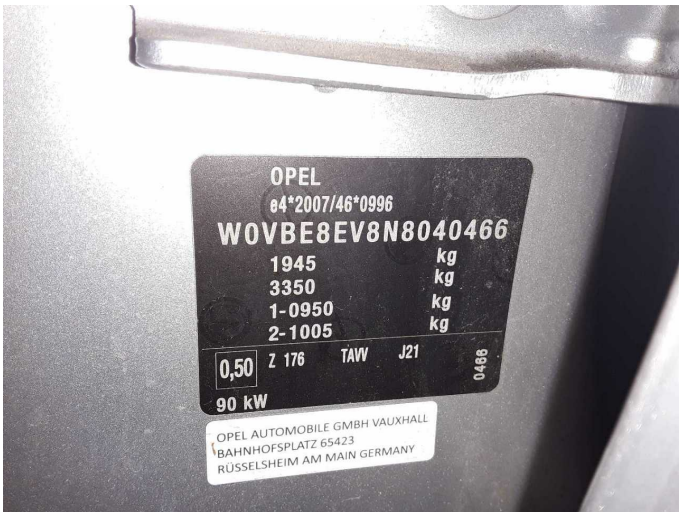


Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Documents

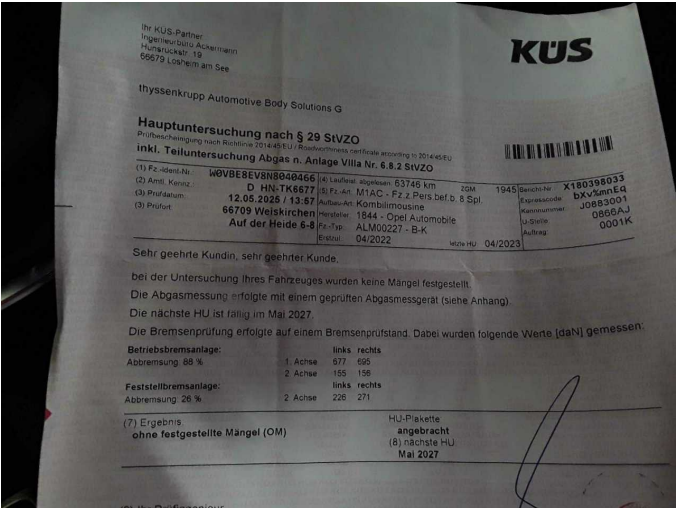


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

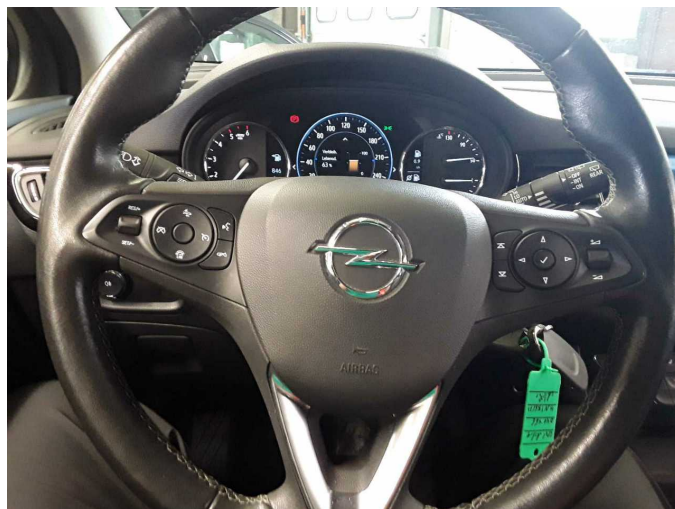


Figure 20: Misc.



Figure 21: Misc.

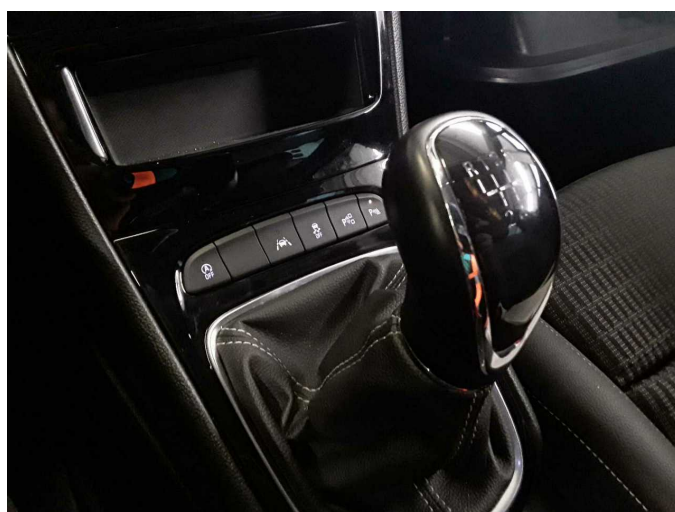


Figure 22: Misc.



Figure 23: Misc.

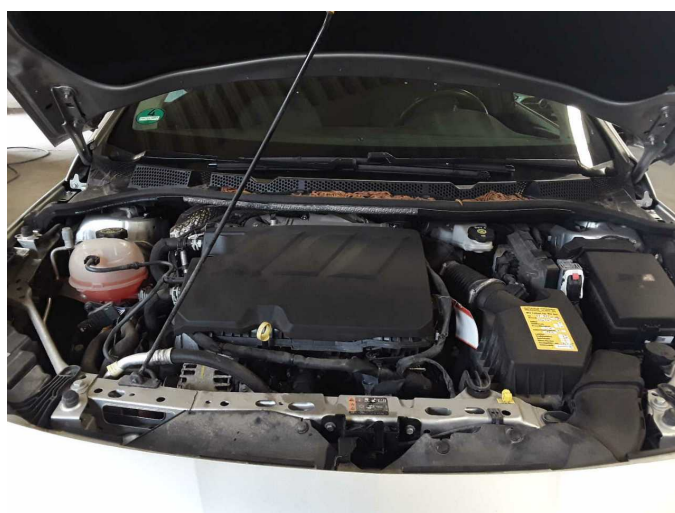


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.




Damage 1: Bonnet: Bonnet - Stone chips - Smart repair



Damage 1: Bonnet: Bonnet - Stone chips - Smart repair

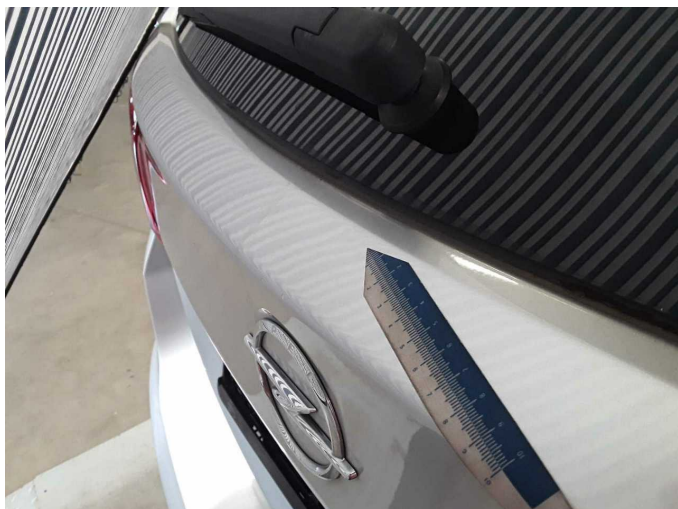

Damage 2: Boot lid / rear door: Boot lid (Delle auf der Kante) - dent(s) - Smart repair

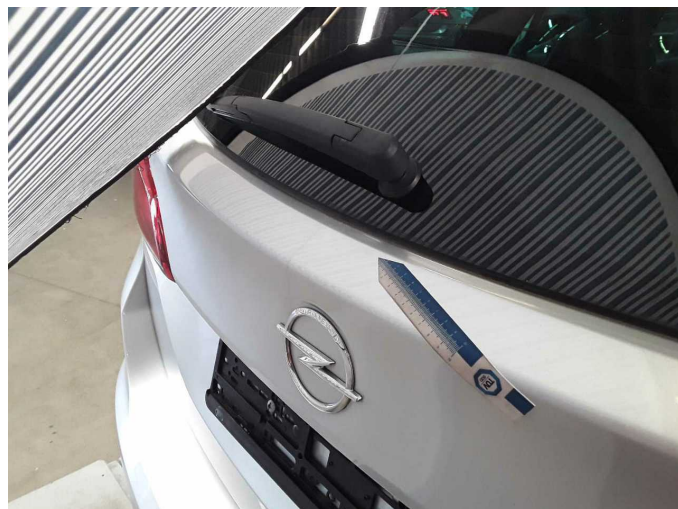


Damage 2: Boot lid / rear door: Boot lid (Delle auf der Kante) - dent(s) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint

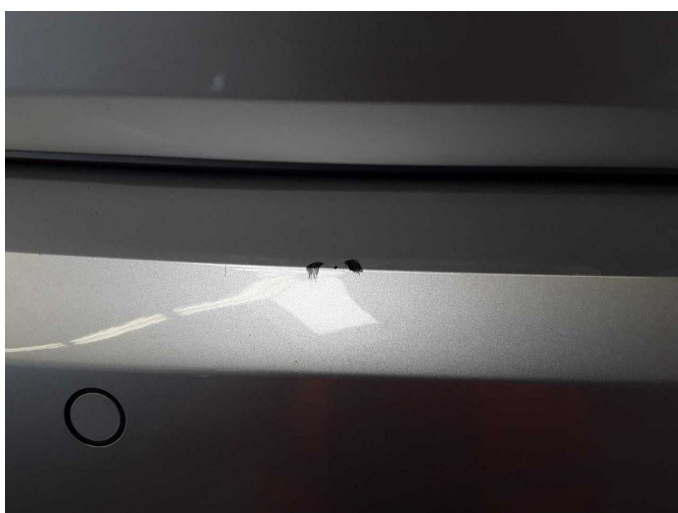

Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 4: Front bumper: Front bumper - Stone chips - Paint

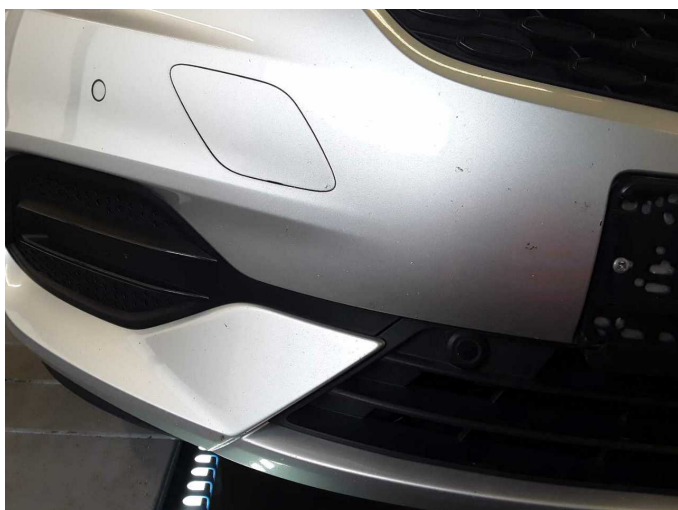

Damage 4: Front bumper: Front bumper - Stone chips - Paint



Damage 5: Door - rear left side: Door - Scratch(es) - Paint




Damage 5: Door - rear left side: Door - Scratch(es) - Paint



Damage 6: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

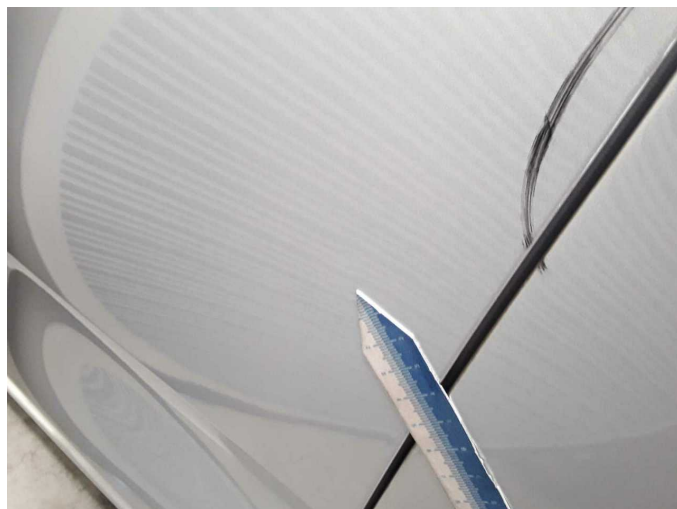

Damage 6: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 7: Roof: Roof - Stone chips - Paint



Damage 7: Roof: Roof - Stone chips - Paint



Damage 7: Roof: Roof - Stone chips - Paint

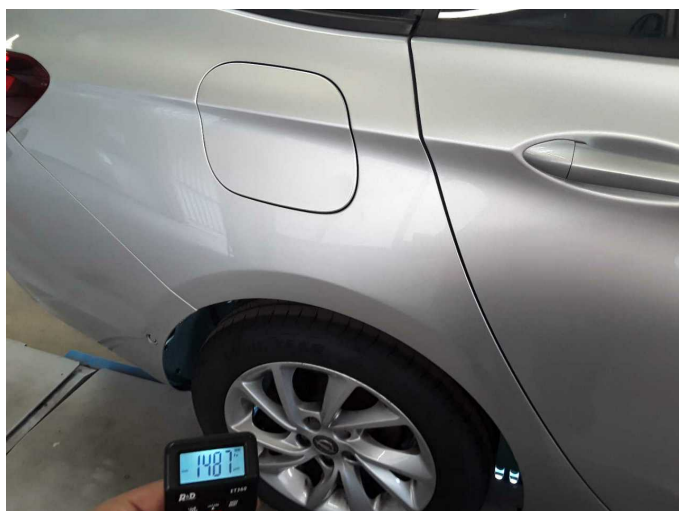

Side panel - rear right side: 1,487 μm



Door - front right side: 201 μm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBE8EV8N8040466

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Elegance

Datum	KM-Stand	Beschreibung
24.03.2026	72.606	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.05.2025	63.746	AU
26.03.2025	62.266	Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
28.03.2023	32.718	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges