



Expertise

Protocol number: 46407830
Order No. / Reference: 26550885
Inspection date: 8 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC 220 d 4Matic 9G-TRONIC Exclusive

VIN: W1N2539151V294648



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC Exclusive	
Vehicle Identification number	W1N2539151V294648
Mileage (Read)	126,871 km
First registration	7 May 2021
Number of holders	1
Next periodical technical inspection	05/2026
(Report on hand)	
Power / Engine displacement	143 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Selenitgrau metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 Tag(e)
Last service on / at	01/2025 at 104,421 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA352977
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AKG 00194		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 104H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/65 R17 104H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103V	Summer tyres on Light alloy	Goodyear	7mm / 7mm
2)	235/60 R18 103V	Summer tyres on Light alloy	Goodyear	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Airbag for driver and front passenger • Airbag: Side airbag for driver and front passenger • Active Brake Assist • Anti-lock braking system (ABS) • Automatic passenger airbag deactivation • On-board computer • Roof rails in polished aluminum • Tachometer • DYNAMIC SELECT • Electronic Stability Program (ESP) • Chassis: AGILITY CONTROL chassis • electric parking brake • Transmission: 9G-TRONIC • rear window wiper • Instrument panel and door sills in ARTICO man-made leather • Remote trunk lid release • Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display • Headrests 5-way • Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather • Mercedes-Benz emergency call system • Package: Storage • Upholstery: ARTICO leatherette/Grenoble fabric • Radio accessories: Digital radio • Tire pressure monitoring system (TPMS) • Windscreen wipers with rain sensor • Seats: Rear seat backrests foldable • Seats: Front seats electrically adjustable • High-visibility vest for drivers • Central locking | <ul style="list-style-type: none"> • Airbag: Kneebag for driver • Airbag: Windowbags • 4MATIC all-wheel drive • ATTENTION ASSIST • Heated exterior mirrors (left and right), electrically adjustable from inside • Diesel particulate filter • Third brake light in LED technology • EASY-Pack cargo cover (removable) • Driving light assistant • Electric windows (4-way) • Velour floor mats in interior color • Rear window heated • Interior headliner fabric crystal grey • KEYLESS-GO start function • Climate: THERMATIC automatic climate control with 2 climate zones • Communication module (LTE) for the use of Mercedes me connect services • LED High Performance Headlights • Steering column mechanically adjustable in height and length • Navigation accessories: Extended MBUX functions • Package: Interior light • Radio: MBUX multimedia system • Radio accessories: Touchpad • Remote Services Plus • Power steering • Seats: i-Size child restraint system on the outer rear seats • Cruise control • Immobiliser • Decorative elements: Linden wood, line structure, glossy brown |
|---|--|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Towbar with ESP trailer stabilization (fully electrically foldable and retractable) • Paint finish: Metallic • Panoramic sunroof • Radio accessories: Burmester surround sound system (with 13 speakers and 590 watts system power. Experience enhanced performance and exclusivity with legendary Burmester sound. The high-performance speakers create a first-class surround sound experience. This can be specifically optimized for the front and rear seats, intensifying the listening experience. A quality that is also visible thanks to the high-quality Burmester logos.) • Partition net for luggage compartment separation (and occupant protection) • Running boards in aluminum look with rubber studs | <ul style="list-style-type: none"> • EASY-Pack tailgate with electric operation for opening and closing • Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity) • Wheels: 45.7 cm (18") alloy wheels, 4-spoke design (tremolite grey painted and polished with 235/60 R18 tires, 8 J x 18 ET 38) • Decorative elements: open-pored black ash wood |
|---|--|



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - Expired - Perform
2	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
3	Misc.	Inspection / maintenance - Expired - Perform
4	Front bumper	Front bumper - Scratched - Paint
5	Side panel - rear right side	Side panel - dent(s) - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No. Accident

- 1 Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

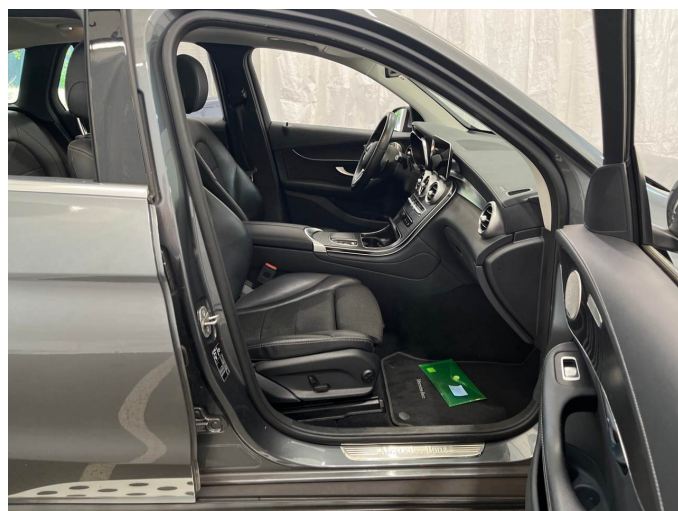


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

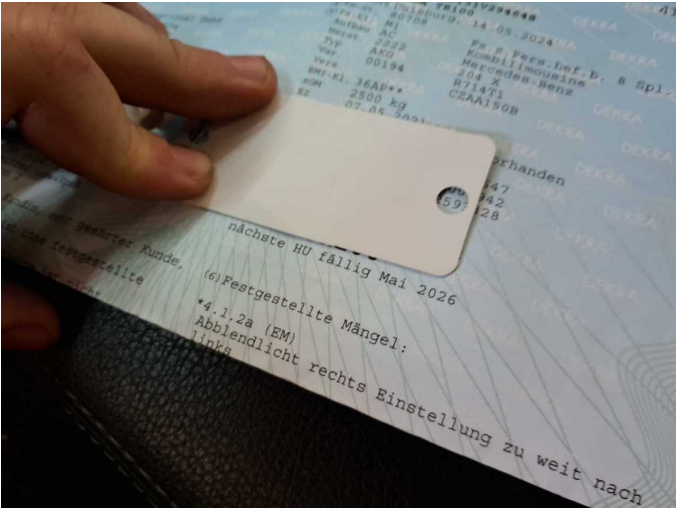


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

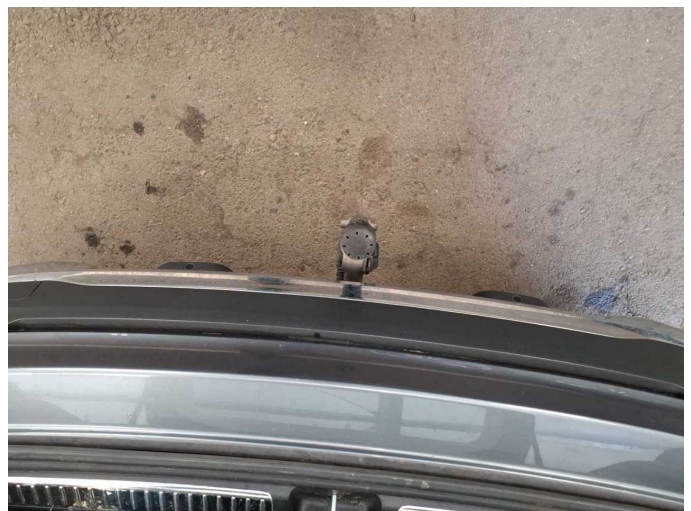


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

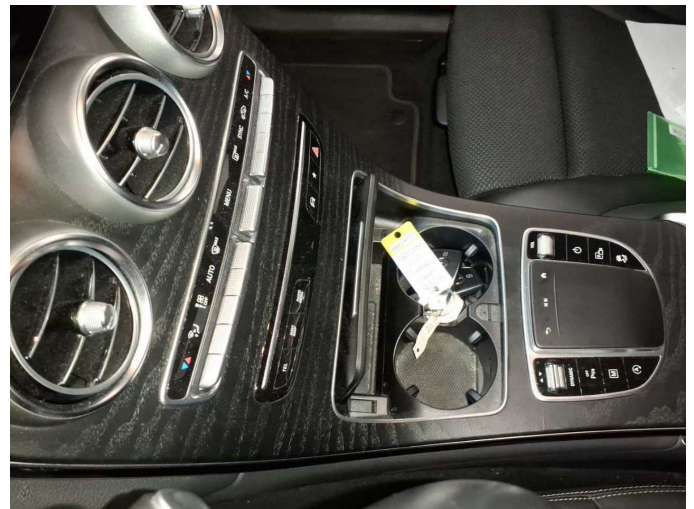


Figure 30: Misc.

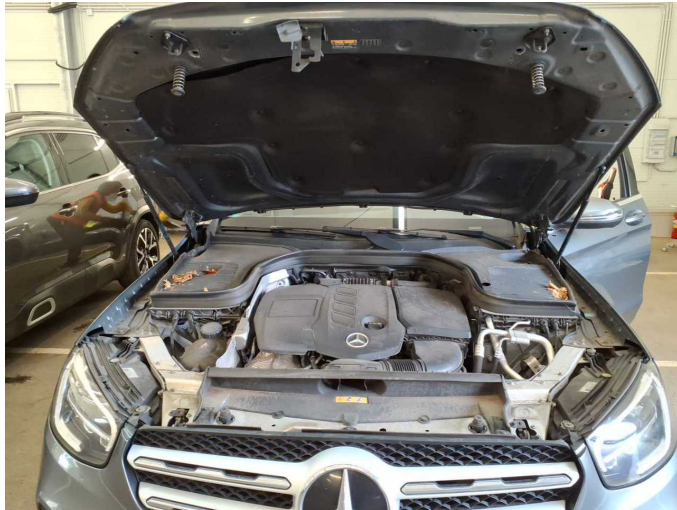


Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

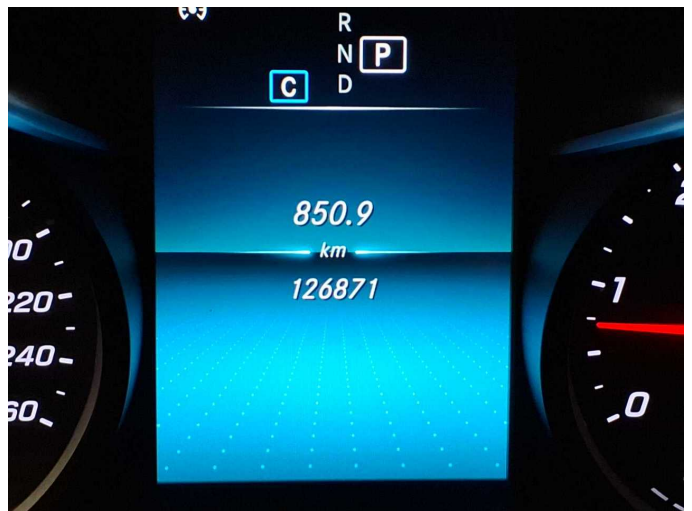


Figure 36: Misc.



Damage 1: Misc.: Main inspection - Expired - Perform



Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 3: Misc.: Inspection / maintenance - Expired - Perform



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint




Damage 4: Front bumper: Front bumper - Scratched - Paint




Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 5: Side panel - rear right side: Side panel - dent(s) - Repair and paint

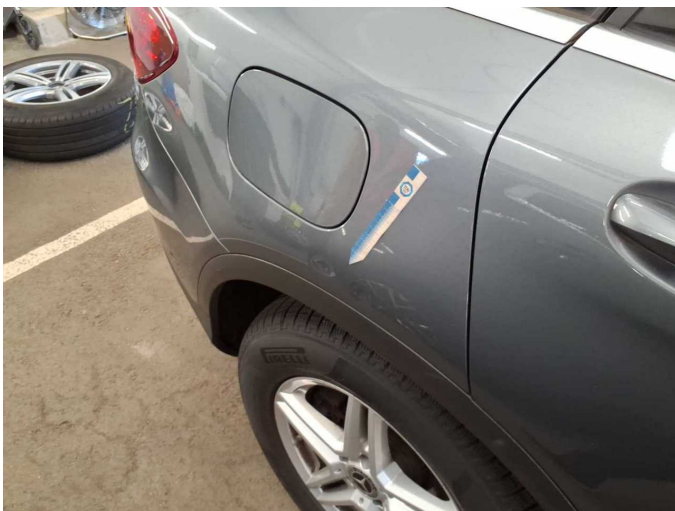

Damage 5: Side panel - rear right side: Side panel - dent(s) - Repair and paint

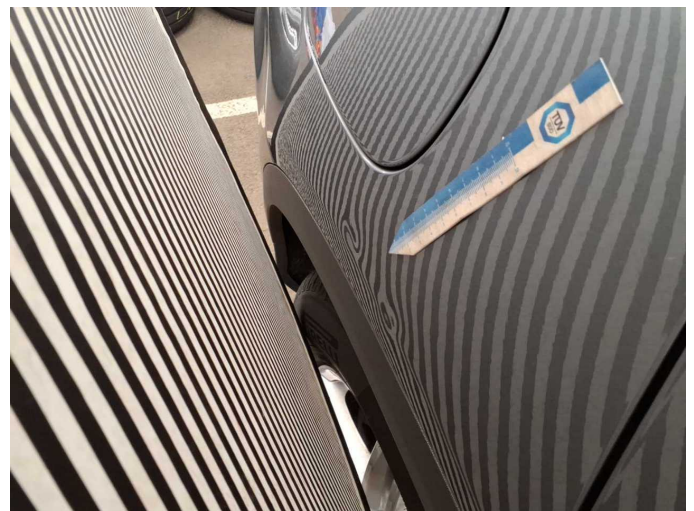

Damage 5: Side panel - rear right side: Side panel - dent(s) - Repair and paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 4: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 4: Rear bumper: Rear bumper - Scratch(es) - No deduction

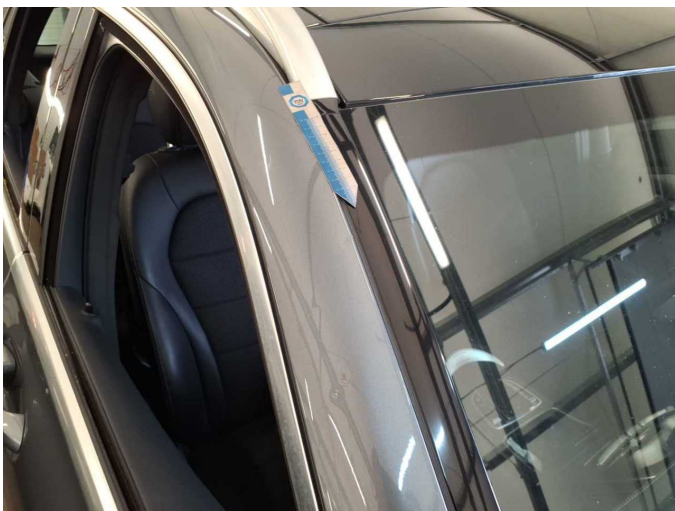

Accident 1: Side right




Accident 1: Side right




Accident 1: Side right




Accident 1: Side right

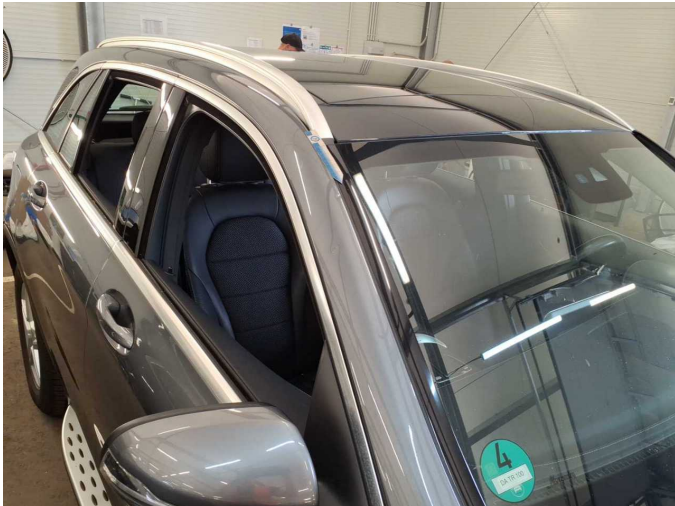

Accident 1: Side right

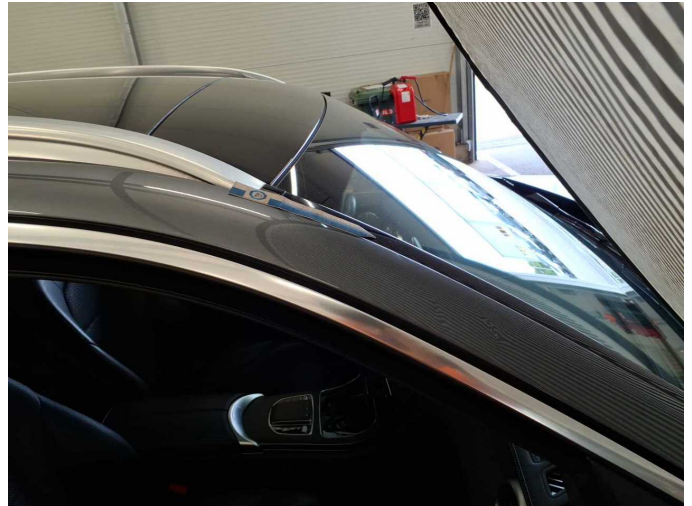

Accident 1: Side right

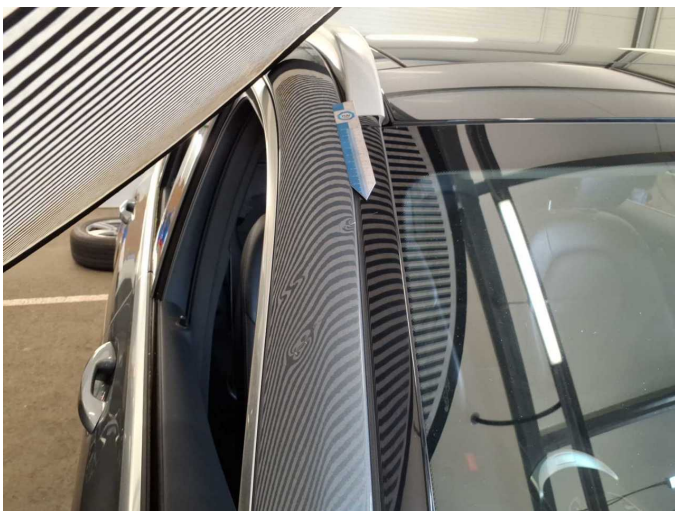

Accident 1: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539151V294648

Hersteller / Modell: MERCEDES-BENZ MB GLC 220 d 4Matic 9G-TRONIC Exclusive

Datum	KM-Stand	Beschreibung
28.01.2025	104.421	Bremsinspektion vo + hi; Regelwartungsdienst
14.05.2024	80.708	HU + AU
14.03.2024	78.879	Regelwartungsdienst
22.03.2023	51.369	Bremsklötze hinten; Regelwartungsdienst