



Expertise

Protocol number: 46703917
Order No. / Reference: 26746743
Inspection date: 24 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 2.0 Diesel Aut. Business Elegance
VIN: W0VZT8GP3M1025237	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business Elegance	
Vehicle Identification number	W0VZT8GP3M1025237
Mileage (Read)	114,833 km
First registration	1 Sept 2021
Number of holders	1
Next periodical technical inspection	09/2026
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Summit White S
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	11 %
Last service on / at	11/2025 at 102,539 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA248644
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMC 00186		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	245/45 R18 100Y	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag: Front and rear outer head airbags
- Ambient lighting
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- Roof rails, silver anodized
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Speed controller
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces)
- LED headlights
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Package: Easy-Access (Keyless locking and starting system (Keyless Open & Start) - Sensor-controlled tailgate, electric - Loading sill protection, stainless steel)
- Package: Innovations 1 (IntelliLux LED Pixel Light - Adaptive LED Matrix Headlights: City Light, Highway Light, Country Road Light, Static Cornering Light, Turning Light, Parking Light, High Beam: Traffic-Dependent Dimming Taking into Account of Oncoming and Ahead Vehicles, Automatic Headlight Range Control - Traffic Sign Assist)
- Radio: Multimedia Navi Pro with 8" color touchscreen display (Multimedia radio, voice control for audio, telephone and navigation, navigation system with SD card storage, road map for over 30 European countries, map display in 2D and 3D, dynamic route guidance via map and/or arrow display and voice prompts, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, 2 USB ports, steering wheel controls, Apple CarPlay and Android Auto)
- Lane Keeping Assist
- Start/Stop System
- Bumpers painted in body color
- Traction Control (TC) Plus
- Pre-installation for child seat mounting system "ISOFIX"
- Immobiliser
- Central locking with remote control
- Airbag: Front airbags (multi-stage) and side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Hill Start Assist
- third brake light
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Pedestrian protection including active hood
- luggage compartment cover
- Transmission: 8-speed automatic transmission
- Child safety lock in the rear doors, manual
- Front headrests
- Paintwork: Solid special color Snow White
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Charging (Sports Tourer) (Wireless Charging (wireless charging of smartphones in the center console) - 2 USB ports, rear center console (charging function) - 12V socket, in the trunk)
- Park & Go with reversing camera, digital
- Electric parking brake
- Parkpilot, front and rear parking aid
- Upholstery: Monita fabric/Premium leather look
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Radio accessories: 2 USB ports (rear center console)
- Tire repair kit
- Tire pressure gauge
- Rear seat backrest with FlexFold function, foldable in a 40:20:40 ratio
- Power steering
- Seat belts: Three-point seat belts in all seats
- safety net
- Visibility equipment
- Seats: Ergonomic active seat (AGR) for driver and front passenger (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - headrest, height and tilt adjustable)
- Thermal insulation glazing, green tinted
- Second folding ignition key



Extra equipment

- Airbag: Side airbags, rear outer
- Package: Innovations 2 (Sports Tourer automatic transmission)
- Package: Winter 2 (Heated seats, multi-stage, driver and front passenger; Heated leather steering wheel; Seat Comfort Equipment 1 (Driver's seat 8-way electrically adjustable: length, height, backrest and seat tilt; Electropneumatic lumbar support; Height and tilt adjustable headrest; Pocket on front seat back; Memory function for driver's seat and exterior mirrors; Electropneumatic adjustment of driver's side bolsters; Massage function for driver; Exterior mirrors with ambient lighting, electrically adjustable, heated and folding); Heated ThermoTec windscreen)
- Panoramic glass sliding/tilting roof, electric (with pre-selection function and spoiler position for the front part, including anti-pinch protection, comfort closing function via radio remote control of the central locking system, electrically operated sunshade, and pre-installation for safety net attachment in the 1st row)
- Wheels: 8.5 J x 18 alloy wheels in high-gloss black (multi-spoke) (with 245/45 R 18 tires)
- Brushed Ice decorative trim
- Package: Winter 1 (AGR, driver and front passenger) (Seat heating, multi-stage, driver and front passenger - Heated leather steering wheel - Ergonomic active seat (AGR), driver and front passenger (length, height and backrest angle manually adjustable, seat angle electrically adjustable, lumbar support electropneumatically adjustable in height and length, extendable thigh support manually, headrest height and angle adjustable))
- Package: Winter 3 (Sports Tourer) (Heated seats, multi-stage, front/rear; Heated leather steering wheel; Seat Comfort Equipment 1 (Driver's seat 8-way electrically adjustable: length, height, backrest and seat tilt; Electropneumatic lumbar support; Height and tilt adjustable headrest; Pocket on front seat back; Memory function for driver's seat and exterior mirrors; Electropneumatic adjustment of driver's side bolsters; Driver's massage function; Exterior mirrors with ambient lighting, electrically adjustable, heated and folding); Heated ThermoTec windscreen; Charging Package)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Engine	Engine (Kostenausweitung möglich) - Leaking - Perform diagnosis
3	Body	Body - Scratched - Conditioning
4	Interior	Interior - Odour - Ozone treatment
5	Wheel / tyres	Alloy rim - rear right side - Scratched - Smart repair
6	Vehicle glazing	Rear window - Scratched - Loss in value
7	Roof	Sun roof / glass - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Professionally repaired, from 8 May 2026	621,60 €
2	Front, Professionally repaired, from 8 May 2026	1.732,38 €
3	Side - left, Side right, Provided by user / customer, from 9 Feb 2026	5.193,51 €

Repainting

No. Repainting

- 1 Door - rear left side, Door - rear right side, Door - front right side

Paint coat thickness measurement

Door - rear left side	206 µm	Door - rear right side	327 µm
Door - front right side	196 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

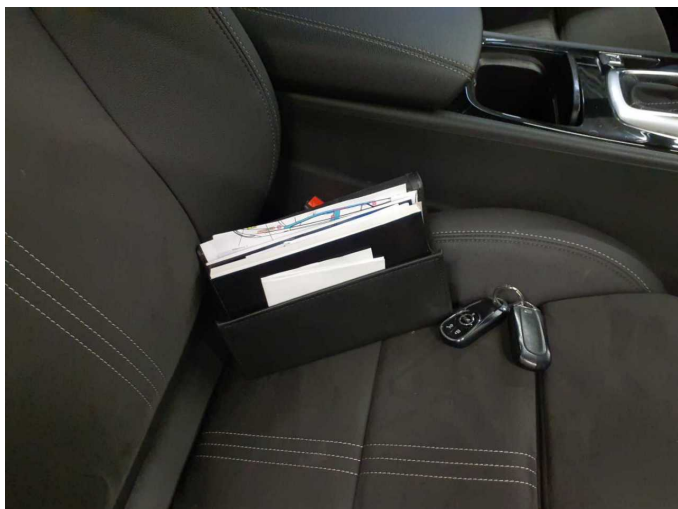


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

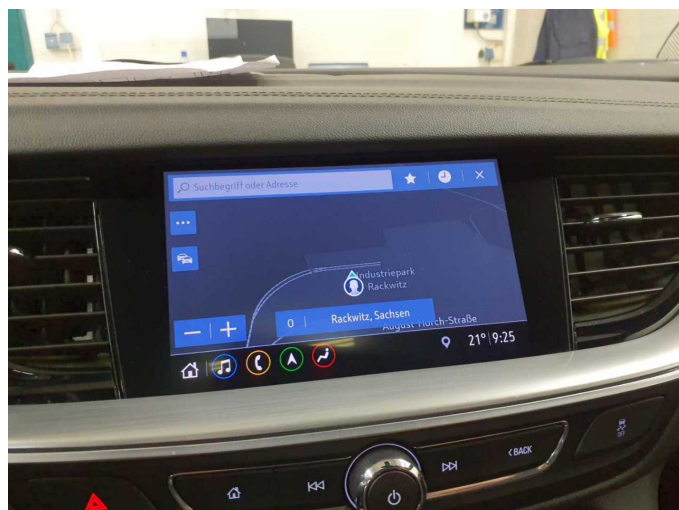


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Damage 2: Engine: Engine (Kostenausweitung möglich) - Leaking - Perform diagnosis

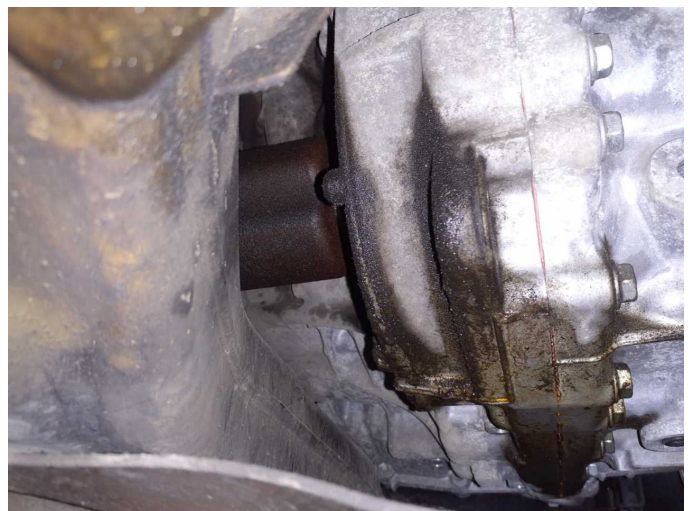

Damage 2: Engine: Engine (Kostenausweitung möglich) - Leaking - Perform diagnosis



Damage 2: Engine: Engine (Kostenausweitung möglich) - Leaking - Perform diagnosis



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning




Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning

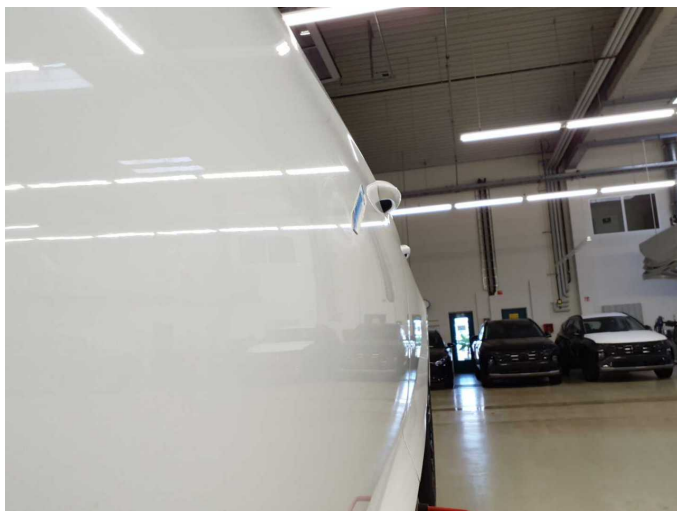

Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 3: Body: Body - Scratched - Conditioning



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Smart repair




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Smart repair




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratched - Smart repair




Damage 6: Vehicle glazing: Rear window - Scratched - Loss in value

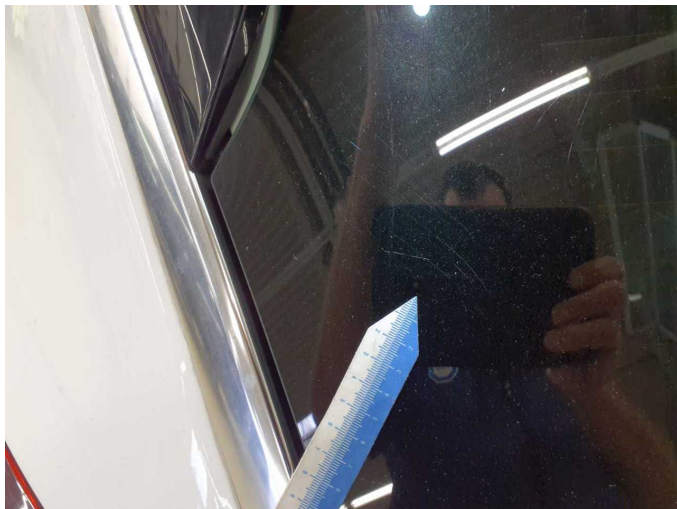


Damage 6: Vehicle glazing: Rear window - Scratched - Loss in value

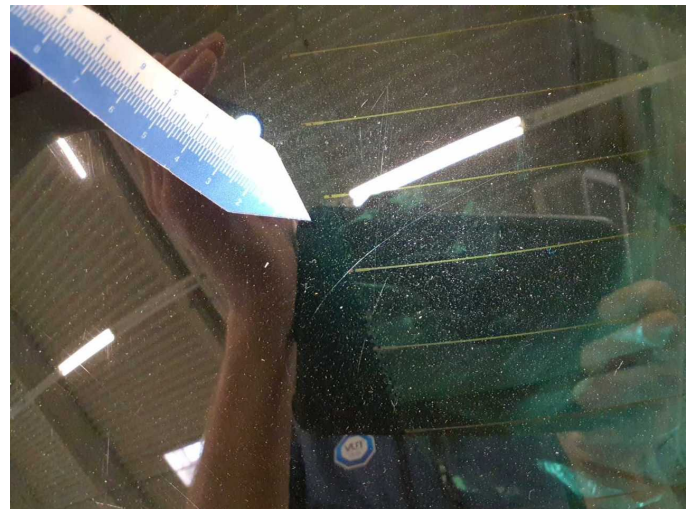

Damage 6: Vehicle glazing: Rear window - Scratched - Loss in value

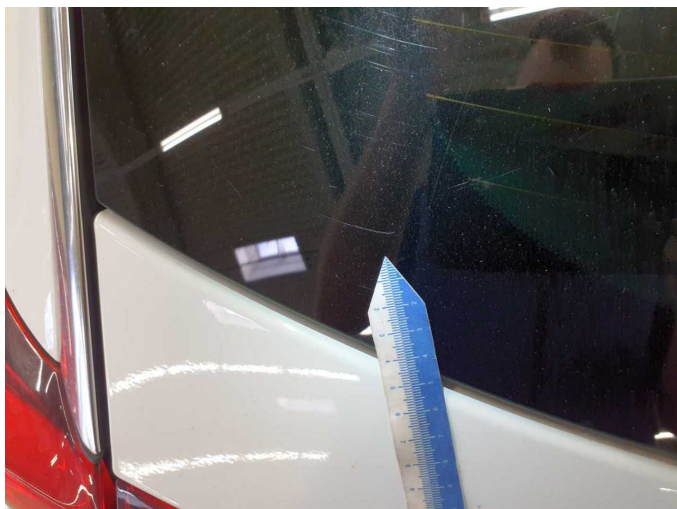

Damage 6: Vehicle glazing: Rear window - Scratched - Loss in value

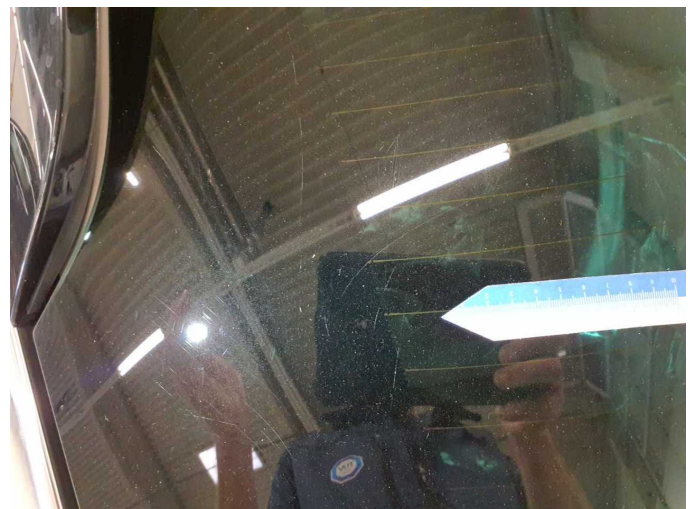

Damage 6: Vehicle glazing: Rear window - Scratched - Loss in value



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Damage 7: Roof: Sun roof / glass - Scratched - Replace



Wear and tear 1: Wing mirror - right side: Cap - Scratched - No deduction



Wear and tear 1: Wing mirror - right side: Cap - Scratched - No deduction



Door - rear left side: 206 µm



Door - rear right side: 327 µm



Door - front right side: 196 µm