



Expertise

Protocol number: 46741248
Order No. / Reference: 26639293
Inspection date: 24 Jul 2026

Manufacturer: Ford

Model: Transit Connect 230 L2 Trend

VIN: WF0SXXWPGSMA40935



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Connect 230 L2 Trend	
Vehicle Identification number	WF0SXXWPGSMA40935
Mileage (Read)	93,735 km
First registration	25 Oct 2021
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	73 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Obsidian Schwarz Metallic
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	89 %
Last service on / at	05/2026 at 91,123 km		
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD561800
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BUU 00563		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R16 97H	Winter tyres on Light alloy	Pirelli	7mm / 7mm
2)	215/55 R16 97H	Winter tyres on Light alloy	Pirelli	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	3mm / 3mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment with 12-volt connection (under the narrow part of the double passenger seat)
- Exterior mirrors, electrically adjustable and heated
- Exterior mirror housing black
- Hill start assist
- On-board computer including outside temperature display
- Double-leaf rear doors without windows
- Tachometer
- Electronic Stability Program (ESP) (with Traction Control (TCS) including Torque Vectoring Control and Adaptive Load Control)
- FordPass Connect (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - incl. live traffic information in real time (in conjunction with Ford navigation system incl. Ford SYNC 3) - incl. Wi-Fi hotspot)
- Transmission: 6-speed transmission
- Front interior lighting with delay function
- Paint finish: Solid
- Cargo area floor protection plastic, molded
- Steering column, adjustable in height and reach
- Center console, front (open with storage area, 2 cup holders)
- Radio: Ford Audio System 2 (DAB/DAB+ radio - FM/AM radio - USB port - Bluetooth interface - Steering wheel audio remote control)
- Sliding door at rear, right
- Side protection strips, plastic
- Emergency Brake Assist (EBA)
- Front seat belts are height-adjustable (front seat belt tensioners and force limiters - warning system for unfastened driver's seat belt)
- Seats: Seat package 4 (driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - single passenger seat, 2-way manually adjustable (forward/backward/backrest) - headrests, height-adjustable - lumbar support, manual (driver's seat) - "Capitol/City" fabric in Ebony (black))
- Daytime running light
- Child safety lock on sliding doors
- Lashing eyes
- Electronic immobilizer (EPATS)
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front
- ABS with EBD
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Battery, reinforced
- Rubberized flooring, front
- Diesel particulate filter (DPF) (with SCR catalyst and AdBlue tank)
- Third brake light
- Front electric windows (with one-touch down function for driver's side)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Heated windscreen (including electrically adjustable and heated exterior mirrors)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Glove compartment with lid
- Front air conditioning including semi-electronic recirculation system
- Cargo area lining, side, half-height
- Alternator/Generator
- Fog light
- Emergency brake light (hazard warning flashing activated during heavy braking)
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Automatic security door lock (45 sec.) (Automatic relocking if no door is opened within 45 seconds of unlocking via remote control)
- Front spoiler lip
- Start-stop system
- Dust and pollen filter
- Power outlet: 12-volt connection on the front center console
- Front bumper and rear bumper end caps painted in body color
- Partition wall to the cargo area without window
- Door handles, black
- Seatbelt warning system (Seatbelt warning system in all other seats)
- Central locking with remote control (door lock only on driver's door - 2 keys, one of which is a remote control key)



Extra equipment

- 3. KEY PROGRAMMED WITH FB
- Cruise control system (with adjustable speed limiter including multifunction leather steering wheel with 4 spokes in aluminium decor)
- Tire pressure monitoring system
- Seats: Seat package 30 (fabric "Capitol/City" in Ebony (black) - double passenger seat, variably foldable and collapsible (with storage compartment under smaller seat section) - driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - headrests, height-adjustable - seat heating for driver's seat - lumbar support, manual (driver's seat))
- Power outlet: 12-volt connection in the charging/luggage compartment
- Exterior mirrors with large mirror format
- Paint finish: Metallic
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- SORTIMO INSTALLATION
- Partition wall to the cargo area with pass-through opening, no window

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Sliding door, right	Door handle - inside (Verkleidung; Mehrkosten möglich) - Loose - Diagnosed and repair if necessary
3	Boot lid / rear door	Rear door - left side (Innen Kratzer Gebrauchspur) - dent(s) - Smooth repair work
4	Body	B-pillar - left side - Scratch(es) - Smart repair
5	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
6	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
7	Door - front right side	Door (an Kante) - dent(s) - Smart repair
8	Sliding door, right	Sliding door (Beulen) - dent(s) - Smooth repair work
9	Equipment	Vehicle key with remote control (Schlüsselbart lose) - Broken / torn - Replace
10	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - Paint
11	Bonnet	Bonnet (+ Steinschläge) - dent(s) - Paint
12	Front bumper	Front bumper - Scratched - Paint
13	Side panel - rear left side	Side panel (+ Korrosion) - Deformed - Repair and paint
14	Roof	Roof - Dent / paintcoat damage - Paint



Wear and tear

No.	Component group	Description
1	2nd wheel set	2 wheel covers - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Engine - Engine cover

Equipment - Vehicle key with remote control (3. Schlüssel)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Professionally repaired, Invoice of repair done Non-existent, from 14 Dec 2021	947,00 €

Repainting

No. Repainting

- 1 Roof, Professionally carried out, Invoice of repair done Non-existent
- 2 Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	202 µm	Door - front right side	178 µm
-----------------------	--------	-------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

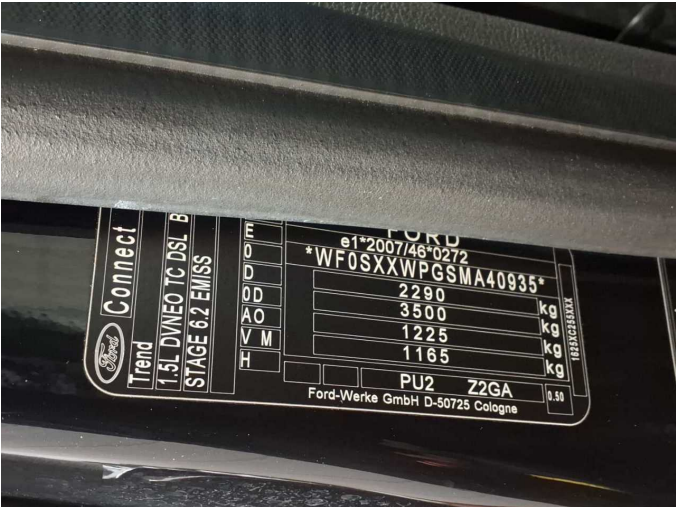


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

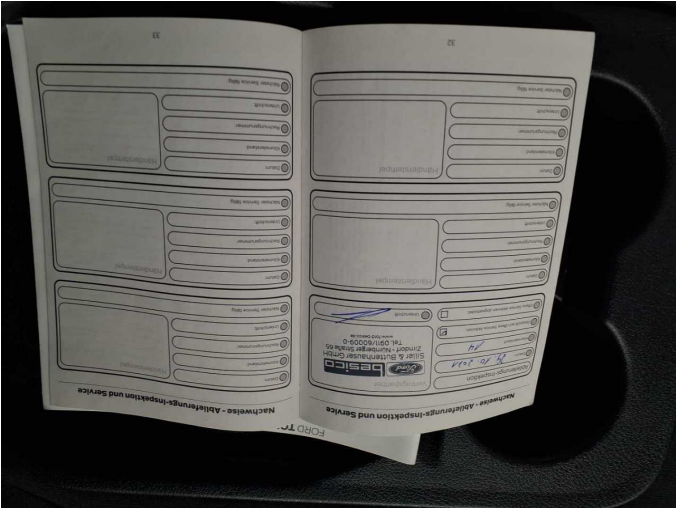


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

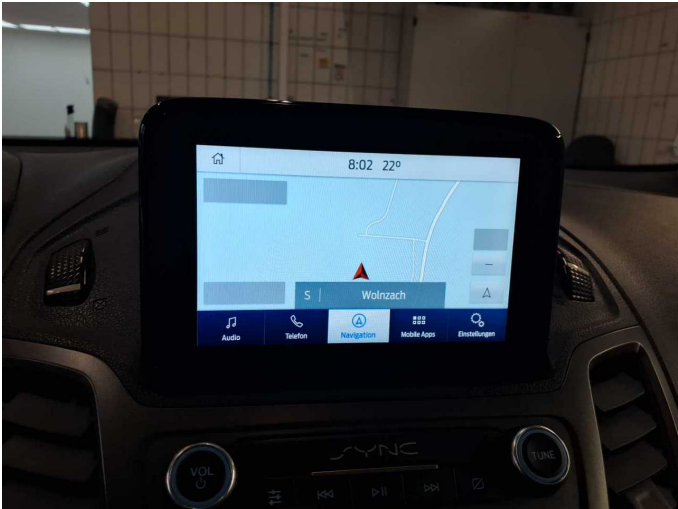


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

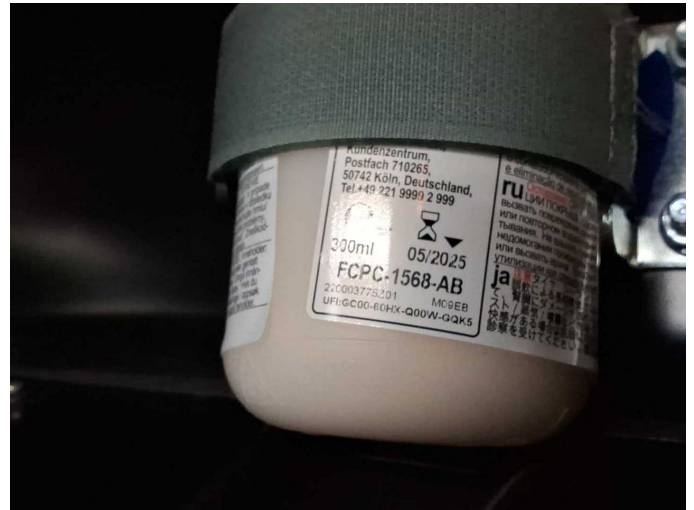

Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Sliding door, right: Door handle - inside (Verkleidung; Mehrkosten möglich) - Loose - Diagnosed and repair if necessary




Damage 2: Sliding door, right: Door handle - inside (Verkleidung; Mehrkosten möglich) - Loose - Diagnosed and repair if necessary




Damage 3: Boot lid / rear door: Rear door - left side (Innen Kratzer Gebrauchspur) - dent(s) - Smooth repair work

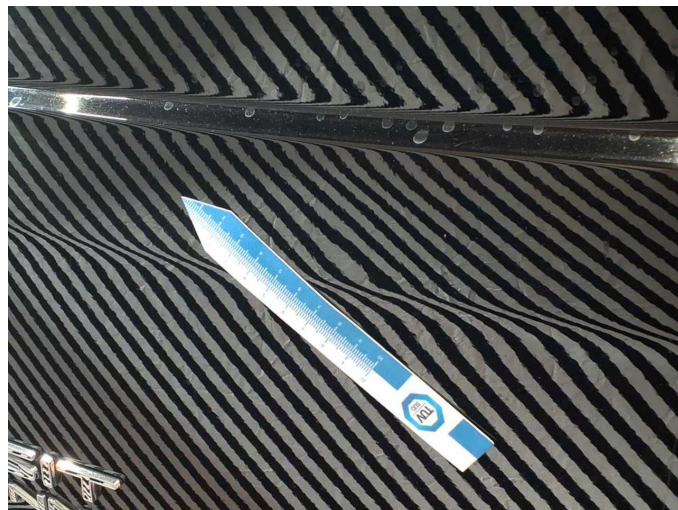


Damage 3: Boot lid / rear door: Rear door - left side (Innen Kratzer Gebrauchspur) - dent(s) - Smooth repair work

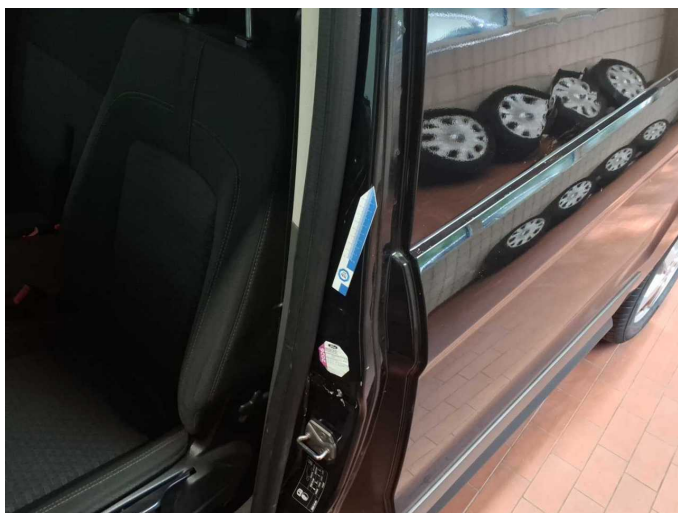

Damage 4: Body: B-pillar - left side - Scratch(es) - Smart repair

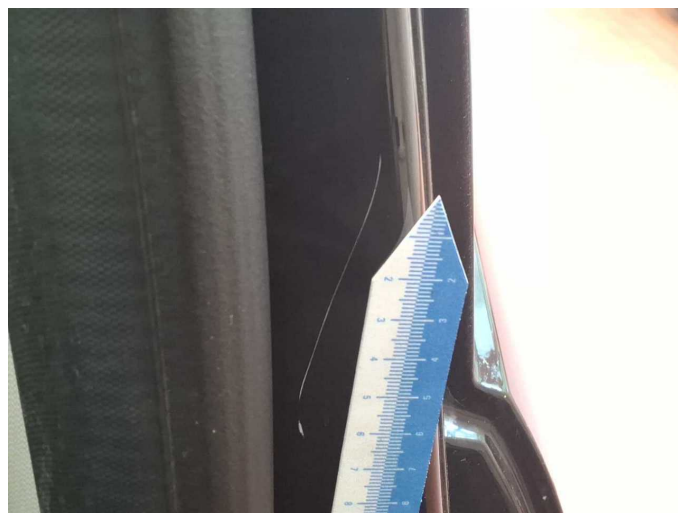

Damage 4: Body: B-pillar - left side - Scratch(es) - Smart repair

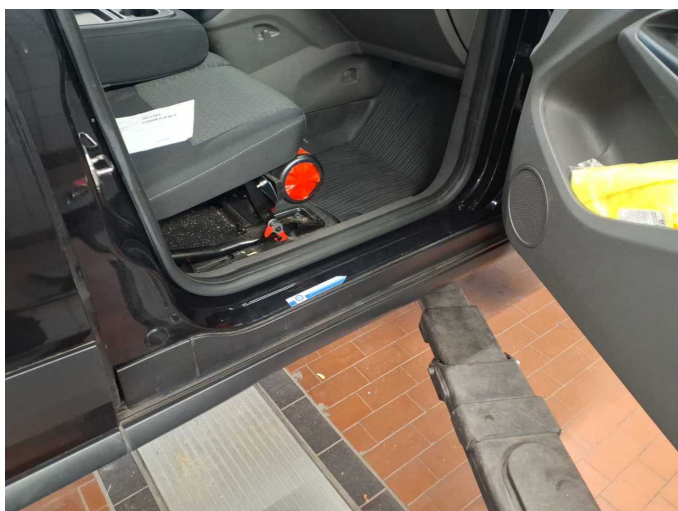


Damage 5: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

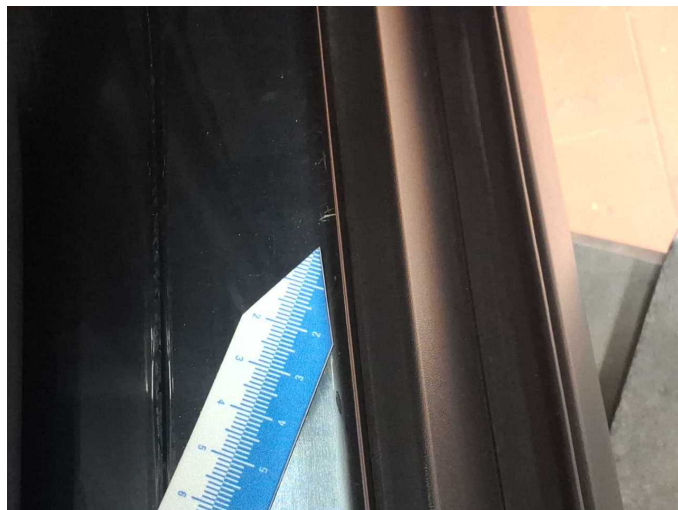

Damage 5: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Door - front right side: Door (an Kante) - dent(s) - Smart repair



Damage 7: Door - front right side: Door (an Kante) - dent(s) - Smart repair



Damage 7: Door - front right side: Door (an Kante) - dent(s) - Smart repair



Damage 8: Sliding door, right: Sliding door (Beulen) - dent(s) - Smooth repair work



Damage 8: Sliding door, right: Sliding door (Beulen) - dent(s) - Smooth repair work



Damage 8: Sliding door, right: Sliding door (Beulen) - dent(s) - Smooth repair work




Damage 8: Sliding door, right: Sliding door (Beulen) - dent(s) - Smooth repair work




Damage 9: Equipment: Vehicle key with remote control (Schlüsselbart lose) - Broken / torn - Replace



Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint

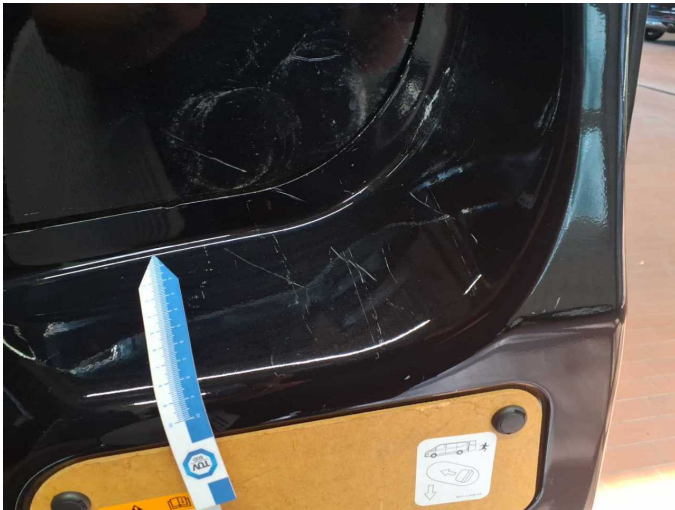

Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint

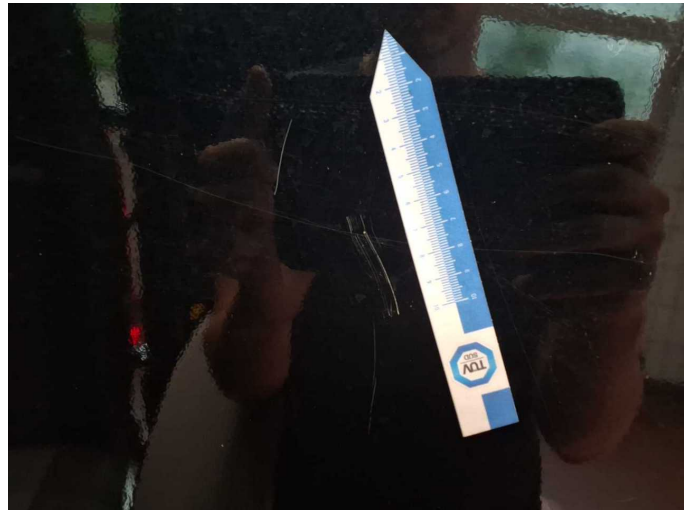

Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint




Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint



Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint



Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint

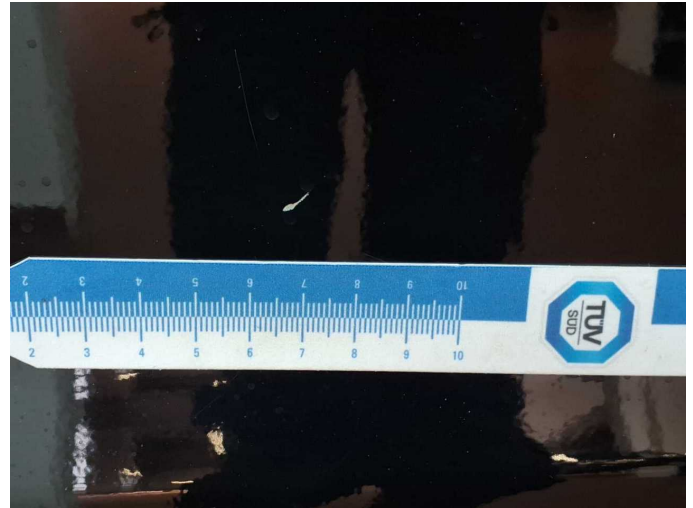

Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint



Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint



Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint




Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint



Damage 10: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Paint



Damage 11: Bonnet: Bonnet (+ Steinschläge) - dent(s) - Paint

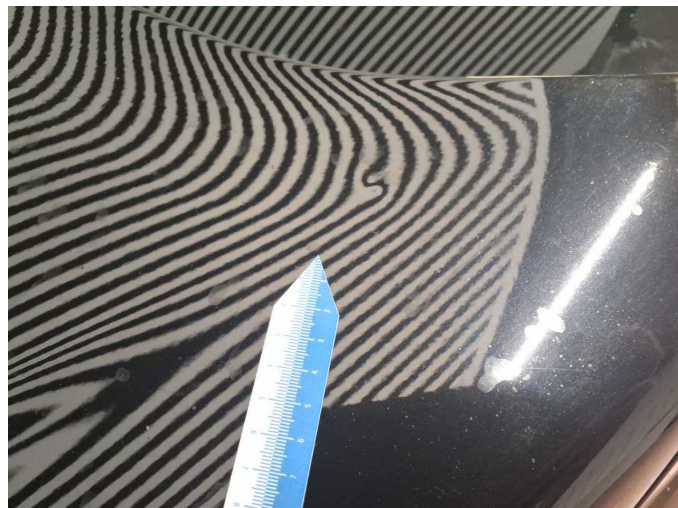

Damage 11: Bonnet: Bonnet (+ Steinschläge) - dent(s) - Paint



Damage 11: Bonnet: Bonnet (+ Steinschläge) - dent(s) - Paint



Damage 11: Bonnet: Bonnet (+ Steinschläge) - dent(s) - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint




Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint

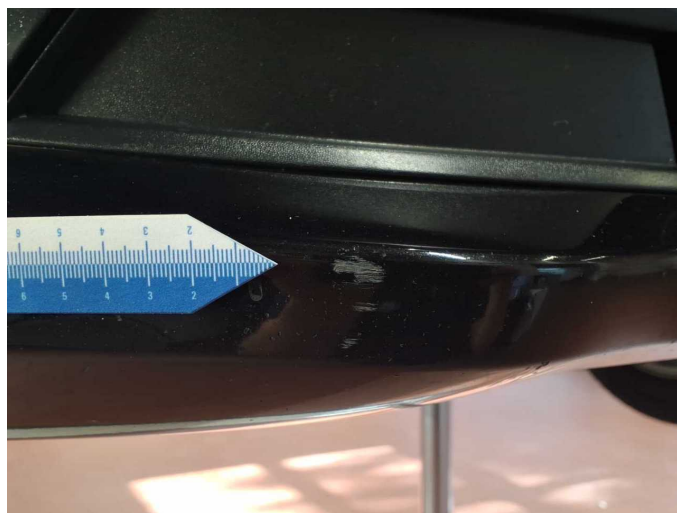


Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint




Damage 12: Front bumper: Front bumper - Scratched - Paint

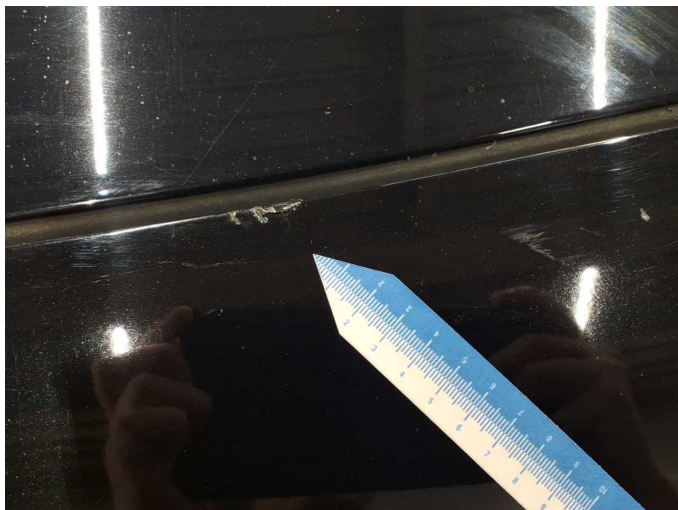


Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint

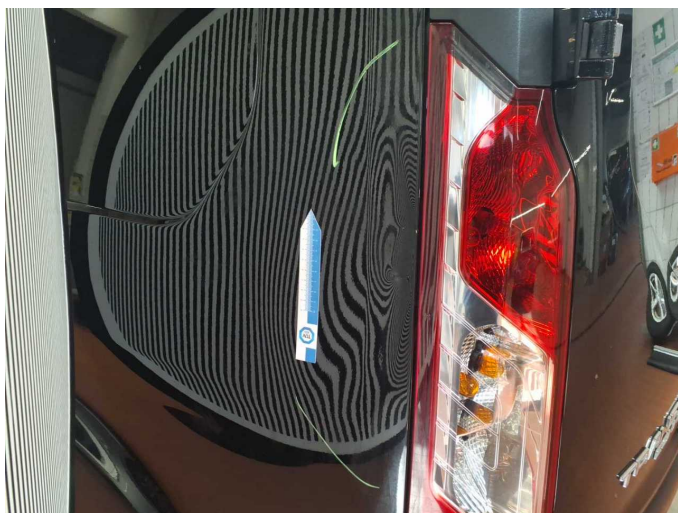

Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint

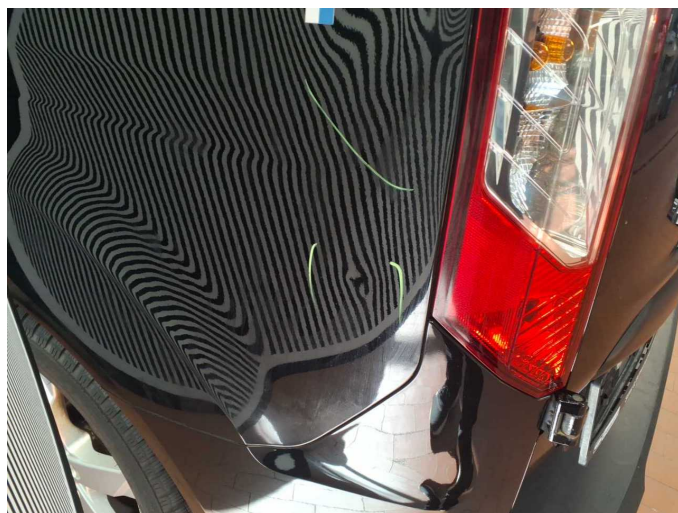

Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint



Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint



Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint




Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint



Damage 13: Side panel - rear left side: Side panel (+ Korrosion) - Deformed - Repair and paint



Damage 14: Roof: Roof - Dent / paintcoat damage - Paint

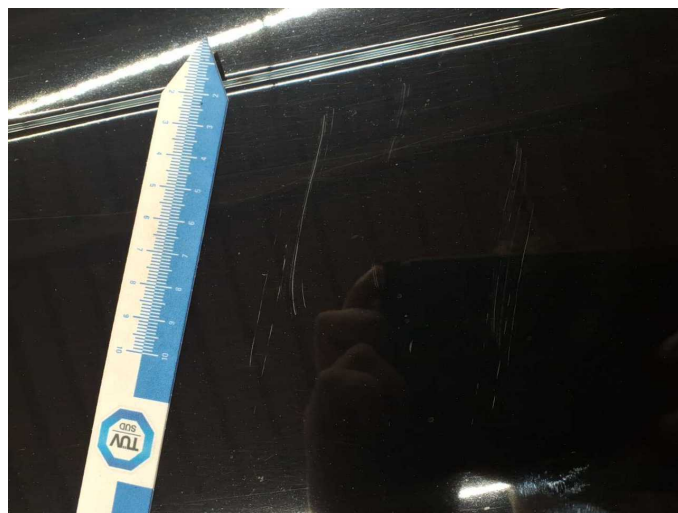

Damage 14: Roof: Roof - Dent / paintcoat damage - Paint



Missing part 1: Engine: Engine cover - Missing - Replace



Repainting 1: Roof



Repainting 2: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0SXXWPGSMA40935
Hersteller / Modell: FORD FORD Transit Connect 230 L2 Trend

Datum	KM-Stand	Beschreibung
11.05.2026	91.123	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.11.2025	85.693	AU; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Systemtest/Eigendiagnose; Wartung Sonstiges
06.09.2024	60.218	Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
27.10.2023	42.027	AU; Bremsklötze vorne; Wartung Sonstiges
23.05.2023	31.148	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.07.2022	12.950	Systemtest/Eigendiagnose; Wartung Sonstiges