



Expertise

Protocol number: 46673916
Order No. / Reference: 26670629
Inspection date: 23 Jul 2026

Manufacturer: Peugeot

Model: 2008 BlueHDi 130 EAT8 GT Pack

VIN: VR3UDYHZSNJ775017



Vehicle details

Manufacturer / Type / Model / Equipment

Peugeot 2008 BlueHDi 130 EAT8 GT Pack

Vehicle Identification number	VR3UDYHZSNJ775017
Mileage (Read)	88,140 km
First registration	26 Jun 2023
Number of holders	1
Next periodical technical inspection	04/2026
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Perla Nera Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17,000 km
Last service on / at	08/2025 at 57,024 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ042186
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / ACD 00075		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,775 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R18 99V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	215/55 R18 99V	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R17 100V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	215/60 R17 100V	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment with smartphone holder
- Active Safety Brake
- Airbags (6)
- ACC automatic cruise control with STOP & GO function
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Hill start assist
- Turn signals with lane change indicator function
- third brake light
- Roof rails in glossy black
- Digital instrument cluster with high-resolution 10" screen, adjustable and customizable
- Front parking aid, acoustic and visual
- Driving mode selector "Eco" and "Sport"
- Misfueling protection
- High beam assist
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Front and rear floor mats with decorative stitching in green
- Transmission: 8-speed automatic transmission EAT8
- Green decorative stitching
- Seat belts: 3-point safety belts in all seats
- rear window wiper
- Rear spoiler, glossy black
- Frameless interior mirror
- Map pockets on the front seatbacks
- Manual child lock
- Front headrests (2)
- Rear headrests (3)
- LED ambient lighting on the dashboard and door trim
- LED ceiling lighting at the front
- LED taillights with 3D effect
- Steering wheel: Multifunction leather steering wheel with GT logo
- makeup mirror
- Fatigue warning
- Emergency brake assist with automatic activation of the hazard warning lights
- Aluminum pedals and stainless steel door sills
- Pollen filter
- Wheel arch liners in black
- Radio accessories: Mirror Screen
- Tire pressure monitoring system
- Reversing camera with 180° surround view
- Side and rear windows are more heavily tinted.
- Seats: Passenger seat height adjustable
- Seats: Rear seat backrest split 40/60, foldable
- 12-volt socket in the trunk
- Blind spot assist
- Traffic sign recognition
- Central locking system, activatable from inside via remote control
- ABS (Anti-lock Braking System)
- Active Safety Brake Plus
- Exhaust with chrome-plated tailpipes
- Electrically folding exterior mirrors with LED approach lighting
- Exterior mirror caps in black
- Trim panel between the taillights in glossy black
- On-board computer
- Black headliner
- Ceiling light at the front, 2 reading lamps at the front
- EBV (Electronic Brakeforce Distribution)
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Electric windows, front and rear
- electric parking brake
- Front collision warning
- Full LED headlights
- Cruise control system with speed limiter
- Cup holder in the center console
- GT logo on the fenders and the trunk lid
- Heated rear window
- Rear apron with chrome-look insert
- Electrically dimming interior mirror
- ISOFIX child seat anchor
- Keyless System Plus
- Automatic climate control (2-zone) including activated carbon filter
- Radiator grille with chrome applications
- White LED lighting on the center console and in the front footwell
- LED daytime running lights
- light sensor
- Air vents with satin chrome trim
- Front center armrests
- Navigation system: 3D navigation system NAC incl. 3D instrument cluster
- Particulate filter: FAP diesel particulate filter
- Peugeot Connect Box
- Upholstery: Alcantara/synthetic leather
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire repair kit (compressor and tire sealant spray)
- paddle shifters on the steering wheel
- Electric power steering
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Stop&Start system
- Doors lock automatically when driving off
- Immobiliser
- Adjustable intermediate loading shelf



Extra equipment

- Alarm system (including all-round, interior and towing protection)
- Inductive charging station E301
- Panoramic tilt/slide sunroof with manual blind
- Wheels: 18" "Evisia" alloy wheels, two-tone, including FOCAL sound system (with 215/55 R18 tires)
- Detachable towbar (with removable ball head without tools)
- Paint finish: Special metallic paint
- Park Assist (active parking system with automatic steering for parallel and perpendicular parking spaces)
- Seats: Heated front seats, adjustable in three stages

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
2	Misc.	Main inspection - Due - Perform
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Engine	Engine (quietschen im Leerlauf) - Noise - Perform diagnosis
5	Door - front left side	Door - Scratch(es) - Paint
6	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction
2	Mudguard - left side	Mudguard - left side - Scratch(es) - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

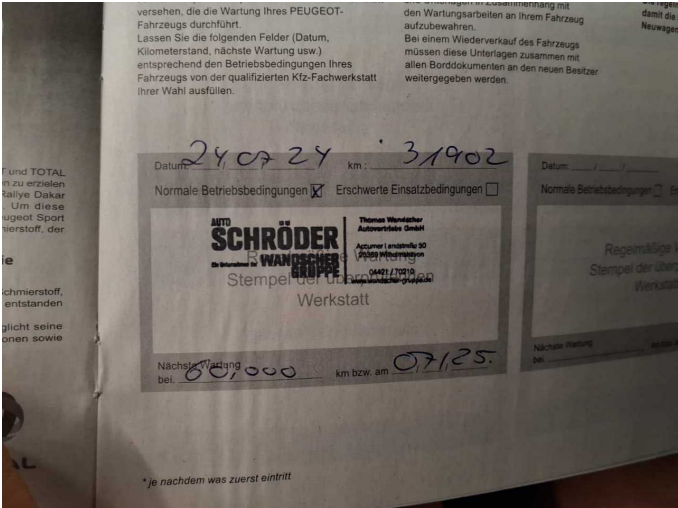


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.


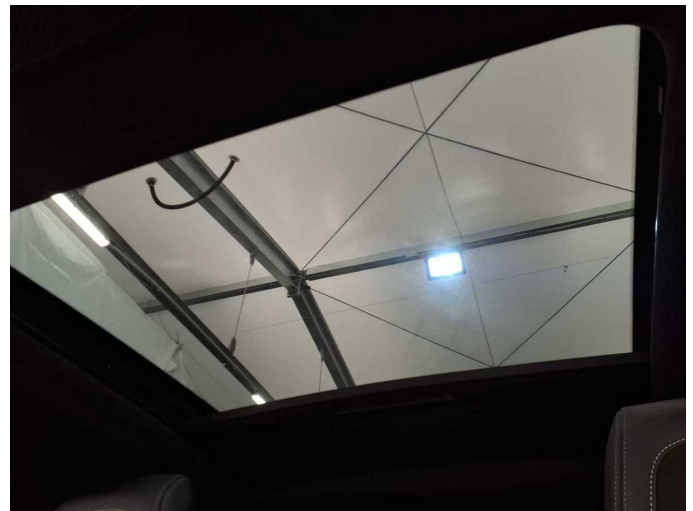



Figure 28: Misc.



Damage 1: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

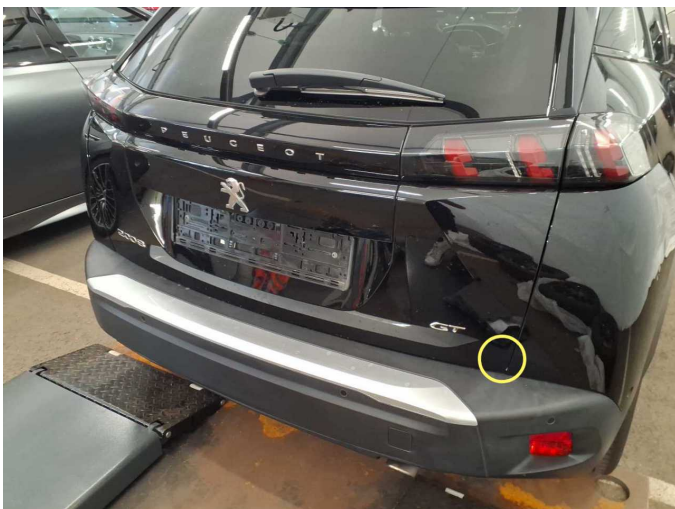

Damage 1: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

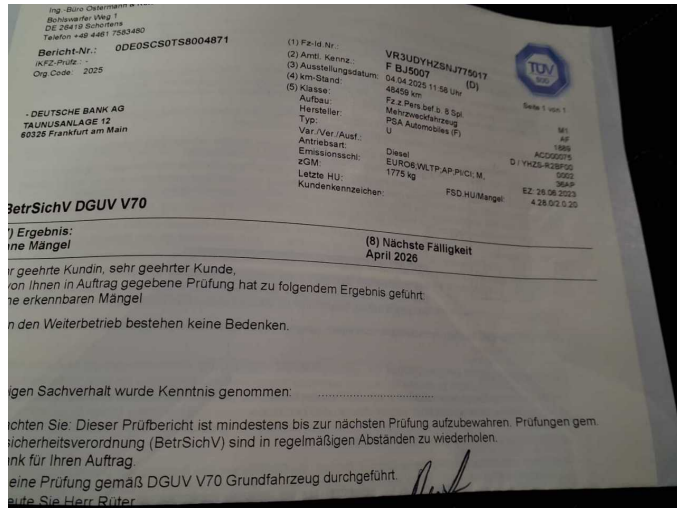

Damage 2: Misc.: Main inspection - Due - Perform



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Door - front left side: Door - Scratch(es) - Paint



Damage 5: Door - front left side: Door - Scratch(es) - Paint



Damage 5: Door - front left side: Door - Scratch(es) - Paint



Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VR3UDYHZSNJ775017

Hersteller / Modell: PEUGEOT PEUGEOT 2008 BlueHDi 130 EAT8 GT Pack

Datum	KM-Stand	Beschreibung
11.08.2025	57.024	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.07.2024	31.902	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges