



Expertise

Protocol number: 47166167
Order No. / Reference: 26827524
Inspection date: 19 Aug 2026

Manufacturer: Opel

Model: Crossland X 1.5 Diesel Start/Stop Innovation

VIN: W0V7H9EG4L4009644



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Crossland X 1.5 Diesel Start/Stop Innovation	
Vehicle Identification number	W0V7H9EG4L4009644
Mileage (Read)	53,183 km
First registration	23 Oct 2019
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	75 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	COULEUR PRINCIPALE - EXTÉRIEUR, GRIS ARTENSE MÉT (510C)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	24,300 km
Last service on / at	11/2025 at 47,499 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FN755911
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AKI 00021		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,820 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R16 89H	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	195/60 R16 89H	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R16 89H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	195/60 R16 89H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag for driver and passenger side
- Airbag: Side airbag for driver and front passenger side
- Armrest, driver
- Manually folding exterior mirrors
- Welcome light when unlocking the vehicle and ambient lighting
- Roof spoiler
- Tachometer
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Luggage compartment floor, 2-way height adjustable
- Transmission: 6-speed manual transmission
- Heating and ventilation system with particle and odor filter, including rear footwell heating
- Automatic climate control, two zones
- Front headrests
- LED ambient lighting
- LED headlights
- Steering wheel: Leather steering wheel with chrome elements
- Fatigue warning
- Upholstery: Fabric/Premium leather look
- Tire repair kit
- Tire pressure warning
- Power steering
- Seat belts: Three-point seat belts in all seats
- Seats: Comfort seats
- Lane Assist
- 12V power outlet in the center console
- Traffic sign assistant
- Pre-installation for child seat mounting system "ISOFIX"
- Heat-insulating glazing, tinted
- Ignition keys with remote control, two, both foldable
- Adaptive brake light
- Airbag: Front and rear outer head airbags
- Anti-lock braking system (ABS)
- Electrically adjustable exterior mirrors for driver and passenger side
- Hill Start Assist
- On-board computer
- Diesel particulate filter (DPF) maintenance-free
- Electronic brake force distribution (EBD)
- Electric rear windows
- Pedestrian protection
- Cruise control with intelligent speed limiter
- rear window wiper
- Interior lighting
- Child safety lock in the rear doors, manual
- Rear headrests 2
- Paint finish: Metallic special color Deep Sea Blue
- LED taillights
- LED daytime running lights
- Steering column adjustable for height and reach
- Make-up mirror in sun visor, passenger side
- Fog light
- Radio: Radio R 4.0 IntelliLink with 7" touchscreen color display, 6 speakers
- Wheels: Alloy wheels 6.5 J x 16, low rolling resistance tires 195/60 R 16
- Visibility equipment
- Seats: Seat backrest split 60:40, foldable
- Start/Stop System
- Traction control (TC Plus)
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control

Extra equipment

- Floor mats, velour, 4-piece set
- Metallic paint with roof and exterior mirrors in contrasting color
- Navi 5.0 IntelliLink with 8" color touchscreen display (navigation system with integrated memory, dynamic route guidance, steering wheel remote control, voice control, Bluetooth audio streaming, hands-free system via mobile phone-compatible Bluetooth interface. Movies/videos and screen presentations are automatically stopped while driving. Aux-in and USB support for audio & video. Video playback via USB interface. OpelConnect with navigation services. Smartphone integration via Apple CarPlay and Apple iPhones).
- Package: Comfort (Park pilot, front and rear parking aid - Heated seats, driver and front passenger, multi-stage switchable - Heated leather steering wheel - Heated ThermoTec windshield)
- Seats: Ergonomic seats with AGR seal of approval for driver and front passenger (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electro-pneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Florey fabric/Morrocana leatherette, black - storage compartment with roller blind in the rear center console - 12-volt power outlet in the rear center console)
- Wheels: Alloy wheels 6.5 J x 16, low rolling resistance tires 195/60 R 16 (4 double spokes in silver)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Soiled - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Mudguard - left side
2	Side panel - rear right side
3	Door - rear left side
4	Door - rear right side
5	Door - front right side

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist nicht Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

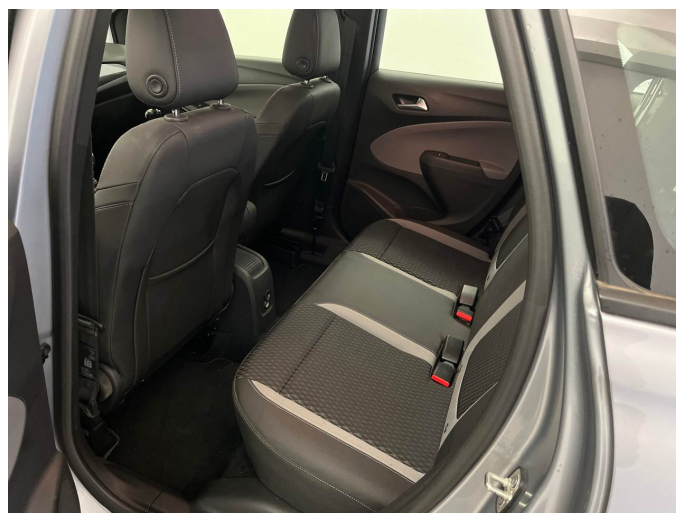


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

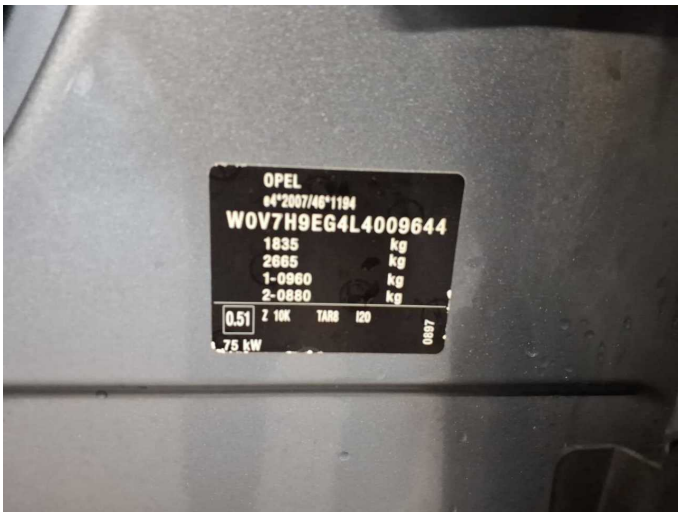


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

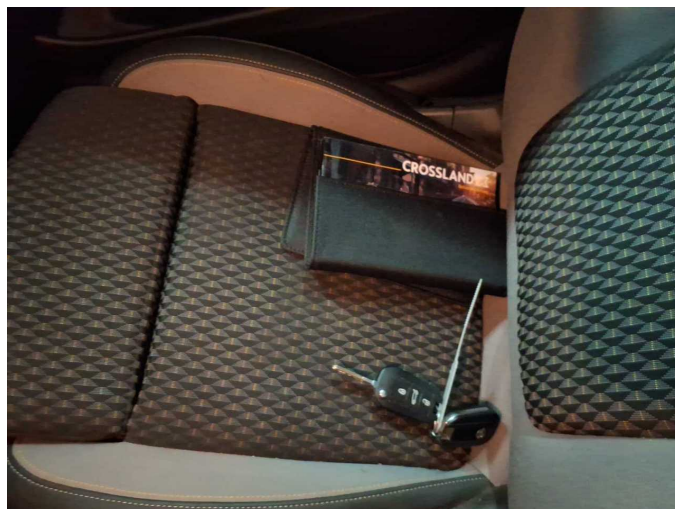


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

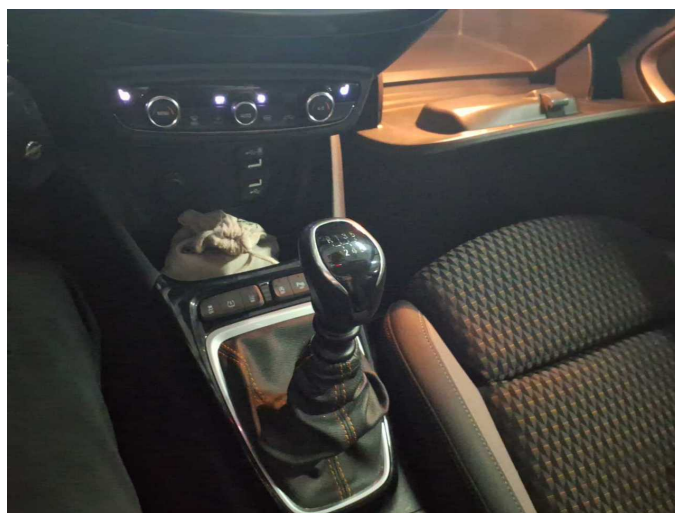


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

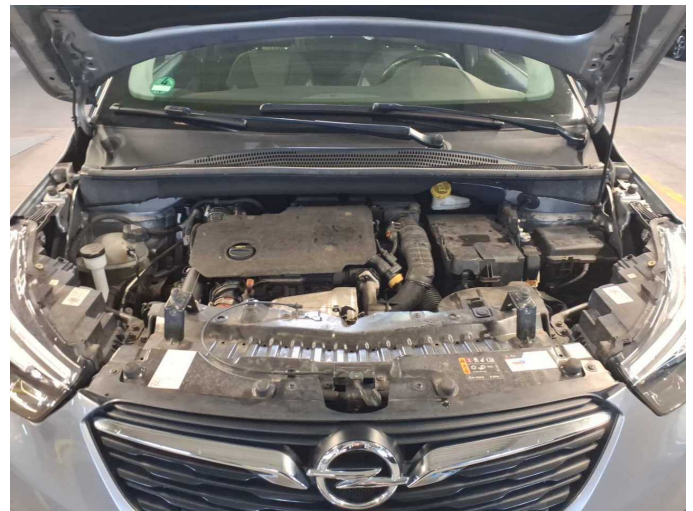


Figure 22: Misc.

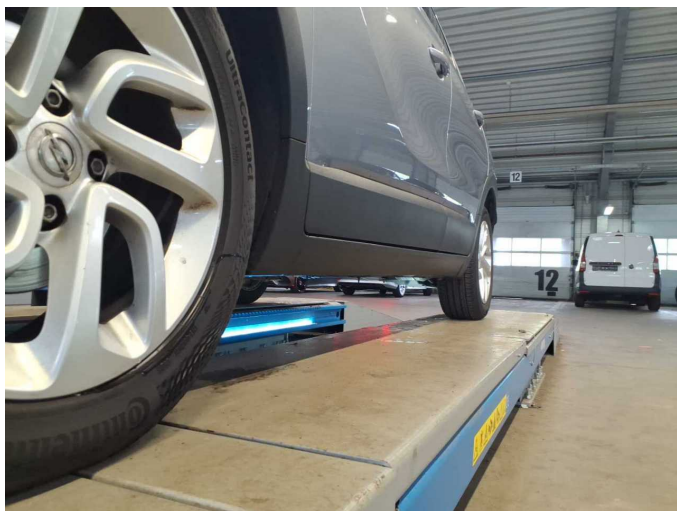


Figure 23: Misc.

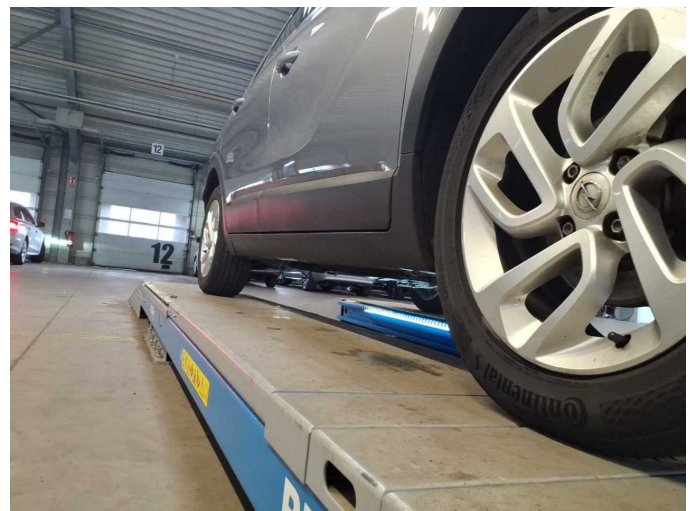


Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.

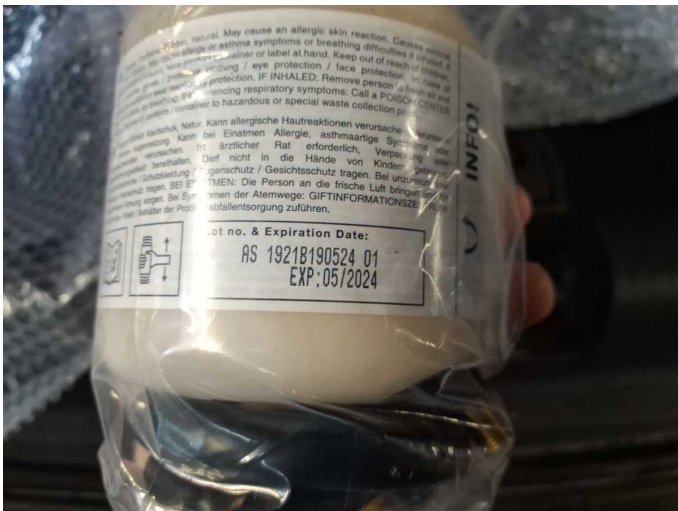


Damage 1: Equipment: Tirefit filler - Expired - Replace

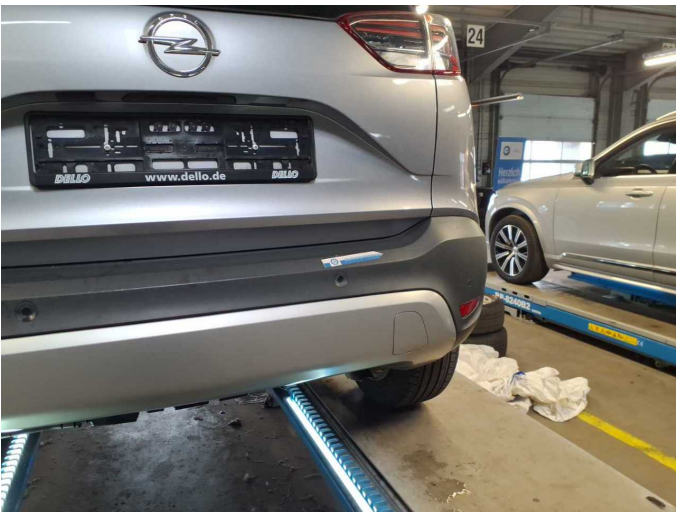

Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value

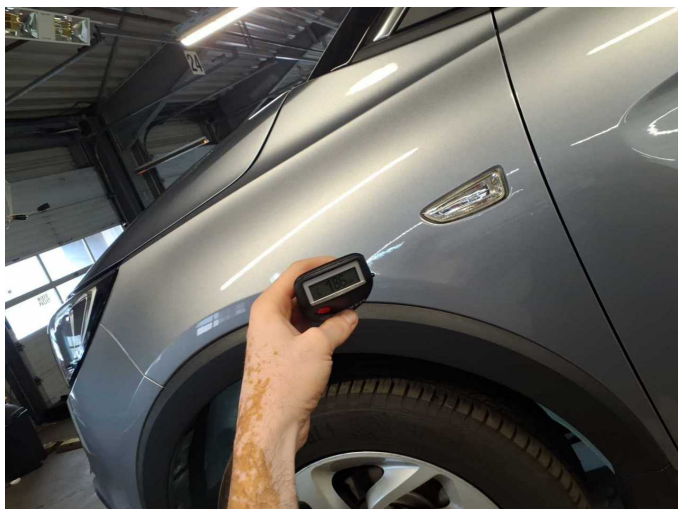

Repainting 1: Mudguard - left side



Repainting 1: Mudguard - left side




Repainting 2: Side panel - rear right side



Repainting 2: Side panel - rear right side



Repainting 3: Door - rear left side

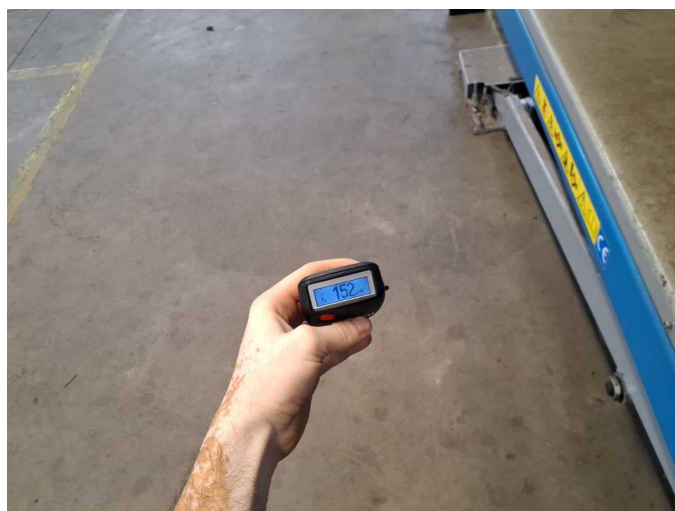

Repainting 3: Door - rear left side



Repainting 4: Door - rear right side



Repainting 4: Door - rear right side



Repainting 5: Door - front right side



Repainting 5: Door - front right side