



Expertise

Protocol number: 46217594
Order No. / Reference: 26554354
Inspection date: 26 Jun 2026

Manufacturer: Skoda
VIN: TMBLJ9NS6N8025907

Model: Kodiaq 2.0 TDI 4x4 DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI 4x4 DSG Style	
Vehicle Identification number	TMBLJ9NS6N8025907
Mileage (Read)	145,638 km
First registration	21 Mar 2022
Number of holders	1
Next periodical technical inspection	08/2027
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	stahlgrau (F7A)
Doors / Seats	5 / 7
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-Black



Vehicle details			
Maintenance booklet / proof	Non-existent	Next maintenance in	16,300 km
Last service on / at	02/2026 at 138,962 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG228500
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ARU 04403		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,430 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	235/55 R18 100V	Summer tyres on Light alloy	4mm / 4mm
2)	235/55 R18 100V	Summer tyres on Light alloy	6mm / 6mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 03/2025	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, anodized
- Diesel particulate filter
- Tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Front radar assistant including city emergency braking function with pedestrian detection
- Cruise control
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Boot cover, roll-up and removable
- Paint finish: Solid
- LED taillights in crystal glass look with animated turn signals
- Reading lights at the front of the headliner
- Rear center armrest with cup holders
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Wheel arch cover
- Radio accessories: 8 speakers
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Electrically adjustable front seats with memory function
- Skoda Care Connect
- Sun visor on driver and passenger side with illuminated vanity mirror
- Front door sill trims
- Variable fastening concept in the trunk
- Immobiliser
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative inlay Linear Diamonds
- Digital Cockpit (8")
- Third brake light
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- High Beam Assist (Light Assist)
- Front footwell lighting
- Closed storage compartment on the driver's side
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Kessy - keyless entry and start-stop system
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED matrix headlights and dynamic high beam assist (Light Assist)
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters.
- Front center armrest, including storage compartment
- Multi-collision brake
- Upholstery: Fabric-leather
- Radio: Bolero infotainment system
- Radio accessories: Digital radio reception DAB+
- Tire Mobility Kit
- Wheels: 18" Elbrus alloy wheels
- Heated windshield washer nozzles, front
- Headlights washer / wiper system
- Kodiaq seat belts
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Speed limiter
- Telephone: Convenient hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Swiveling trailer hitch • Paint finish: Special paint finish, solid color • Proactive occupant protection including rear side airbags • Seats: 3rd row of seats (7-seater), cargo cover in the trunk • Tablet holder in the rear | <ul style="list-style-type: none"> • Luggage net partition • Package: Family • Rear view camera • Seats: Folding tables on the front seatbacks |
|--|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
6	Rear bumper	Spoiler - Scratch(es) - Replace
7	Roof	Roof - Damage by hail - Smooth repair work
8	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
9	Front bumper	Front bumper - Scratch(es) - Paint
10	Bonnet	Bonnet - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 5 Apr 2026	5.906,81 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

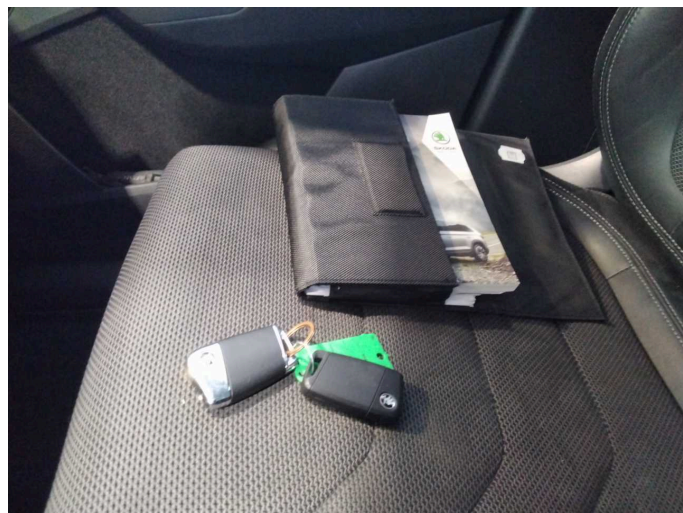


Figure 13: Documents



Figure 14: Navigation

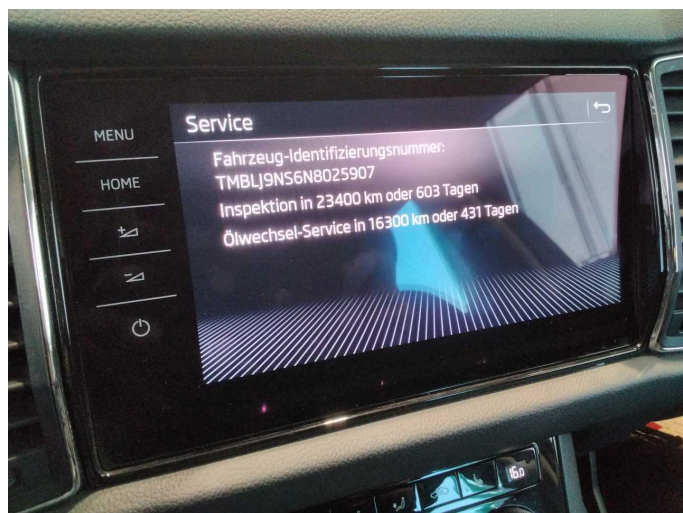


Figure 15: Misc.

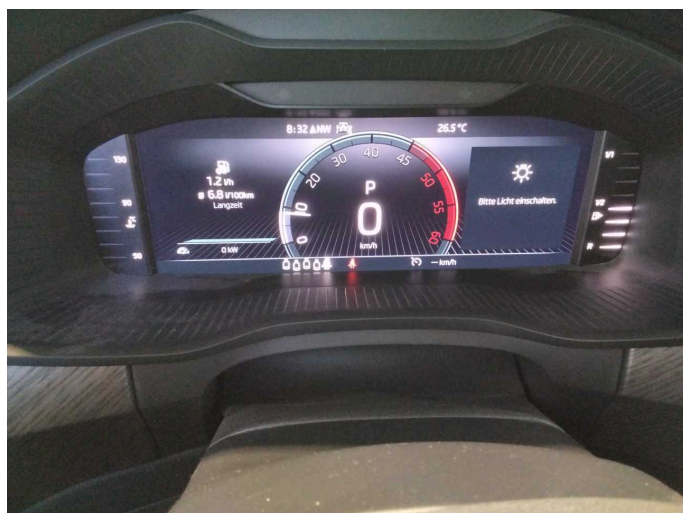


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

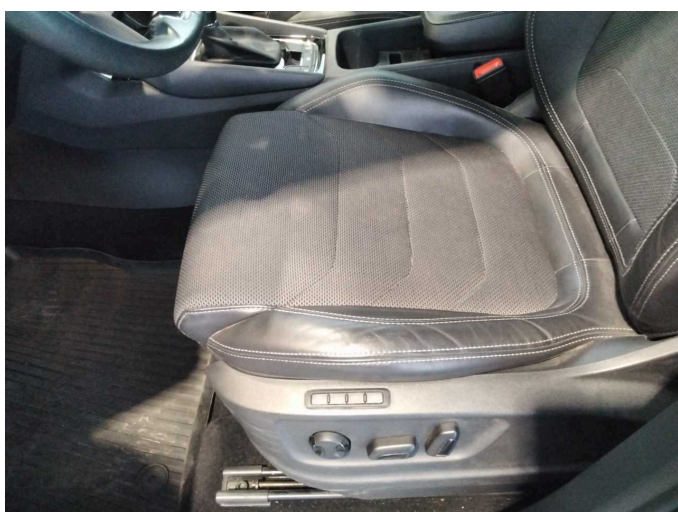


Figure 21: Misc.

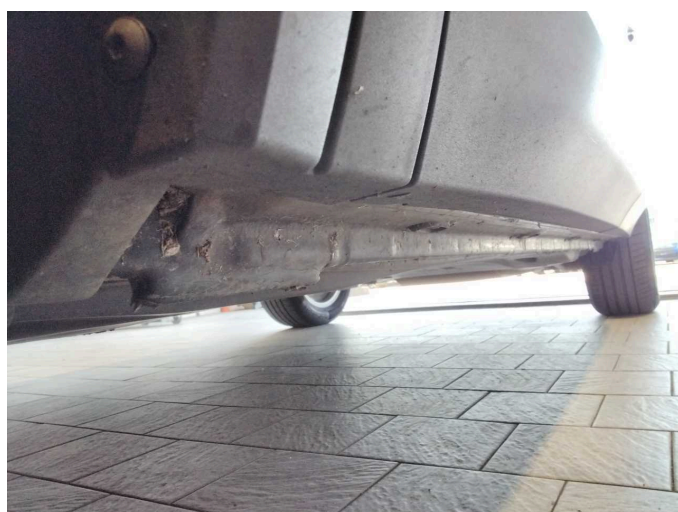


Figure 22: Misc.

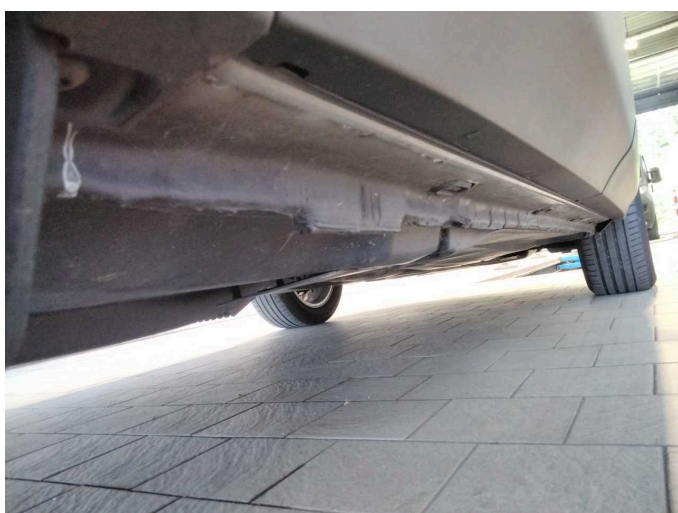


Figure 23: Misc.

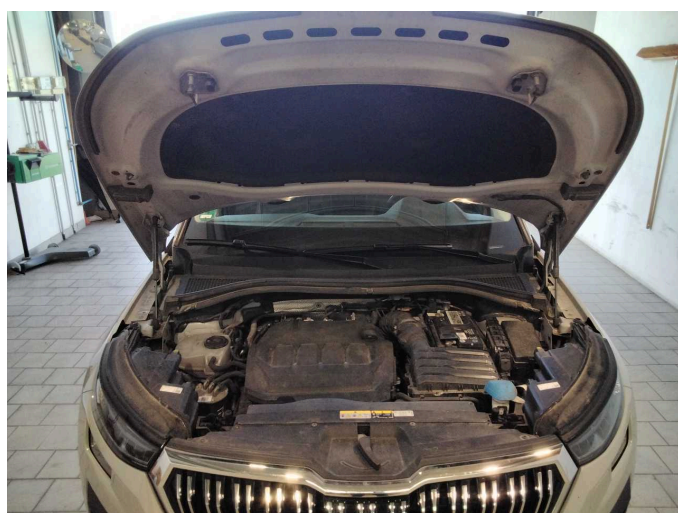


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair

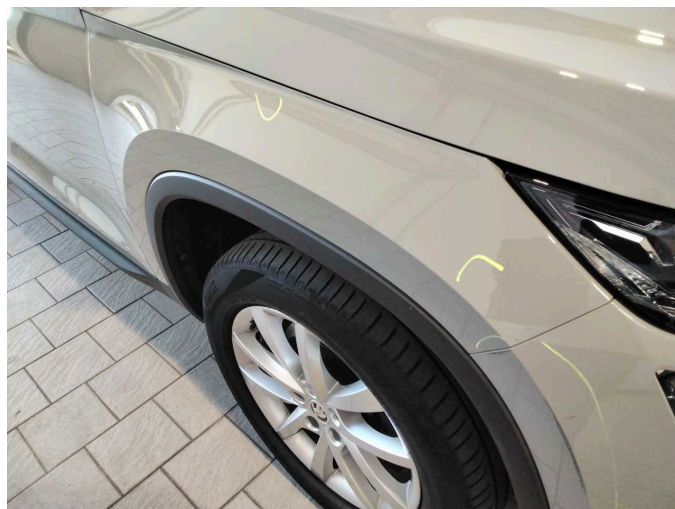

Damage 3: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work

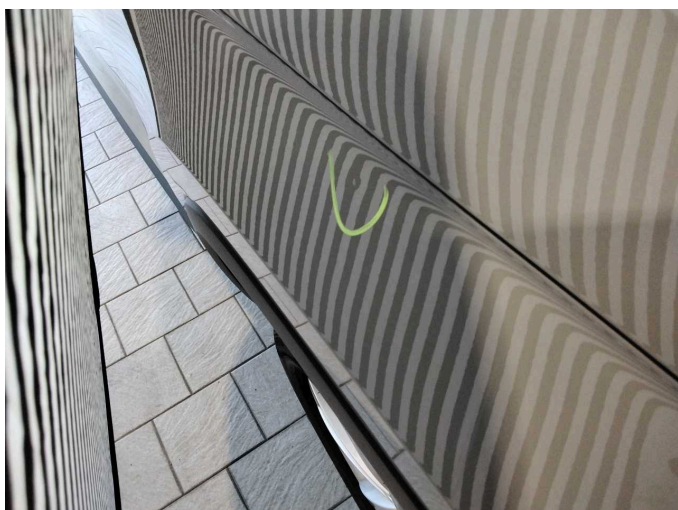

Damage 3: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work

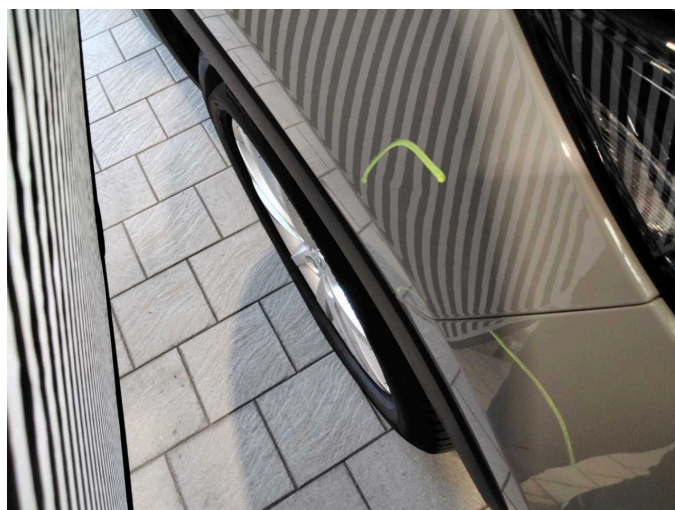

Damage 3: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work




Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

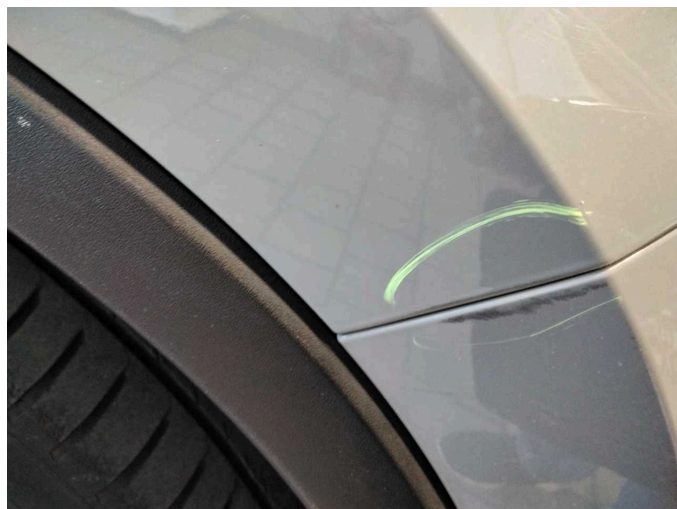

Damage 5: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 6: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 6: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 7: Roof: Roof - Damage by hail - Smooth repair work



Damage 7: Roof: Roof - Damage by hail - Smooth repair work




Damage 7: Roof: Roof - Damage by hail - Smooth repair work



Damage 7: Roof: Roof - Damage by hail - Smooth repair work




Damage 7: Roof: Roof - Damage by hail - Smooth repair work

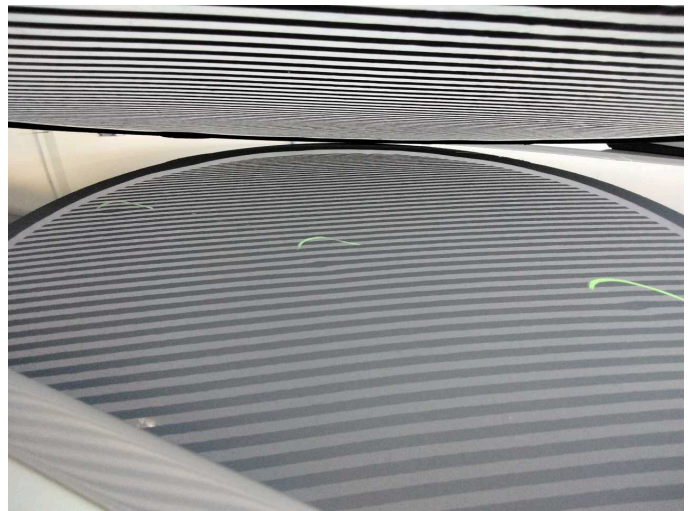

Damage 7: Roof: Roof - Damage by hail - Smooth repair work



Damage 7: Roof: Roof - Damage by hail - Smooth repair work

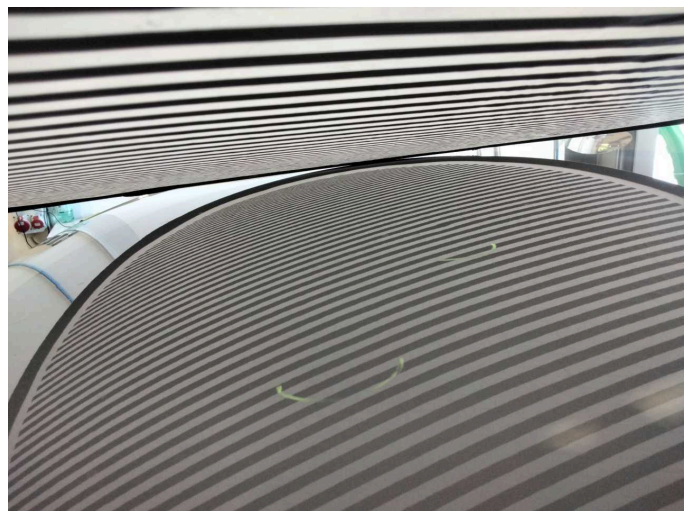


Damage 7: Roof: Roof - Damage by hail - Smooth repair work



Damage 7: Roof: Roof - Damage by hail - Smooth repair work



Damage 7: Roof: Roof - Damage by hail - Smooth repair work

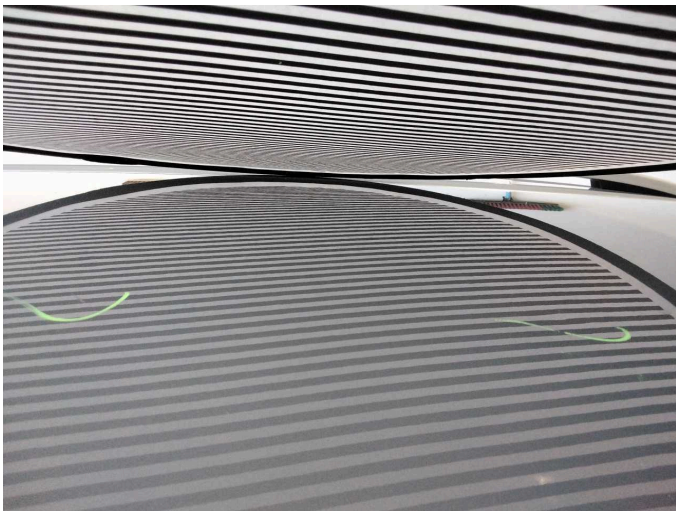

Damage 7: Roof: Roof - Damage by hail - Smooth repair work




Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

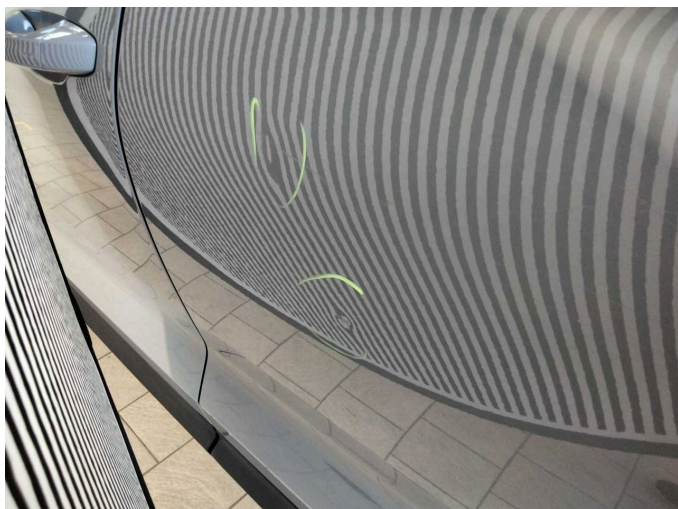

Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

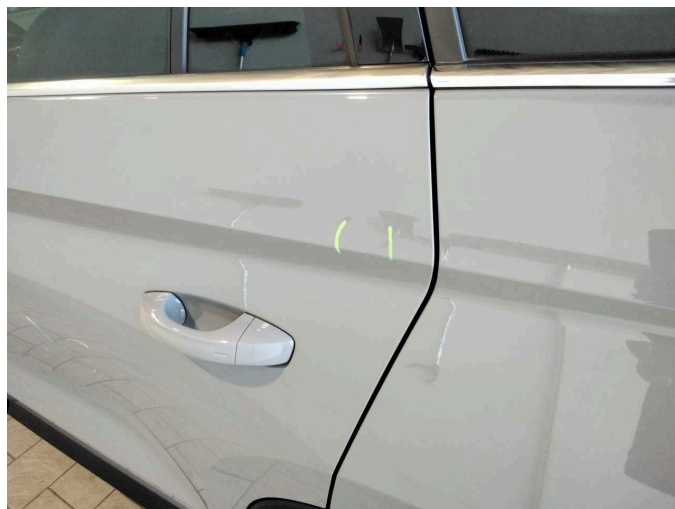


Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

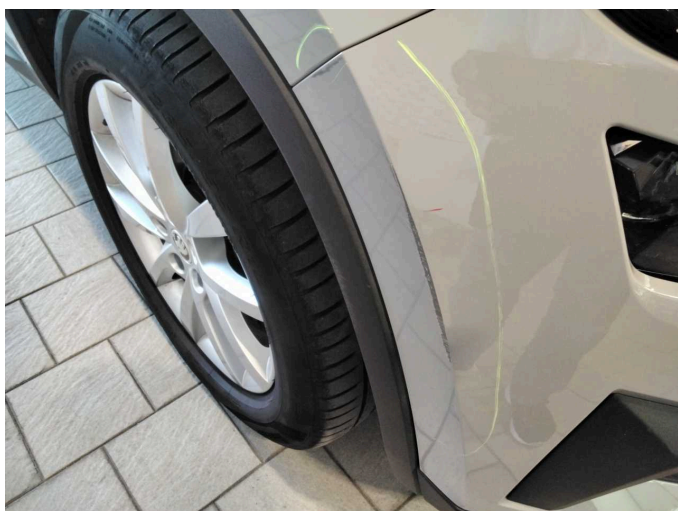

Damage 9: Front bumper: Front bumper - Scratch(es) - Paint

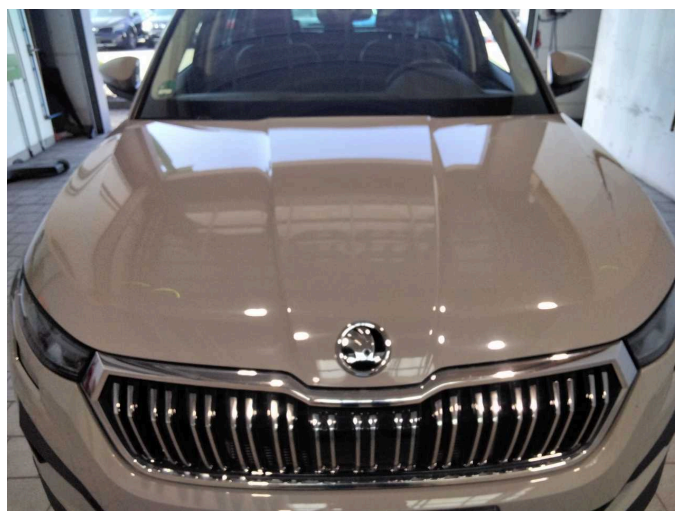

Damage 10: Bonnet: Bonnet - Stone chips - Paint




Damage 10: Bonnet: Bonnet - Stone chips - Paint




Damage 10: Bonnet: Bonnet - Stone chips - Paint



Damage 10: Bonnet: Bonnet - Stone chips - Paint

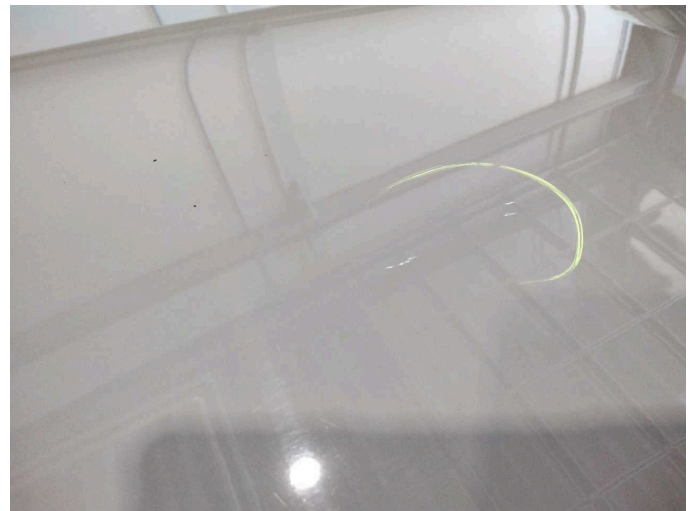

Damage 10: Bonnet: Bonnet - Stone chips - Paint

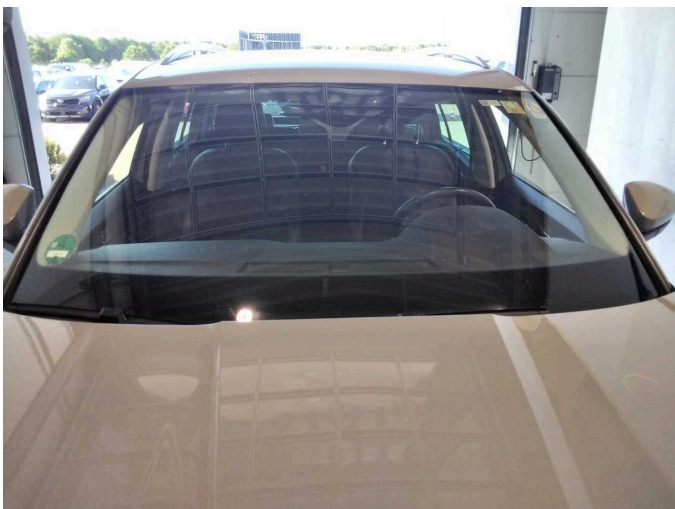

Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction