



Expertise

Protocol number: 46707931
Order No. / Reference: 26602932
Inspection date: 23 Jul 2026

Manufacturer: Ford

Model: Ranger 2,0 I EcoBlue Autm. Wildtrak

VIN: 6FPPXXMJ2PNR77761



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Ranger 2,0 I EcoBlue Autm. Wildtrak	
Vehicle Identification number	6FPPXXMJ2PNR77761
Mileage (Read)	193,432 km
First registration	27 Feb 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,996 ccm / 4
Power	157 kW
Gearbox / Number of gears	Automatic / 10
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Agate Black Metallic
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	14,000 km
Last service on / at	05/2026 at 188,338 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT872464
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1566 / AAN 00112		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	265/60 R18 110T	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	265/60 R18 110T	Summer tyres on Light alloy	Continental	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/70 R16 111T	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	255/70 R16 111T	Winter tyres on Light alloy	Cooper	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	265/60 R18 110T	Summer tyres on Light alloy	Continental	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS
- Airbag: Front and side airbag system for driver and front passenger
- All-wheel drive (switchable four-wheel drive)
- Electrically folding, adjustable and heated exterior mirrors
- Flooring: Carpet
- Dark headliner
- Theft/alarm system
- Third brake light
- Electric rear windows
- Ford KeyFree system
- Floor mats: Premium carpet front, rear
- Cruise control
- Transmission: 10-speed automatic transmission
- tailgate lock
- rear window wiper
- Isofix bracket
- Cargo area sports railing
- LED fog lights
- Leather gear knob
- Package: Off-Road Package
- Package: Seat 52
- Front parking pilot system
- Upholstery: Leather
- Tire pressure monitoring system
- Reversing camera with image display in the multifunction display
- Front mud flaps
- Electro-mechanical power steering
- Sports bars
- Power outlet: 12-volt connection, one connection in the rear.
- Daytime running light
- Lashing eyes
- Heat-insulating glazing, low tint level (behind B-pillar)
- Second key, foldable, with remote control
- Airbag: Passenger airbag deactivation function
- Airbag: Driver's knee airbag
- Airbag: Head airbags, above the side windows
- Ambient lighting
- Exterior mirror housings in anthracite "Sport" decor
- On-board computer
- Roof rails, aluminum
- Tachometer
- ESP (Electronic Stability Program)
- Electric front windows
- Heated windshield
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Grab handle, driver and passenger side
- Heated rear window
- Interior mirror automatically dimming
- Front headrests (2)
- Cargo area protection tray
- LED headlights
- Centre console
- Package: Rear seat 11
- Rear parking pilot system
- Particulate filter: Diesel particulate filter (DPF)
- Radio: Audio system 129: Audio system including Ford SYNC 3 with AppLink and touchscreen
- Windscreen wipers with rain sensor
- Rear mud flaps
- Brushed side sill protector insert
- Voltage converter 230 volts
- Start-stop system
- Bumper rear
- Front bumper in body color
- Door handles in anthracite "Sport" decor
- Immobiliser
- Central/double locking with remote control

Extra equipment

- Towbar (13-pin - 90° tailgate opening angle - lane keeping assist)
- Package: Cargo area 11 (sports bar, aerodynamic, lashing rails, C-profile cargo cover, Mountain Top)
- Package: Wildtrak 1 (Adaptive cruise control - Parking Assist)
- Start-stop system removed
- Paint finish: Metallic
- Package: Wheel 24 (Light alloy wheels 8J x 18 with 265/60 R 18 - 6-spoke Y-design, black - Spare wheel light alloy wheel)
- Parking heater, programmable, with remote control



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Documents	Service book - Incomplete - No deduction
2	Heating system	Remote control auxiliary heating (Batterie) - Empty - Replace
3	Tail light	License plate lamp - right side (Halter) - Loose - Replace
4	Documents	Log book - Incomplete - Replace
5	Side panel - rear left side	Sill - dent(s) - Smooth repair work
6	Door - rear left side	Strip - outer - Scratched - Replace
7	Mudguard - left side	Mudguard - left side - Stone chips - Smart repair
8	Side panel - rear right side	Side panel - Stone chips - Smart repair
9	Sill - left side	Sill - dent(s) - Smooth repair work
10	Engine	Engine cover - Damage caused by marten / rodent - Replace
11	Seat - front	Seat cover - left side - Broken / torn - Replace
12	Door - rear left side	Door - Scratched - Paint
13	Door - front left side	Door - Stone chips - Paint
14	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
15	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
16	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 5 Dec 2023	2.204,69 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

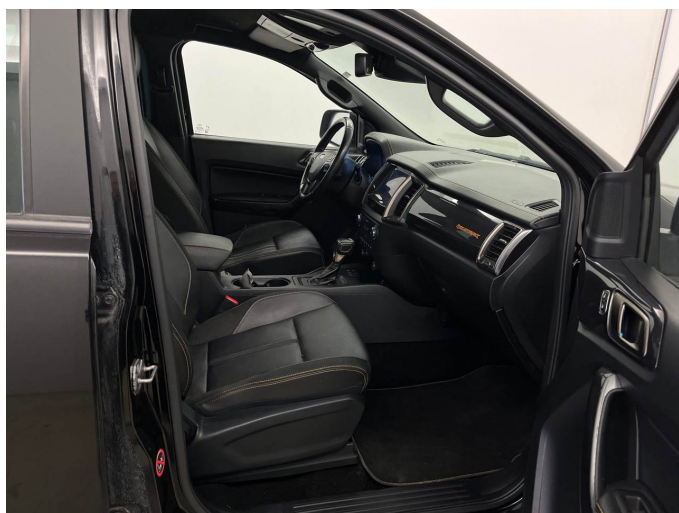


Figure 5: Interior - front

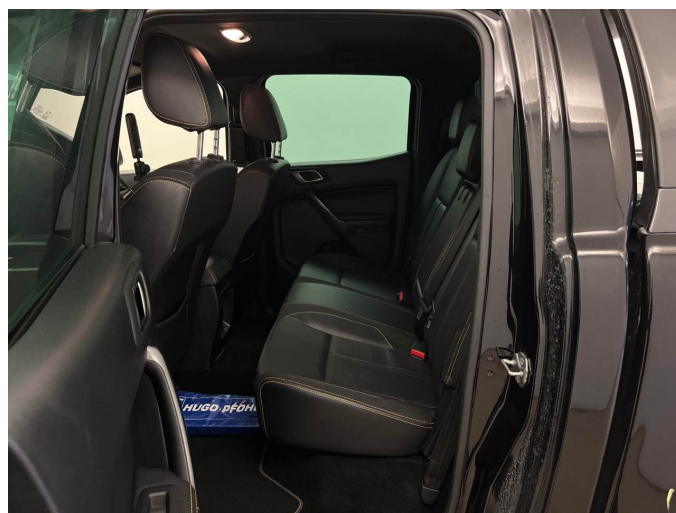


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

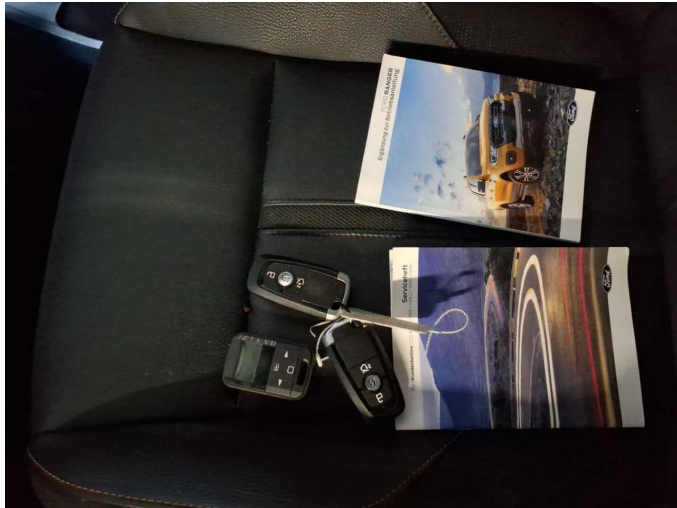


Figure 13: Documents

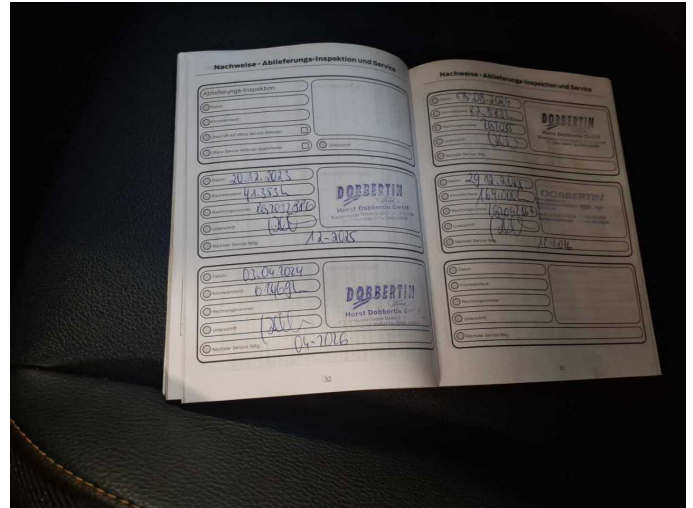


Figure 14: Documents

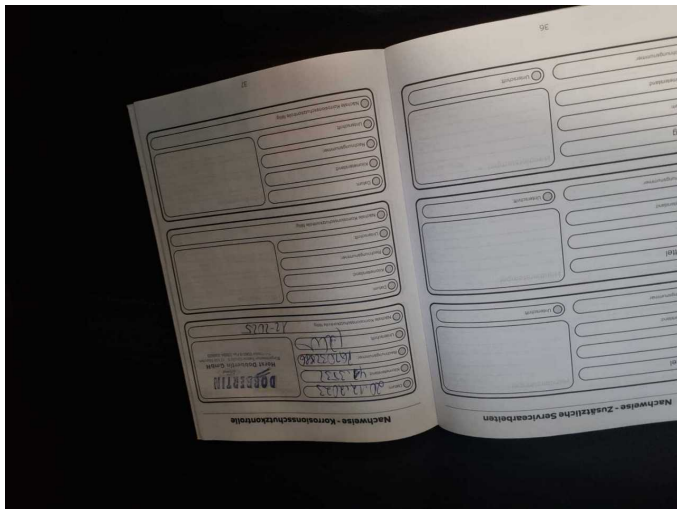


Figure 15: Documents

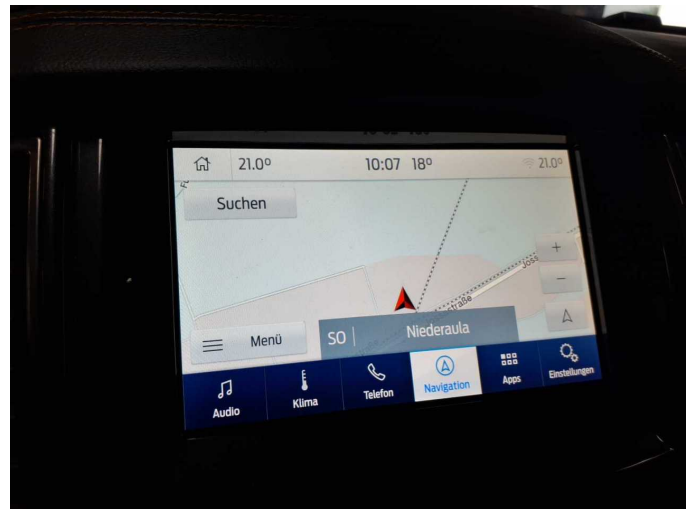


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

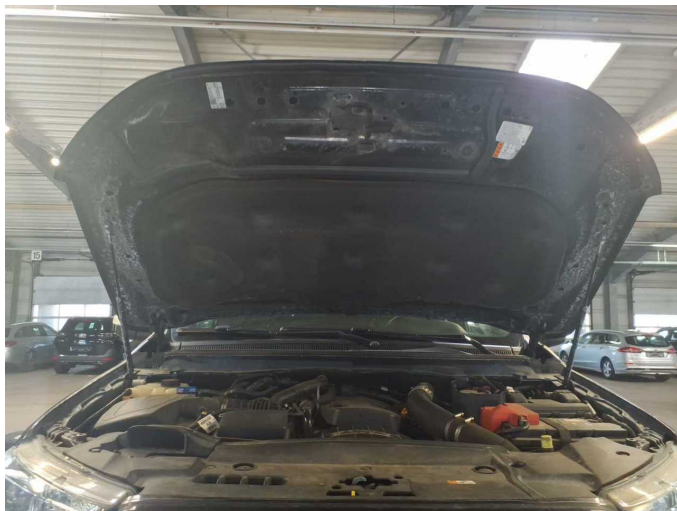


Figure 21: Misc.



Figure 22: Misc.

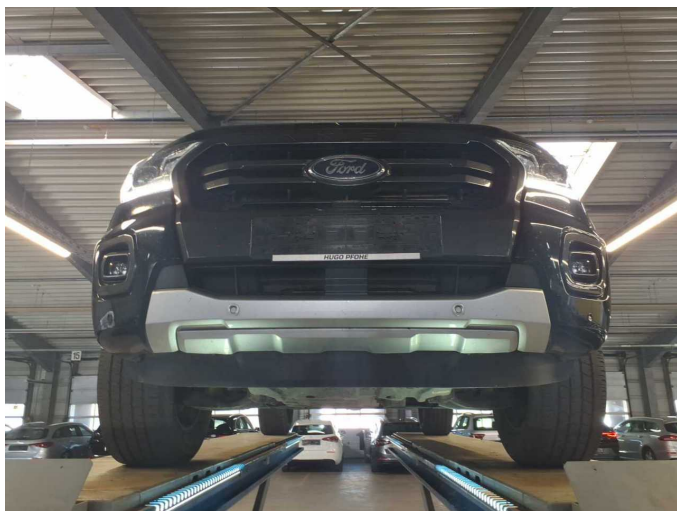


Figure 23: Misc.

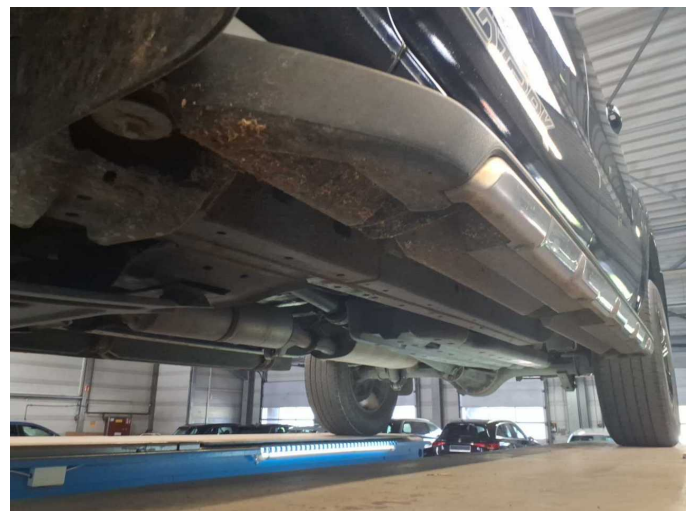


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.




Damage 3: Tail light: License plate lamp - right side (Halter) - Loose - Replace




Damage 3: Tail light: License plate lamp - right side (Halter) - Loose - Replace

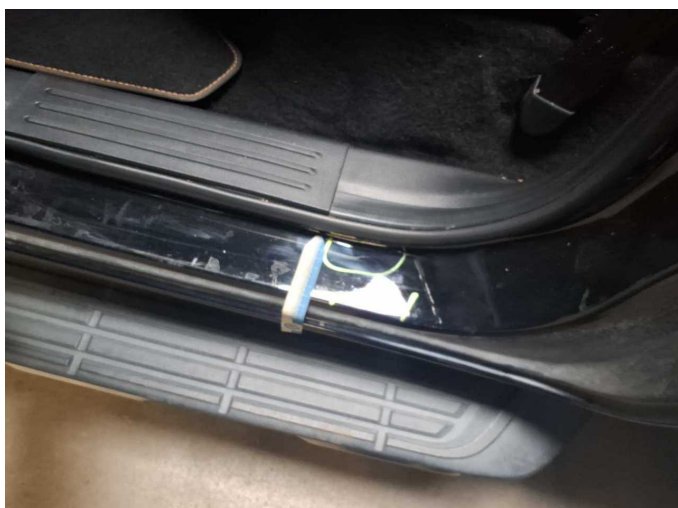


Damage 5: Side panel - rear left side: Sill - dent(s) - Smooth repair work

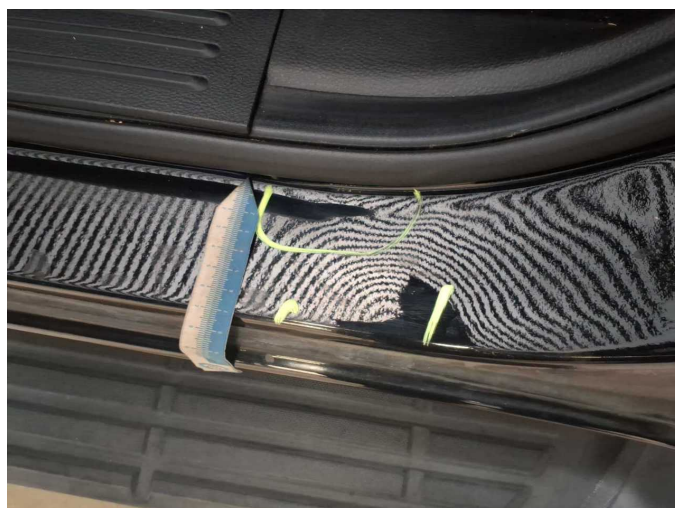

Damage 5: Side panel - rear left side: Sill - dent(s) - Smooth repair work

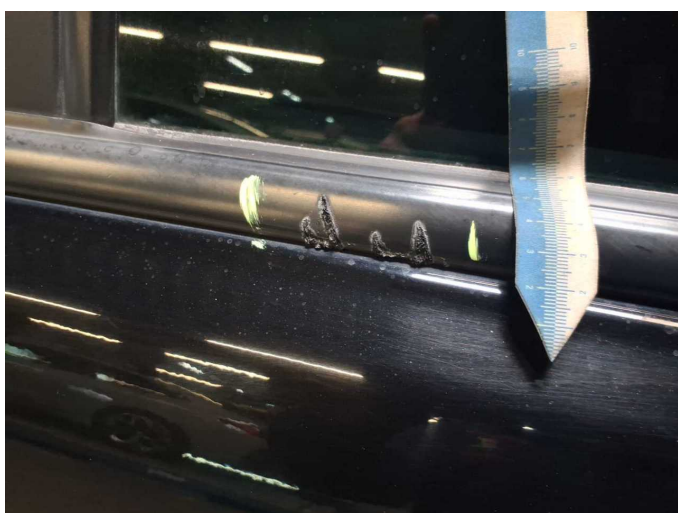


Damage 6: Door - rear left side: Strip - outer - Scratched - Replace

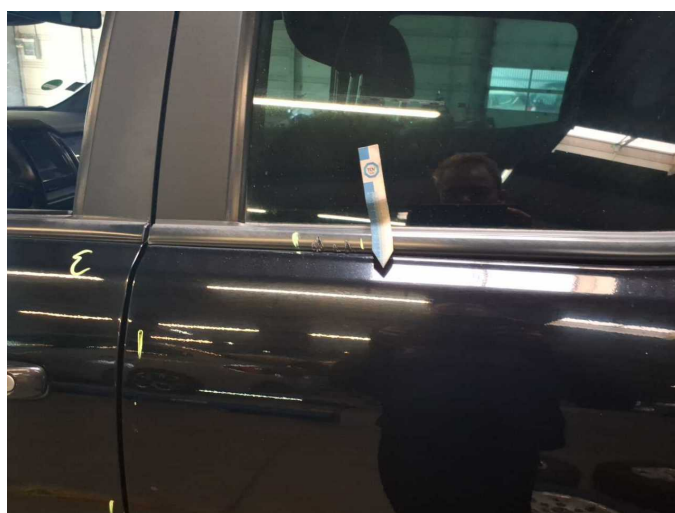

Damage 6: Door - rear left side: Strip - outer - Scratched - Replace




Damage 7: Mudguard - left side: Mudguard - left side - Stone chips - Smart repair

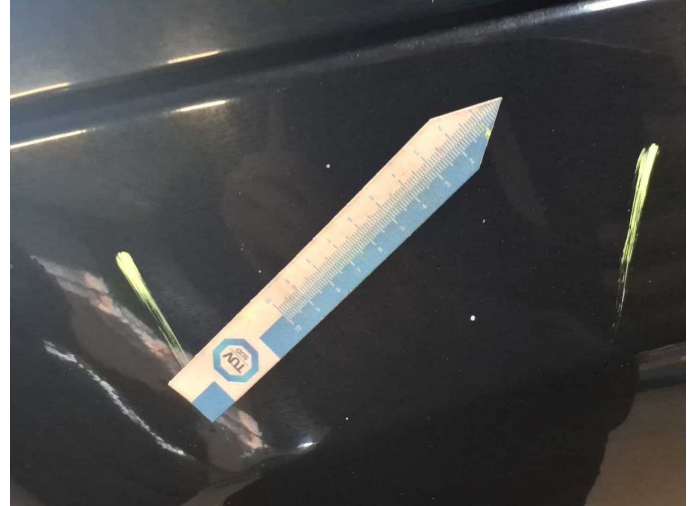

Damage 7: Mudguard - left side: Mudguard - left side - Stone chips - Smart repair



Damage 8: Side panel - rear right side: Side panel - Stone chips - Smart repair

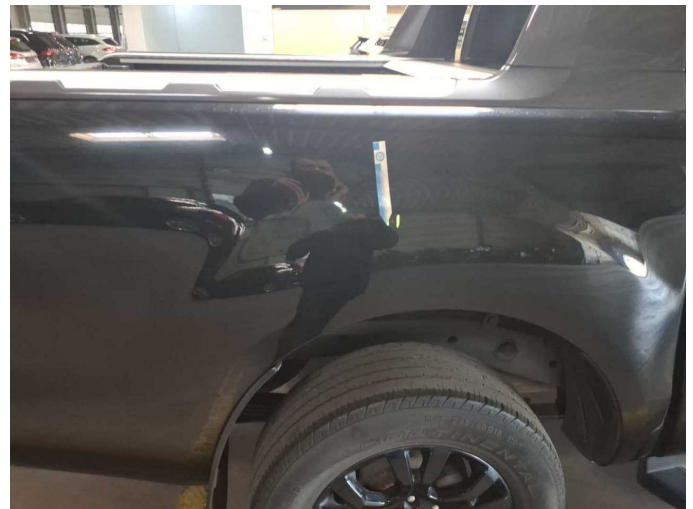

Damage 8: Side panel - rear right side: Side panel - Stone chips - Smart repair



Damage 9: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 9: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 9: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 9: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 10: Engine: Engine cover - Damage caused by martensite / rodent - Replace




Damage 11: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 11: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 12: Door - rear left side: Door - Scratched - Paint

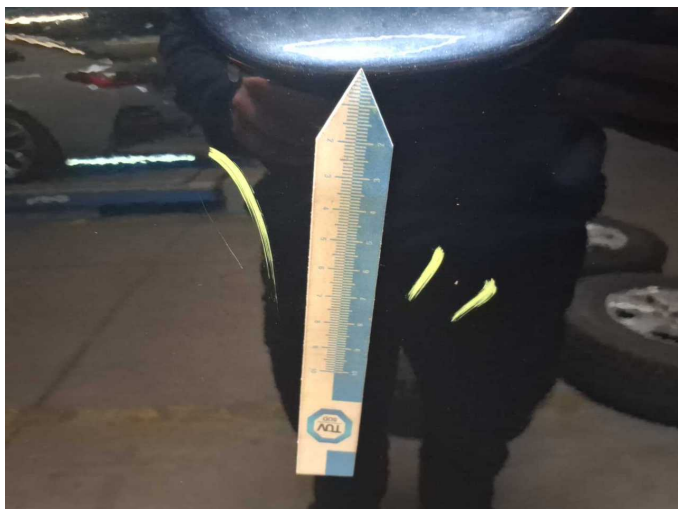

Damage 12: Door - rear left side: Door - Scratched - Paint




Damage 12: Door - rear left side: Door - Scratched - Paint




Damage 12: Door - rear left side: Door - Scratched - Paint



Damage 12: Door - rear left side: Door - Scratched - Paint

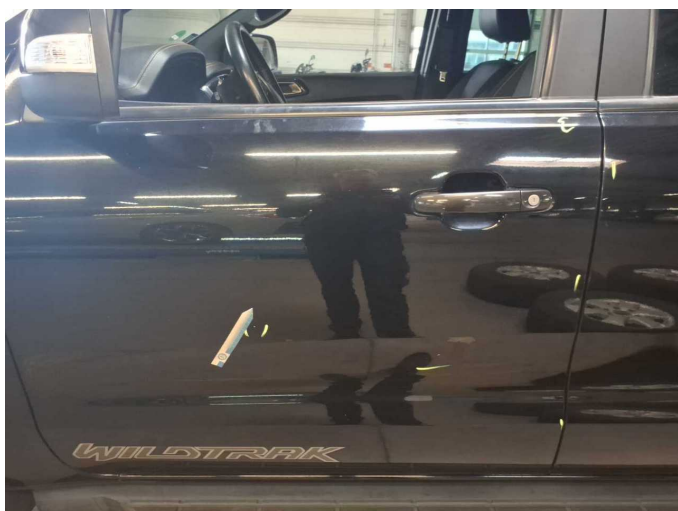

Damage 13: Door - front left side: Door - Stone chips - Paint

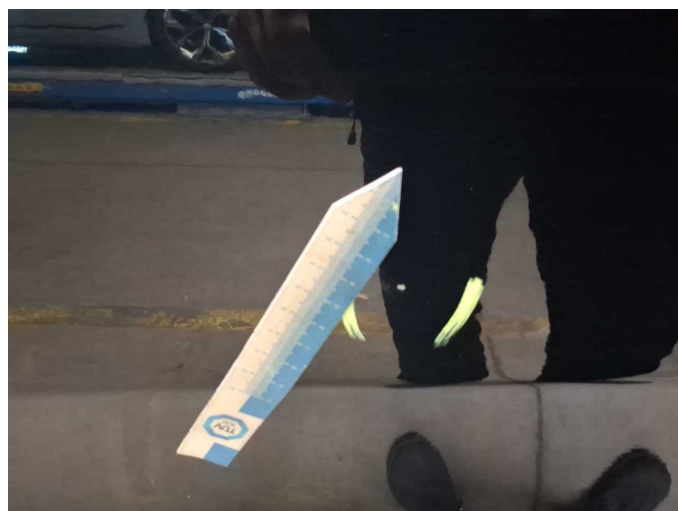


Damage 13: Door - front left side: Door - Stone chips - Paint



Damage 13: Door - front left side: Door - Stone chips - Paint



Damage 13: Door - front left side: Door - Stone chips - Paint

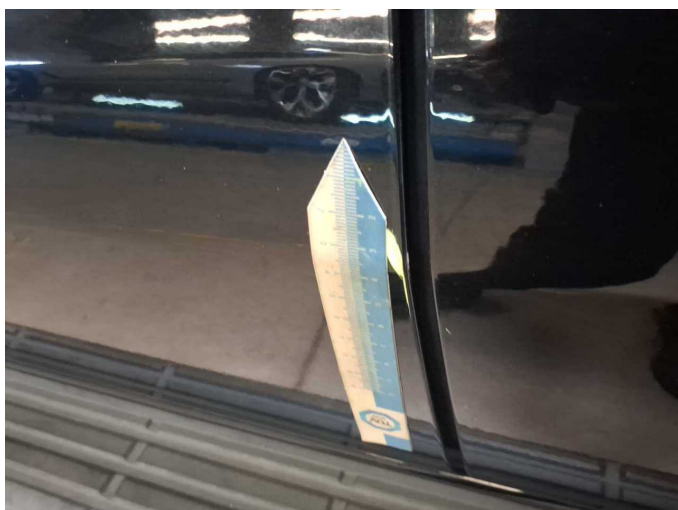

Damage 13: Door - front left side: Door - Stone chips - Paint



Damage 14: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 14: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 14: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 14: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

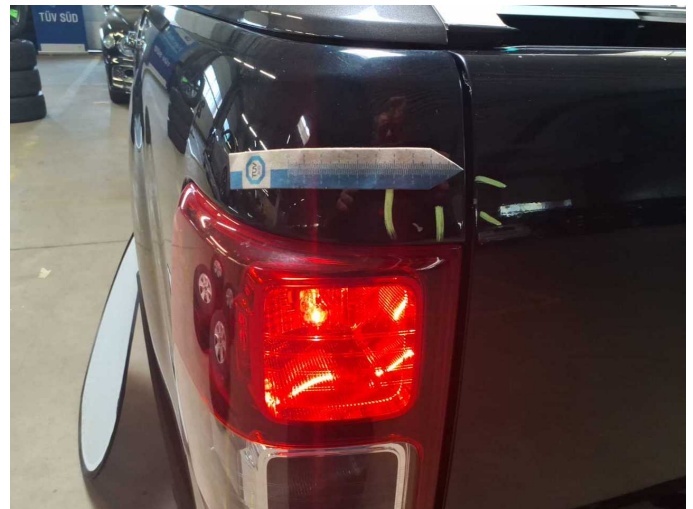


Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

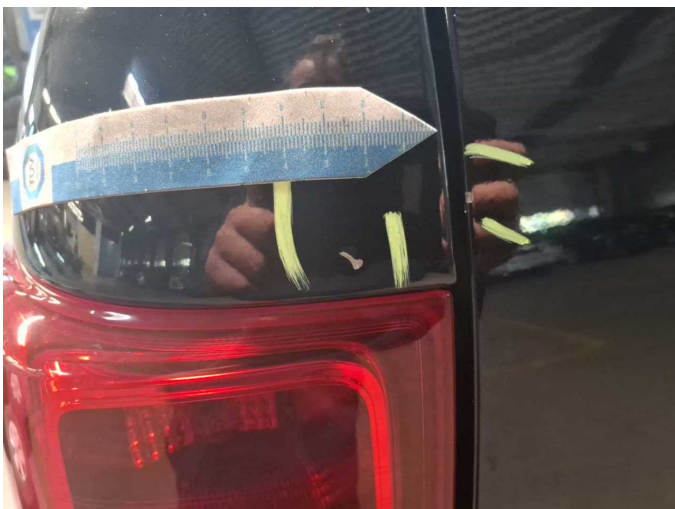

Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

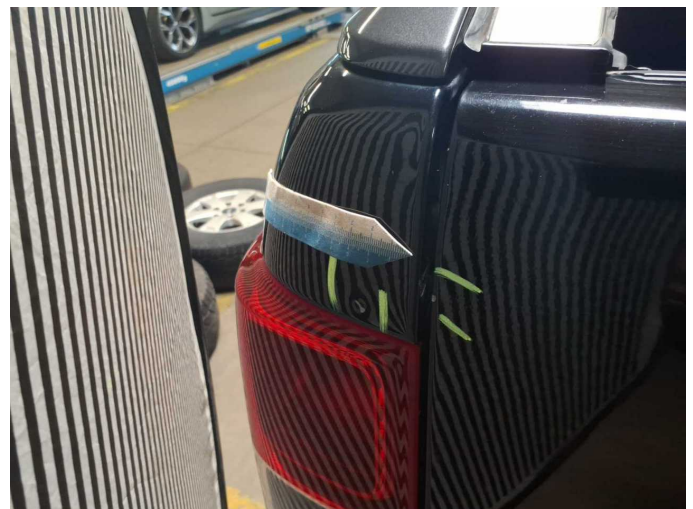

Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

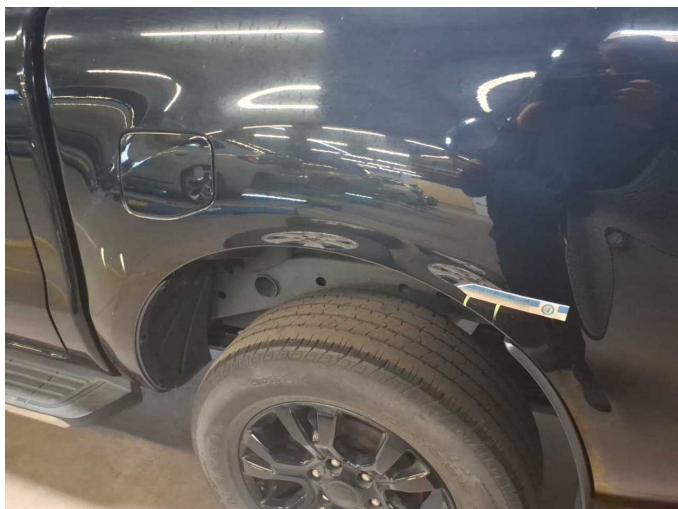


Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

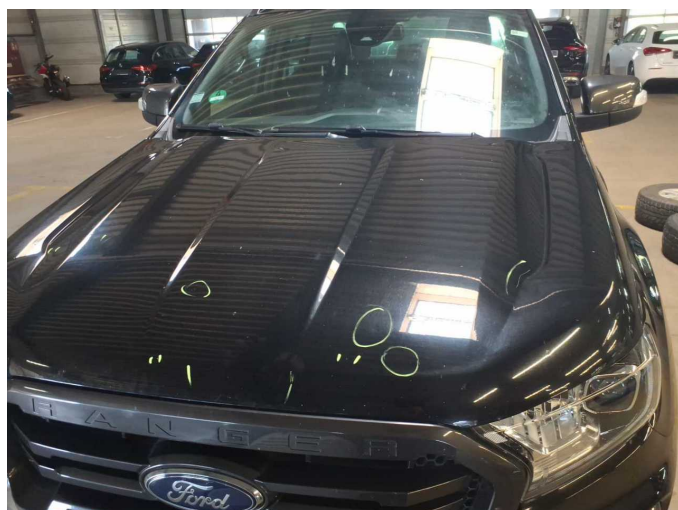

Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

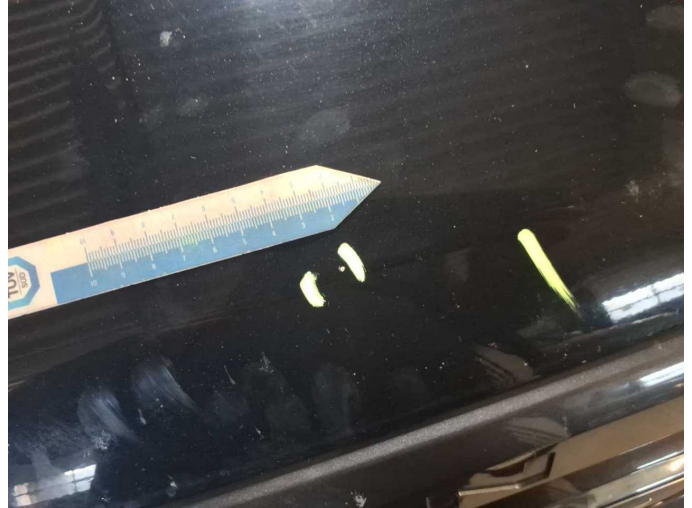


Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

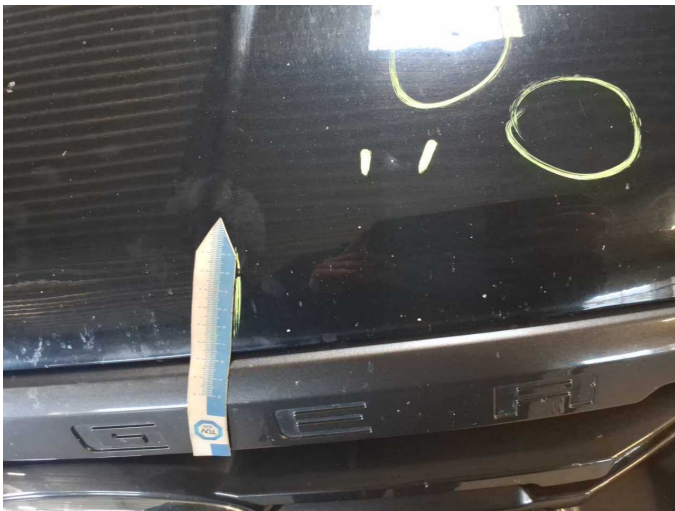


Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

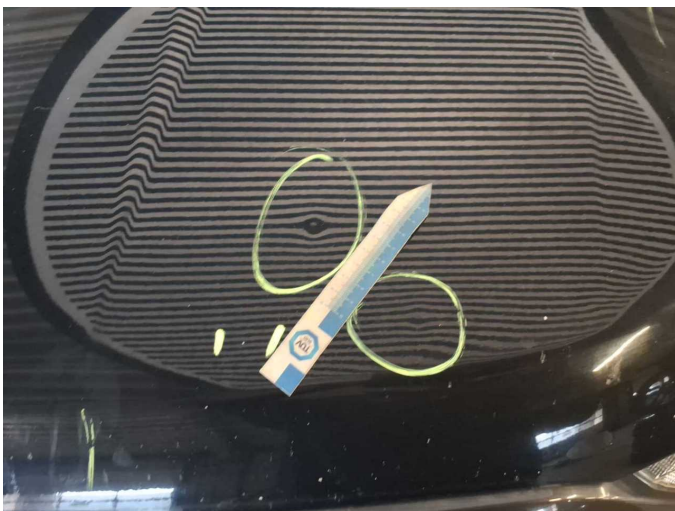

Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

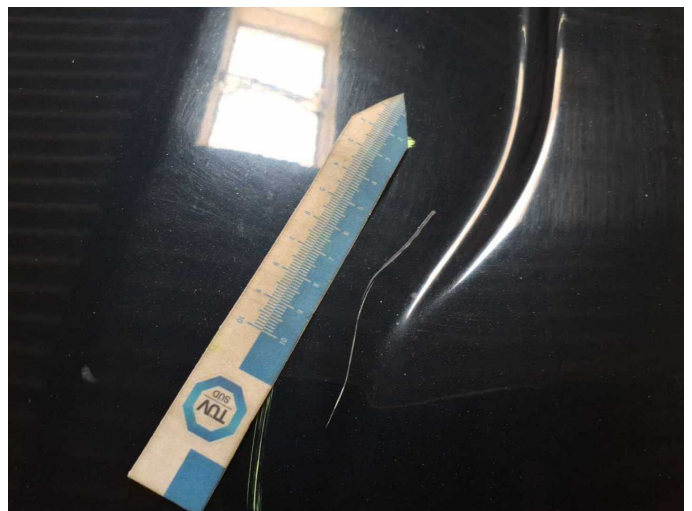

Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

Wartungshistorie

(gemäß Auftraggeber Informationen)



Fahrgestellnummer: 6FPPXXMJ2PNR77761
Hersteller / Modell: FORD FORD Ranger 2,0 I EcoBlue Autm. Wildtrak

Datum	KM-Stand	Beschreibung
15.05.2026	188.338	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.09.2025	147.515	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.05.2025	108.491	AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.12.2024	108.491	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.09.2024	82.583	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.04.2024	61.469	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.12.2023	41.353	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.08.2023	20.514	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges