

Vehicle details

VIN	W1K5J8GB4 PN366278	Registration date	01/01/1900	Exterior Color	Unknown
Brand	MERCEDES	Licence Plate	2FMJ288	Odometer	59 858 km
Model	CLA				

Inspection Details

Arrival Date	16/06/2026	Inspection ID	7044828	Inspection date	08/07/2026
Assign Date	16/06/2026	Fleet owner	LIZY Belgique	Inspection loc.	Parc Lizy



Generic equipment

Removable element

Spare wheel kit




Technical Document

Service manual holder	✓
User manual	✓
Key	✓
Certificate of conformity	✓
Title / License document	✓

Tyres

Bridgestone 225/45/18 W Summer
4.0 mm

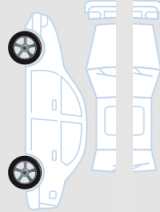

Bridgestone 225/45/18 W Summer
4.0 mm



Bridgestone 225/45/18 W Summer
5.0 mm

Bridgestone 225/45/18 W Summer
5.0 mm

Damages

1



Part	Special rim 18"	Repair Time	-	Part Cost	-
Position	Front right	Repair Cost	-	Gross Cost	225.00€
Damages	Scratched	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	225.00€	Net Cost	225.00€

2



Part	Bumper extension moulding	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	90.00€
Damages	Scratched	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	90.00€	Net Cost	90.00€

DEKRA Automotive Solutions

3		Part	Front face	Repair Time	-	Part Cost	-
		Position	-	Repair Cost	-	Gross Cost	-
		Damages	Stone impact	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
4		Part	Special rim 18"	Repair Time	-	Part Cost	-
		Position	Front left	Repair Cost	-	Gross Cost	225.00€
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Smart Repair	Flat Rate	225.00€	Net Cost	225.00€
		ovb					
5		Part	Geometry inspection	Repair Time	1.00	Part Cost	-
		Position	Front	Repair Cost	75.00€	Gross Cost	75.00€
		Damages	Misaligned	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Adjust	Flat Rate	75.00€	Net Cost	75.00€
6		Part	Tyre	Repair Time	0.50	Part Cost	240.00€
		Position	Front left	Repair Cost	37.50€	Gross Cost	277.50€
		Damages	Cut	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Replace	Flat Rate	-	Net Cost	277.50€
7		Part	Wing	Repair Time	-	Part Cost	-
		Position	Front left	Repair Cost	-	Gross Cost	-
		Damages	Dented	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
8		Part	Special rim 18"	Repair Time	-	Part Cost	-
		Position	Back left	Repair Cost	-	Gross Cost	225.00€
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Smart Repair	Flat Rate	225.00€	Net Cost	225.00€
9		Part	Tyre	Repair Time	0.50	Part Cost	240.00€
		Position	Back left	Repair Cost	37.50€	Gross Cost	277.50€
		Damages	Cut	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Replace	Flat Rate	-	Net Cost	277.50€
10		Part	Bumper	Repair Time	-	Part Cost	-
		Position	Back	Repair Cost	-	Gross Cost	148.75€
		Damages	Scratched	Paint Time	1.75	Depreciation %	-
		Severity	-	Paint cost	148.75€	Depreciation	-
		Repair mode	Repair	Flat Rate	-	Net Cost	148.75€

DEKRA Automotive Solutions

11		Part	Baguette Chromée de pare-chocs	Repair Time	0.40	Part Cost	134.95€
				Repair Cost	30.00€	Gross Cost	164.95€
		Position	Back	Paint Time	-	Depreciation %	-
		Damages	Dent & Chips	Paint cost	-	Depreciation	-
		Severity	-	Flat Rate	-	Net Cost	164.95€
		Repair mode	Replace				
12		Part	Special rim 18"	Repair Time	-	Part Cost	-
		Position	Back right	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
13		Part	Door	Repair Time	1.00	Part Cost	-
		Position	Back right	Repair Cost	75.00€	Gross Cost	253.50€
		Damages	Dent & Chips	Paint Time	2.10	Depreciation %	-
		Severity	-	Paint cost	178.50€	Depreciation	-
		Repair mode	Repair	Flat Rate	-	Net Cost	253.50€
14		Part	Door	Repair Time	-	Part Cost	-
		Position	Front right	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-
15		Part	Exterior door mirror shell	Repair Time	0.50	Part Cost	-
		Position	Right	Repair Cost	37.50€	Gross Cost	63.00€
		Damages	Scratched	Paint Time	0.30	Depreciation %	-
		Severity	-	Paint cost	25.50€	Depreciation	-
		Repair mode	Repair	Flat Rate	-	Net Cost	63.00€
16		Part	Interior cleaning	Repair Time	0.50	Part Cost	-
		Position	-	Repair Cost	37.50€	Gross Cost	37.50€
		Damages	Stained/dirty	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	Cleaning	Flat Rate	37.50€	Net Cost	37.50€
17		Part	Door sill	Repair Time	-	Part Cost	-
		Position	Front left	Repair Cost	-	Gross Cost	-
		Damages	Scratched	Paint Time	-	Depreciation %	-
		Severity	-	Paint cost	-	Depreciation	-
		Repair mode	For info	Flat Rate	-	Net Cost	-

Summary Inspection

Gross Price	2,062.70€	Depreciation	-	Net Price	2,062.70€
-------------	-----------	--------------	---	-----------	-----------

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	75.00€	4.40	330.00€	-	-	330.00€
Paintwork	85.00€	4.15	352.75€	-	-	352.75€
Paint preparation	85.00€	0.00	0.00€	-	-	0.00€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	614.95€	-	-	614.95€
Flat Rate	765.00€	-	-	765.00€

Signatures
Signature Receiver
Signature Expert
Signature Customer / Driver