



Expertise

Protocol number: 46594226
Order No. / Reference: 26550548
Inspection date: 17 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 2.0 Diesel Aut. Business
VIN: W0VZT8EP9N1045397	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business	
Vehicle Identification number	W0VZT8EP9N1045397
Mileage (Read)	103,569 km
First registration	19 Jan 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Diamant Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	16 %
Last service on / at	10/2025 at 81,025 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ331858
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMC 00314		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97W	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	225/55 R17 97W	Summer tyres on Light alloy	Bridgestone	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag: Front airbags and side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Hill Start Assist
- third brake light
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Pedestrian protection including active hood
- luggage compartment cover
- Speed controller
- Back window, heater
- Child safety lock in the rear doors, manual
- Front headrests
- LED headlights
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake
- Upholstery: Billy fabric, black
- Radio: Digital radio reception DAB+
- Tire repair kit
- Tire pressure gauge
- Rear seat backrest folds forward in a 60:40 split
- Power steering
- safety net
- Seats: Ergonomic active seat (AGR) driver
- Start/Stop System
- Traction Control (TC) Plus
- Pre-installation for child seat mounting system "ISOFIX"
- Thermal insulation glazing, green tinted

Extra equipment

- Paint finish: Metallic
- Wheels: Additional set of 17" alloy winter wheels SFP

- Adaptive brake light
- Airbag: Front and rear outer head airbags
- Ambient lighting
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- Glasses compartment in the headliner
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Noise-reducing, laminated front side windows
- Transmission: 8-speed automatic transmission
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1
- Parkpilot, front and rear parking aid
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display
- Wheels: 7.5 J x 17 alloy wheels in a 5 double-spoke design
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- Lane Keeping Assist
- Bumpers painted in body color
- Traffic sign assistant
- Immobiliser
- Central locking with remote control

- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Side panel - rear left side	Side panel - dent(s) - Smart repair
3	Roof	Roof - dent(s) - Smooth repair work
4	Door - rear left side	Door - Scratch(es) - Smart repair
5	Interior	Interior (Zigarette) - Odour - Ozone treatment
6	Body	Underbody panelling - Broken / torn - Replace
7	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
8	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
9	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
10	Front bumper	Grille - Broken / torn - Replace
11	Body	Body - Glued / labelled - De-glue / neutralise
12	Front bumper	Front bumper - Scratched - Paint

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

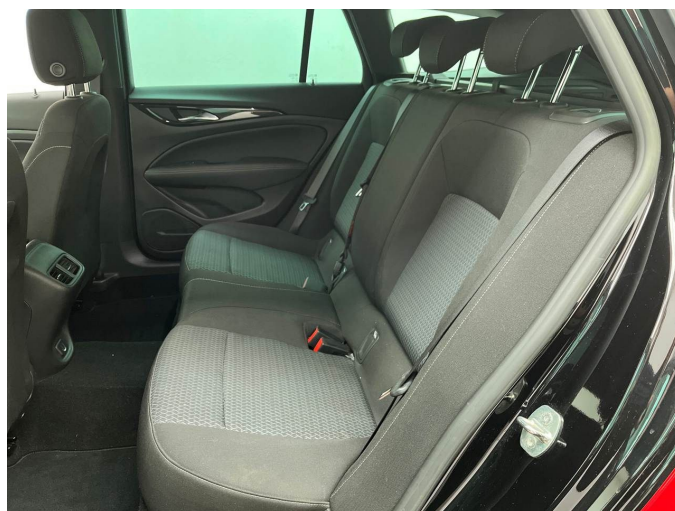


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

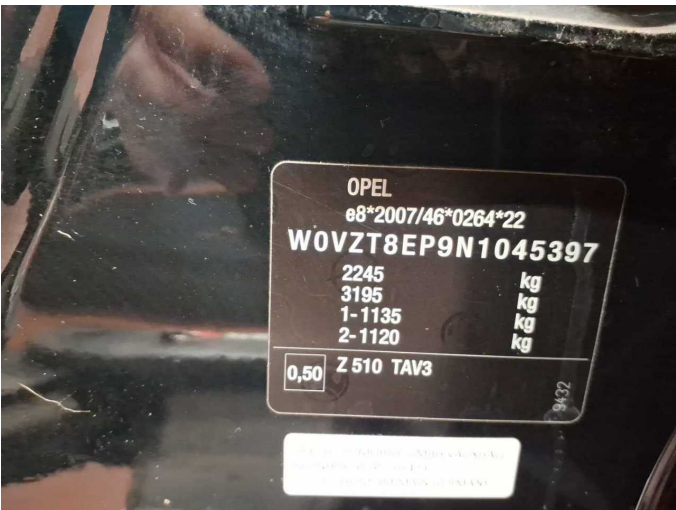


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

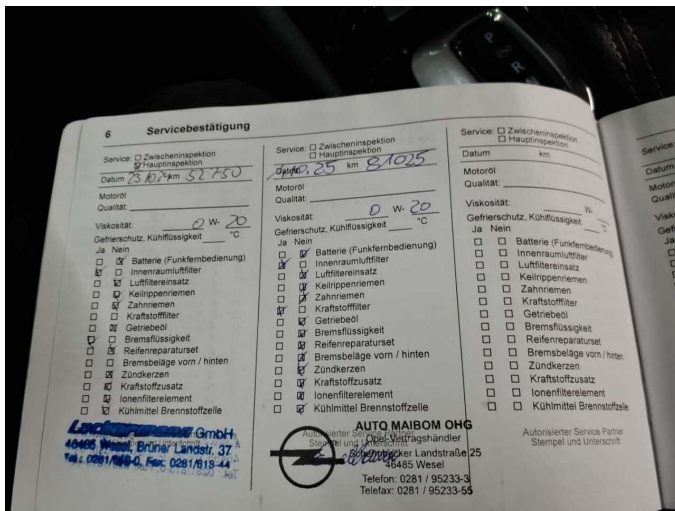


Figure 15: Documents

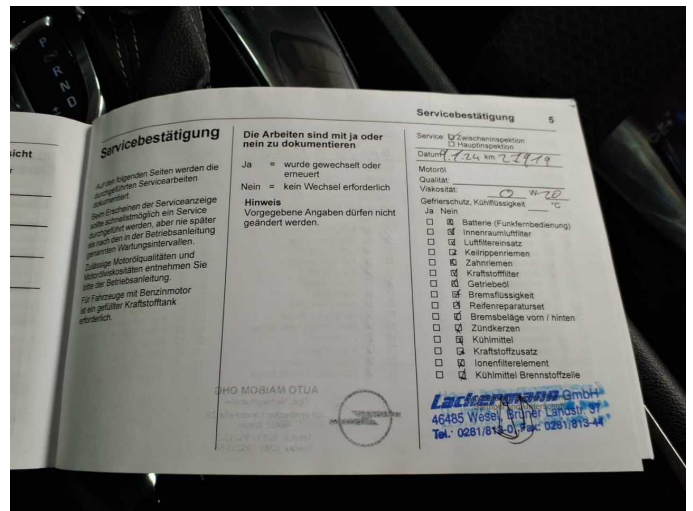


Figure 16: Documents



Figure 17: Additional tyres

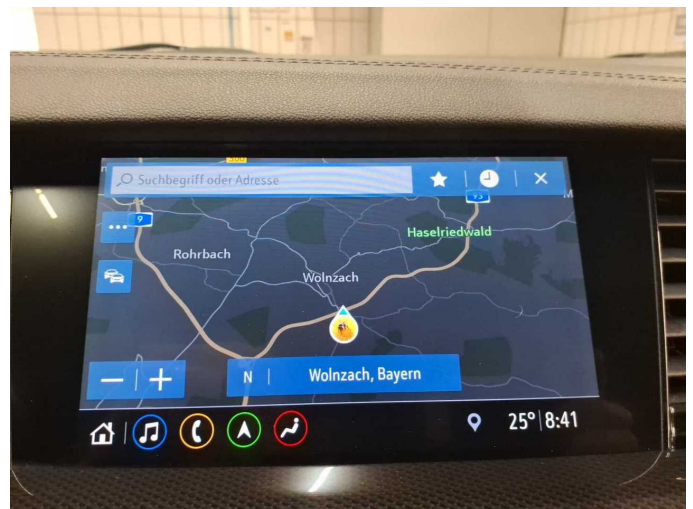


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

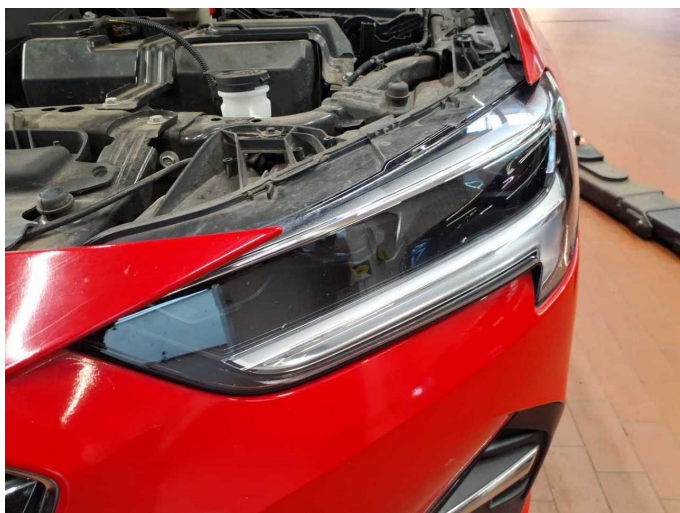


Figure 21: Misc.



Figure 22: Misc.

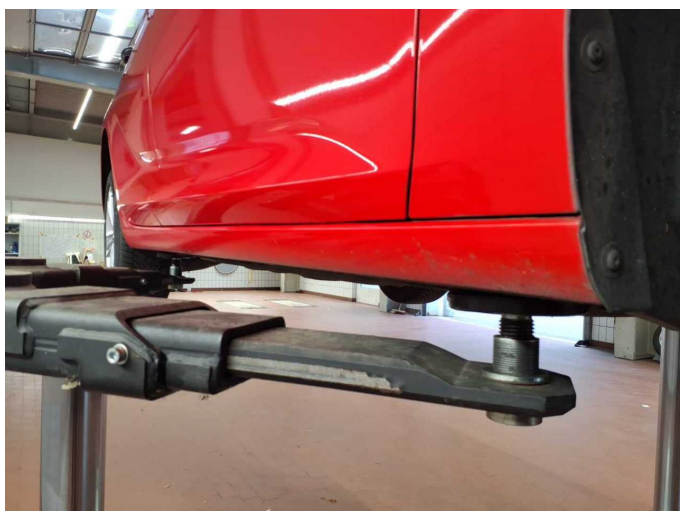


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

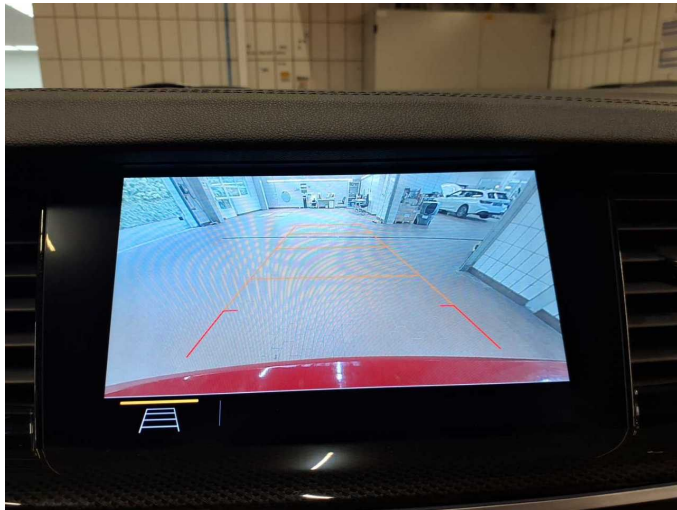


Figure 33: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 4: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 4: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 6: Body: Underbody panelling - Broken / torn - Replace



Damage 6: Body: Underbody panelling - Broken / torn - Replace



Damage 6: Body: Underbody panelling - Broken / torn - Replace



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 9: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair




Damage 9: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Front bumper: Grille - Broken / torn - Replace

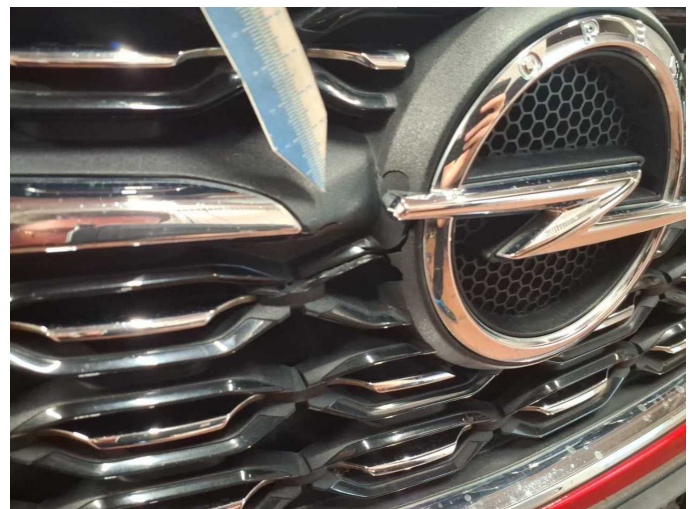

Damage 10: Front bumper: Grille - Broken / torn - Replace



Damage 11: Body: Body - Glued / labelled - De-glue / neutralise



Damage 11: Body: Body - Glued / labelled - De-glue / neutralise



Damage 11: Body: Body - Glued / labelled - De-glue / neutralise



Damage 11: Body: Body - Glued / labelled - De-glue / neutralise



Damage 12: Front bumper: Front bumper - Scratched - Paint




Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint

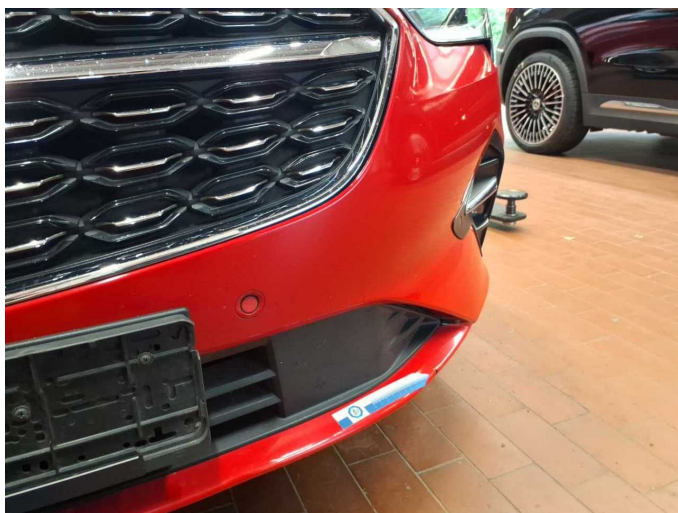

Damage 12: Front bumper: Front bumper - Scratched - Paint